



捷聯電子股份有限公司

Top Victory Electronics (Taiwan) Co., Ltd.

18F, No. 738, Chung-Cheng Rd, Chung-Ho, Taipei Hsien, Taiwan 臺北縣中和市中正路 738 號 18 樓 TEL: 886-2-82261668 FAX: 886-2-82261666

Date: Nov. 02, 2001

Subject : RFI related modifications incorporated into unit with [FCC ID. : ARSTF1760](#)

Dear Sir,

This letter services as our declaration that all modifications listed below are implemented in the sample submitted for pre-grant testing. We further declare that the same modifications will be implemented into all production unit to enhance compliance of the unit to FCC limits.

The modifications include the following :

**** FOR LM-700*(Black) & LM-700A****

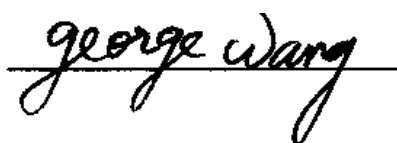
1. Added two ferrite cores on both end of video cable. (for LM-700*(Black) only)
@ Refer to Figure 2 & Figure 50. (Page 9 & Page 33)
2. Added a ferrite core on end of video cable near PC. (for LM-700A only)
@ Refer to Figure 21. (Page 19.)
3. Added a ferrite core on end of video cable near main board. (inside the case)
@ Refer to Figure 35 & Figure 57. (Page 26 & Page 37)
4. Added a ferrite core on cable from function-key-board to main board.
@ Refer to Figure 35 & Figure 57. (Page 26 & Page 37)
5. Added a ferrite core on DC power cord.
@ Refer to Figure 24 & Figure 52. (Page 20 & Page 34)
6. Added conductive fabric tape on cable from main board to LCD panel control board.
@ Refer to Figure 36 or 47 & Figure 67. (Page 26 or 32 & Page 42)
7. Added four copper foils on metal frame of panel. (for LM-700A only)
@ Refer to Figure 44 (Page 30)

**** FOR LM-700 (White)****

1. Added two ferrite cores on both end of video cble.
@ Refer to Figure 2 or 12. (Page 9 or 14.)
2. Added a ferrite core on end of video cable near main board. (inside the case)
@ Refer to Figure 7. (Page 12)
3. Added a ferrite core on DC power cord.
@ Refer to Figure 52. (Page 34)
4. Added three aluminum foils from panel to metal frame.
@ Refer to Figure 5. (Page 11)
5. Added aluminum foil on cable from main board to DC connector.
@ Refer to Figure 6. (Page 11)
6. Added conductive fabric tape on cable from main board to LCD panel control board.
@ Refer to Figure 8. (Page 12)
7. Added two aluminum foils from panel to metal frame.
@ Refer to Figure 17. (Page 17)
8. Added two aluminum foils on metal frame of panel.
@ Refer to Figure 17. (Page 17)

If you have any questions or require any other information please do not hesitate to contact our agent.

Sincerely Yours,

A handwritten signature in black ink that reads "George Wang". The signature is written in a cursive, flowing style and is positioned above a horizontal line.

George Wang
Manager

Top Victory Electronics (Taiwan) Co., Ltd.