

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com



Test Report

Product Name: HANDHELD WIRELESS MICROPHONE

FCC ID: BZB10HT

Applicant:

**AZDEN CORPORATION
147 NEW HYDE PARK ROAD
FRANKLIN SQUARE, NY 11010**

Date Receipt: MARCH 12, 2004

Date Tested: MARCH 29, 2004

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

COVER SHEET

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

TABLE OF CONTENTS LIST

TEST REPORT CONTAINING:

PAGE 1.....	GENERAL INFORMATION & TECHNICAL DESCRIPTION
PAGE 2.....	TECHNICAL DESCRIPTION
	RF POWER OUTPUT
PAGE 3.....	MODULATION CHARACTERISTICS
	AUDIO FREQUENCY RESPONSE GRAPH
	AUDIO LOW PASS FILTER
PAGE 4.....	AUDIO INPUT VERSUS MODULATION GRAPH
PAGE 5.....	OCCUPIED BANDWIDTH
PAGE 6.....	OCCUPIED BANDWIDTH PLOTS
PAGE 7-9.....	RADIATED EMISSIONS TEST DATA
PAGE 10.....	METHOD OF MEASURING RADIATED SPURIOUS EMISSIONS
PAGE 11.....	FREQUENCY STABILITY TEST DATA
PAGE 12-13.....	EQUIPMENT LIST

EXHIBITS CONTAINING:

BLOCK DIAGRAM
SCHEMATICS
PARTS LIST
USERS MANUAL
LABEL SAMPLE
LABEL LOCATION
EXTERNAL PHOTOGRAPHS
INTERNAL PHOTOGRAPHS
TUNING PROCEDURE
OPERATIONAL DESCRIPTION
TEST SET UP PHOTOGRAPH

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

GENERAL INFORMATION REQUIRED FOR TYPE ACCEPTANCE

2.1033(c)(1)(2) AZDEN CORPORATION will manufacture the 10HT in quantity, for use under FCC RULES PART 74.801, LOW POWER AUXILIARY STATIONS.

AZDEN CORPORATION
147 NEW HYDE PARK ROAD
FRANKLIN SQUARE, NY 11010

TECHNICAL DESCRIPTION

(c)(3) Instruction book. The instruction manual is included in the exhibits.

(c)(4) Type of Emission: 75K2F3E

Bn = 2M + 2DK

M = 7.6 kHz

D = 30 kHz(Peak Deviation)

K = 1

Bn = 2(7.6k) + 2(30k)(1) = 75.2k

74.861 (e)(5) ALLOWED AUTHORIZED BANDWIDTH = 200kHz.

(c)(5) Frequency Range: 793.750 - 805.375 MHz

(c)(6) Power Range and Controls: UNIT has no controls.

(c)(7) Maximum Output Power Rating: .00631 Watts into 50 ohms resistive load.

(c)(8) DC Voltages and Current into Final Amplifier:

FINAL AMPLIFIER ONLY

Vce = 3.0 Volts

Ice = .11 A

Pin = 0.33

(c)(9) Tune-up procedure. The tune-up procedure is given in the exhibits.

(c)(10) Complete Circuit Diagrams: The circuit diagram and block diagram are included in the exhibits.

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1033(c)(11) Photo or Drawing of Label and sketch of location:
See the exhibits.

2.1033(c)(12) Photos of Equipment:
See the exhibits.

(c)(13) Description of all circuitry and devices provided for determining and stabilizing frequency.

Description of any circuits or devices employed for suppression of spurious radiation, for limiting modulation, and for limiting power.

This circuitry is described in the exhibits.

Limiting Modulation:

The transmitter audio circuitry is contained in IC101, IC102 and IC103.

Limiting Power:

There is no provision for limiting power.

(14) Digital modulation. This unit does not use digital modulation.


2.1033(c)(15) The data required by 2.1046 through 2.1057 is submitted below.

2.1046 **RF power output**

RF power measured is:

OUTPUT POWER: .006310 Watts

R.F. POWER OUTPUT TEST PROCEDURE

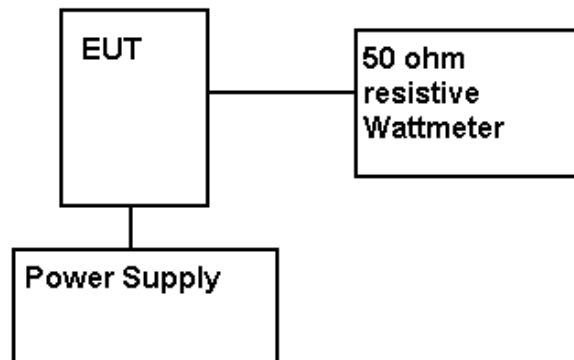

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com


2.1047(a)(b)

Modulation characteristics:

AUDIO FREQUENCY RESPONSE

The audio frequency response was measured in accordance with TIA/EIA Specification 603. The audio frequency response curve is shown below.

Audio Frequency Response Plot

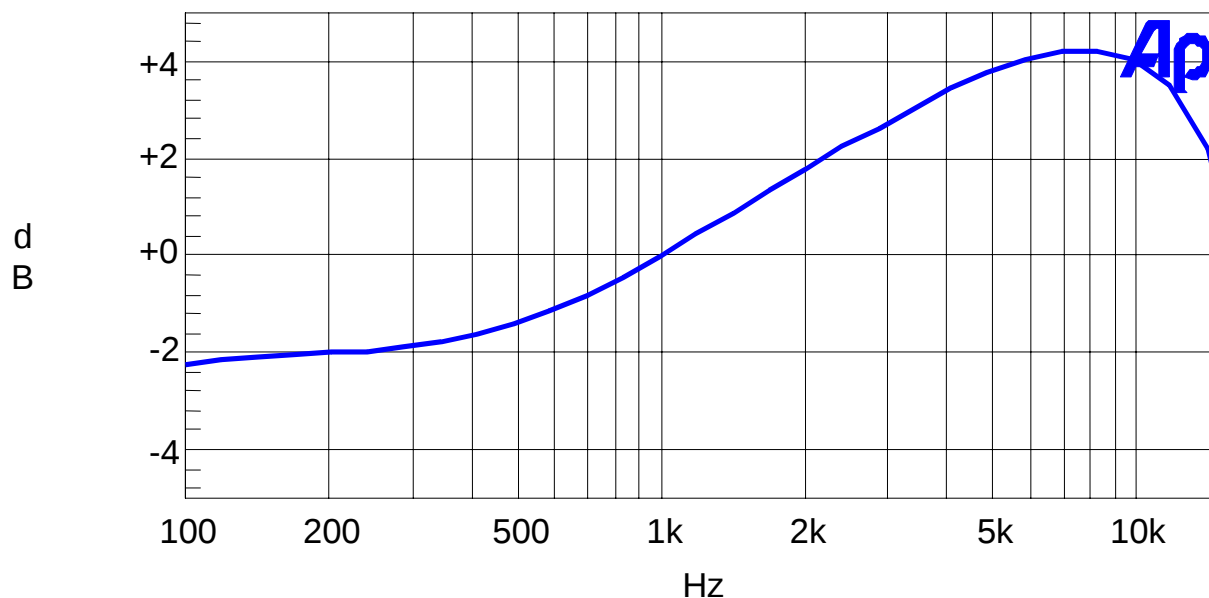

AUDIO LOW PASS FILTER

The audio low pass filter is not required in this unit.

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>


888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1047(b)

Audio input versus modulation

A plot of the audio input versus deviation is shown below.

Modulation Limiting Plots:
15KHz (Green), 1.0KHz (Blue), and 300Hz (Yellow)

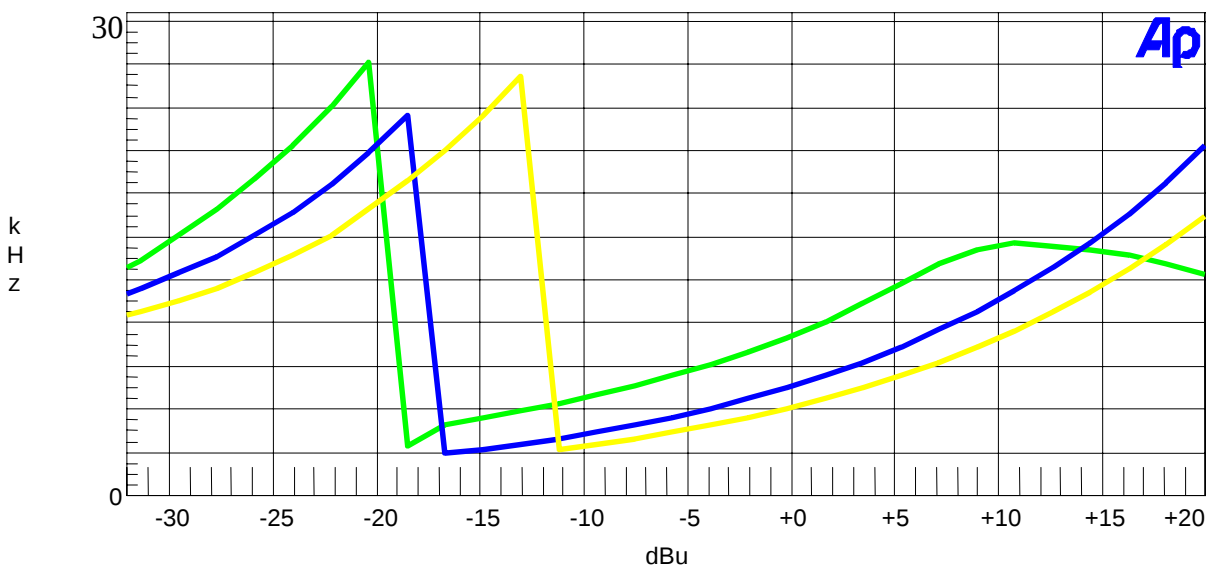

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1049(c)


Occupied Bandwidth:

Data in the plots show that all sidebands between 50 and 100% for the authorized bandwidth are attenuated by at least 25dB. From 100 to 250% of the authorized bandwidth they are attenuated by at least 35dB and beyond 250% $43 \log(P_o)$ dB. The plot shows the transmitter modulated with 15000 Hz (the highest modulation frequency), adjusted for 50% modulation plus 16 dB. The spectrum analyzer was set with the un-modulated carrier at the top of the screen. The test procedure diagram and occupied bandwidth plots follow.

Wireless Microphone transmitter:

Test procedure diagram

OCCUPIED BANDWIDTH MEASUREMENT

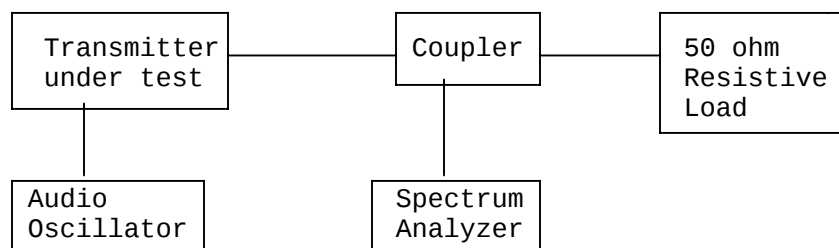

REQUIREMENT: PART 74: 200kHz EMISSION BANDWIDTH.

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc


TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

OCCUPIED BANDWIDTH

NOTES:

AZDEN CORPORATION - FCC ID: BZB10HT
OCCUPIED BANDWIDTH PLOT

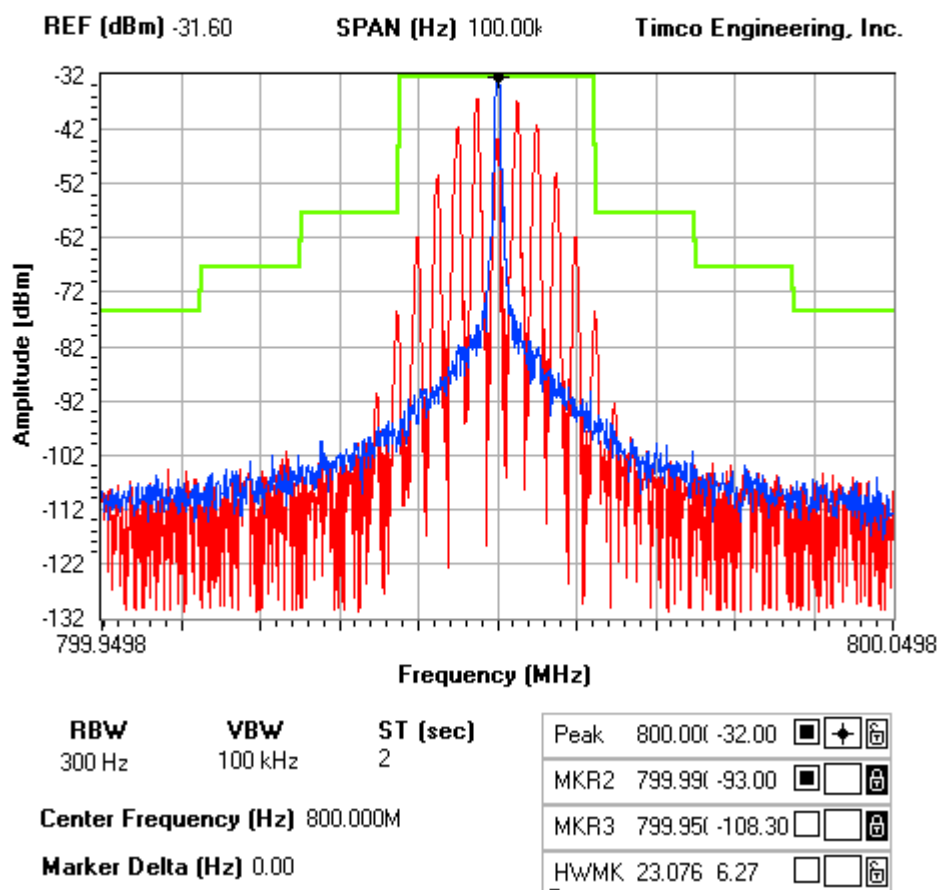

APPLICANT: AZDEN CORPORATION
FCC ID: BZB10HT
REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1051 **Spurious emissions at antenna terminals (conducted):**
Not Applicable no antenna connector.

2.1053(a)(b) **Field strength of spurious emissions:**

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (794 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

$$43 + 10 \log(.0063) = 21.00 \text{ dB}$$

TEST DATA:

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
794.00	V	8.00	0	0	0
1588.00	V	-43.00	1.12	5.02	47.10
2382.00	V	-22.60	1.28	6.42	25.46
3176.00	V	-12.80	1.37	7.29	14.88
3970.00	V	-34.00	1.45	7.64	35.81
4764.00	V	-22.60	1.55	7.93	24.22
5558.00	V	-28.60	1.72	8.43	29.89
6352.00	V	-50.40	1.94	8.91	51.43
7146.00	H	-43.90	1.94	7.80	46.04
7940.00	V	-40.70	2.09	7.59	43.20

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053(a)(b) **Field strength of spurious emissions:**

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (800 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

$$43 + 10 \log(.0063) = 21.00 \text{ dB}$$

TEST DATA:

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
800.00	V	6.90	0	0	0
1600.00	V	-44.10	1.12	5.03	47.09
2400.00	V	-20.30	1.28	6.47	22.01
3200.00	V	-25.50	1.37	7.31	26.46
4000.00	H	-37.60	1.45	7.65	38.30
4800.00	H	-32.80	1.56	7.89	33.37
5600.00	V	-28.90	1.74	8.49	29.05
6400.00	V	-45.80	1.94	8.89	45.75
7200.00	H	-45.40	2.00	7.93	46.37
8000.00	H	-39.50	2.10	7.45	41.05

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1053(a)(b) **Field strength of spurious emissions:**

NAME OF TEST: RADIATED SPURIOUS EMISSIONS (805 MHz)

REQUIREMENTS: Emissions must be $43 + 10\log(P_o)$ dB below the mean power output of the transmitter.

$$43 + 10 \log(.0063) = 21.00 \text{ dB}$$

TEST DATA:

Emission Frequency MHz	Ant. Polarity	Corrected EUT Signal Reading	Coax Loss (dB)	Substitution Antenna (dBd)	dB Below Carrier (dBc)
805.00	V	6.50	0	0	0
1610.00	V	-46.70	1.12	5.04	49.28
2415.00	V	-22.30	1.28	6.51	23.57
3220.00	V	-26.10	1.37	7.33	26.64
4025.00	H	-41.30	1.45	7.68	41.57
4830.00	H	-37.40	1.57	7.85	37.62
5635.00	V	-33.40	1.75	8.54	33.11
6440.00	H	-44.50	1.94	8.87	44.07
7245.00	H	-45.80	2.00	8.04	46.26
8050.00	H	-50.20	2.11	7.56	51.25

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Method of Measuring Radiated Spurious Emissions

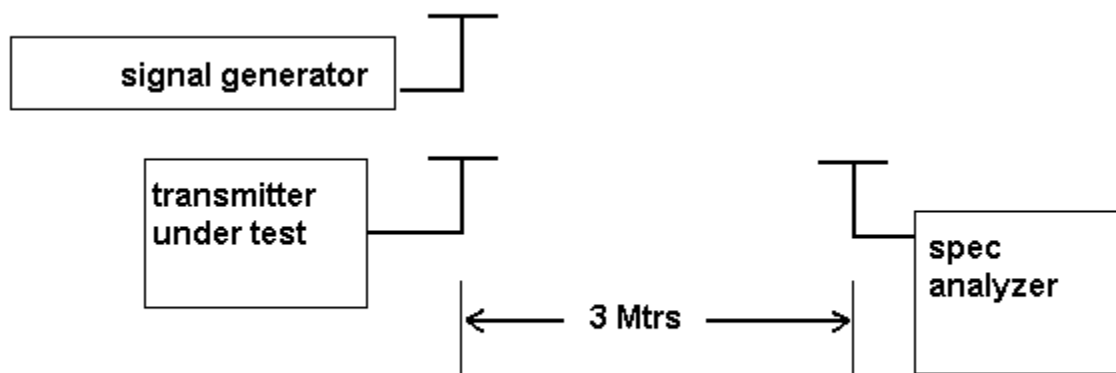

METHOD OF MEASUREMENT: The procedure used was TIA/EIA STANDARD 603. The spectrum was scanned from 30 to at least the tenth harmonic of the fundamental using a HP model 8566B spectrum analyzer and an appropriate antenna. Measurements were made at the open field test site of TIMCO ENGINEERING INC. located at 849 NW SR 45 Newberry, Florida 32669.

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

2.1055 Frequency stability:
S74.861(e)(4)

Temperature and voltage tests were performed to verify that the frequency remains within the .0050%, (50 ppm)(74.861 e.4) specification limit.

The test was conducted as follows: The transmitter was placed in the temperature chamber at 25 degrees C and allowed to stabilize for one hour. The transmitter was keyed ON for one minute during which four frequency readings were recorded at 15-second intervals. The worse case number was taken for temperature plotting. The assigned channel frequency was considered to be the reference frequency. The temperature was then reduced to -30 degrees C after which the transmitter was again allowed to stabilize for one hour. The transmitter was keyed ON for one minute, and again frequency readings were noted at 15-second intervals. The worst-case number was recorded for temperature plotting. This procedure was repeated in 10-degree increments up to + 50 degrees C.

MEASUREMENT DATA:

Assigned Frequency (Ref. Frequency): 800.000 147 MHz

TEMPERATURE_C	FREQUENCY_MHz	PPM
REFERENCE	800.000 147	00.0
-30	799.995 670	-5.60
-20	799.998 175	-2.46
-10	800.000 531	+0.48
0	800.001 334	+1.48
+10	800.001 255	+1.38
+20	800.000 787	0.80
+30	799.999 660	-0.61
+40	799.999 276	-1.09
+50	799.998 799	-1.68

	<u>VOLTS</u>	<u>Batt. Data</u>	<u>Batt. PPM</u>
-15%	2.55	800.000 269	+0.15

RESULTS OF MEASUREMENTS: The test results indicates that the EUT meets the requirements.

APPLICANT: AZDEN CORPORATION
FCC ID: BZB10HT
REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

EMC Equipment List

Device	Manufacturer	Model	Serial Number	Cal/Char Date	Due Date
3/10-Meter OATS	TEI	N/A	N/A	Listed 3/26/01	3/26/04
3-Meter OATS	TEI	N/A	N/A	Listed 1/13/03	1/13/06
AC Voltmeter	HP	400FL	2213A14499	CAL 10/9/01	10/9/03
Blue Tower Quasi-Peak Adapter	HP	85650A	2811A01279	CAL 4/15/03	4/15/05
Blue Tower RF Preselector	HP	85685A	2926A00983	CAL 4/15/03	4/15/05
Blue Tower Spectrum Analyzer	HP	8568B	2928A04729	CAL 4/15/03	4/15/05
Coaxial Cable #64	Semflex Inc.	60637	Timco #64	CHAR 1/24/02	1/24/04
Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	152	CAL 3/21/01	3/21/04
Dipole Antenna Kit	Electro-Metrics	TDA-30/1-4	153	CAL 9/26/02	9/26/05
Frequency Counter	HP	5385A	2730A03025	CAL 3/7/03	3/7/05
Hygro-Thermometer	Extech	445703	0602	CAL 10/4/02	10/4/04
Log-Periodic Antenna	Electro-Metrics	LPA-25	1122	CAL 10/2/01	10/2/03
Measuring Tape-7.5M	Kraftixx	7.5M PROFI		CHAR 2/1/02	2/1/04
Modulation Analyzer	HP	8901A	3435A06868	CAL 9/5/01	9/5/03
Multimeter	Fluke	FLUKE-77-3	79510405	CHAR 9/26/01	9/26/03
Silver Tower Preamplifier	HP	8449B	3008A01075	CHAR 1/28/02	1/28/04
Silver Tower Quasi-Peak Adapter	HP	85650A	3303A01844	CAL 10/14/02	10/14/04

APPLICANT: AZDEN CORPORATION
FCC ID: BZB10HT
REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

Silver Tower RF Preselector	HP	85685A	2620A00294	CAL 10/14/02	10/14/04
Silver Tower Spectrum Analyzer System One	HP	8566B Opt 462	3552A22064 3638A08608	CAL 10/14/02	10/14/04
	Audio Precision	System One	SYS1-45868	CHAR 4/25/02	4/25/04
Tan Tower Preamplifier	HP	8449B- H02	3008A00372	CAL 9/23/03	9/23/05
Tan Tower Quasi-Peak Adapter	HP	85650A	3303A01690	CAL 9/23/03	9/23/05
Tan Tower RF Preselector	HP	85685A	3221A01400	CAL 9/23/03	9/23/05
Tan Tower Spectrum Analyzer	HP	8566B Opt 462	3138A07786 3144A20661	CAL 9/23/03	9/23/05
Temperature Chamber	Tenney Engineering	TTRC	11717-7	CHAR 1/22/02	1/22/04

APPLICANT: AZDEN CORPORATION

FCC ID: BZB10HT

REPORT #: A\AZDEN\331AUT4\331AUT4TestReport.doc