




-26dB Bandwidth					
Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	22.923	Pass
NVNT	a	5200	Ant1	24.575	Pass
NVNT	a	5240	Ant1	22.548	Pass
NVNT	a	5260	Ant1	25.233	Pass
NVNT	a	5300	Ant1	26.323	Pass
NVNT	a	5320	Ant1	22.338	Pass
NVNT	a	5500	Ant1	24.972	Pass
NVNT	a	5580	Ant1	26	Pass
NVNT	a	5700	Ant1	27.426	Pass
NVNT	a	5180	Ant2	22.218	Pass
NVNT	a	5200	Ant2	26.28	Pass
NVNT	a	5240	Ant2	26.245	Pass
NVNT	a	5260	Ant2	27	Pass
NVNT	a	5300	Ant2	26.237	Pass
NVNT	a	5320	Ant2	28.916	Pass
NVNT	a	5500	Ant2	28.165	Pass
NVNT	a	5580	Ant2	24.894	Pass
NVNT	a	5700	Ant2	24.858	Pass
NVNT	n20	5180	Ant1	23.091	Pass
NVNT	n20	5200	Ant1	24.212	Pass
NVNT	n20	5240	Ant1	23.493	Pass
NVNT	n20	5260	Ant1	23.229	Pass
NVNT	n20	5300	Ant1	23.686	Pass
NVNT	n20	5320	Ant1	23.266	Pass
NVNT	n20	5500	Ant1	23.511	Pass
NVNT	n20	5580	Ant1	24.36	Pass
NVNT	n20	5700	Ant1	24.283	Pass
NVNT	n20	5180	Ant2	23.509	Pass
NVNT	n20	5200	Ant2	23.894	Pass
NVNT	n20	5240	Ant2	22.829	Pass
NVNT	n20	5260	Ant2	23.55	Pass
NVNT	n20	5300	Ant2	25.61	Pass
NVNT	n20	5320	Ant2	23.118	Pass
NVNT	n20	5500	Ant2	23.371	Pass
NVNT	n20	5580	Ant2	23.128	Pass
NVNT	n20	5700	Ant2	23.104	Pass
NVNT	n40	5190	Ant1	39.778	Pass
NVNT	n40	5230	Ant1	40.053	Pass
NVNT	n40	5270	Ant1	39.78	Pass
NVNT	n40	5310	Ant1	40.134	Pass
NVNT	n40	5510	Ant1	40.248	Pass
NVNT	n40	5550	Ant1	40.242	Pass
NVNT	n40	5670	Ant1	40.473	Pass
NVNT	n40	5190	Ant2	39.767	Pass
NVNT	n40	5230	Ant2	39.922	Pass
NVNT	n40	5270	Ant2	39.665	Pass
NVNT	n40	5310	Ant2	39.993	Pass
NVNT	n40	5510	Ant2	39.516	Pass
NVNT	n40	5550	Ant2	39.628	Pass
NVNT	n40	5670	Ant2	40.267	Pass
NVNT	ac80	5210	Ant1	79.034	Pass
NVNT	ac80	5290	Ant1	79.304	Pass
NVNT	ac80	5530	Ant1	79.045	Pass
NVNT	ac80	5610	Ant1	79.513	Pass
NVNT	ac80	5210	Ant2	78.835	Pass
NVNT	ac80	5290	Ant2	79.011	Pass
NVNT	ac80	5530	Ant2	78.82	Pass
NVNT	ac80	5610	Ant2	78.864	Pass
NVNT	ax80	5210	Ant1	79.476	Pass
NVNT	ax80	5290	Ant1	79.713	Pass
NVNT	ax80	5530	Ant1	79.657	Pass
NVNT	ax80	5610	Ant1	79.471	Pass
NVNT	ax80	5210	Ant2	79.475	Pass
NVNT	ax80	5290	Ant2	79.327	Pass
NVNT	ax80	5530	Ant2	79.493	Pass
NVNT	ax80	5610	Ant2	79.329	Pass







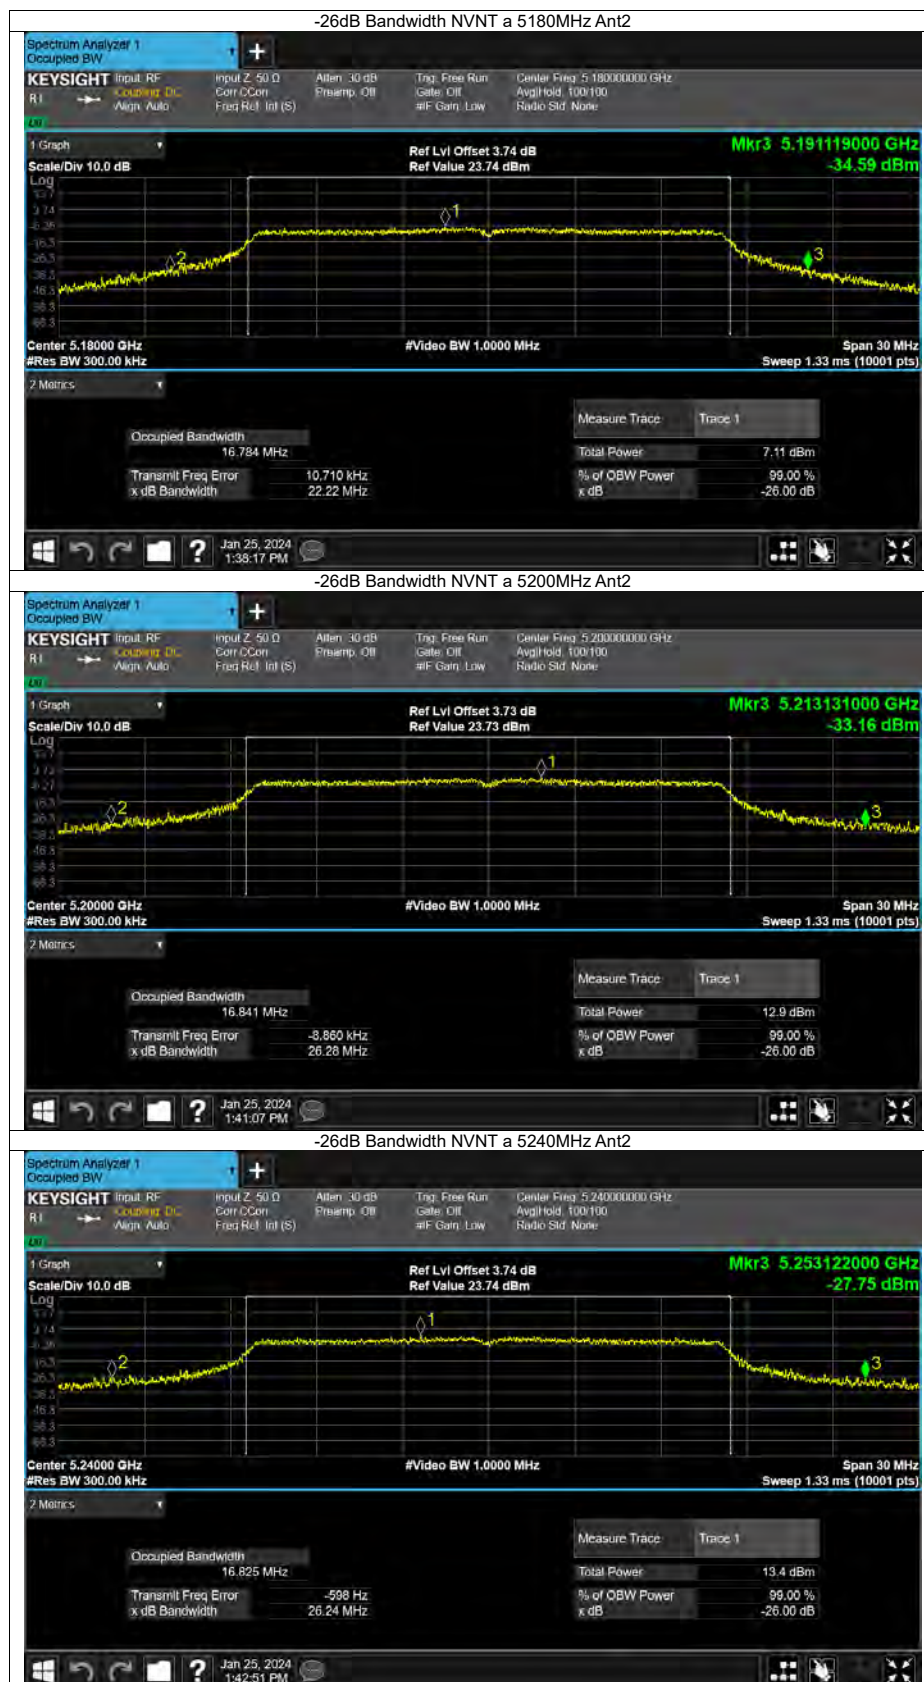

















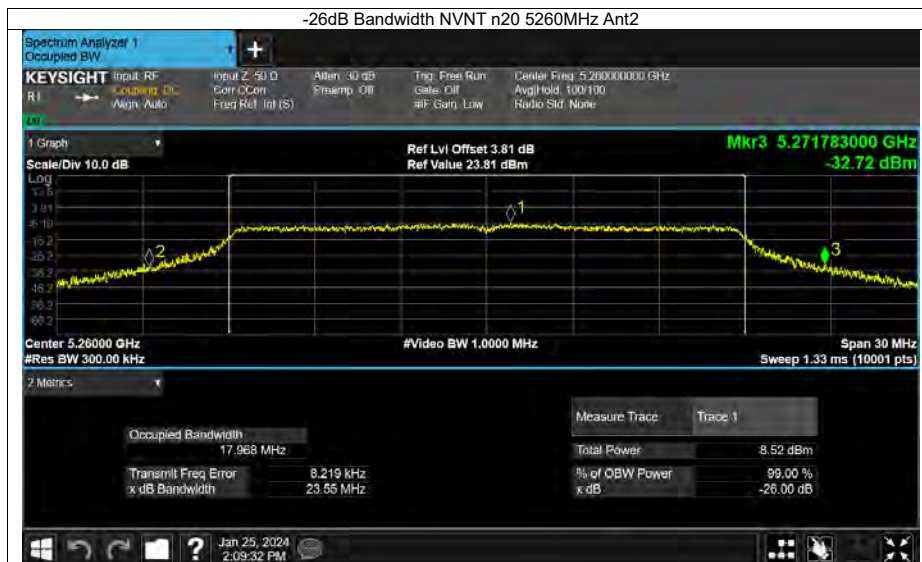





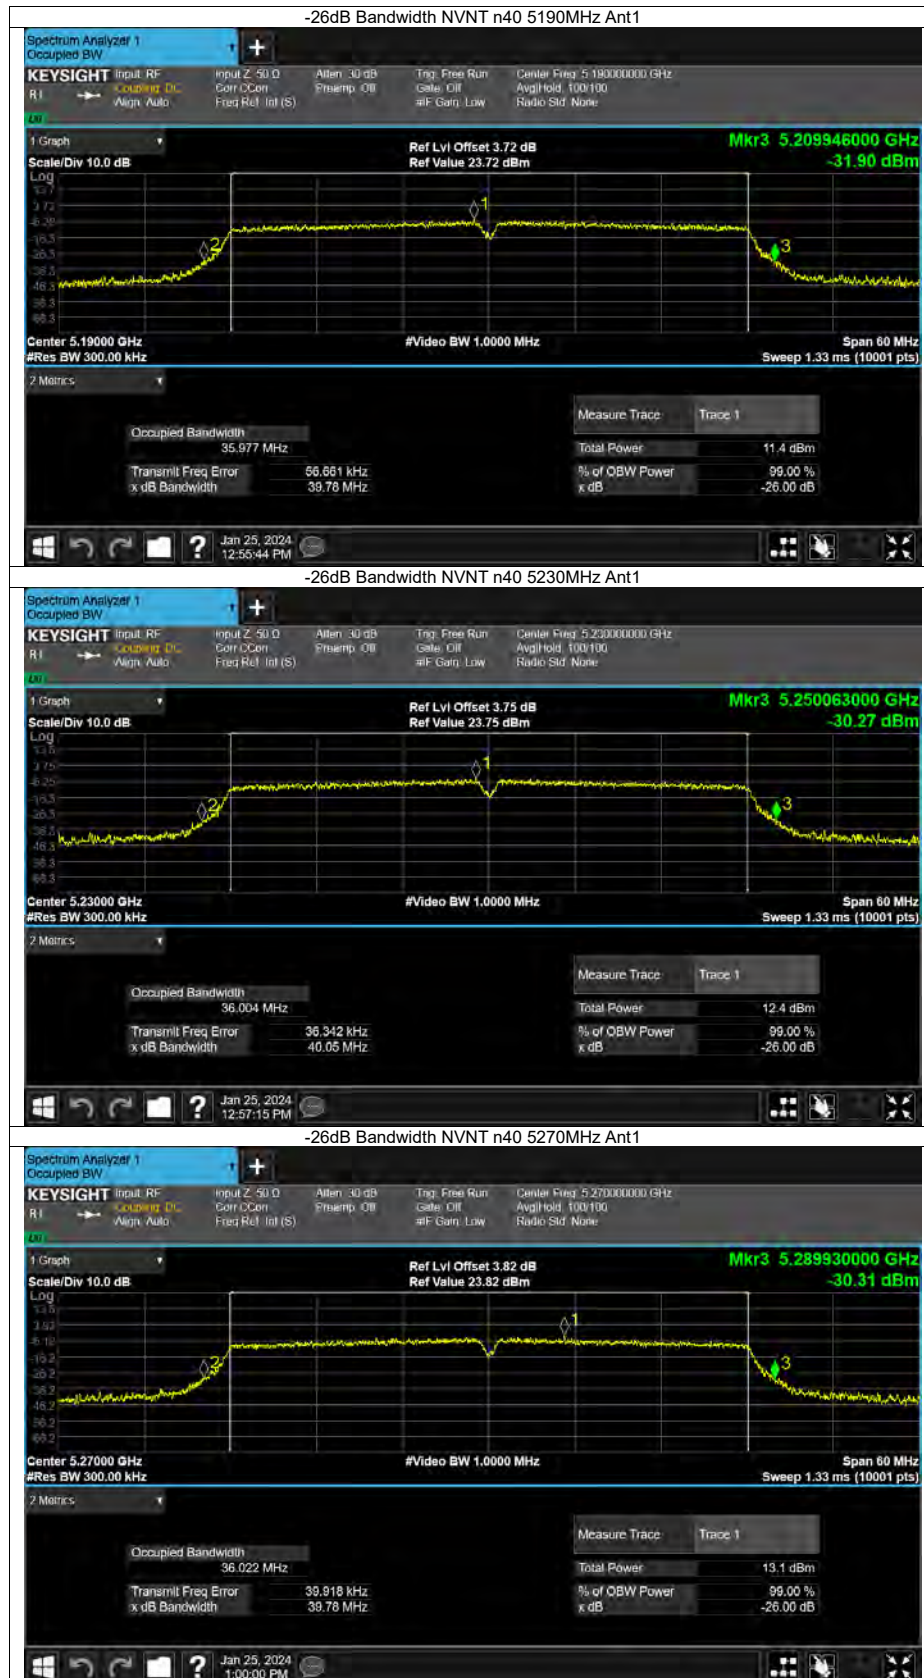


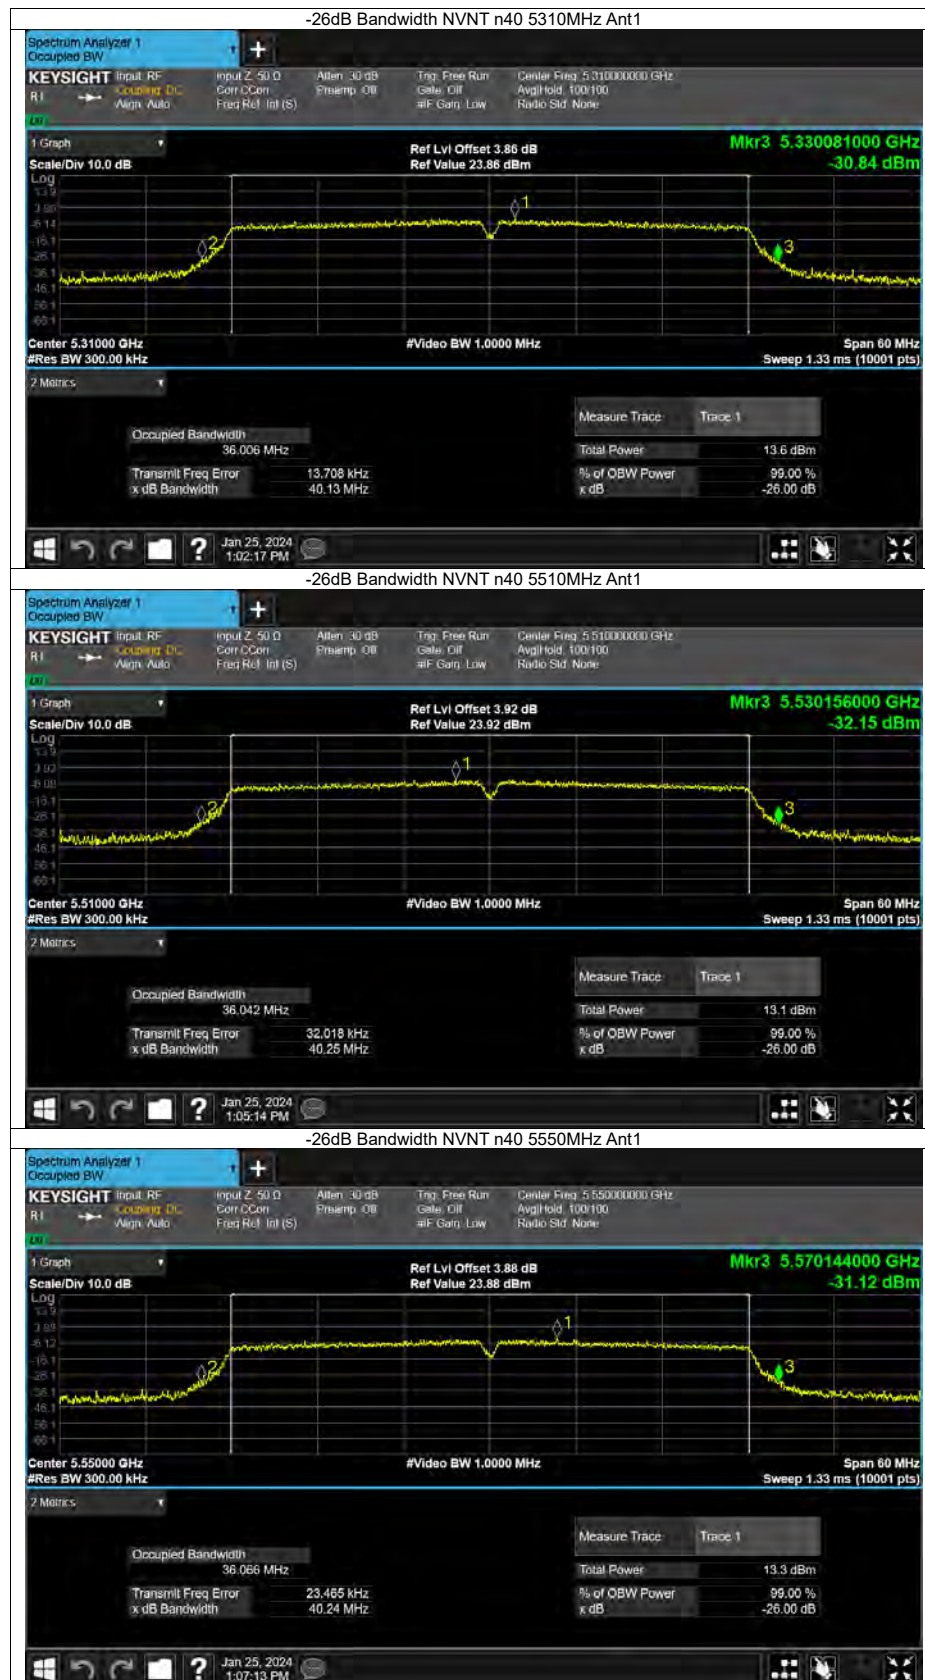


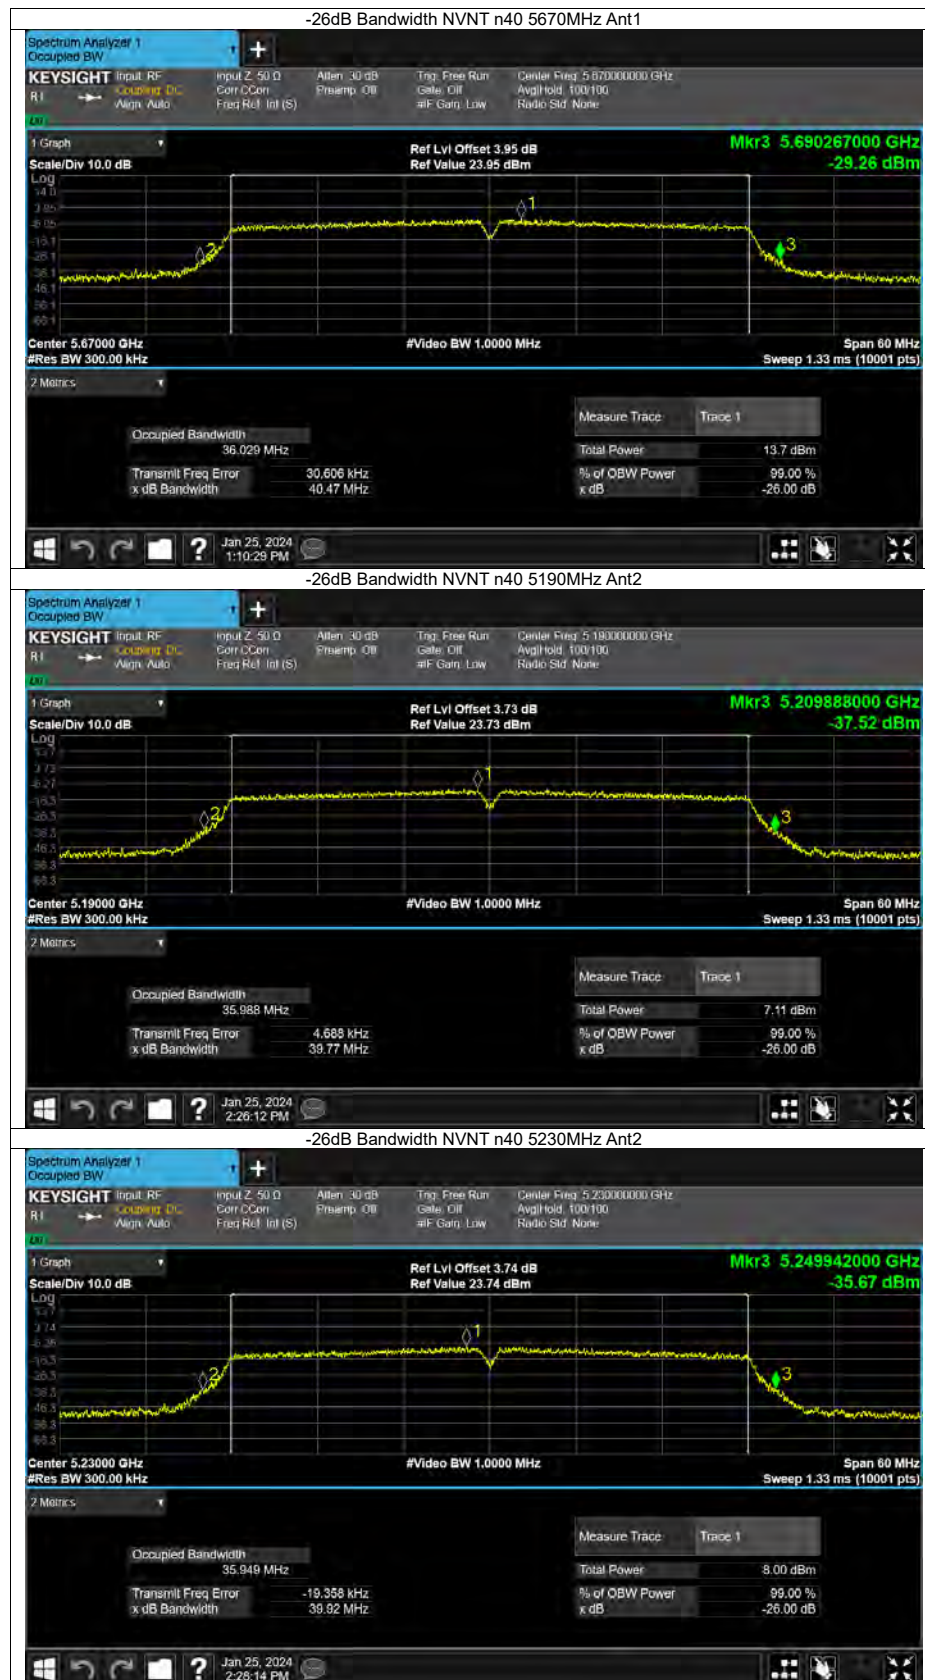


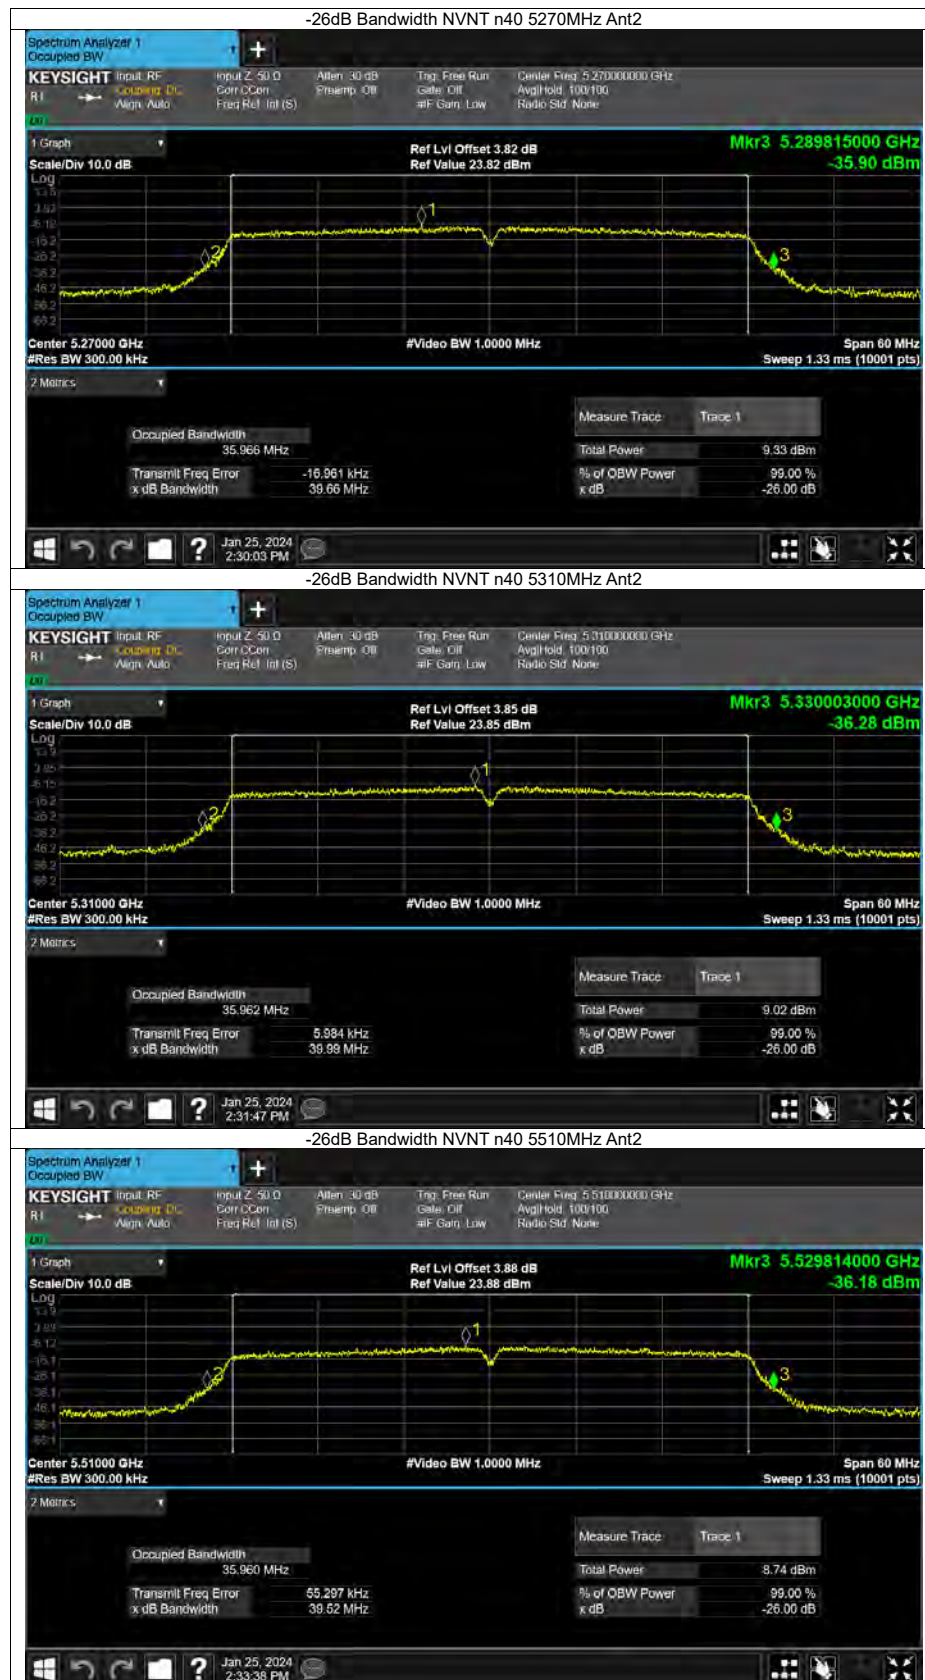


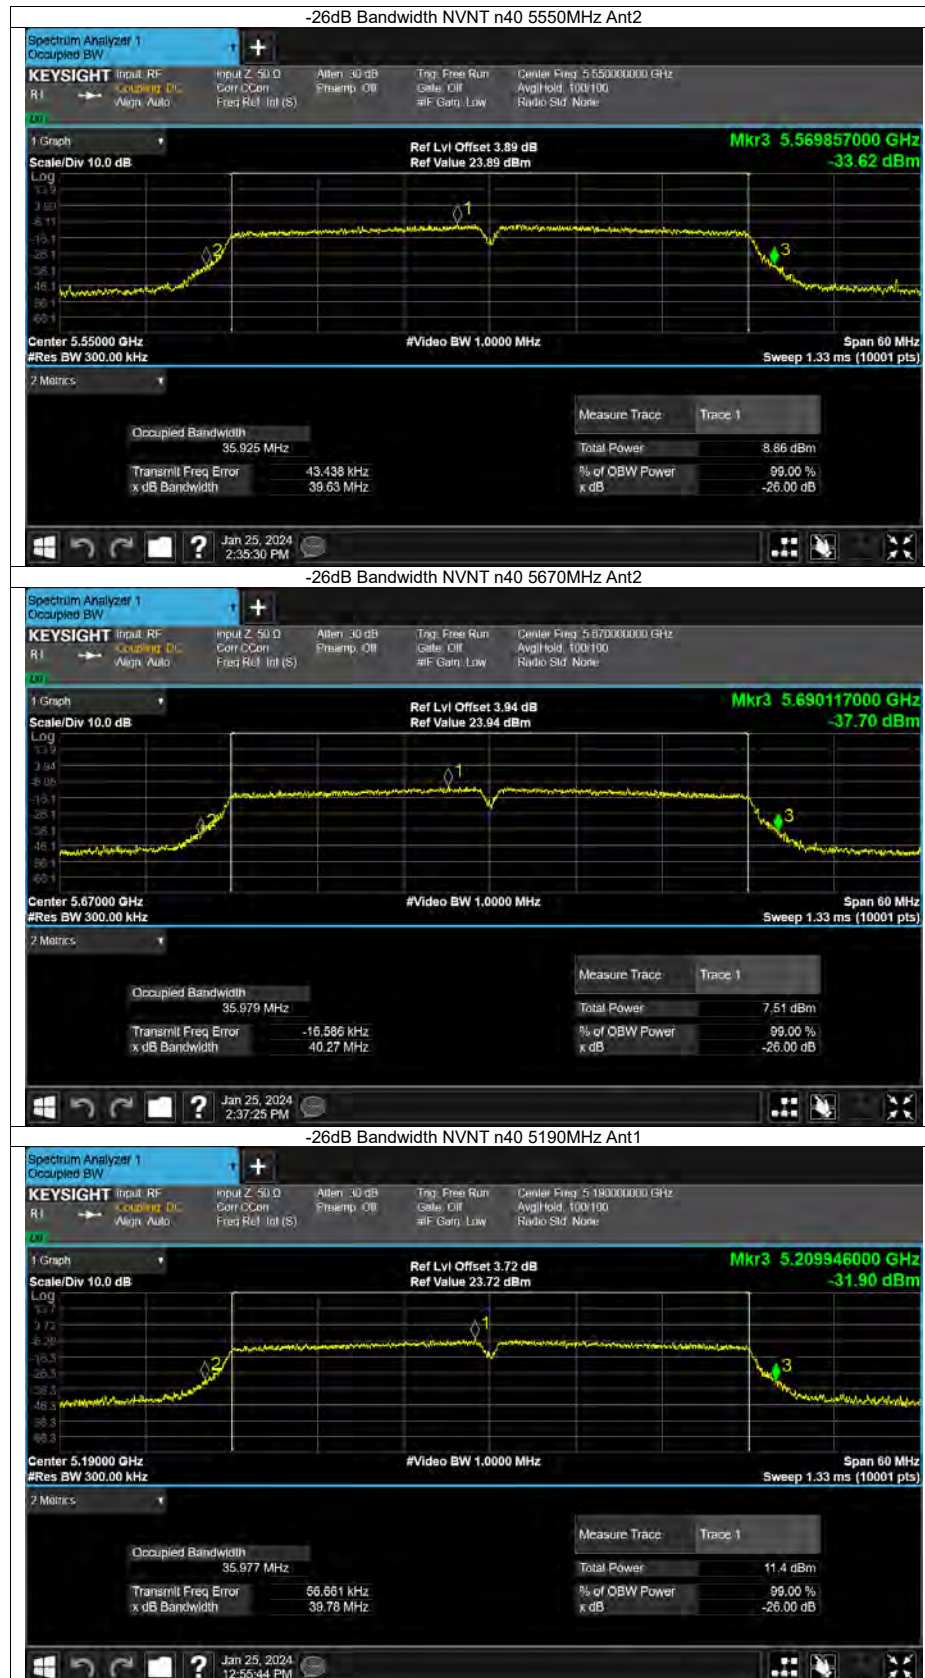


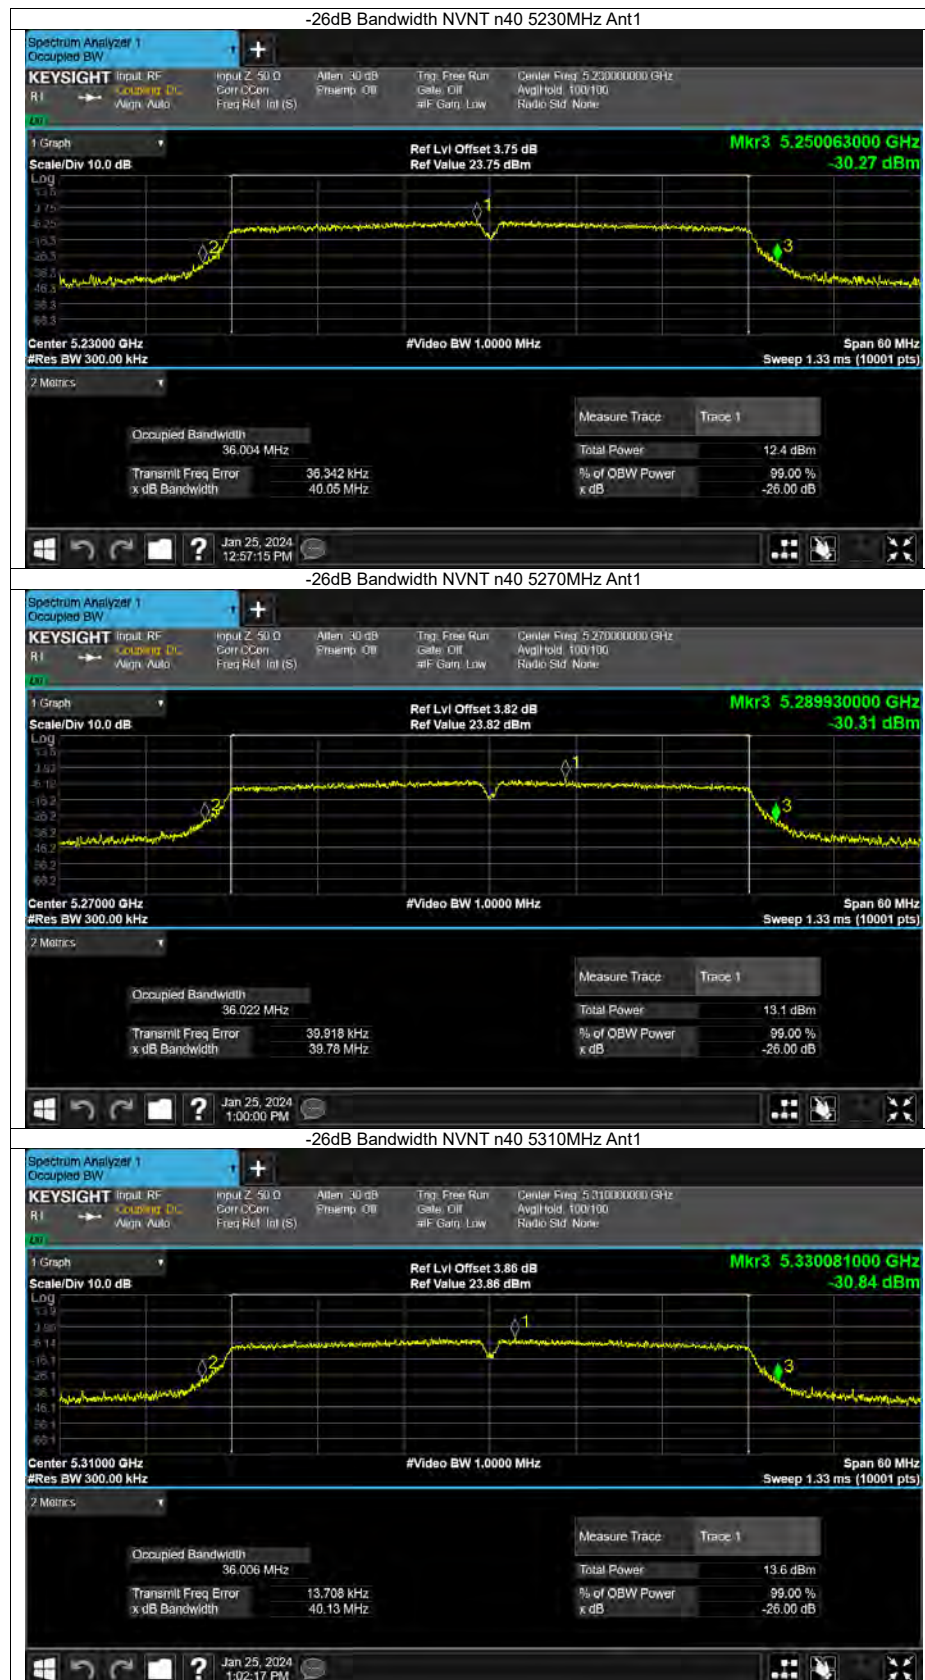


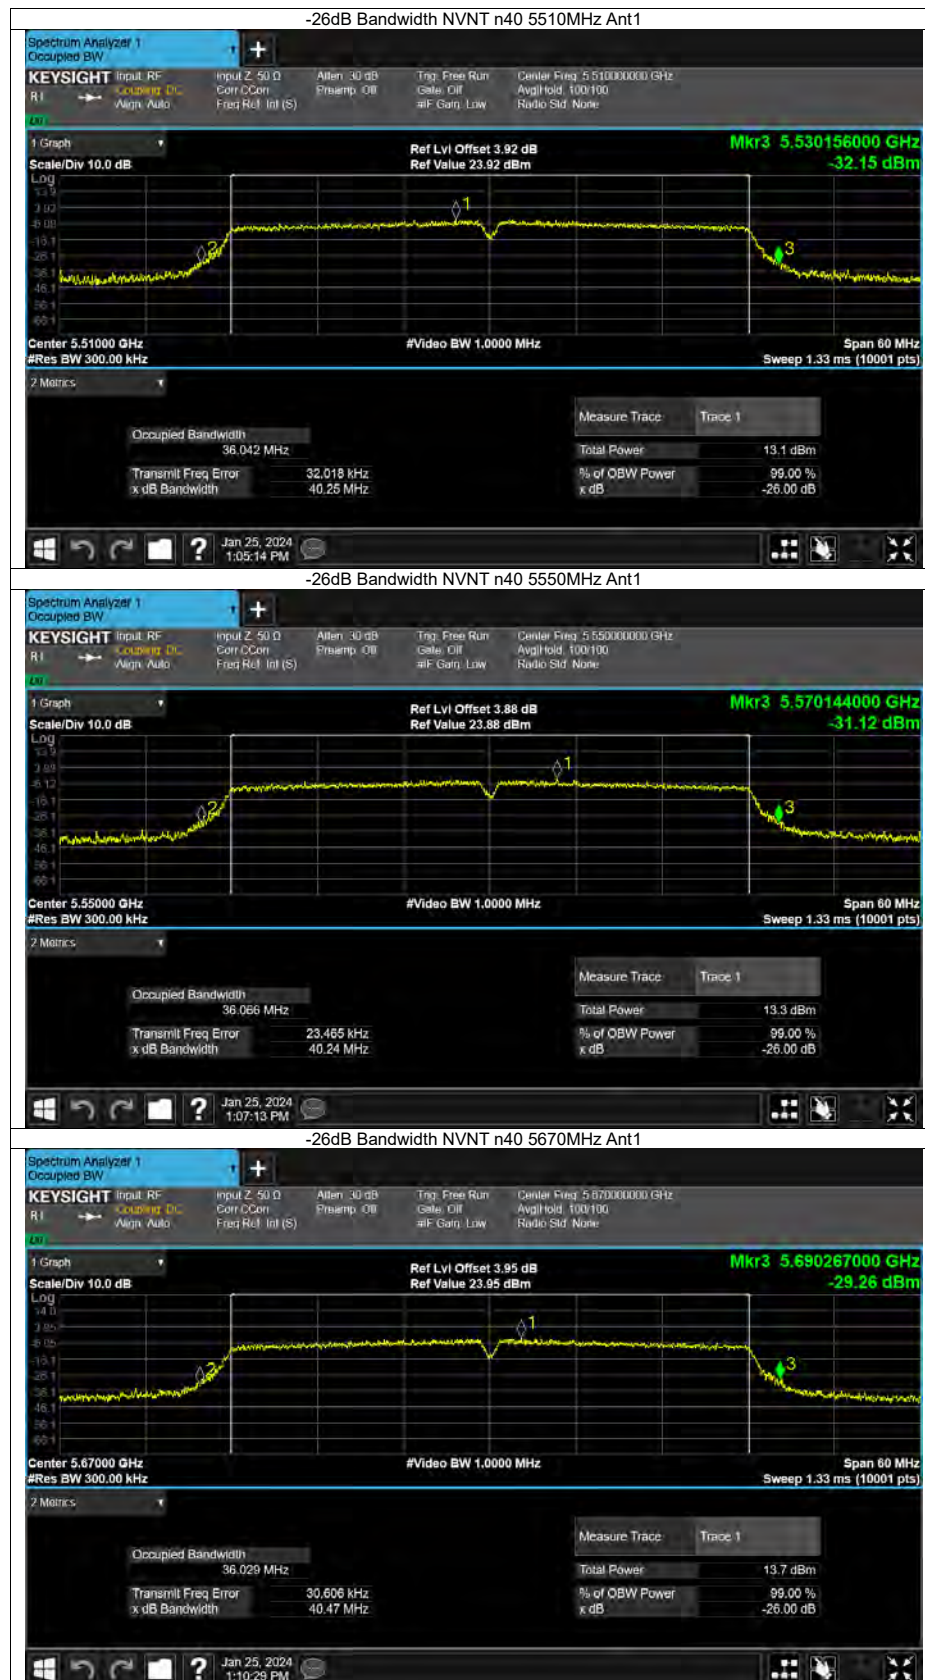


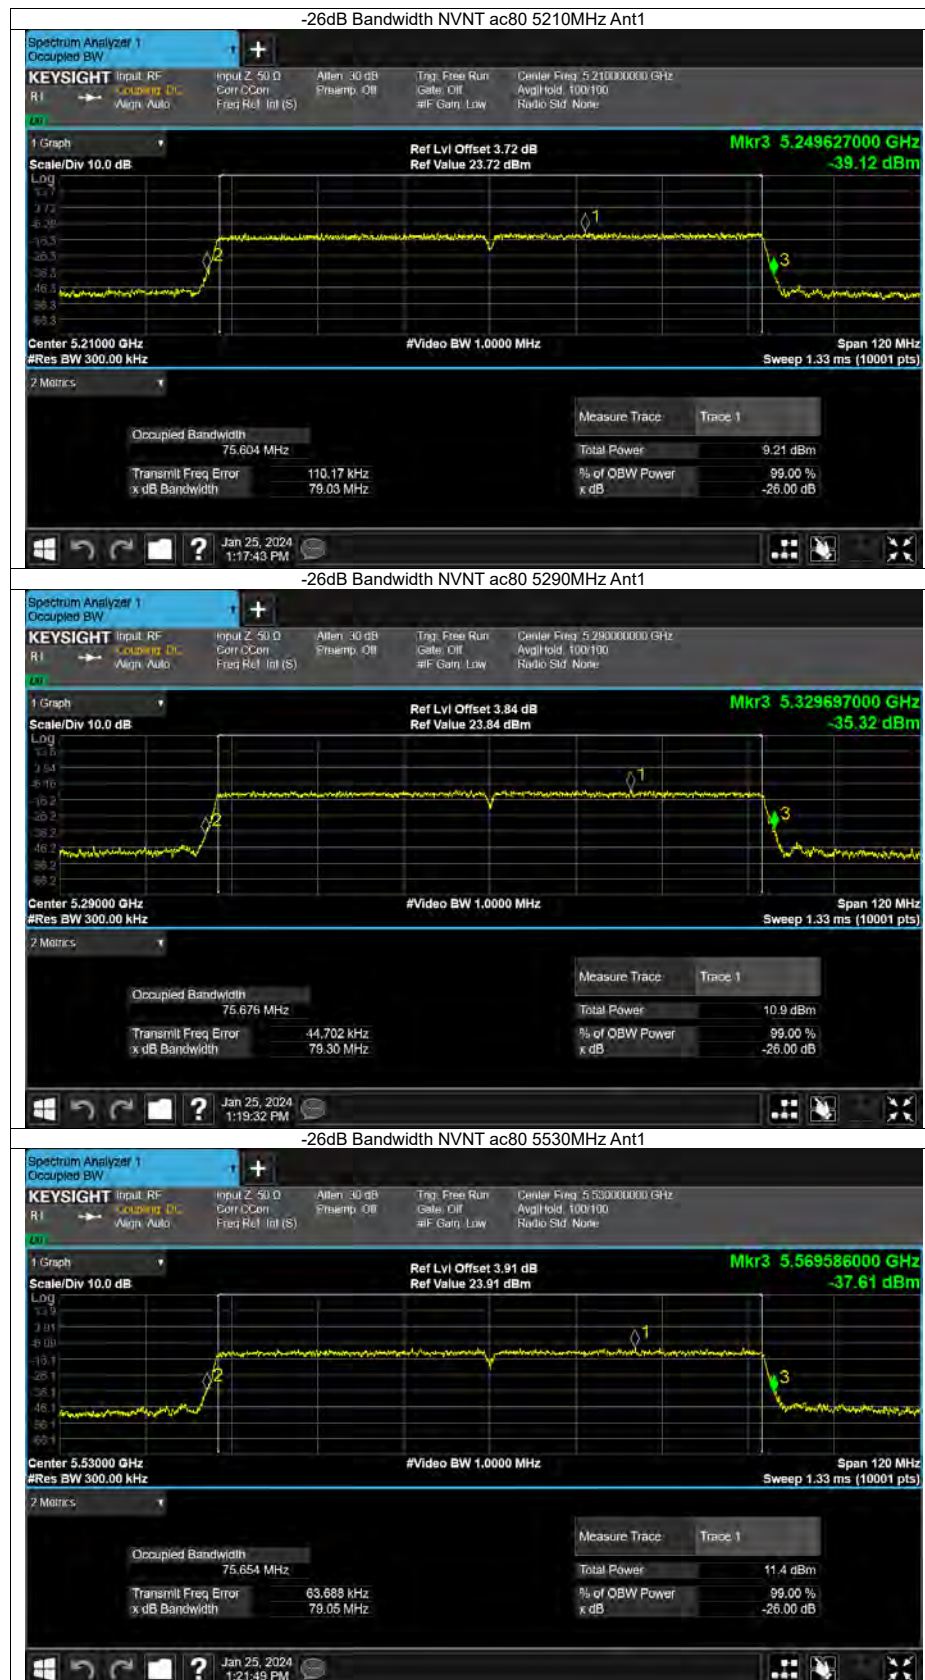


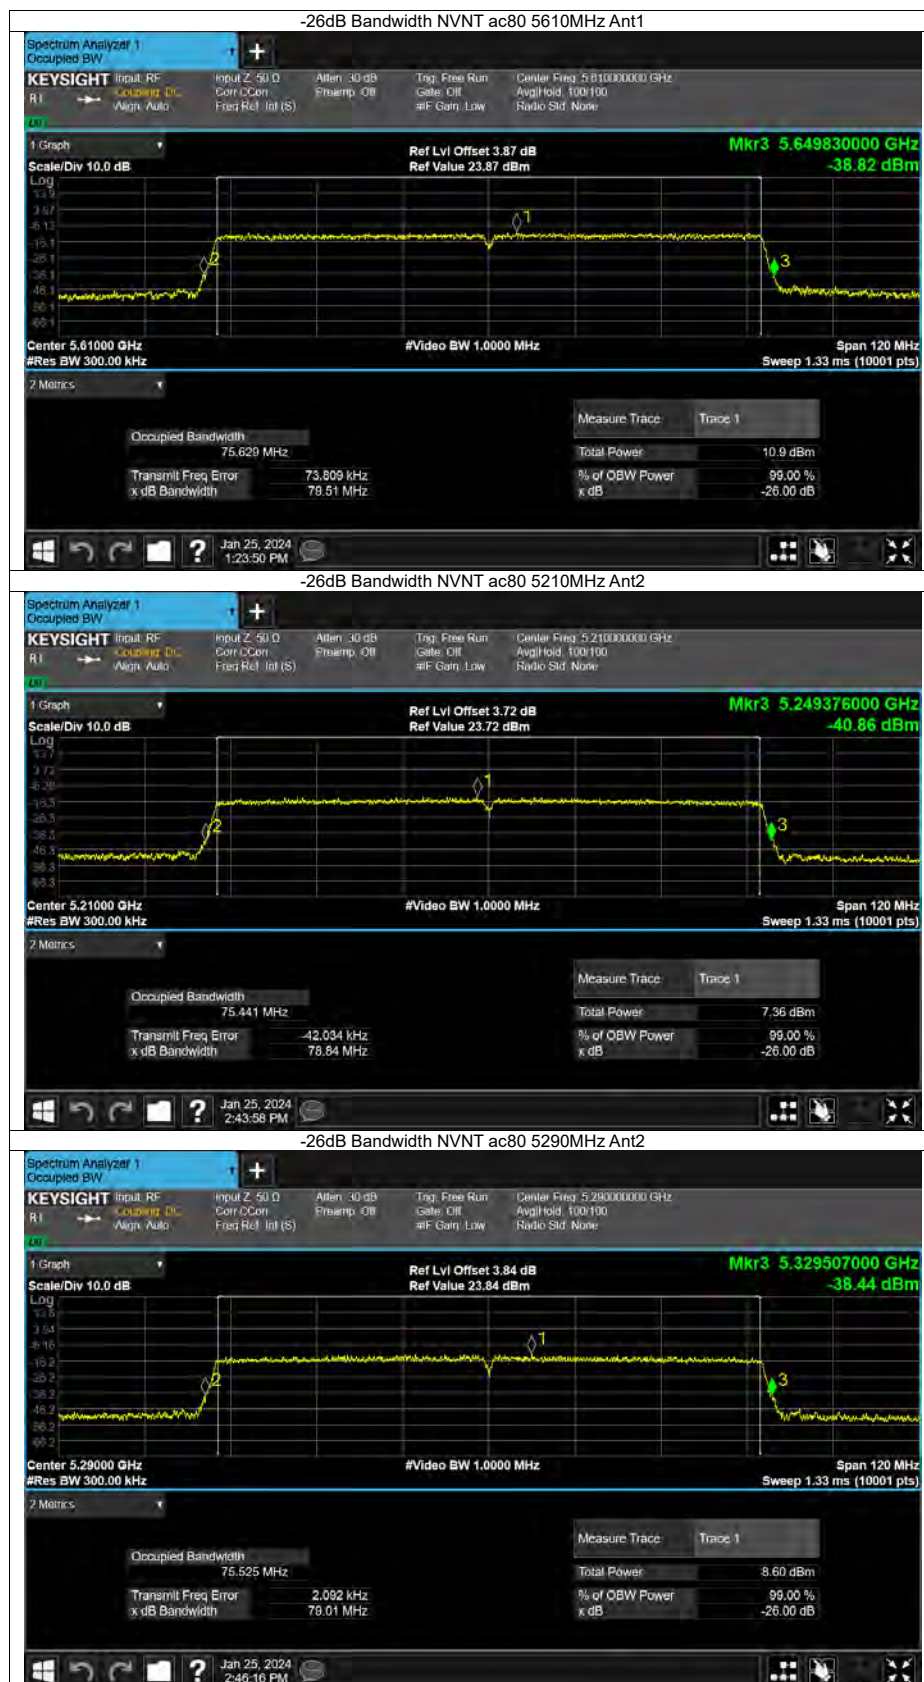

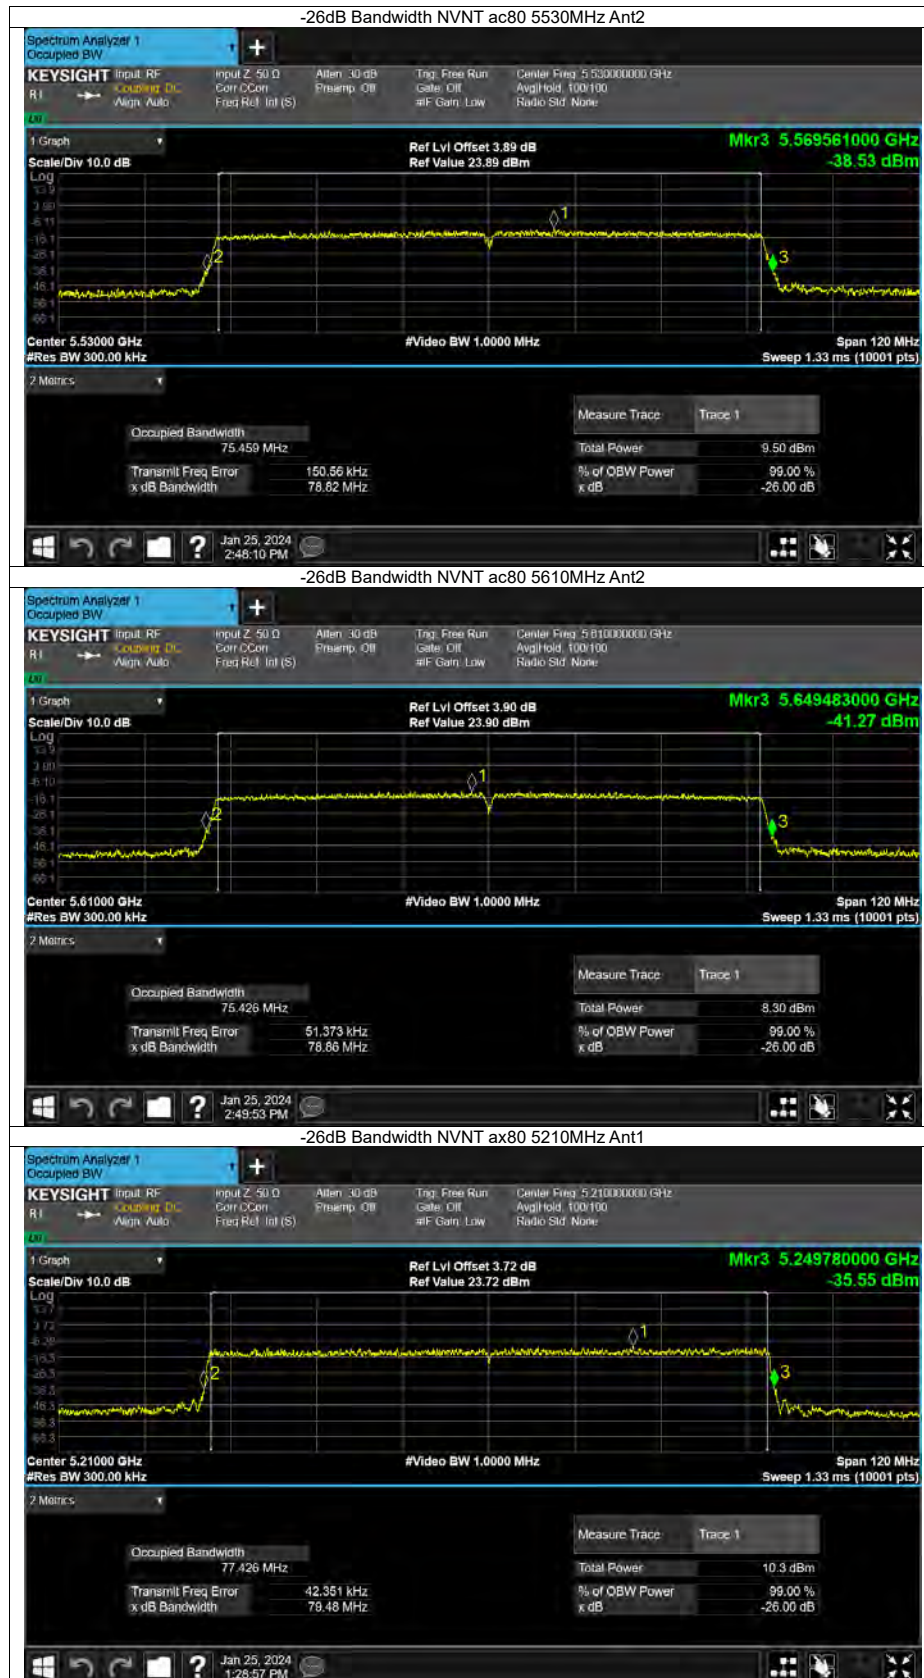

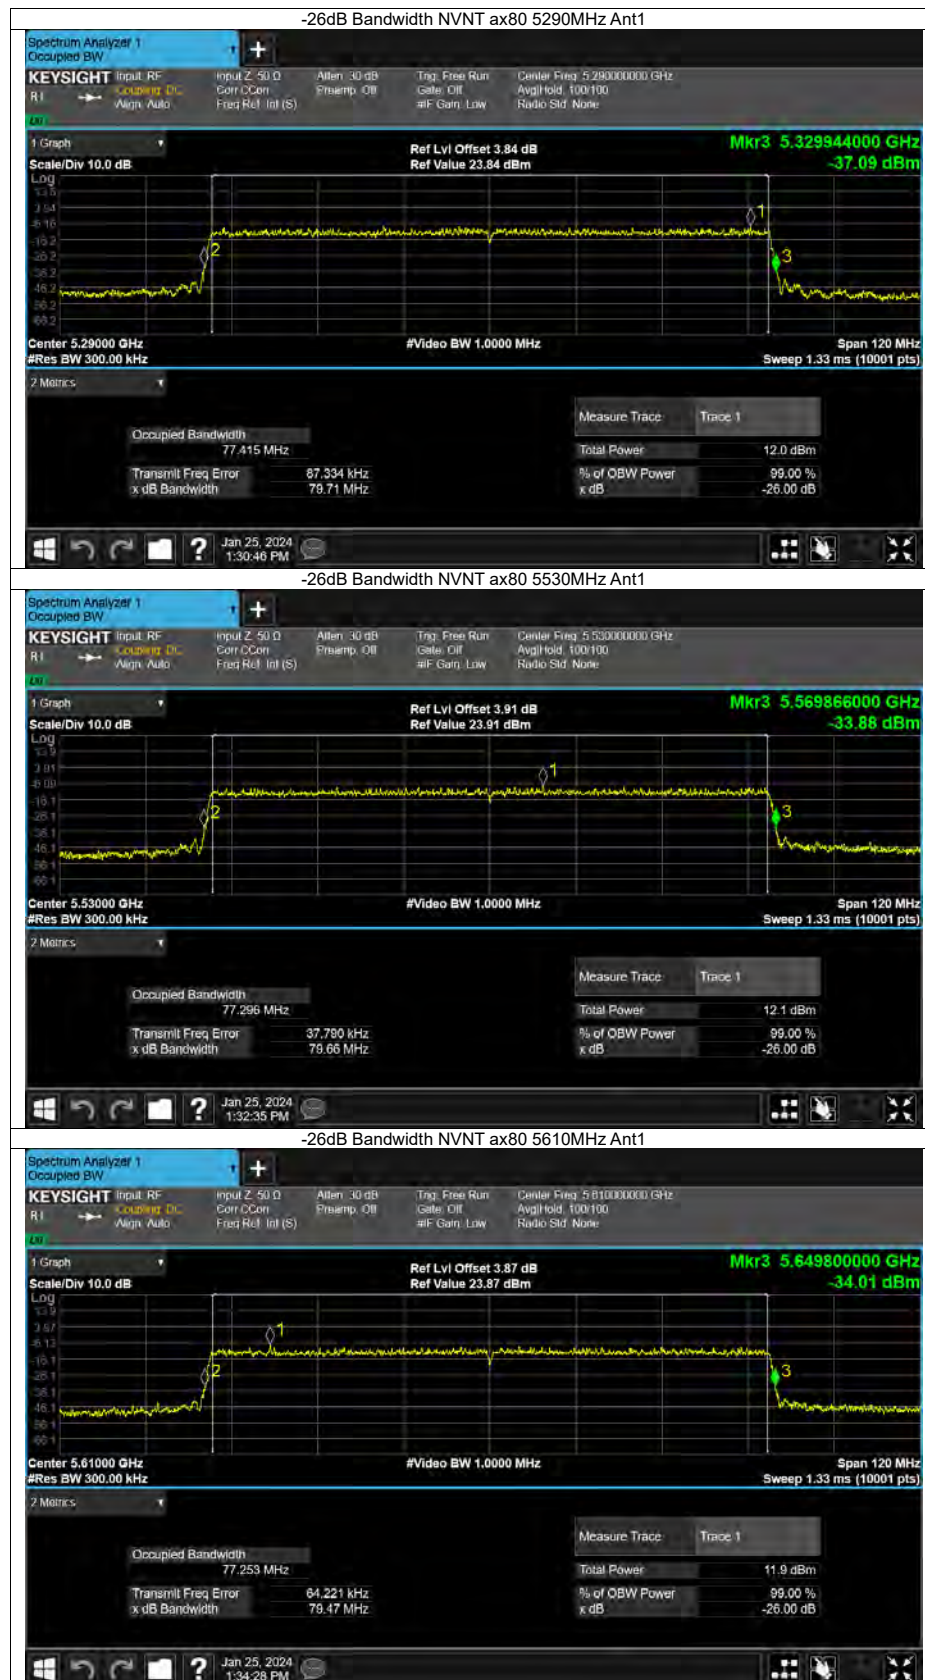

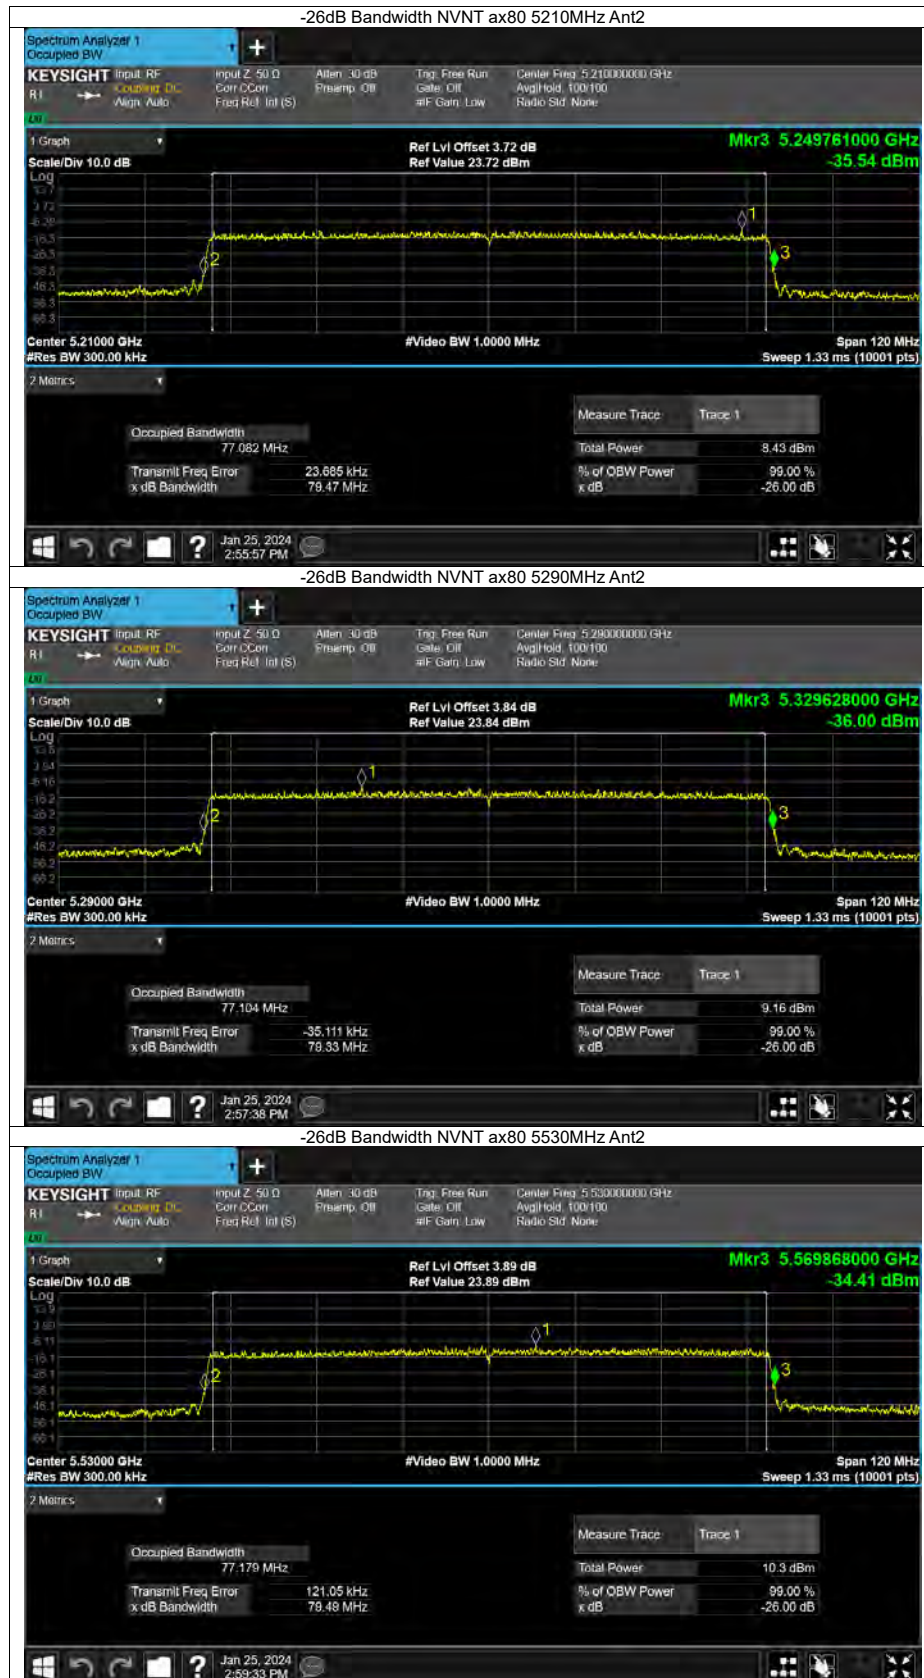

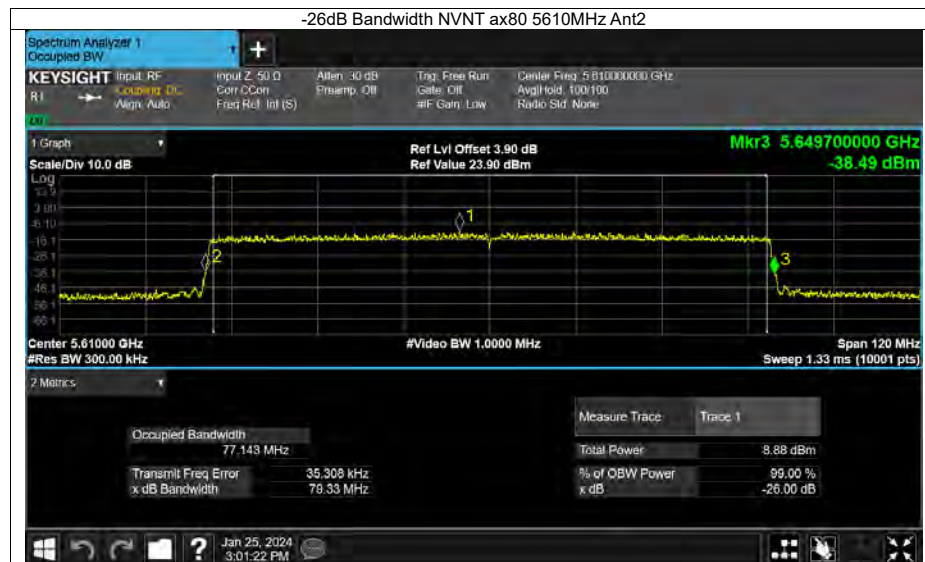



Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
NVNT	a	5180	Ant1	16.614
NVNT	a	5200	Ant1	16.65
NVNT	a	5240	Ant1	16.605
NVNT	a	5260	Ant1	16.654
NVNT	a	5300	Ant1	16.618
NVNT	a	5320	Ant1	16.62
NVNT	a	5500	Ant1	16.654
NVNT	a	5580	Ant1	16.664
NVNT	a	5700	Ant1	16.665
NVNT	a	5745	Ant1	16.618
NVNT	a	5785	Ant1	16.64
NVNT	a	5825	Ant1	16.603
NVNT	a	5180	Ant2	16.59
NVNT	a	5200	Ant2	16.629
NVNT	a	5240	Ant2	16.692
NVNT	a	5260	Ant2	16.751
NVNT	a	5300	Ant2	16.732
NVNT	a	5320	Ant2	16.752
NVNT	a	5500	Ant2	16.719
NVNT	a	5580	Ant2	16.669
NVNT	a	5700	Ant2	16.67
NVNT	a	5745	Ant2	16.651
NVNT	a	5785	Ant2	16.645
NVNT	a	5825	Ant2	16.627
NVNT	n20	5180	Ant1	17.817
NVNT	n20	5200	Ant1	17.805
NVNT	n20	5240	Ant1	17.826
NVNT	n20	5260	Ant1	17.848
NVNT	n20	5300	Ant1	17.82
NVNT	n20	5320	Ant1	17.834
NVNT	n20	5500	Ant1	17.831
NVNT	n20	5580	Ant1	17.841
NVNT	n20	5700	Ant1	17.811
NVNT	n20	5745	Ant1	17.816
NVNT	n20	5785	Ant1	17.824
NVNT	n20	5825	Ant1	17.823
NVNT	n20	5180	Ant2	17.813
NVNT	n20	5200	Ant2	17.806
NVNT	n20	5240	Ant2	17.785
NVNT	n20	5260	Ant2	17.793
NVNT	n20	5300	Ant2	17.854
NVNT	n20	5320	Ant2	17.796
NVNT	n20	5500	Ant2	17.801
NVNT	n20	5580	Ant2	17.817
NVNT	n20	5700	Ant2	17.802
NVNT	n20	5745	Ant2	17.793
NVNT	n20	5785	Ant2	17.803
NVNT	n20	5825	Ant2	17.784
NVNT	n40	5190	Ant1	36.091
NVNT	n40	5230	Ant1	36.047
NVNT	n40	5270	Ant1	36.082
NVNT	n40	5310	Ant1	36.11
NVNT	n40	5510	Ant1	36.101
NVNT	n40	5550	Ant1	36.101
NVNT	n40	5670	Ant1	36.139
NVNT	n40	5755	Ant1	36.015
NVNT	n40	5795	Ant1	36.075
NVNT	n40	5190	Ant2	36.046
NVNT	n40	5230	Ant2	36.014
NVNT	n40	5270	Ant2	36.044
NVNT	n40	5310	Ant2	36.011
NVNT	n40	5510	Ant2	35.98
NVNT	n40	5550	Ant2	35.961
NVNT	n40	5670	Ant2	35.973
NVNT	n40	5755	Ant2	35.973
NVNT	n40	5795	Ant2	35.994
NVNT	ac80	5210	Ant1	75.663
NVNT	ac80	5290	Ant1	75.668
NVNT	ac80	5530	Ant1	75.668
NVNT	ac80	5610	Ant1	75.631
NVNT	ac80	5775	Ant1	75.625
NVNT	ac80	5210	Ant2	75.465
NVNT	ac80	5290	Ant2	75.46
NVNT	ac80	5530	Ant2	75.428
NVNT	ac80	5610	Ant2	75.398
NVNT	ac80	5775	Ant2	75.458
NVNT	ax80	5210	Ant1	77.302
NVNT	ax80	5290	Ant1	77.322
NVNT	ax80	5530	Ant1	77.367
NVNT	ax80	5610	Ant1	77.226
NVNT	ax80	5775	Ant1	77.272
NVNT	ax80	5210	Ant2	77.197
NVNT	ax80	5290	Ant2	77.126
NVNT	ax80	5530	Ant2	77.078
NVNT	ax80	5610	Ant2	77.18
NVNT	ax80	5775	Ant2	77.122

















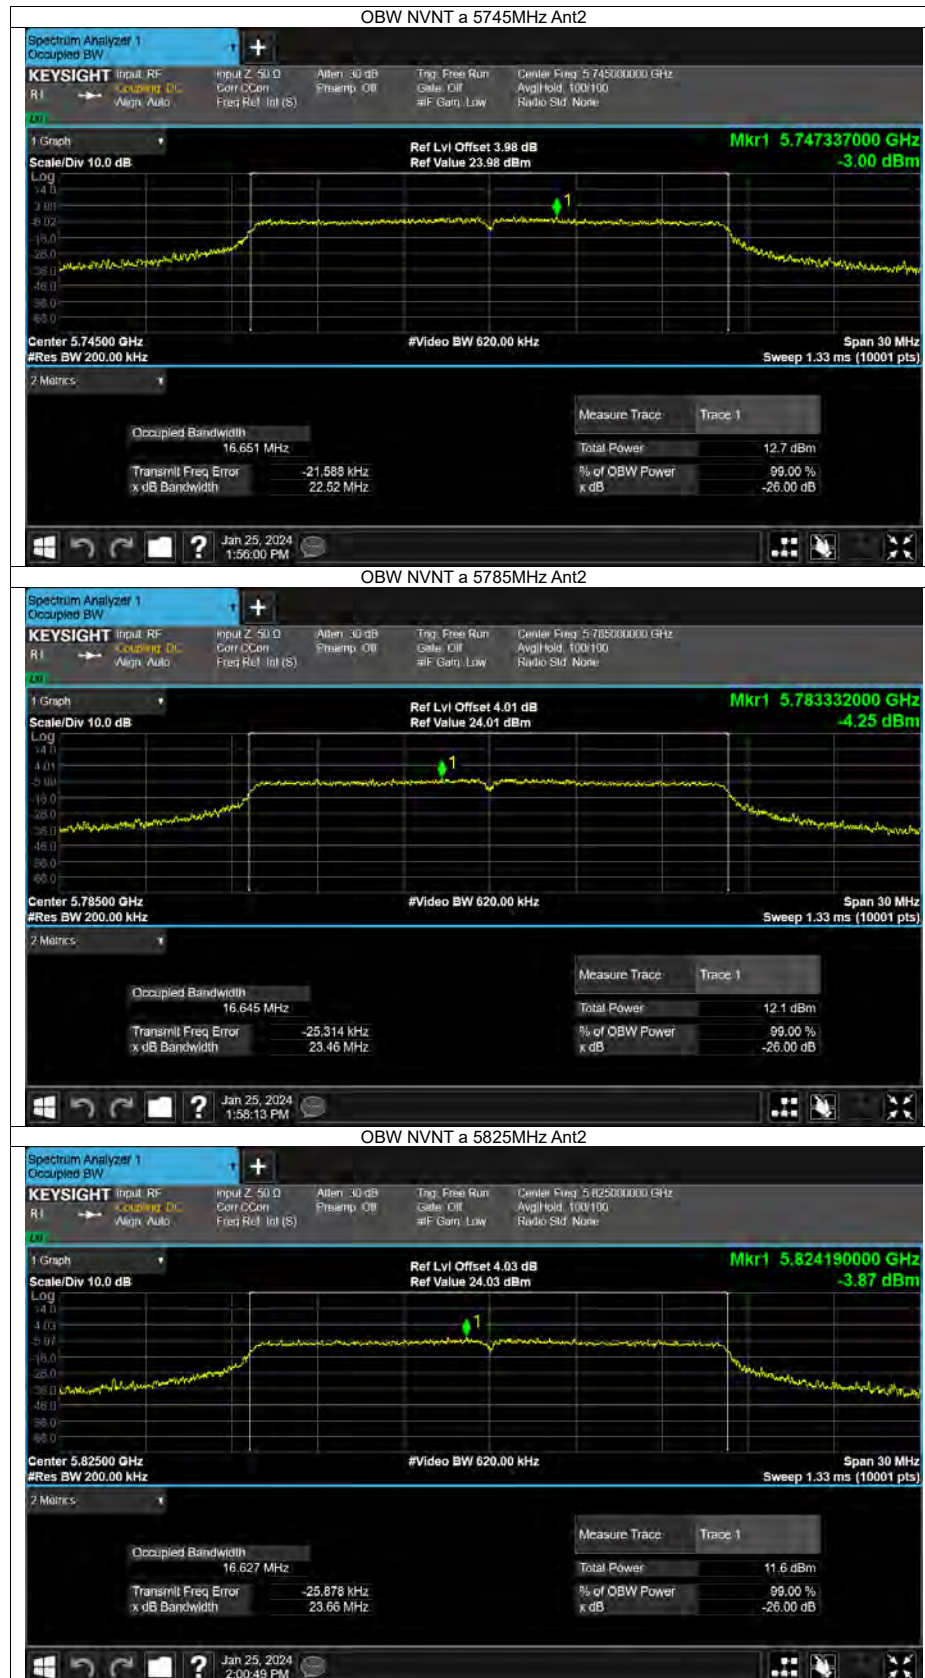







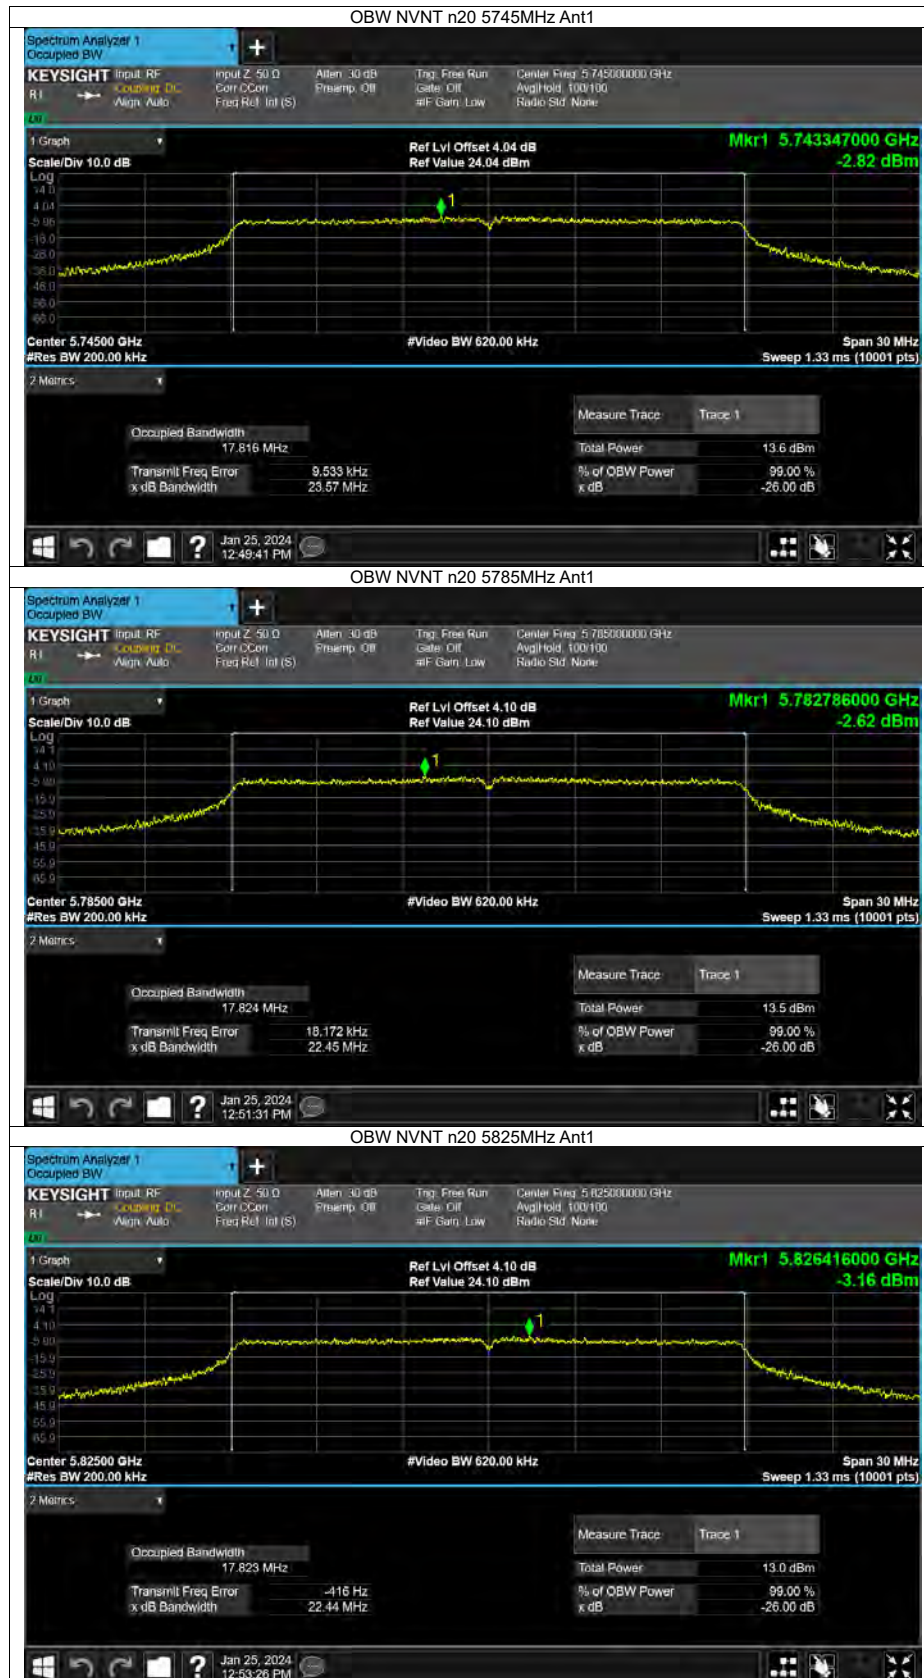














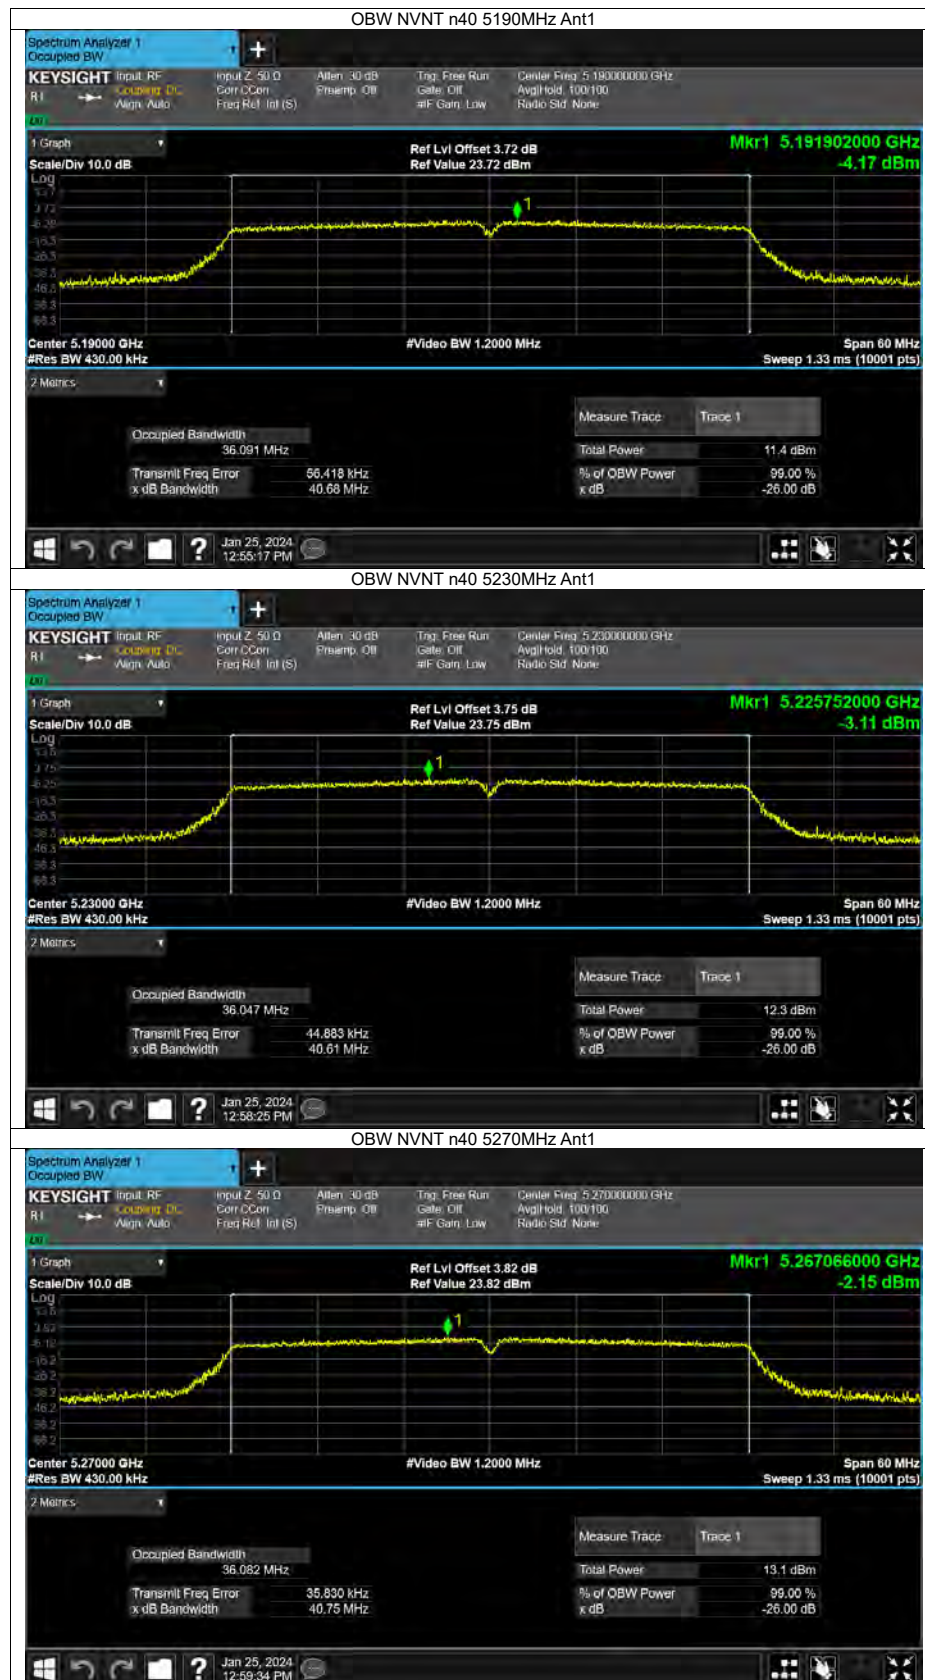


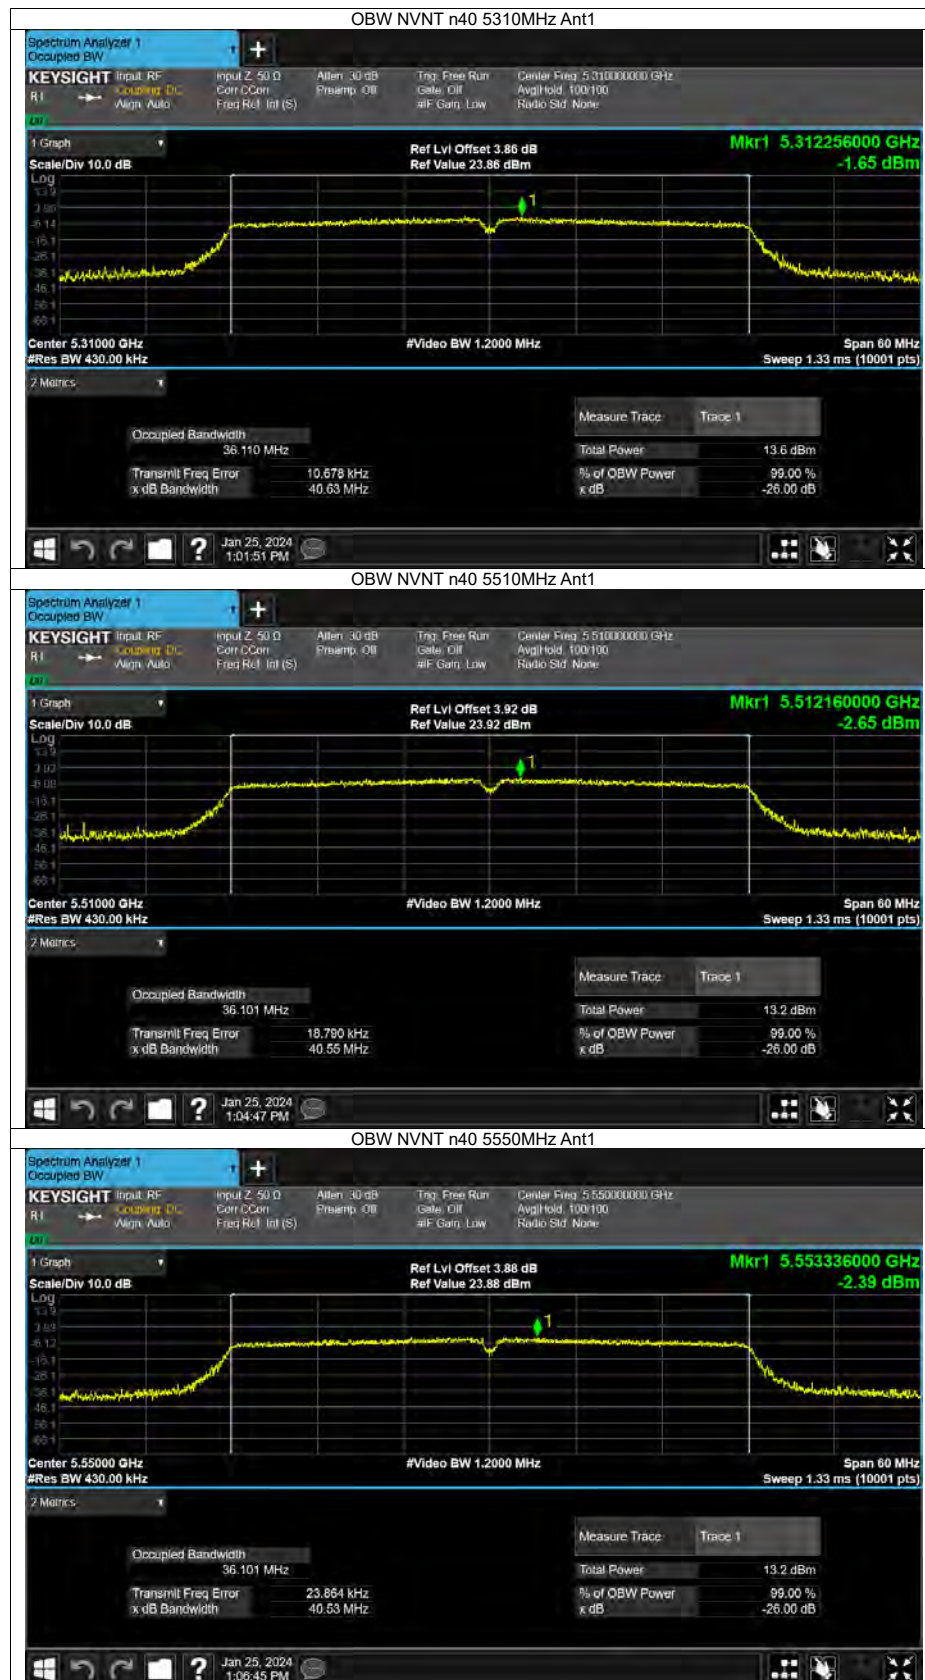


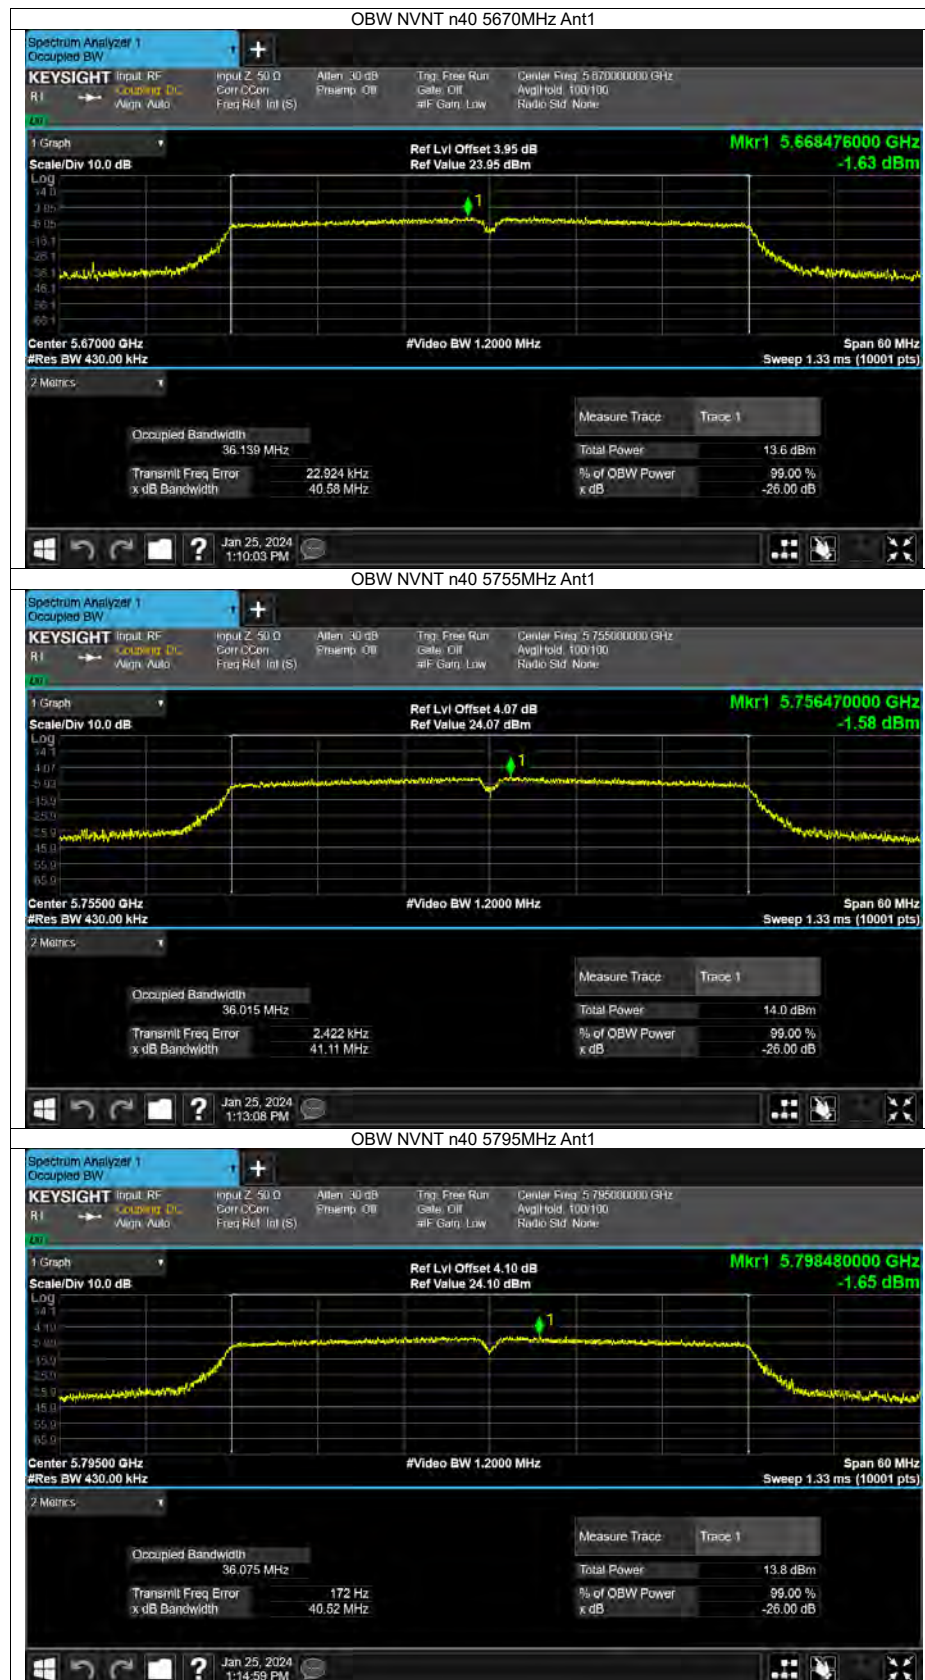


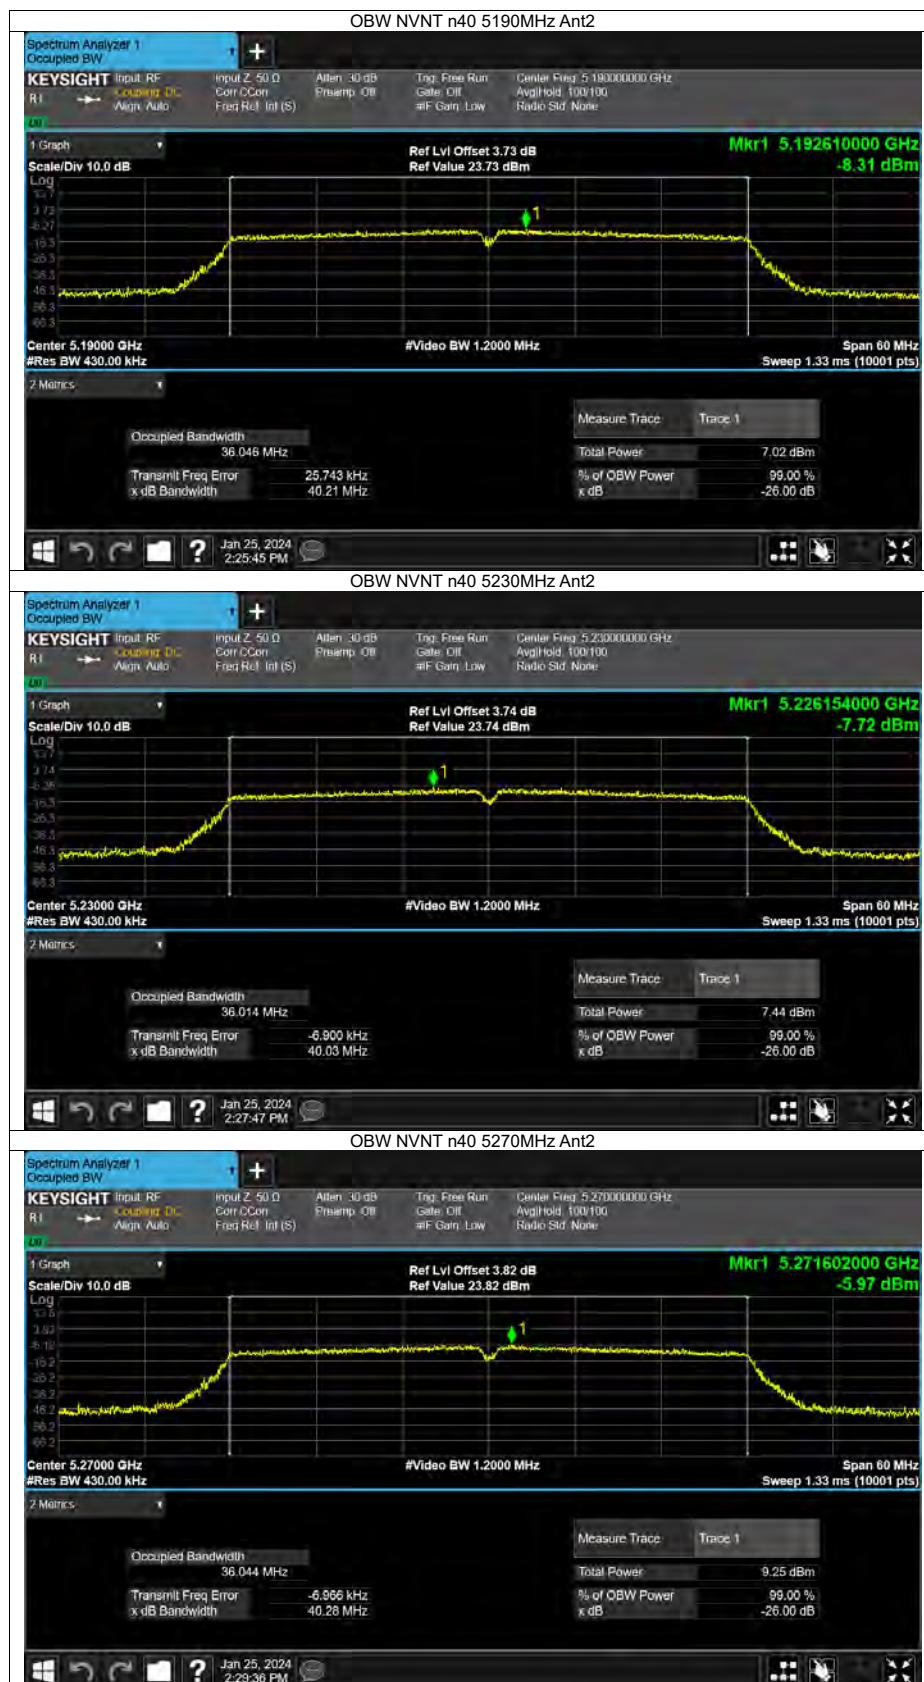


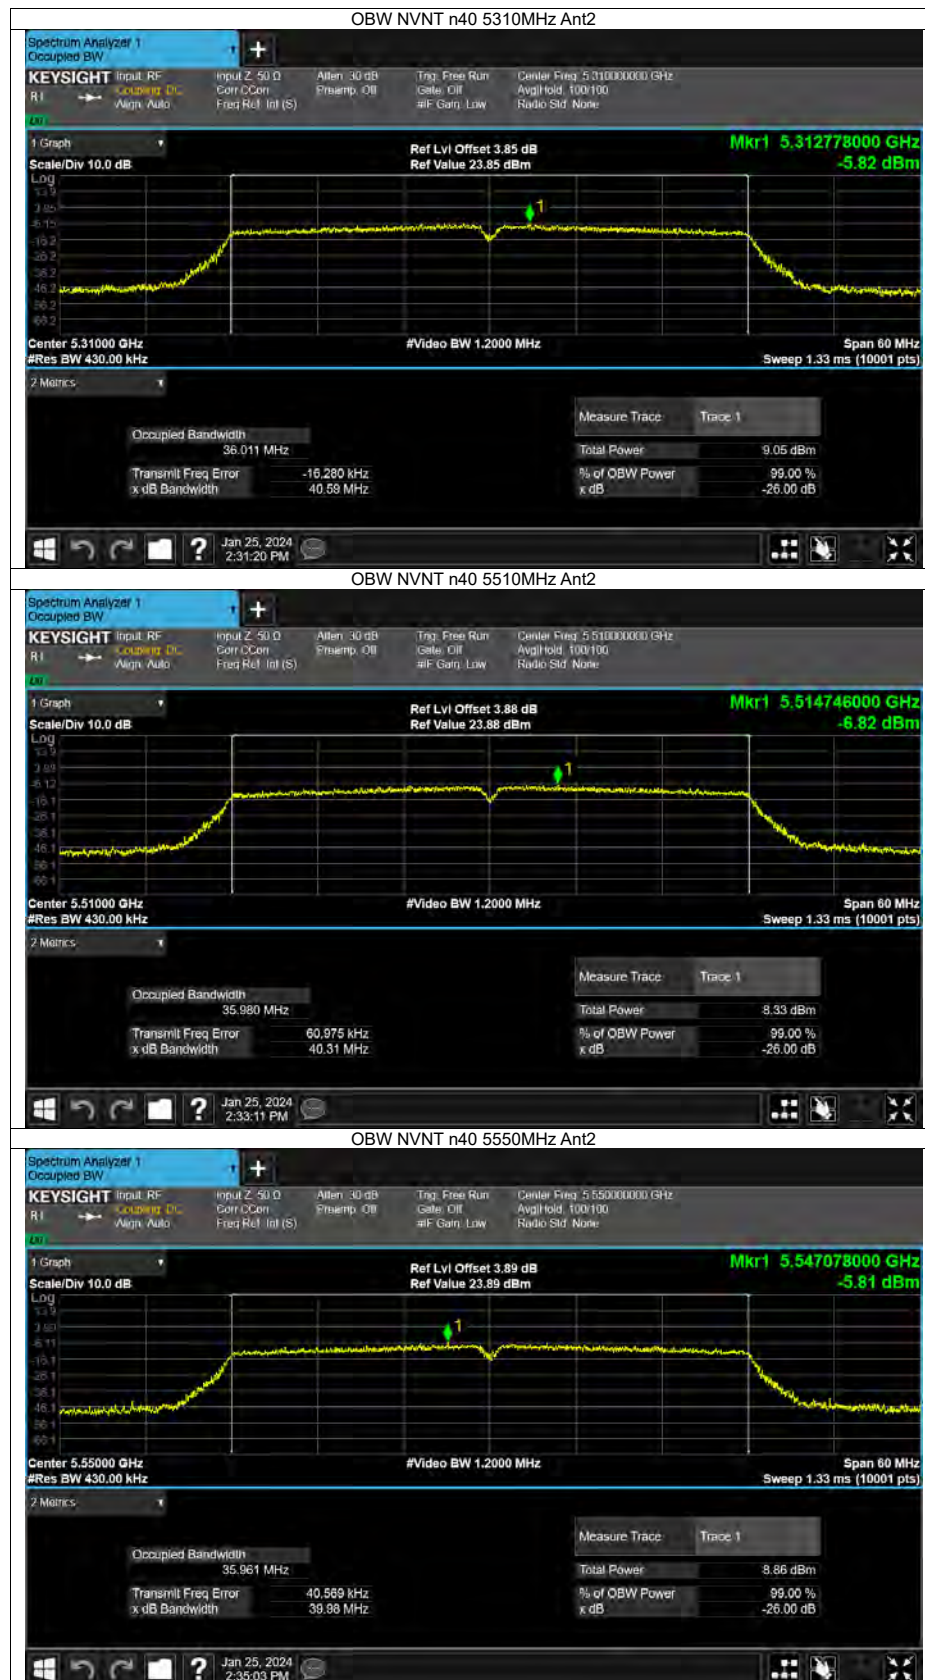


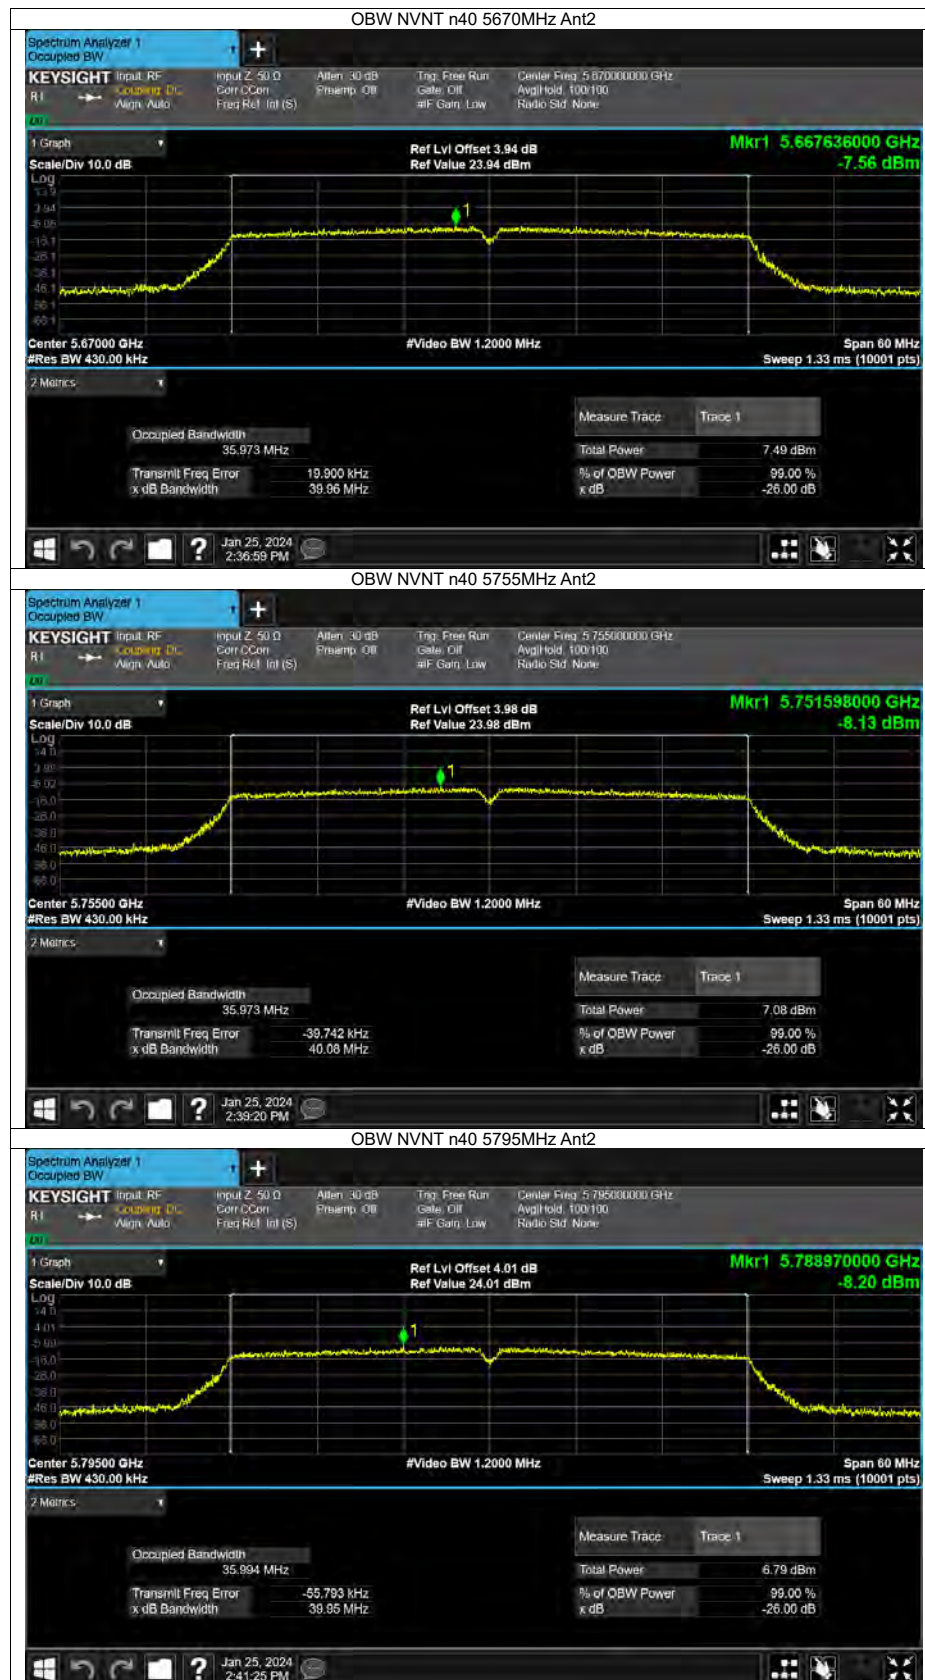


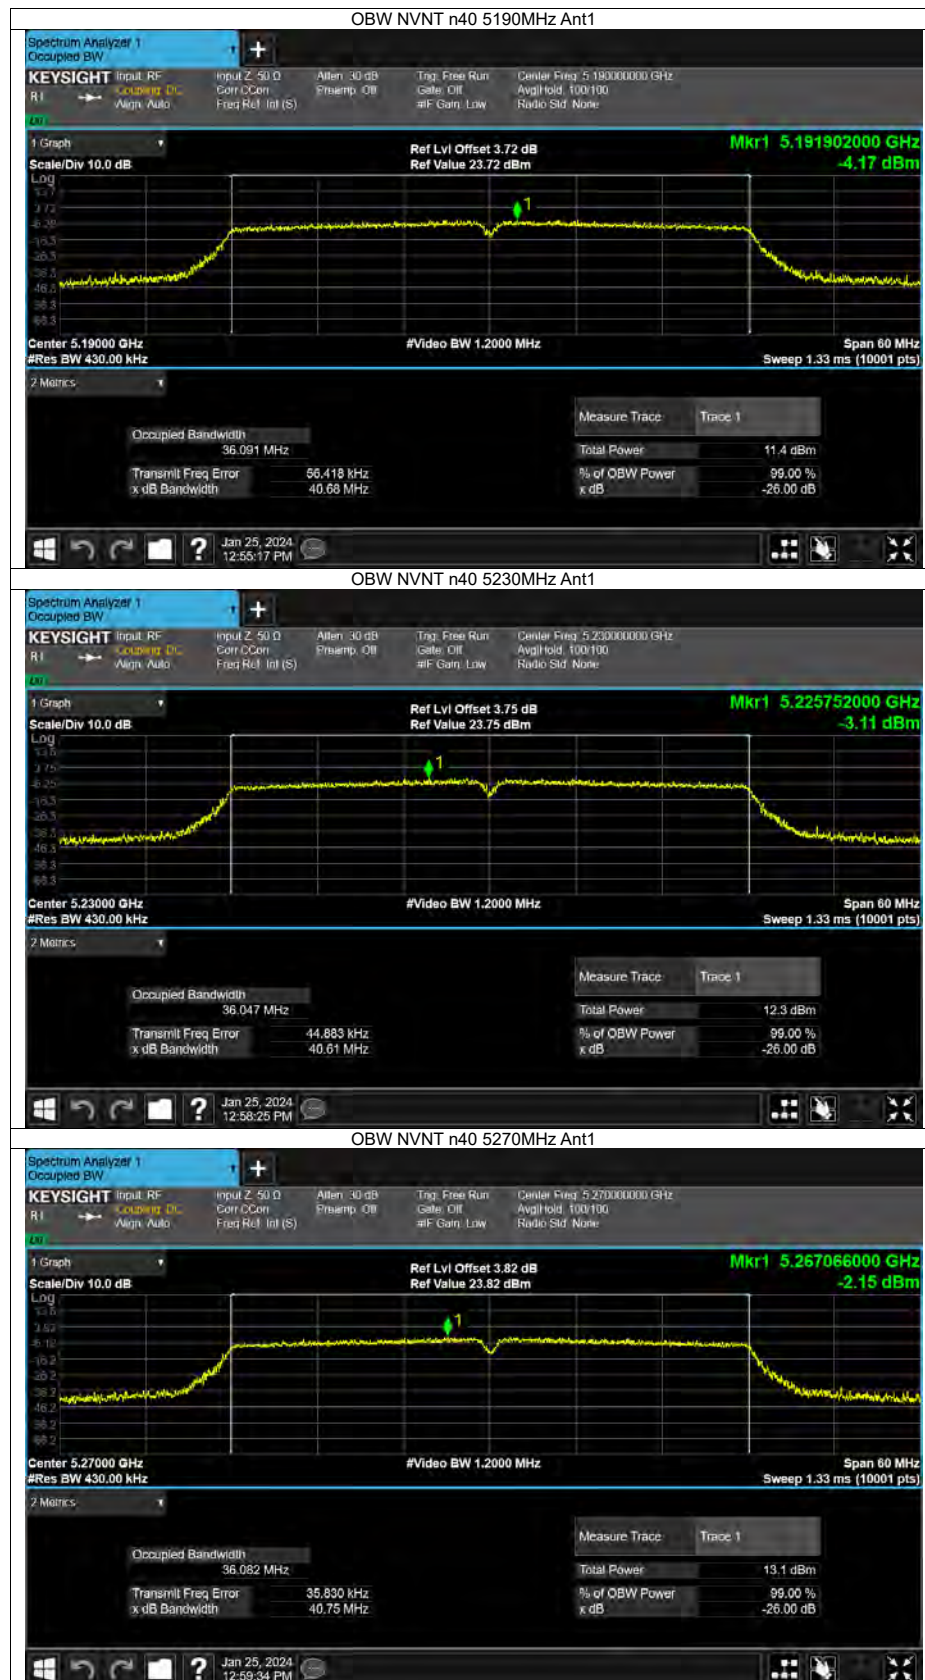


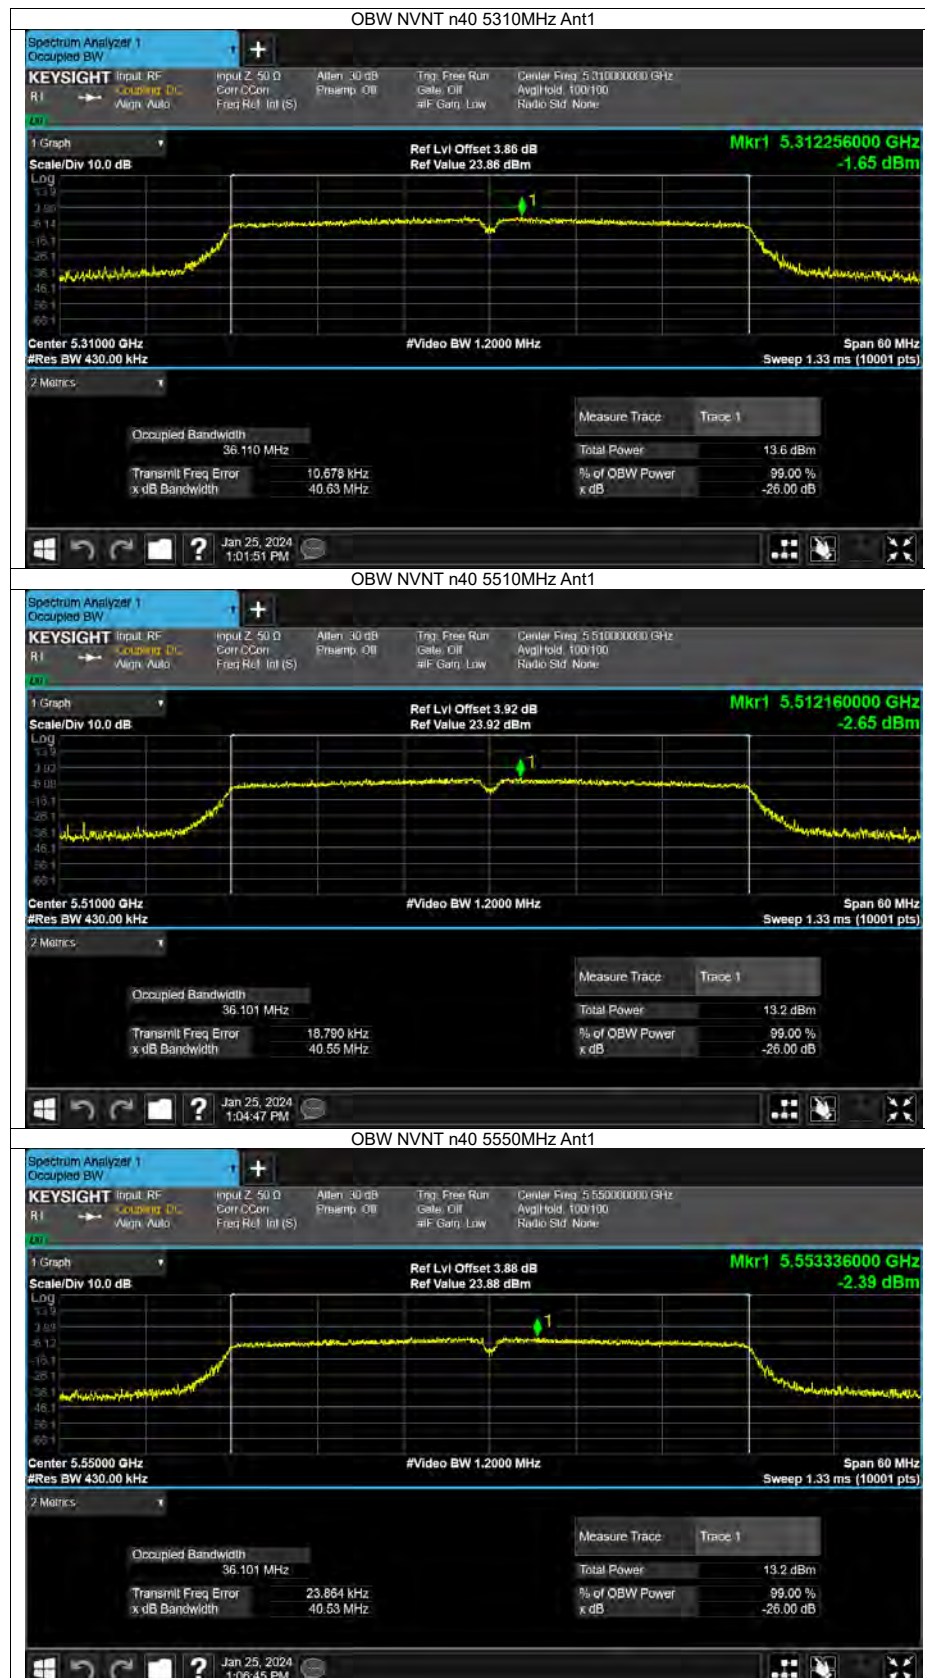


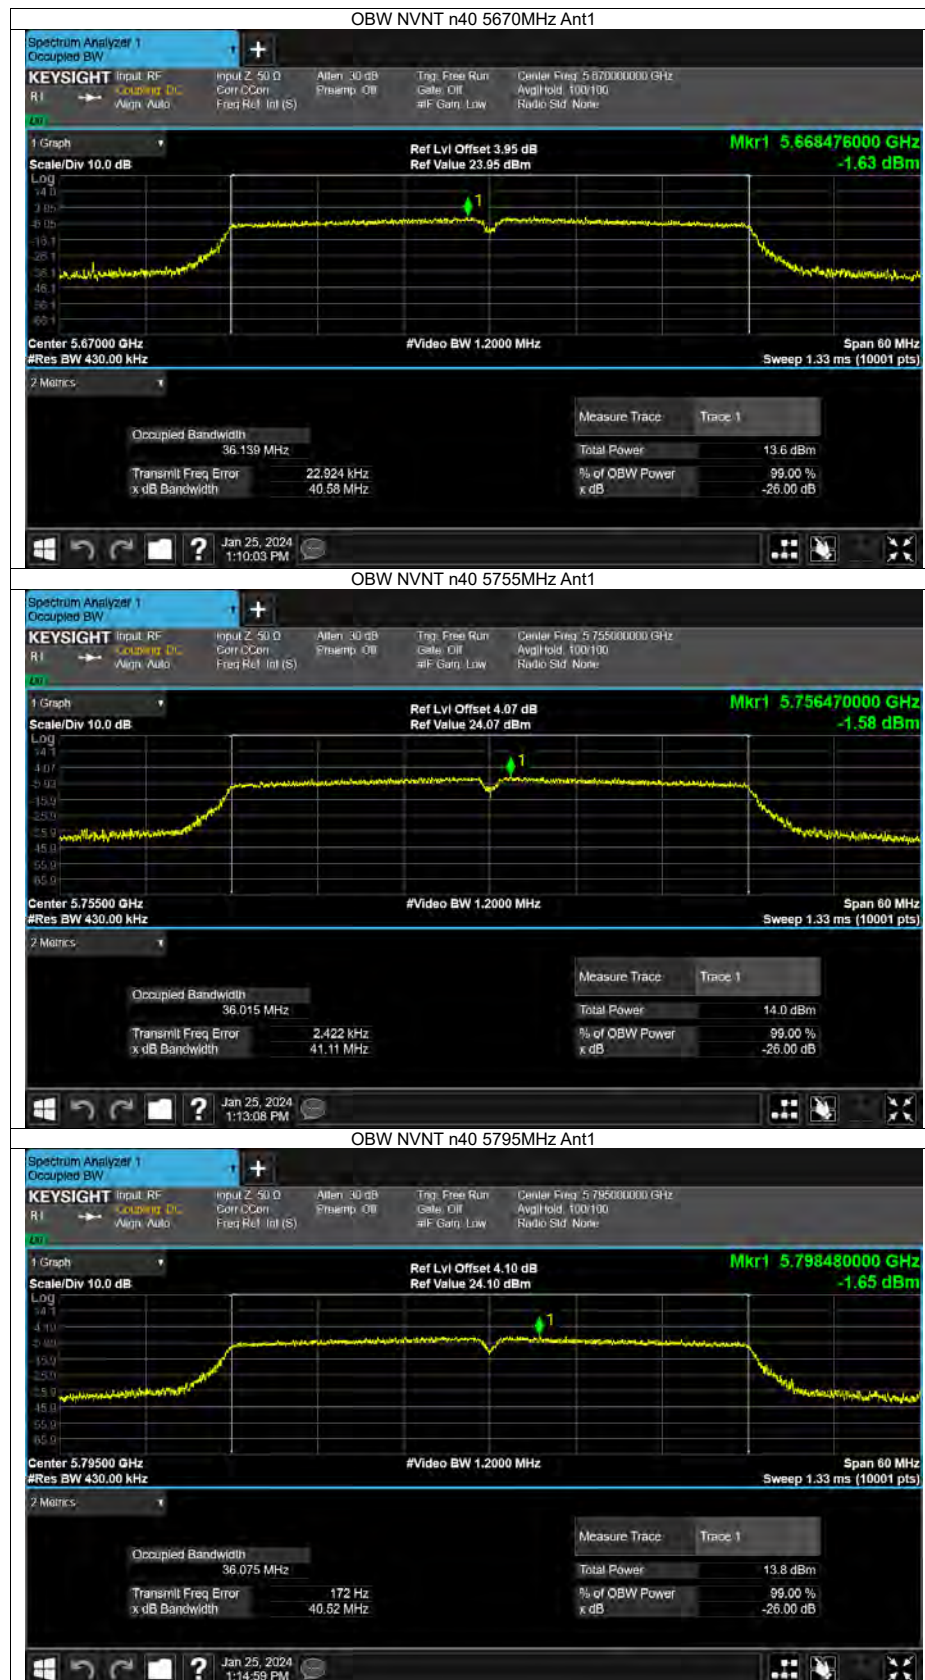


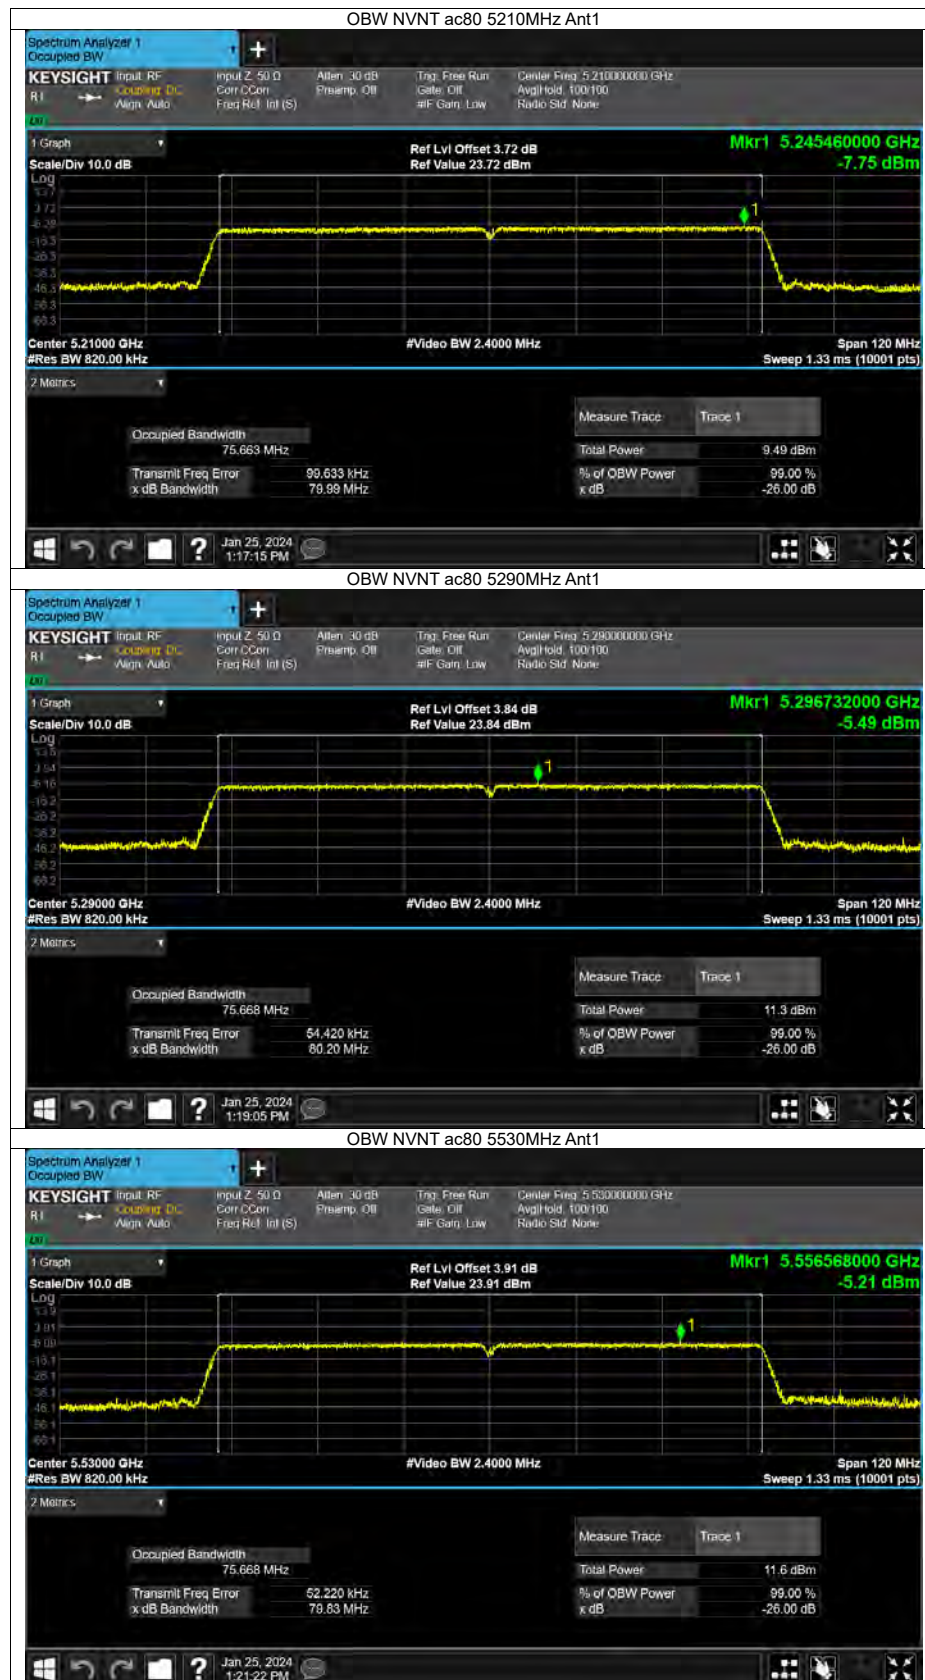


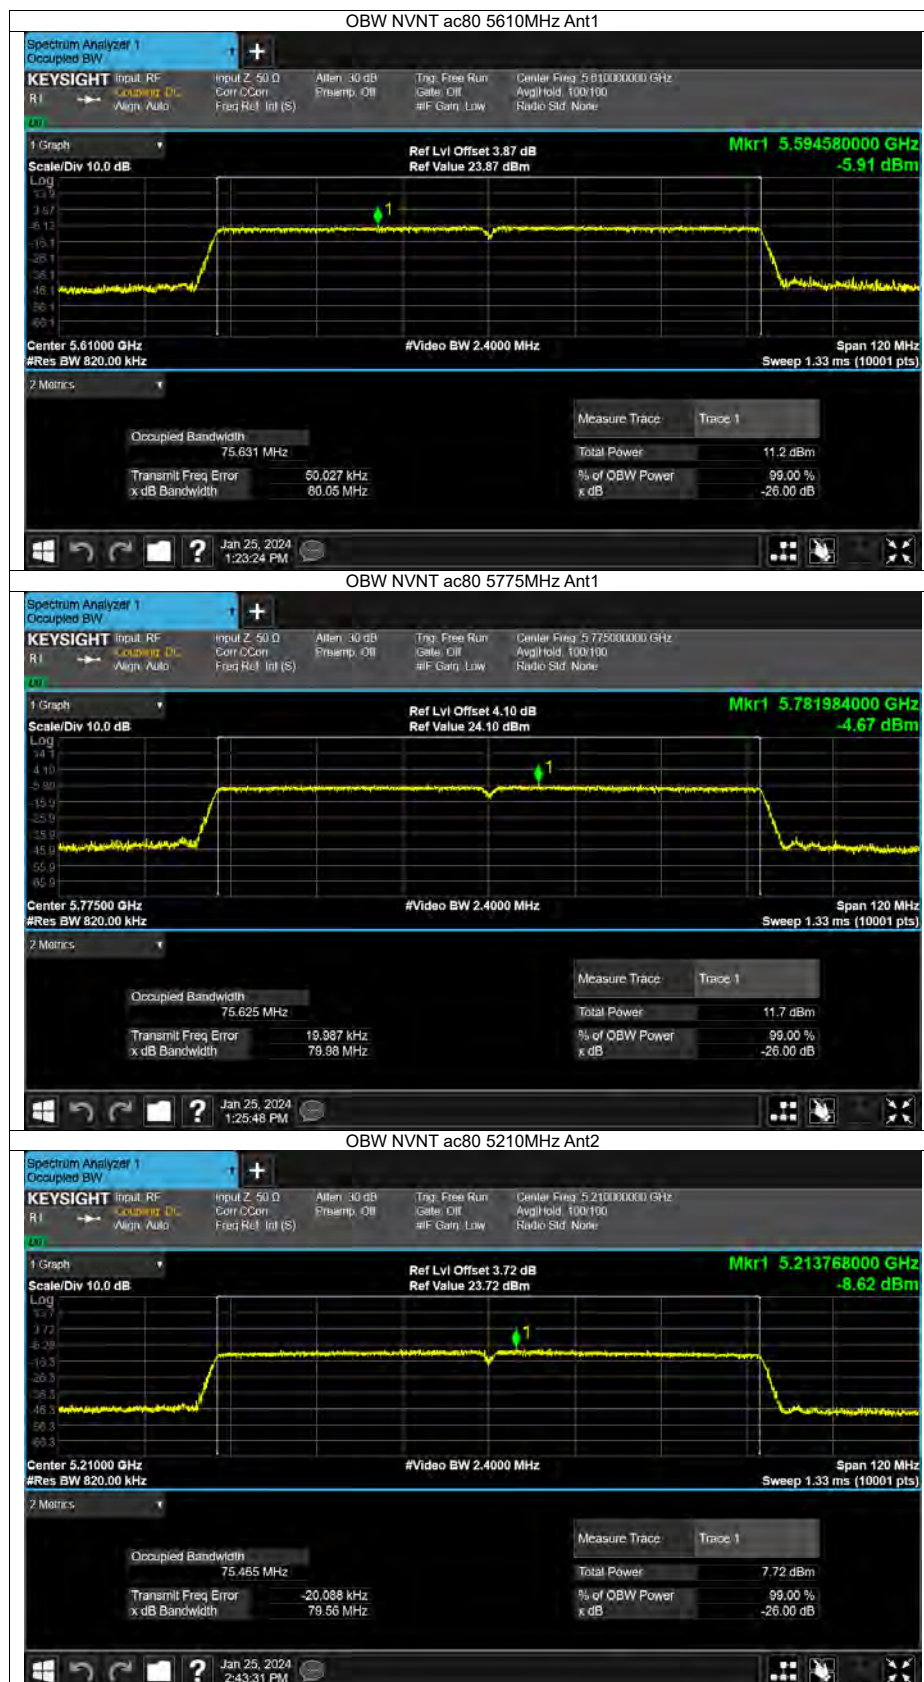


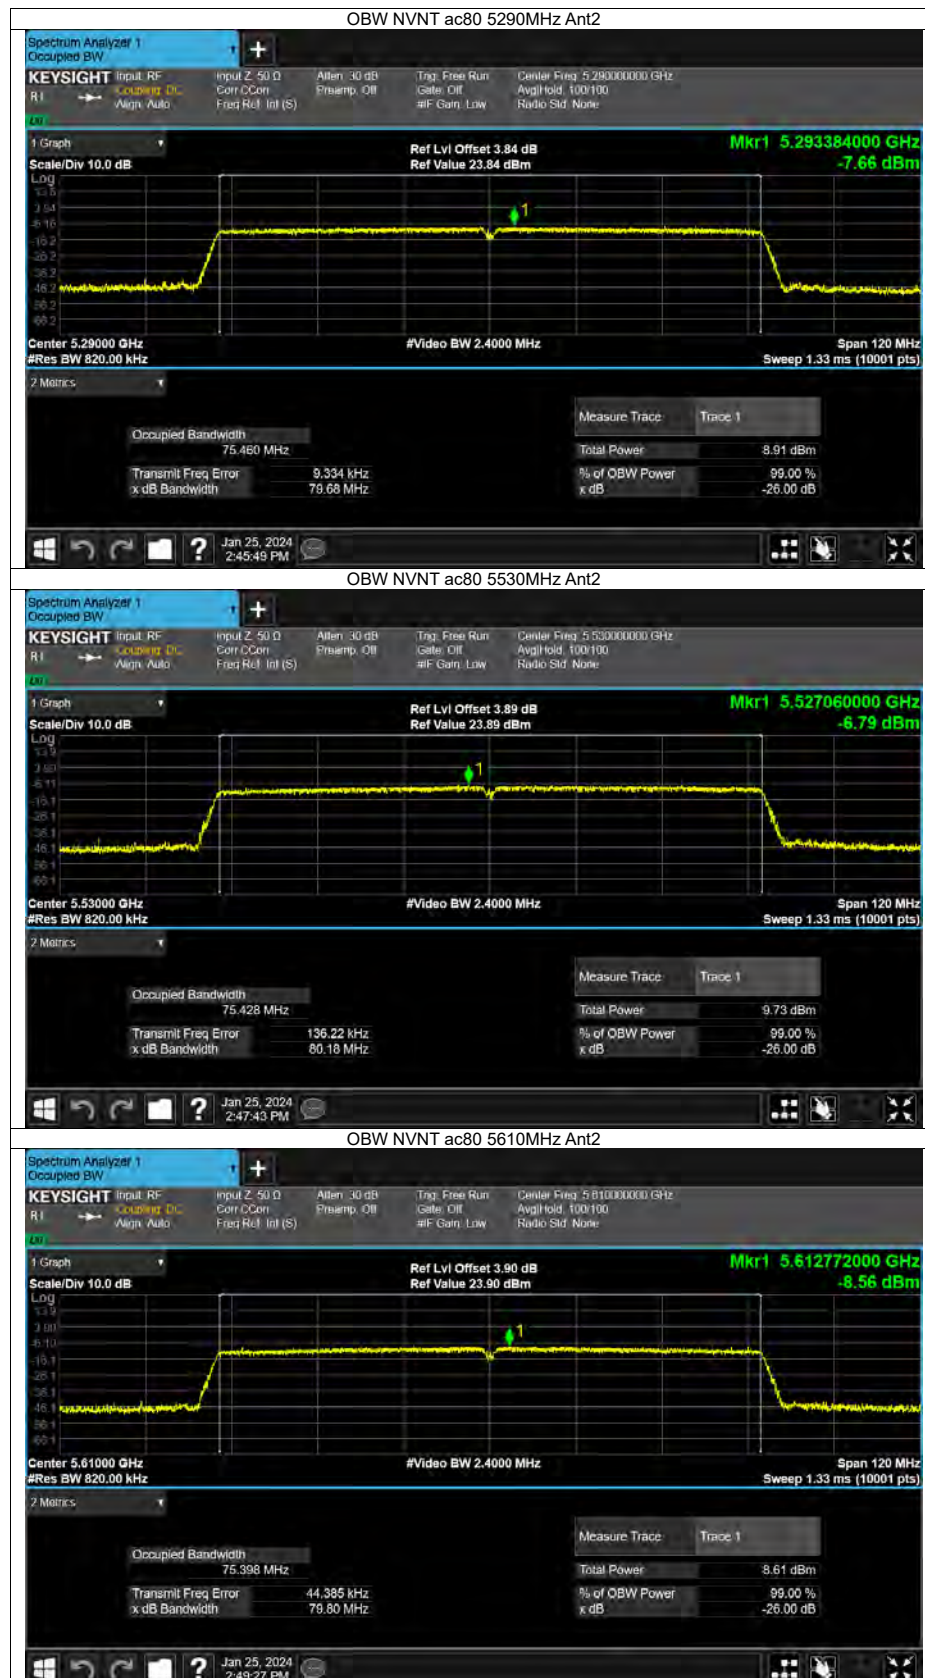

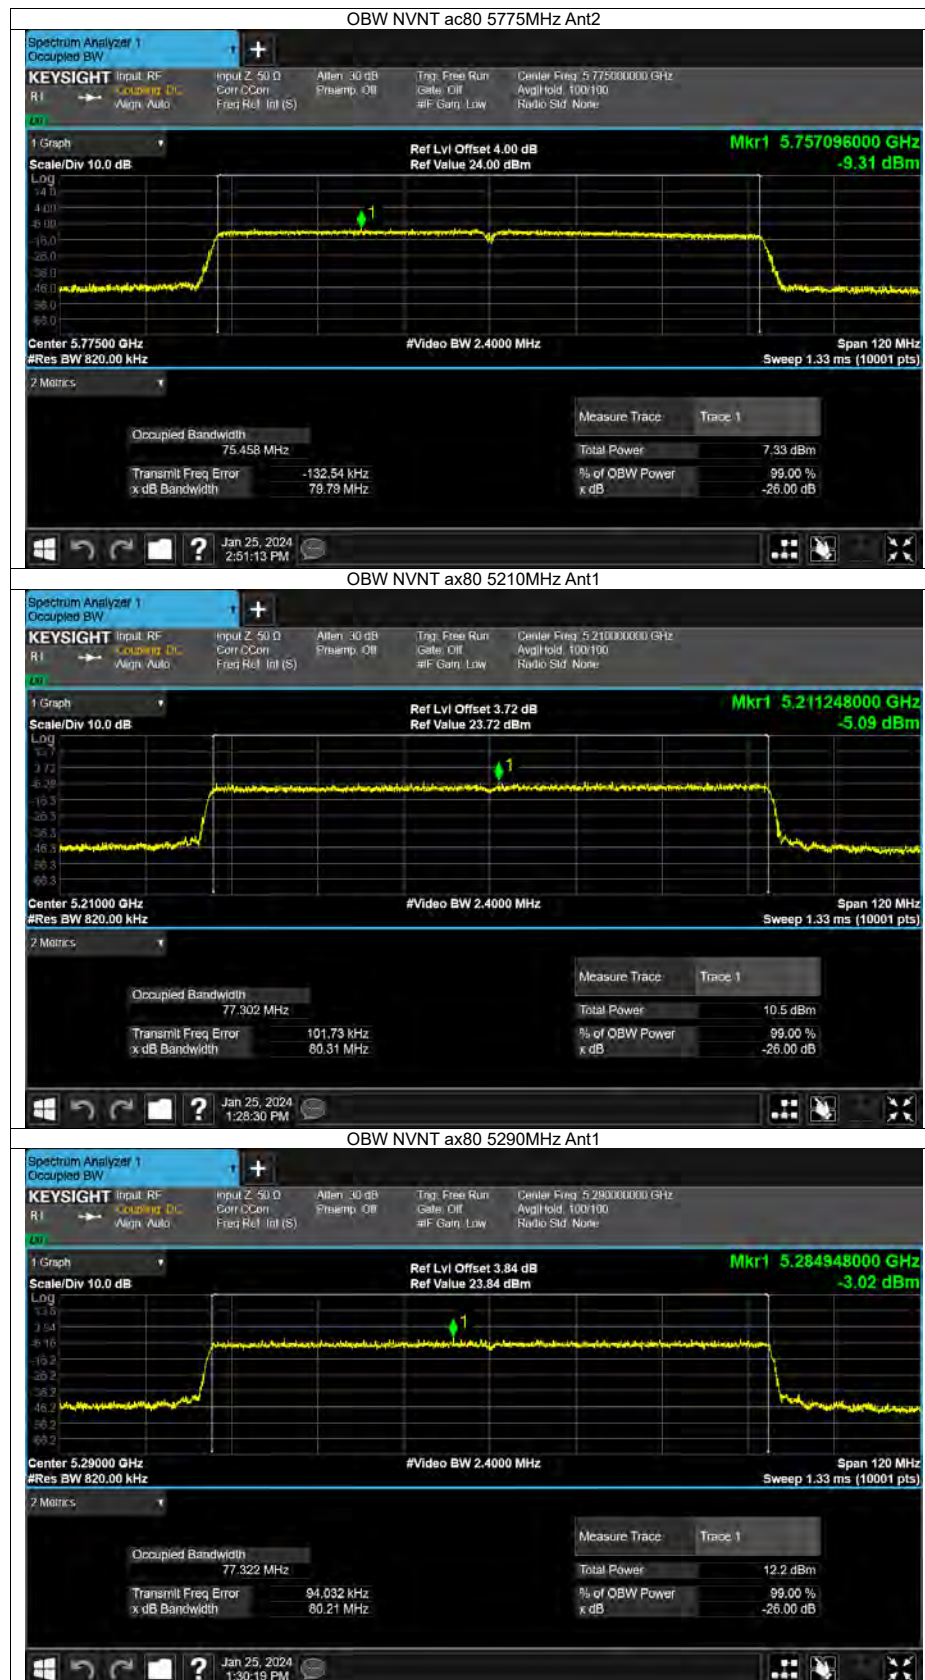

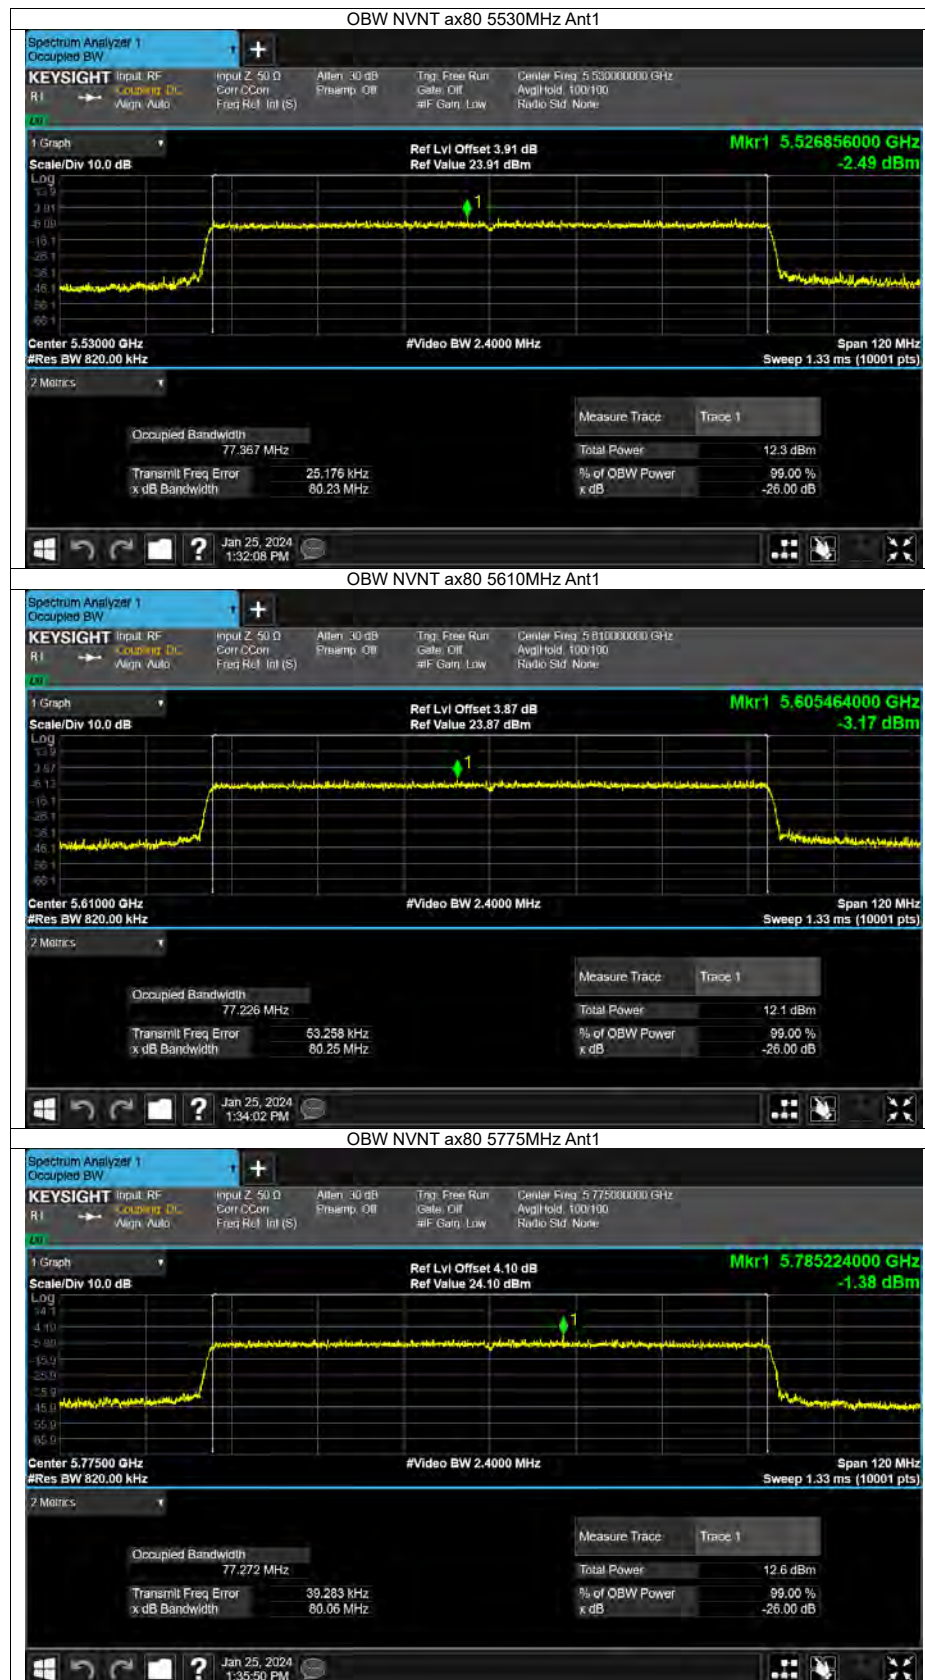

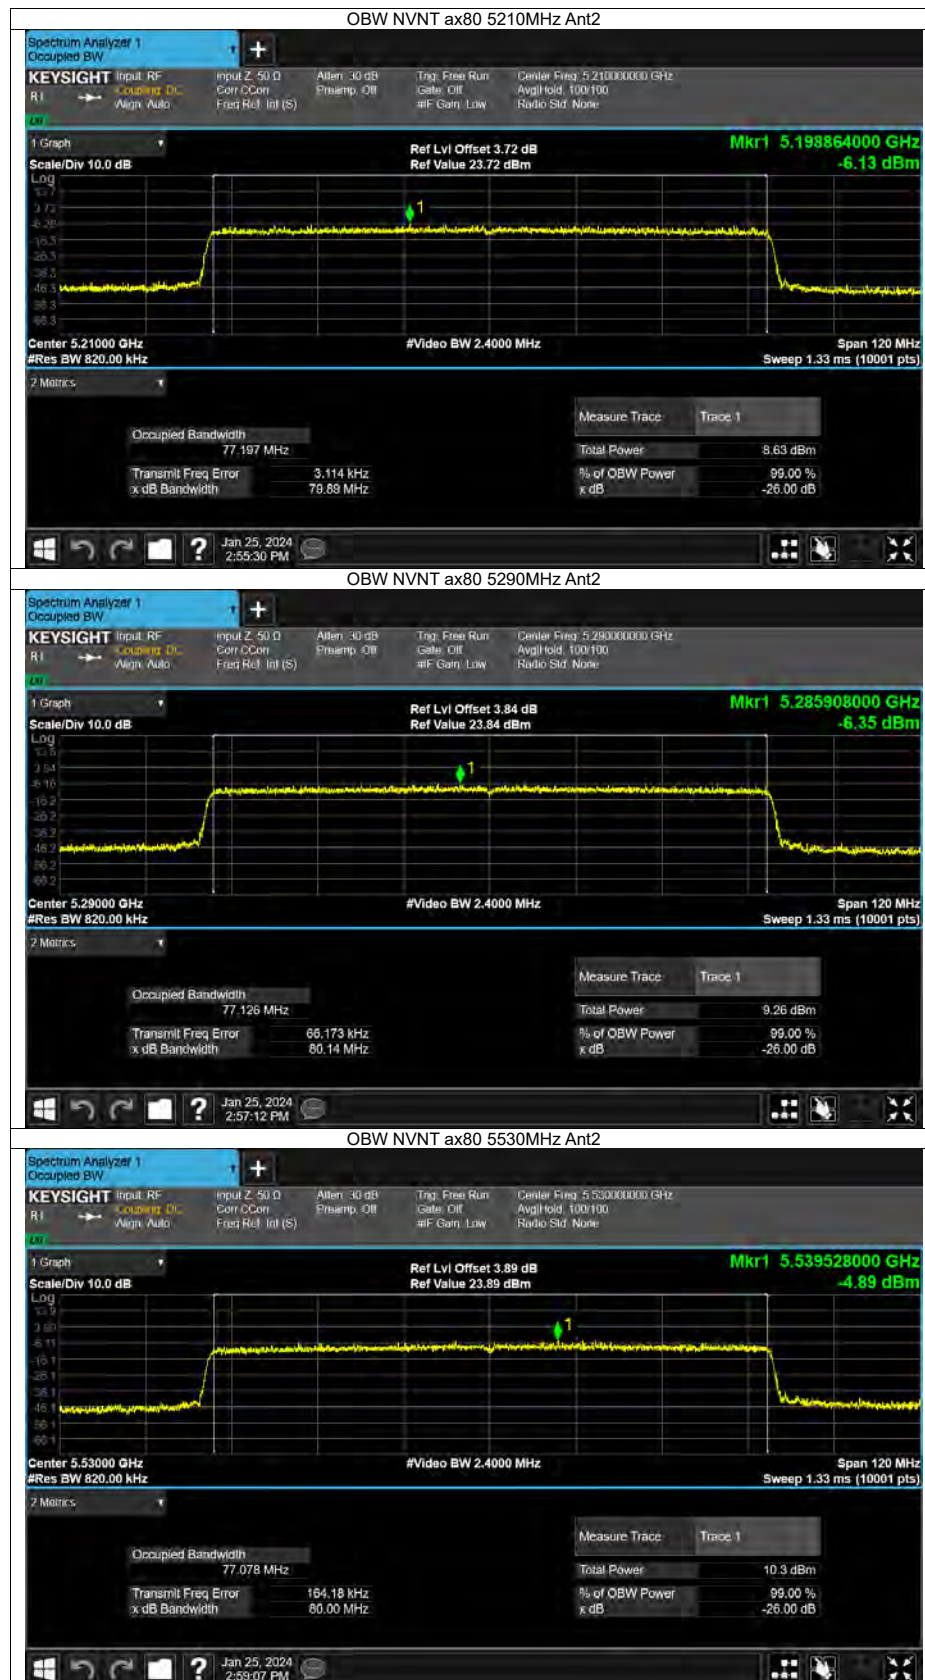

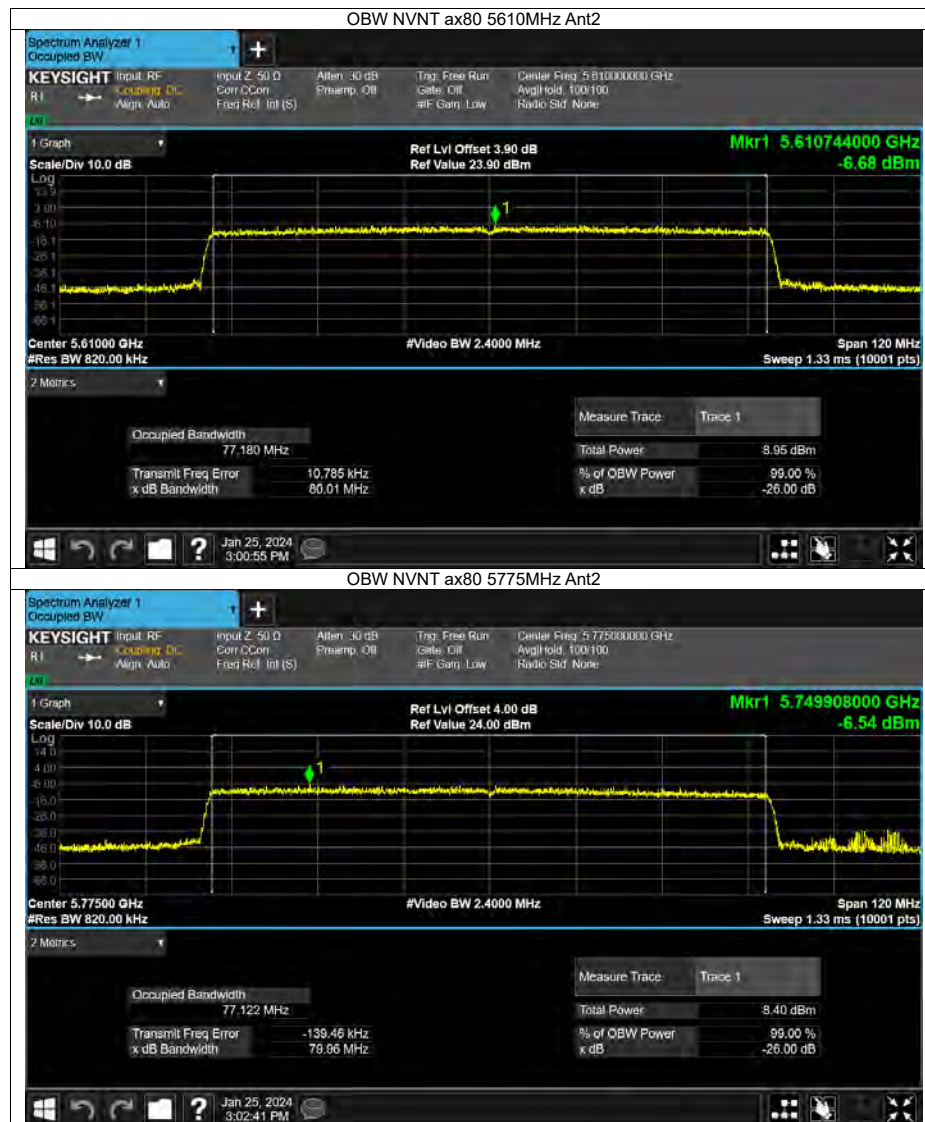



Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	-4.82	0	-4.82	11	Pass
NVNT	a	5200	Ant1	-3.39	0	-3.39	11	Pass
NVNT	a	5240	Ant1	-3.3	0	-3.3	11	Pass
NVNT	a	5260	Ant1	-2.19	0	-2.19	11	Pass
NVNT	a	5300	Ant1	-1.69	0	-1.69	11	Pass
NVNT	a	5320	Ant1	-1.52	0	-1.52	11	Pass
NVNT	a	5500	Ant1	-1.68	0	-1.68	11	Pass
NVNT	a	5580	Ant1	-1.38	0	-1.38	11	Pass
NVNT	a	5700	Ant1	-1.59	0	-1.59	11	Pass
NVNT	a	5180	Ant2	-10.16	0	-10.16	11	Pass
NVNT	a	5200	Ant2	-4.56	0	-4.56	11	Pass
NVNT	a	5240	Ant2	-3.92	0	-3.92	11	Pass
NVNT	a	5260	Ant2	-3.09	0	-3.09	11	Pass
NVNT	a	5300	Ant2	-3.31	0	-3.31	11	Pass
NVNT	a	5320	Ant2	-2.45	0	-2.45	11	Pass
NVNT	a	5500	Ant2	-1.79	0	-1.79	11	Pass
NVNT	a	5580	Ant2	-2.58	0	-2.58	11	Pass
NVNT	a	5700	Ant2	-3.86	0	-3.86	11	Pass
NVNT	n20	5180	Ant1	-6.6	0	-6.6	11	Pass
NVNT	n20	5200	Ant1	-6.42	0	-6.42	11	Pass
NVNT	n20	5240	Ant1	-5.19	0	-5.19	11	Pass
NVNT	n20	5260	Ant1	-4.32	0	-4.32	11	Pass
NVNT	n20	5300	Ant1	-3.91	0	-3.91	11	Pass
NVNT	n20	5320	Ant1	-3.54	0	-3.54	11	Pass
NVNT	n20	5500	Ant1	-3.52	0	-3.52	11	Pass
NVNT	n20	5580	Ant1	-3.47	0	-3.47	11	Pass
NVNT	n20	5700	Ant1	-3.92	0	-3.92	11	Pass
NVNT	n20	5180	Ant2	-10.52	0	-10.52	11	Pass
NVNT	n20	5200	Ant2	-10.18	0	-10.18	11	Pass
NVNT	n20	5240	Ant2	-10.01	0	-10.01	11	Pass
NVNT	n20	5260	Ant2	-8.78	0	-8.78	11	Pass
NVNT	n20	5300	Ant2	-4.45	0	-4.45	11	Pass
NVNT	n20	5320	Ant2	-8.78	0	-8.78	11	Pass
NVNT	n20	5500	Ant2	-8.04	0	-8.04	11	Pass
NVNT	n20	5580	Ant2	-8.86	0	-8.86	11	Pass
NVNT	n20	5700	Ant2	-10.18	0	-10.18	11	Pass
NVNT	n20	5180	Ant1	-9.53	0	-9.53	11	Pass
NVNT	n20	5180	Ant2	-12.21	0	-12.21	11	Pass
NVNT	n20	5180	Sum	-7.66	0	-7.66	11	Pass
NVNT	n20	5200	Ant1	-8.58	0	-8.58	11	Pass
NVNT	n20	5200	Ant2	-11.28	0	-11.28	11	Pass
NVNT	n20	5200	Sum	-6.71	0	-6.71	11	Pass
NVNT	n20	5240	Ant1	-9.16	0	-9.16	11	Pass
NVNT	n20	5240	Ant2	-10.92	0	-10.92	11	Pass
NVNT	n20	5240	Sum	-6.94	0	-6.94	11	Pass
NVNT	n20	5260	Ant1	-8.79	0	-8.79	11	Pass
NVNT	n20	5260	Ant2	-10.35	0	-10.35	11	Pass
NVNT	n20	5260	Sum	-6.49	0	-6.49	11	Pass
NVNT	n20	5300	Ant1	-7.44	0	-7.44	11	Pass
NVNT	n20	5300	Ant2	-10.34	0	-10.34	11	Pass
NVNT	n20	5300	Sum	-5.64	0	-5.64	11	Pass
NVNT	n20	5320	Ant1	-6.38	0	-6.38	11	Pass
NVNT	n20	5320	Ant2	-10.64	0	-10.64	11	Pass
NVNT	n20	5320	Sum	-5	0	-5	11	Pass
NVNT	n20	5500	Ant1	-7.36	0	-7.36	11	Pass
NVNT	n20	5500	Ant2	-9.47	0	-9.47	11	Pass
NVNT	n20	5500	Sum	-5.28	0	-5.28	11	Pass
NVNT	n20	5580	Ant1	-6.51	0	-6.51	11	Pass
NVNT	n20	5580	Ant2	-9.71	0	-9.71	11	Pass
NVNT	n20	5580	Sum	-4.81	0	-4.81	11	Pass
NVNT	n20	5700	Ant1	-7.03	0	-7.03	11	Pass
NVNT	n20	5700	Ant2	-11.35	0	-11.35	11	Pass
NVNT	n20	5700	Sum	-5.66	0	-5.66	11	Pass
NVNT	n40	5190	Ant1	-9	0	-9	11	Pass
NVNT	n40	5230	Ant1	-7.8	0	-7.8	11	Pass
NVNT	n40	5270	Ant1	-7.06	0	-7.06	11	Pass
NVNT	n40	5310	Ant1	-6.81	0	-6.81	11	Pass
NVNT	n40	5510	Ant1	-6.86	0	-6.86	11	Pass
NVNT	n40	5550	Ant1	-7.11	0	-7.11	11	Pass
NVNT	n40	5670	Ant1	-6.64	0	-6.64	11	Pass
NVNT	n40	5190	Ant2	-13.2	0	-13.2	11	Pass
NVNT	n40	5230	Ant2	-12.26	0	-12.26	11	Pass
NVNT	n40	5270	Ant2	-10.96	0	-10.96	11	Pass
NVNT	n40	5310	Ant2	-11.25	0	-11.25	11	Pass
NVNT	n40	5510	Ant2	-11.45	0	-11.45	11	Pass
NVNT	n40	5550	Ant2	-11.64	0	-11.64	11	Pass
NVNT	n40	5670	Ant2	-12.62	0	-12.62	11	Pass
NVNT	n40	5190	Ant1	-11.35	0	-11.35	11	Pass
NVNT	n40	5190	Ant2	-13.86	0	-13.86	11	Pass
NVNT	n40	5190	Sum	-9.42	0	-9.42	11	Pass
NVNT	n40	5230	Ant1	-11.37	0	-11.37	11	Pass
NVNT	n40	5230	Ant2	-13.72	0	-13.72	11	Pass
NVNT	n40	5230	Sum	-9.38	0	-9.38	11	Pass
NVNT	n40	5270	Ant1	-11.31	0	-11.31	11	Pass
NVNT	n40	5270	Ant2	-12.83	0	-12.83	11	Pass
NVNT	n40	5270	Sum	-8.99	0	-8.99	11	Pass
NVNT	n40	5310	Ant1	-9.46	0	-9.46	11	Pass
NVNT	n40	5310	Ant2	-12.82	0	-12.82	11	Pass
NVNT	n40	5310	Sum	-7.81	0	-7.81	11	Pass
NVNT	n40	5510	Ant1	-10.88	0	-10.88	11	Pass
NVNT	n40	5510	Ant2	-12.25	0	-12.25	11	Pass



NVNT	n40	5510	Sum	-8.5	0	-8.5	11	Pass
NVNT	n40	5550	Ant1	-9.3	0	-9.3	11	Pass
NVNT	n40	5550	Ant2	-11.77	0	-11.77	11	Pass
NVNT	n40	5550	Sum	-7.35	0	-7.35	11	Pass
NVNT	n40	5670	Ant1	-9.77	0	-9.77	11	Pass
NVNT	n40	5670	Ant2	-13.59	0	-13.59	11	Pass
NVNT	n40	5670	Sum	-8.26	0	-8.26	11	Pass
NVNT	ac20	5180	Ant1	-8.55	0	-8.55	11	Pass
NVNT	ac20	5200	Ant1	-8.69	0	-8.69	11	Pass
NVNT	ac20	5240	Ant1	-7.98	0	-7.98	11	Pass
NVNT	ac20	5260	Ant1	-7.33	0	-7.33	11	Pass
NVNT	ac20	5300	Ant1	-6.87	0	-6.87	11	Pass
NVNT	ac20	5320	Ant1	-6.39	0	-6.39	11	Pass
NVNT	ac20	5500	Ant1	-6.46	0	-6.46	11	Pass
NVNT	ac20	5580	Ant1	-6.39	0	-6.39	11	Pass
NVNT	ac20	5700	Ant1	-7.02	0	-7.02	11	Pass
NVNT	ac20	5180	Ant2	-11.13	0	-11.13	11	Pass
NVNT	ac20	5200	Ant2	-11.25	0	-11.25	11	Pass
NVNT	ac20	5240	Ant2	-10.89	0	-10.89	11	Pass
NVNT	ac20	5260	Ant2	-9.93	0	-9.93	11	Pass
NVNT	ac20	5300	Ant2	-9.98	0	-9.98	11	Pass
NVNT	ac20	5320	Ant2	-9.71	0	-9.71	11	Pass
NVNT	ac20	5500	Ant2	-8.81	0	-8.81	11	Pass
NVNT	ac20	5580	Ant2	-8.45	0	-8.45	11	Pass
NVNT	ac20	5700	Ant2	-11.2	0	-11.2	11	Pass
NVNT	ac20	5180	Ant1	-13.78	0	-13.78	11	Pass
NVNT	ac20	5180	Ant2	-16.39	0	-16.39	11	Pass
NVNT	ac20	5180	Sum	-11.88	0	-11.88	11	Pass
NVNT	ac20	5200	Ant1	-13.68	0	-13.68	11	Pass
NVNT	ac20	5200	Ant2	-16.47	0	-16.47	11	Pass
NVNT	ac20	5200	Sum	-11.84	0	-11.84	11	Pass
NVNT	ac20	5240	Ant1	-14.79	0	-14.79	11	Pass
NVNT	ac20	5240	Ant2	-16.32	0	-16.32	11	Pass
NVNT	ac20	5240	Sum	-12.48	0	-12.48	11	Pass
NVNT	ac20	5260	Ant1	-12.9	0	-12.9	11	Pass
NVNT	ac20	5260	Ant2	-15.59	0	-15.59	11	Pass
NVNT	ac20	5260	Sum	-11.03	0	-11.03	11	Pass
NVNT	ac20	5300	Ant1	-12.59	0	-12.59	11	Pass
NVNT	ac20	5300	Ant2	-15.63	0	-15.63	11	Pass
NVNT	ac20	5300	Sum	-10.84	0	-10.84	11	Pass
NVNT	ac20	5320	Ant1	-11.85	0	-11.85	11	Pass
NVNT	ac20	5320	Ant2	-14.72	0	-14.72	11	Pass
NVNT	ac20	5320	Sum	-10.04	0	-10.04	11	Pass
NVNT	ac20	5500	Ant1	-12.29	0	-12.29	11	Pass
NVNT	ac20	5500	Ant2	-14.22	0	-14.22	11	Pass
NVNT	ac20	5500	Sum	-10.14	0	-10.14	11	Pass
NVNT	ac20	5580	Ant1	-11.3	0	-11.3	11	Pass
NVNT	ac20	5580	Ant2	-14.56	0	-14.56	11	Pass
NVNT	ac20	5580	Sum	-9.62	0	-9.62	11	Pass
NVNT	ac20	5700	Ant1	-12.26	0	-12.26	11	Pass
NVNT	ac20	5700	Ant2	-16.75	0	-16.75	11	Pass
NVNT	ac20	5700	Sum	-10.94	0	-10.94	11	Pass
NVNT	ac40	5190	Ant1	-16.05	0	-16.05	11	Pass
NVNT	ac40	5230	Ant1	-14.61	0	-14.61	11	Pass
NVNT	ac40	5270	Ant1	-13.86	0	-13.86	11	Pass
NVNT	ac40	5310	Ant1	-13.79	0	-13.79	11	Pass
NVNT	ac40	5510	Ant1	-13.72	0	-13.72	11	Pass
NVNT	ac40	5550	Ant1	-13.8	0	-13.8	11	Pass
NVNT	ac40	5670	Ant1	-13.66	0	-13.66	11	Pass
NVNT	ac40	5190	Ant2	-13.35	0	-13.35	11	Pass
NVNT	ac40	5230	Ant2	-13.35	0	-13.35	11	Pass
NVNT	ac40	5270	Ant2	-12.57	0	-12.57	11	Pass
NVNT	ac40	5310	Ant2	-12.39	0	-12.39	11	Pass
NVNT	ac40	5510	Ant2	-12.47	0	-12.47	11	Pass
NVNT	ac40	5550	Ant2	-12.31	0	-12.31	11	Pass
NVNT	ac40	5670	Ant2	-13.43	0	-13.43	11	Pass
NVNT	ac40	5190	Ant1	-16.27	0	-16.27	11	Pass
NVNT	ac40	5190	Ant2	-19.17	0	-19.17	11	Pass
NVNT	ac40	5190	Sum	-14.47	0	-14.47	11	Pass
NVNT	ac40	5230	Ant1	-16.9	0	-16.9	11	Pass
NVNT	ac40	5230	Ant2	-18.59	0	-18.59	11	Pass
NVNT	ac40	5230	Sum	-14.65	0	-14.65	11	Pass
NVNT	ac40	5270	Ant1	-16.3	0	-16.3	11	Pass
NVNT	ac40	5270	Ant2	-17.9	0	-17.9	11	Pass
NVNT	ac40	5270	Sum	-14.02	0	-14.02	11	Pass
NVNT	ac40	5310	Ant1	-14.56	0	-14.56	11	Pass
NVNT	ac40	5310	Ant2	-18.03	0	-18.03	11	Pass
NVNT	ac40	5310	Sum	-12.95	0	-12.95	11	Pass
NVNT	ac40	5510	Ant1	-16.13	0	-16.13	11	Pass
NVNT	ac40	5510	Ant2	-17.95	0	-17.95	11	Pass
NVNT	ac40	5510	Sum	-13.94	0	-13.94	11	Pass
NVNT	ac40	5550	Ant1	-14.14	0	-14.14	11	Pass
NVNT	ac40	5550	Ant2	-16.43	0	-16.43	11	Pass
NVNT	ac40	5550	Sum	-12.13	0	-12.13	11	Pass
NVNT	ac40	5670	Ant1	-14.34	0	-14.34	11	Pass
NVNT	ac40	5670	Ant2	-18.41	0	-18.41	11	Pass
NVNT	ac40	5670	Sum	-12.9	0	-12.9	11	Pass
NVNT	ac80	5210	Ant1	-15.42	0	-15.42	11	Pass
NVNT	ac80	5290	Ant1	-13.78	0	-13.78	11	Pass
NVNT	ac80	5530	Ant1	-13.3	0	-13.3	11	Pass
NVNT	ac80	5610	Ant1	-14.23	0	-14.23	11	Pass
NVNT	ac80	5210	Ant2	-17.44	0	-17.44	11	Pass
NVNT	ac80	5290	Ant2	-16.04	0	-16.04	11	Pass
NVNT	ac80	5530	Ant2	-15.25	0	-15.25	11	Pass



NVNT	ac80	5610	Ant2	-16.3	0	-16.3	11	Pass
NVNT	ac80	5210	Ant1	-21.35	0	-21.35	11	Pass
NVNT	ac80	5210	Ant2	-23.41	0	-23.41	11	Pass
NVNT	ac80	5210	Sum	-19.25	0	-19.25	11	Pass
NVNT	ac80	5290	Ant1	-19.47	0	-19.47	11	Pass
NVNT	ac80	5290	Ant2	-22.6	0	-22.6	11	Pass
NVNT	ac80	5290	Sum	-17.75	0	-17.75	11	Pass
NVNT	ac80	5530	Ant1	-18.79	0	-18.79	11	Pass
NVNT	ac80	5530	Ant2	-21.18	0	-21.18	11	Pass
NVNT	ac80	5530	Sum	-16.81	0	-16.81	11	Pass
NVNT	ac80	5610	Ant1	-19.72	0	-19.72	11	Pass
NVNT	ac80	5610	Ant2	-22.58	0	-22.58	11	Pass
NVNT	ac80	5610	Sum	-17.91	0	-17.91	11	Pass
NVNT	ax20	5180	Ant1	-9.44	0	-9.44	11	Pass
NVNT	ax20	5200	Ant1	-9.34	0	-9.34	11	Pass
NVNT	ax20	5240	Ant1	-9.04	0	-9.04	11	Pass
NVNT	ax20	5260	Ant1	-8.06	0	-8.06	11	Pass
NVNT	ax20	5300	Ant1	-7.62	0	-7.62	11	Pass
NVNT	ax20	5320	Ant1	-7.35	0	-7.35	11	Pass
NVNT	ax20	5500	Ant1	-7.28	0	-7.28	11	Pass
NVNT	ax20	5580	Ant1	-7.67	0	-7.67	11	Pass
NVNT	ax20	5700	Ant1	-7.71	0	-7.71	11	Pass
NVNT	ax20	5180	Ant2	-11.95	0	-11.95	11	Pass
NVNT	ax20	5200	Ant2	-11.38	0	-11.38	11	Pass
NVNT	ax20	5240	Ant2	-11.03	0	-11.03	11	Pass
NVNT	ax20	5260	Ant2	-10.27	0	-10.27	11	Pass
NVNT	ax20	5300	Ant2	-10.41	0	-10.41	11	Pass
NVNT	ax20	5320	Ant2	-10.12	0	-10.12	11	Pass
NVNT	ax20	5500	Ant2	-9	0	-9	11	Pass
NVNT	ax20	5580	Ant2	-10.06	0	-10.06	11	Pass
NVNT	ax20	5700	Ant2	-11.23	0	-11.23	11	Pass
NVNT	ax20	5180	Ant1	-14.37	0	-14.37	11	Pass
NVNT	ax20	5180	Ant2	-17.25	0	-17.25	11	Pass
NVNT	ax20	5180	Sum	-12.57	0	-12.57	11	Pass
NVNT	ax20	5200	Ant1	-14.13	0	-14.13	11	Pass
NVNT	ax20	5200	Ant2	-17.1	0	-17.1	11	Pass
NVNT	ax20	5200	Sum	-12.36	0	-12.36	11	Pass
NVNT	ax20	5240	Ant1	-14.27	0	-14.27	11	Pass
NVNT	ax20	5240	Ant2	-15.81	0	-15.81	11	Pass
NVNT	ax20	5240	Sum	-11.96	0	-11.96	11	Pass
NVNT	ax20	5260	Ant1	-14.31	0	-14.31	11	Pass
NVNT	ax20	5260	Ant2	-15.35	0	-15.35	11	Pass
NVNT	ax20	5260	Sum	-11.79	0	-11.79	11	Pass
NVNT	ax20	5300	Ant1	-12.77	0	-12.77	11	Pass
NVNT	ax20	5300	Ant2	-15.73	0	-15.73	11	Pass
NVNT	ax20	5300	Sum	-10.99	0	-10.99	11	Pass
NVNT	ax20	5320	Ant1	-11.76	0	-11.76	11	Pass
NVNT	ax20	5320	Ant2	-15.85	0	-15.85	11	Pass
NVNT	ax20	5320	Sum	-10.33	0	-10.33	11	Pass
NVNT	ax20	5500	Ant1	-12.71	0	-12.71	11	Pass
NVNT	ax20	5500	Ant2	-14.32	0	-14.32	11	Pass
NVNT	ax20	5500	Sum	-10.43	0	-10.43	11	Pass
NVNT	ax20	5580	Ant1	-12.21	0	-12.21	11	Pass
NVNT	ax20	5580	Ant2	-15.52	0	-15.52	11	Pass
NVNT	ax20	5580	Sum	-10.55	0	-10.55	11	Pass
NVNT	ax20	5700	Ant1	-12.41	0	-12.41	11	Pass
NVNT	ax20	5700	Ant2	-16.24	0	-16.24	11	Pass
NVNT	ax20	5700	Sum	-10.91	0	-10.91	11	Pass
NVNT	ax40	5190	Ant1	-11.31	0	-11.31	11	Pass
NVNT	ax40	5230	Ant1	-10.7	0	-10.7	11	Pass
NVNT	ax40	5270	Ant1	-10.15	0	-10.15	11	Pass
NVNT	ax40	5310	Ant1	-9.61	0	-9.61	11	Pass
NVNT	ax40	5510	Ant1	-9.79	0	-9.79	11	Pass
NVNT	ax40	5550	Ant1	-9.72	0	-9.72	11	Pass
NVNT	ax40	5670	Ant1	-9.28	0	-9.28	11	Pass
NVNT	ax40	5190	Ant2	-13.8	0	-13.8	11	Pass
NVNT	ax40	5230	Ant2	-13.79	0	-13.79	11	Pass
NVNT	ax40	5270	Ant2	-12.88	0	-12.88	11	Pass
NVNT	ax40	5310	Ant2	-12.8	0	-12.8	11	Pass
NVNT	ax40	5510	Ant2	-12.84	0	-12.84	11	Pass
NVNT	ax40	5550	Ant2	-11.99	0	-11.99	11	Pass
NVNT	ax40	5670	Ant2	-13.28	0	-13.28	11	Pass
NVNT	ax40	5190	Ant1	-16.84	0	-16.84	11	Pass
NVNT	ax40	5190	Ant2	-19.51	0	-19.51	11	Pass
NVNT	ax40	5190	Sum	-14.96	0	-14.96	11	Pass
NVNT	ax40	5230	Ant1	-16.51	0	-16.51	11	Pass
NVNT	ax40	5230	Ant2	-18.54	0	-18.54	11	Pass
NVNT	ax40	5230	Sum	-14.4	0	-14.4	11	Pass
NVNT	ax40	5270	Ant1	-16.73	0	-16.73	11	Pass
NVNT	ax40	5270	Ant2	-18.39	0	-18.39	11	Pass
NVNT	ax40	5270	Sum	-14.47	0	-14.47	11	Pass
NVNT	ax40	5310	Ant1	-14.51	0	-14.51	11	Pass
NVNT	ax40	5310	Ant2	-17.99	0	-17.99	11	Pass
NVNT	ax40	5310	Sum	-12.9	0	-12.9	11	Pass
NVNT	ax40	5510	Ant1	-15.98	0	-15.98	11	Pass
NVNT	ax40	5510	Ant2	-17.51	0	-17.51	11	Pass
NVNT	ax40	5510	Sum	-13.67	0	-13.67	11	Pass
NVNT	ax40	5550	Ant1	-14.04	0	-14.04	11	Pass
NVNT	ax40	5550	Ant2	-17.02	0	-17.02	11	Pass
NVNT	ax40	5550	Sum	-12.27	0	-12.27	11	Pass
NVNT	ax40	5670	Ant1	-14.71	0	-14.71	11	Pass
NVNT	ax40	5670	Ant2	-18.74	0	-18.74	11	Pass
NVNT	ax40	5670	Sum	-13.26	0	-13.26	11	Pass
NVNT	ax80	5210	Ant1	-15.5	0	-15.5	11	Pass



NVNT	ax80	5290	Ant1	-13.72	0	-13.72	11	Pass
NVNT	ax80	5530	Ant1	-13.91	0	-13.91	11	Pass
NVNT	ax80	5610	Ant1	-13.97	0	-13.97	11	Pass
NVNT	ax80	5210	Ant2	-17.04	0	-17.04	11	Pass
NVNT	ax80	5290	Ant2	-16.67	0	-16.67	11	Pass
NVNT	ax80	5530	Ant2	-15.56	0	-15.56	11	Pass
NVNT	ax80	5610	Ant2	-16.44	0	-16.44	11	Pass
Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500kHz)	Duty Factor (dB)	Total PSD (dBm/500kHz)	Limit (dBm/500kHz)	Verdict
NVNT	a	5745	Ant1	-5.04	0	-5.04	30	Pass
NVNT	a	5785	Ant1	-4.55	0	-4.55	30	Pass
NVNT	a	5825	Ant1	-5.37	0	-5.37	30	Pass
NVNT	a	5745	Ant2	-7.45	0	-7.45	30	Pass
NVNT	a	5785	Ant2	-7.91	0	-7.91	30	Pass
NVNT	a	5825	Ant2	-8.68	0	-8.68	30	Pass
NVNT	n20	5745	Ant1	-6.8	0	-6.8	30	Pass
NVNT	n20	5785	Ant1	-7.11	0	-7.11	30	Pass
NVNT	n20	5825	Ant1	-7.53	0	-7.53	30	Pass
NVNT	n20	5745	Ant2	-13.5	0	-13.5	30	Pass
NVNT	n20	5785	Ant2	-13.73	0	-13.73	30	Pass
NVNT	n20	5825	Ant2	-13.83	0	-13.83	30	Pass
NVNT	n20	5745	Ant1	-10.61	0	-10.61	30	Pass
NVNT	n20	5745	Ant2	-14.63	0	-14.63	30	Pass
NVNT	n20	5745	Sum	-9.16	0	-9.16	30	Pass
NVNT	n20	5785	Ant1	-10.36	0	-10.36	30	Pass
NVNT	n20	5785	Ant2	-14.99	0	-14.99	30	Pass
NVNT	n20	5785	Sum	-9.07	0	-9.07	30	Pass
NVNT	n20	5825	Ant1	-10.44	0	-10.44	30	Pass
NVNT	n20	5825	Ant2	-15.2	0	-15.2	30	Pass
NVNT	n20	5825	Sum	-9.19	0	-9.19	30	Pass
NVNT	n40	5755	Ant1	-9.23	0	-9.23	30	Pass
NVNT	n40	5795	Ant1	-8.77	0	-8.77	30	Pass
NVNT	n40	5755	Ant2	-15.86	0	-15.86	30	Pass
NVNT	n40	5795	Ant2	-16.1	0	-16.1	30	Pass
NVNT	n40	5755	Ant1	-13.29	0	-13.29	30	Pass
NVNT	n40	5755	Ant2	-17.41	0	-17.41	30	Pass
NVNT	n40	5755	Sum	-11.87	0	-11.87	30	Pass
NVNT	n40	5795	Ant1	-12.54	0	-12.54	30	Pass
NVNT	n40	5795	Ant2	-17.51	0	-17.51	30	Pass
NVNT	n40	5795	Sum	-11.34	0	-11.34	30	Pass
NVNT	ac20	5745	Ant1	-10.08	0	-10.08	30	Pass
NVNT	ac20	5785	Ant1	-9.66	0	-9.66	30	Pass
NVNT	ac20	5825	Ant1	-10.43	0	-10.43	30	Pass
NVNT	ac20	5745	Ant2	-13.88	0	-13.88	30	Pass
NVNT	ac20	5785	Ant2	-17.07	0	-17.07	30	Pass
NVNT	ac20	5825	Ant2	-14.88	0	-14.88	30	Pass
NVNT	ac20	5745	Ant1	-16.23	0	-16.23	30	Pass
NVNT	ac20	5745	Ant2	-19.31	0	-19.31	30	Pass
NVNT	ac20	5745	Sum	-14.49	0	-14.49	30	Pass
NVNT	ac20	5785	Ant1	-15.18	0	-15.18	30	Pass
NVNT	ac20	5785	Ant2	-19.95	0	-19.95	30	Pass
NVNT	ac20	5785	Sum	-13.93	0	-13.93	30	Pass
NVNT	ac20	5825	Ant1	-15.09	0	-15.09	30	Pass
NVNT	ac20	5825	Ant2	-20.23	0	-20.23	30	Pass
NVNT	ac20	5825	Sum	-13.93	0	-13.93	30	Pass
NVNT	ac40	5755	Ant1	-16.16	0	-16.16	30	Pass
NVNT	ac40	5795	Ant1	-16.06	0	-16.06	30	Pass
NVNT	ac40	5755	Ant2	-16.97	0	-16.97	30	Pass
NVNT	ac40	5795	Ant2	-17.06	0	-17.06	30	Pass
NVNT	ac40	5755	Ant1	-17.76	0	-17.76	30	Pass
NVNT	ac40	5755	Ant2	-21.94	0	-21.94	30	Pass
NVNT	ac40	5755	Sum	-16.36	0	-16.36	30	Pass
NVNT	ac40	5795	Ant1	-17.55	0	-17.55	30	Pass
NVNT	ac40	5795	Ant2	-22.56	0	-22.56	30	Pass
NVNT	ac40	5795	Sum	-16.36	0	-16.36	30	Pass
NVNT	ac80	5775	Ant1	-16.35	0	-16.35	30	Pass
NVNT	ac80	5775	Ant2	-20.07	0	-20.07	30	Pass
NVNT	ac80	5775	Ant1	-22.37	0	-22.37	30	Pass
NVNT	ac80	5775	Ant2	-26.54	0	-26.54	30	Pass
NVNT	ac80	5775	Sum	-20.96	0	-20.96	30	Pass
NVNT	ax20	5745	Ant1	-10.66	0	-10.66	30	Pass
NVNT	ax20	5785	Ant1	-10.73	0	-10.73	30	Pass
NVNT	ax20	5825	Ant1	-10.56	0	-10.56	30	Pass
NVNT	ax20	5745	Ant2	-14.83	0	-14.83	30	Pass
NVNT	ax20	5785	Ant2	-15.15	0	-15.15	30	Pass
NVNT	ax20	5825	Ant2	-15.02	0	-15.02	30	Pass
NVNT	ax20	5745	Ant1	-16.69	0	-16.69	30	Pass
NVNT	ax20	5745	Ant2	-19.65	0	-19.65	30	Pass
NVNT	ax20	5745	Sum	-14.91	0	-14.91	30	Pass
NVNT	ax20	5785	Ant1	-16.25	0	-16.25	30	Pass
NVNT	ax20	5785	Ant2	-20.4	0	-20.4	30	Pass
NVNT	ax20	5785	Sum	-14.84	0	-14.84	30	Pass
NVNT	ax20	5825	Ant1	-15.21	0	-15.21	30	Pass
NVNT	ax20	5825	Ant2	-19.85	0	-19.85	30	Pass
NVNT	ax20	5825	Sum	-13.93	0	-13.93	30	Pass
NVNT	ax40	5755	Ant1	-12.3	0	-12.3	30	Pass
NVNT	ax40	5795	Ant1	-12.31	0	-12.31	30	Pass
NVNT	ax40	5755	Ant2	-17.12	0	-17.12	30	Pass
NVNT	ax40	5795	Ant2	-17.76	0	-17.76	30	Pass
NVNT	ax40	5755	Ant1	-18.71	0	-18.71	30	Pass
NVNT	ax40	5755	Ant2	-22.07	0	-22.07	30	Pass
NVNT	ax40	5755	Sum	-17.06	0	-17.06	30	Pass
NVNT	ax40	5795	Ant1	-18.01	0	-18.01	30	Pass
NVNT	ax40	5795	Ant2	-22.89	0	-22.89	30	Pass



NVNT	ax40	5795	Sum	-16.79	0	-16.79	30	Pass
NVNT	ax80	5775	Ant1	-16.15	0	-16.15	30	Pass
NVNT	ax80	5775	Ant2	-20.09	0	-20.09	30	Pass
NVNT	ax80	5775	Ant1	-22.14	0	-22.14	30	Pass
NVNT	ax80	5775	Ant2	-26.42	0	-26.42	30	Pass
NVNT	ax80	5775	Sum	-20.76	0	-20.76	30	Pass

