






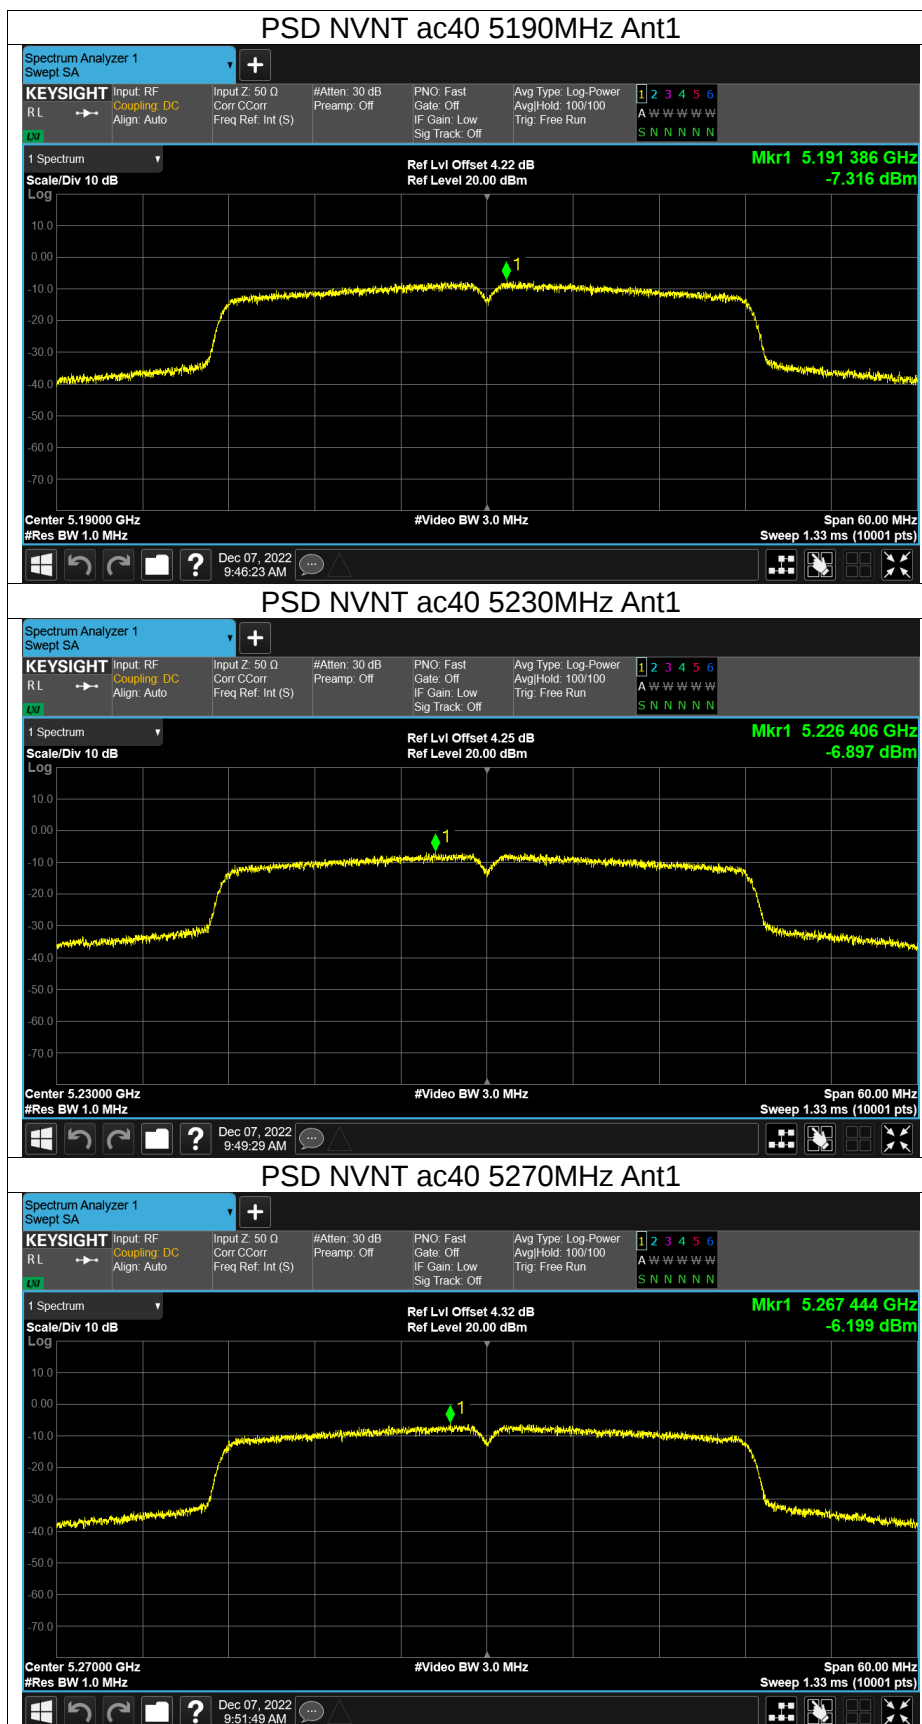

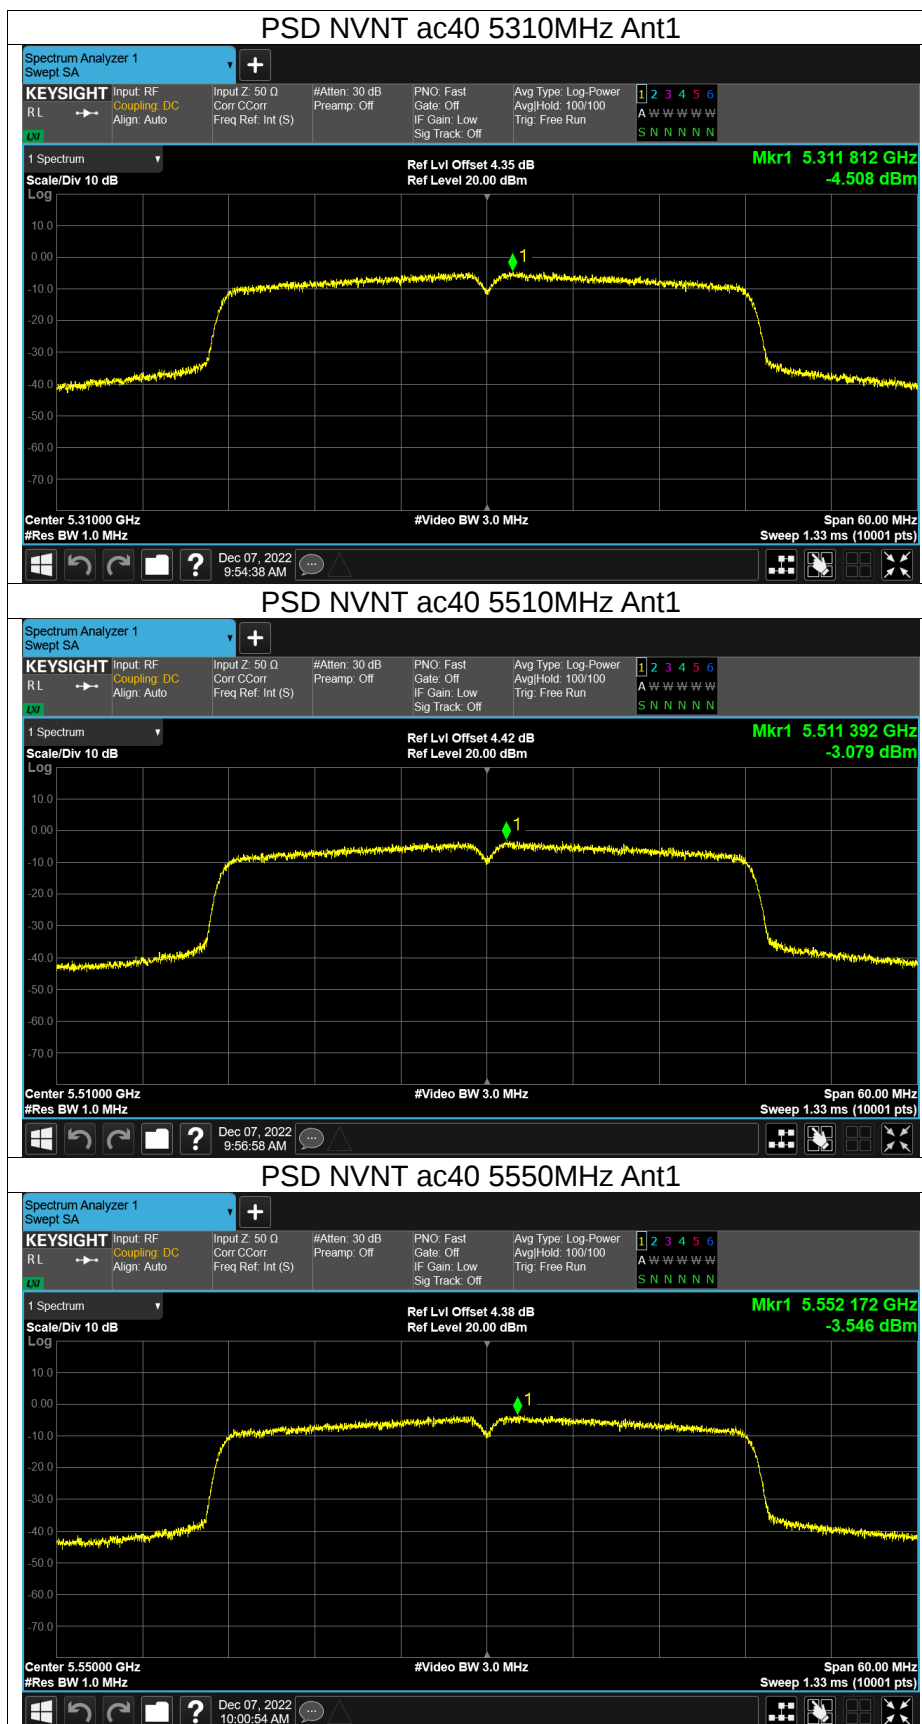

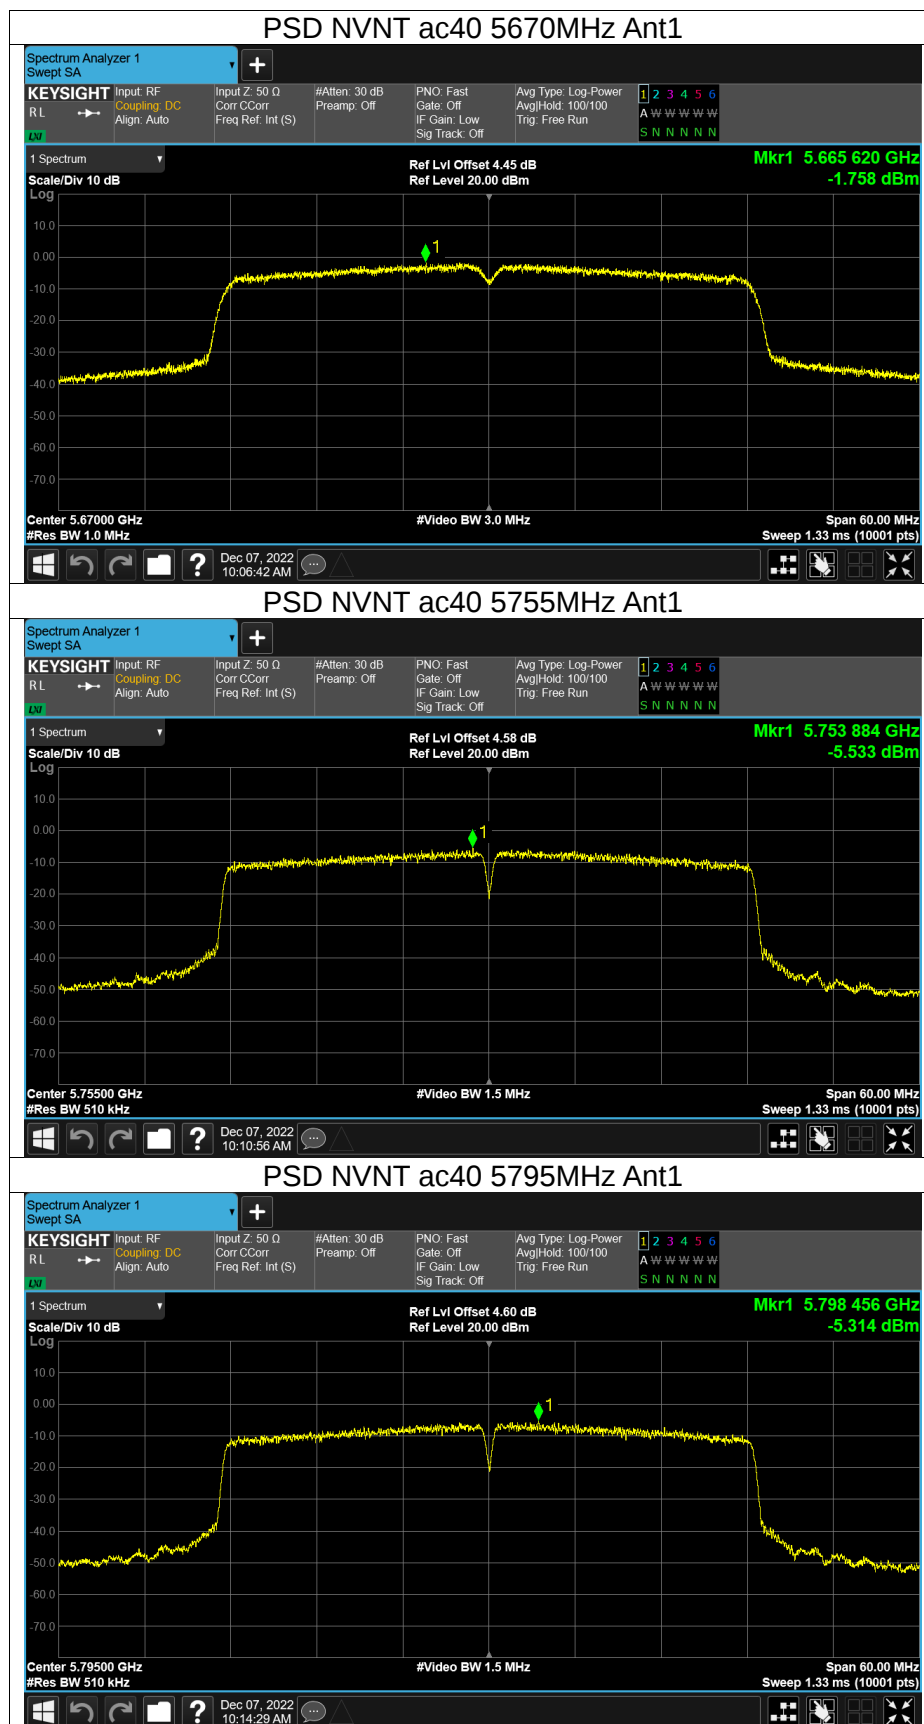

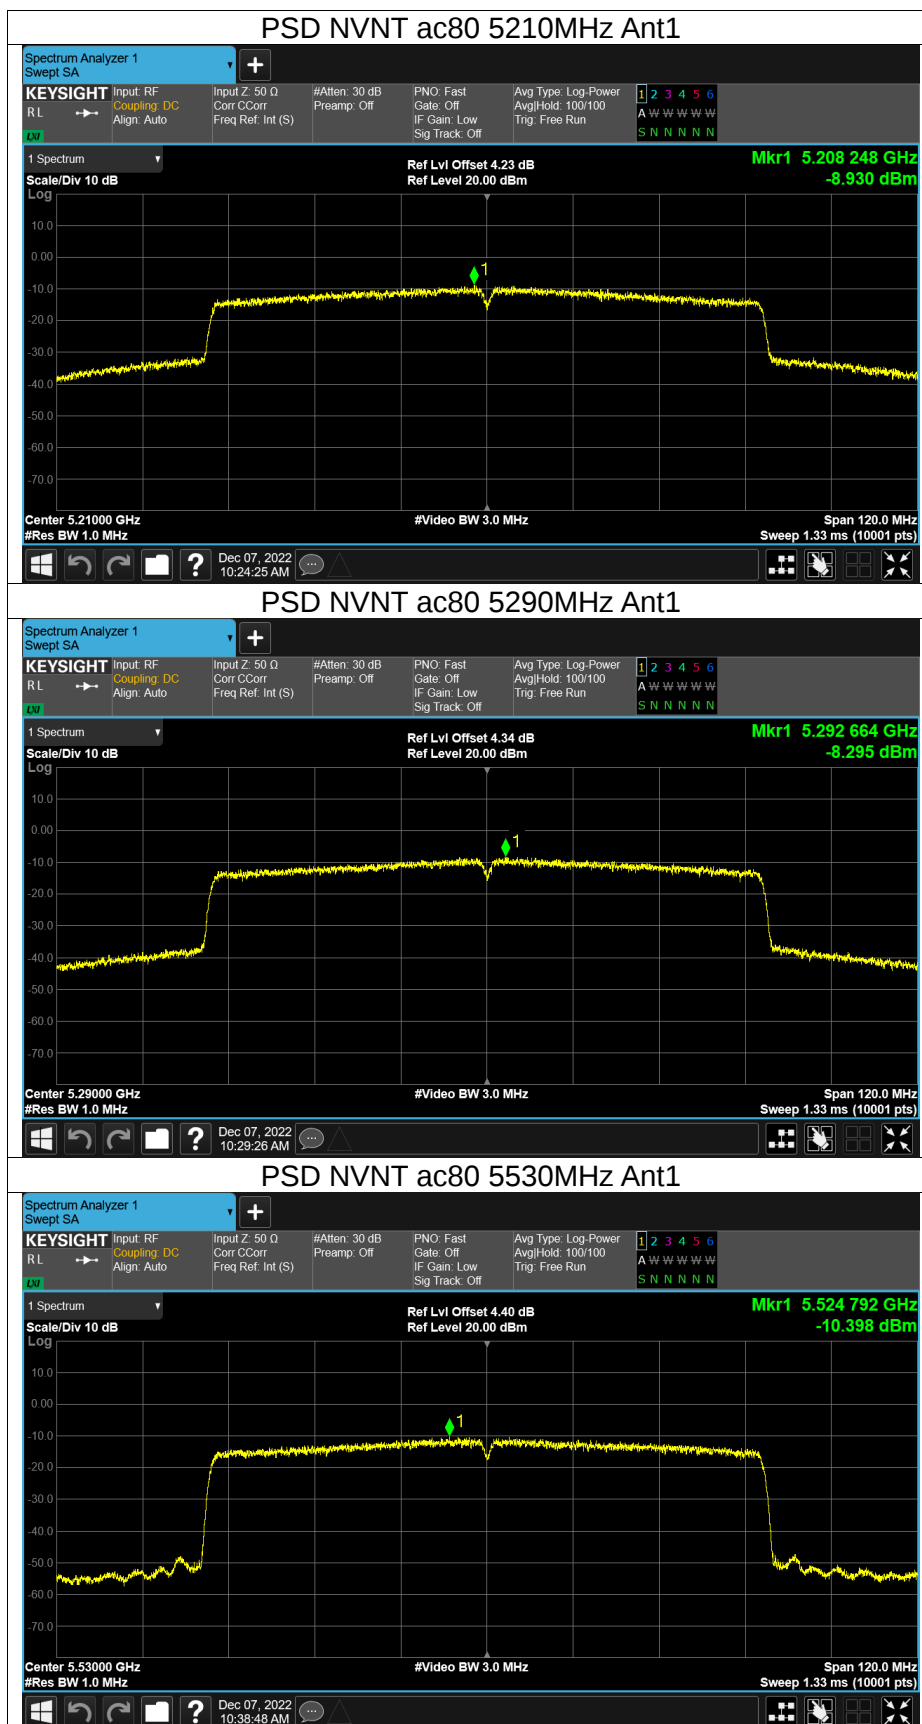


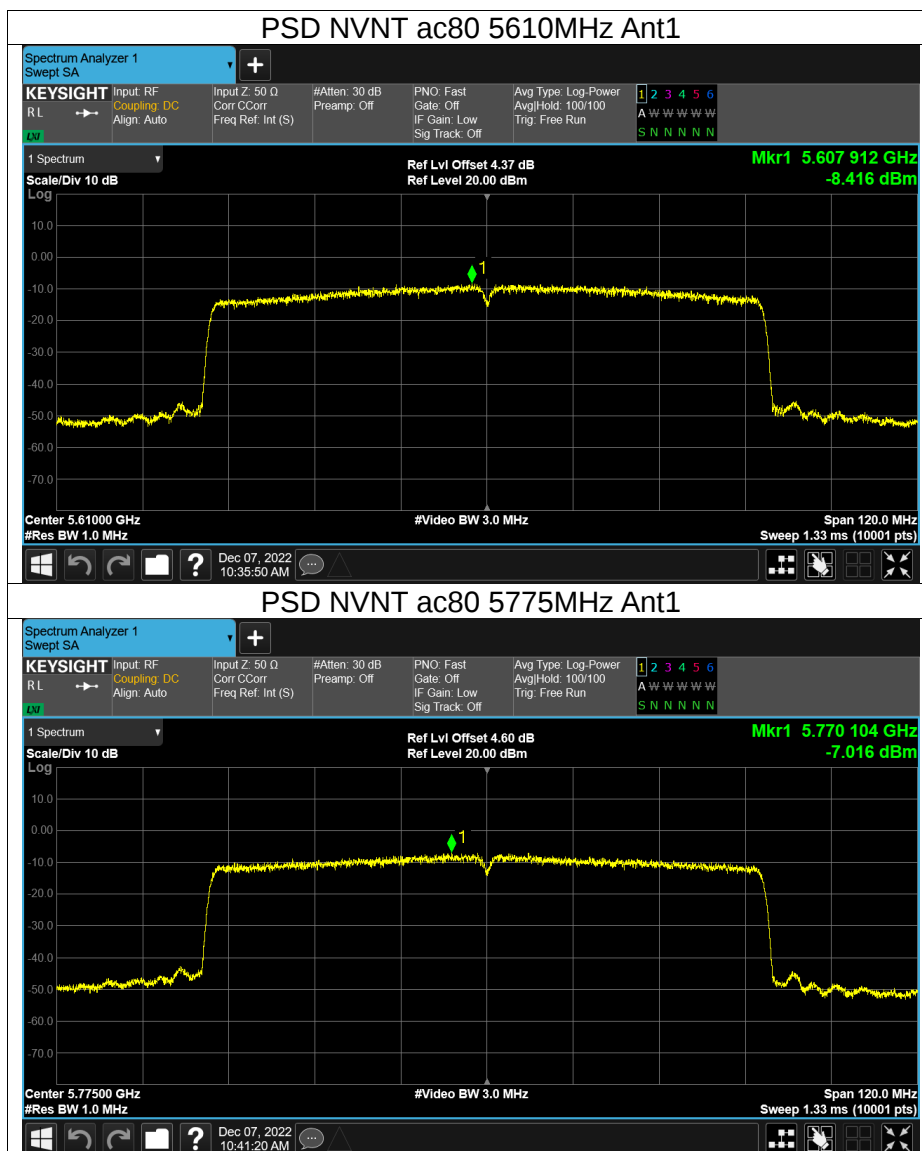










-6dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	15.117	0.5	Pass
NVNT	a	5785	Ant1	15.071	0.5	Pass
NVNT	a	5825	Ant1	14.646	0.5	Pass
NVNT	n20	5745	Ant1	16.33	0.5	Pass
NVNT	n20	5785	Ant1	17.588	0.5	Pass
NVNT	n20	5825	Ant1	17.589	0.5	Pass
NVNT	n40	5755	Ant1	36.311	0.5	Pass
NVNT	n40	5795	Ant1	36.338	0.5	Pass
NVNT	ac20	5745	Ant1	17.529	0.5	Pass
NVNT	ac20	5785	Ant1	17.605	0.5	Pass
NVNT	ac20	5825	Ant1	17.581	0.5	Pass
NVNT	ac40	5755	Ant1	35.789	0.5	Pass
NVNT	ac40	5795	Ant1	36.023	0.5	Pass

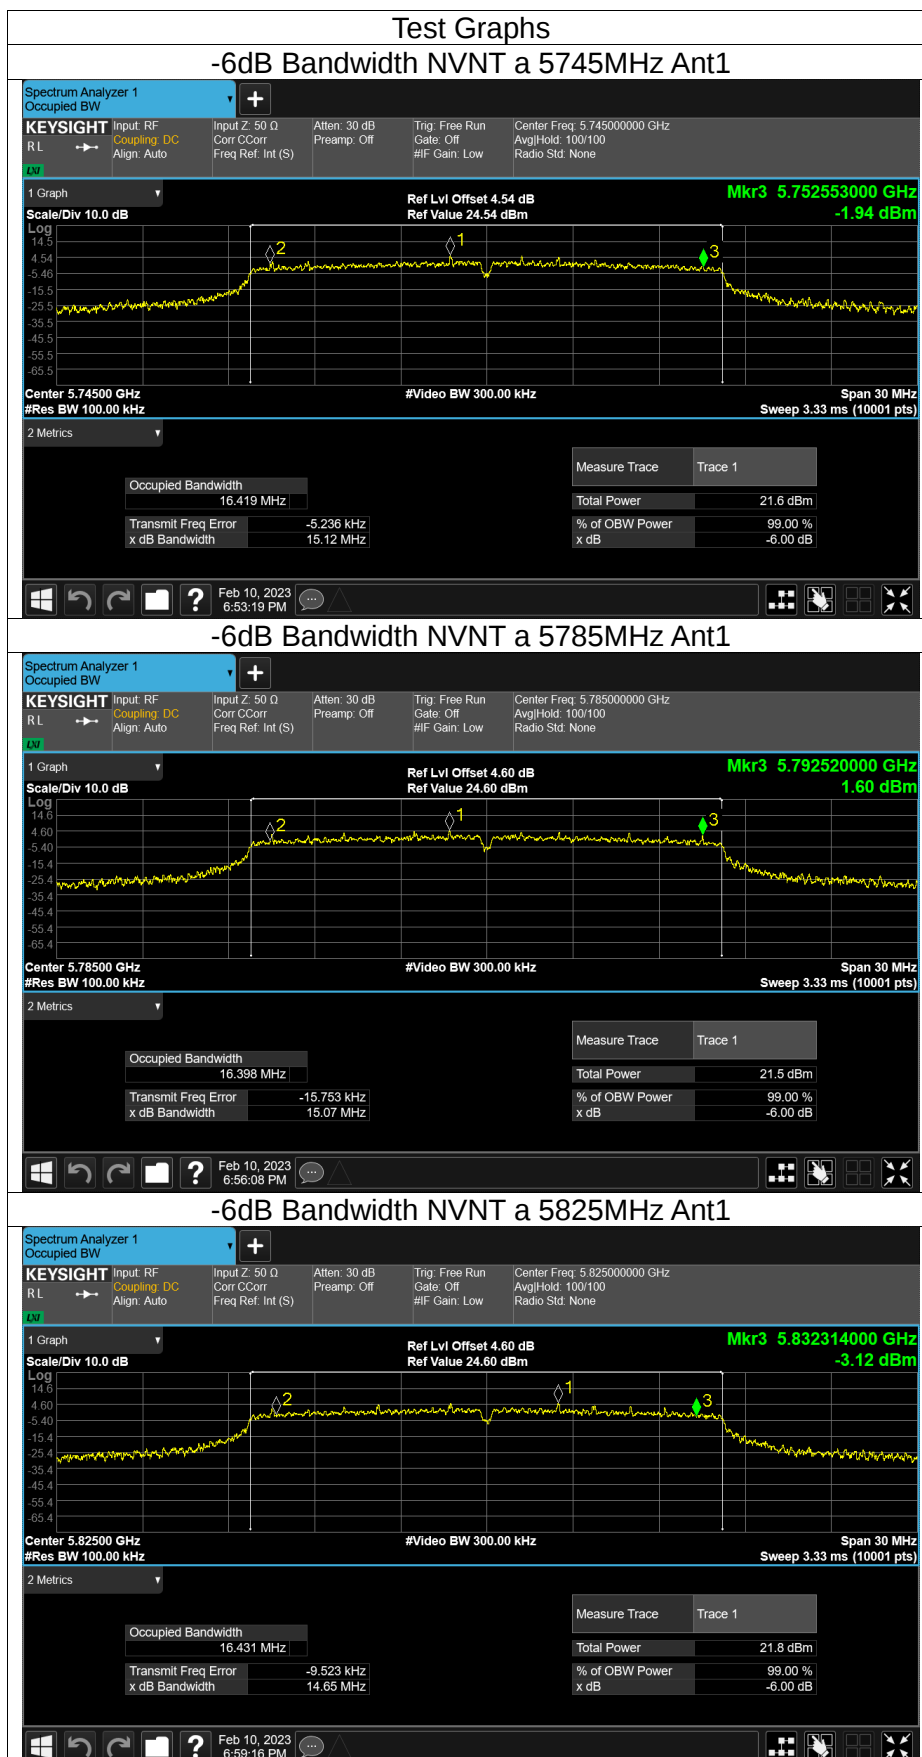

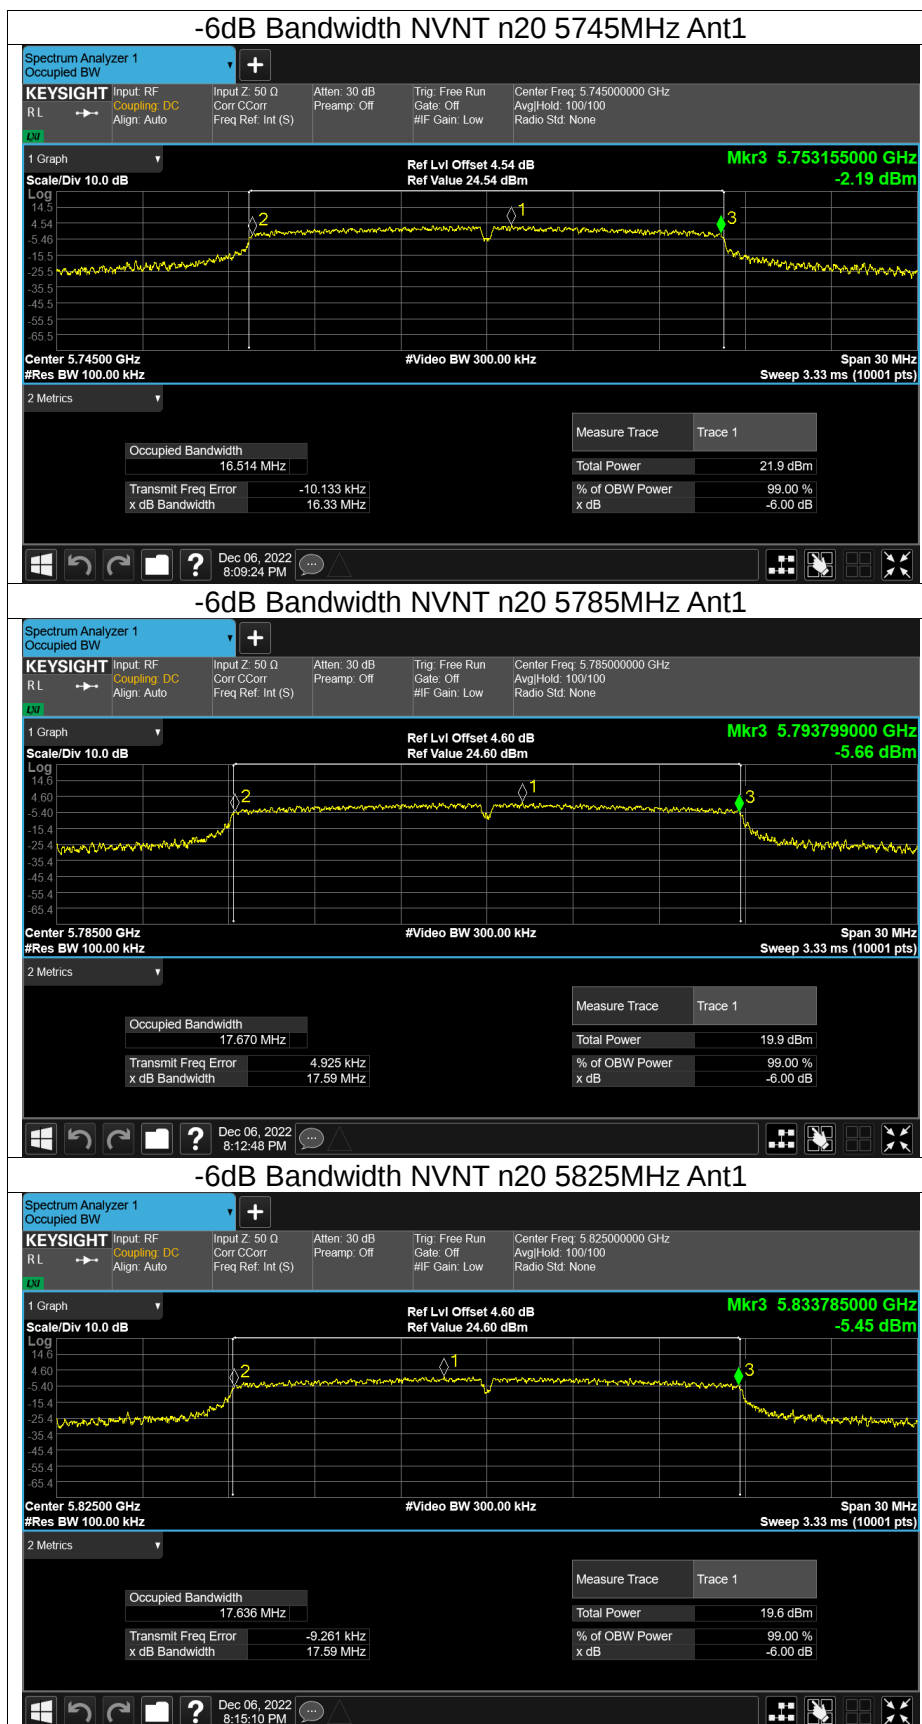

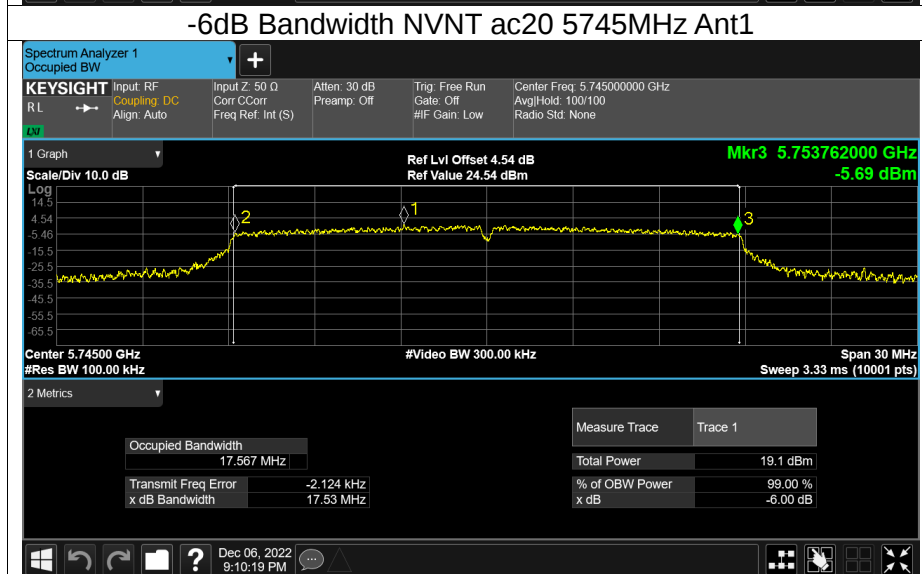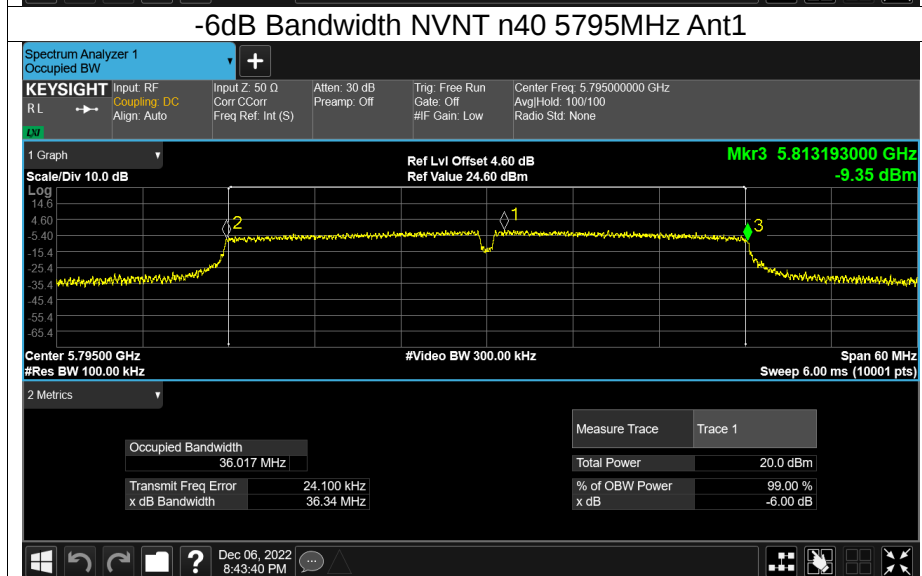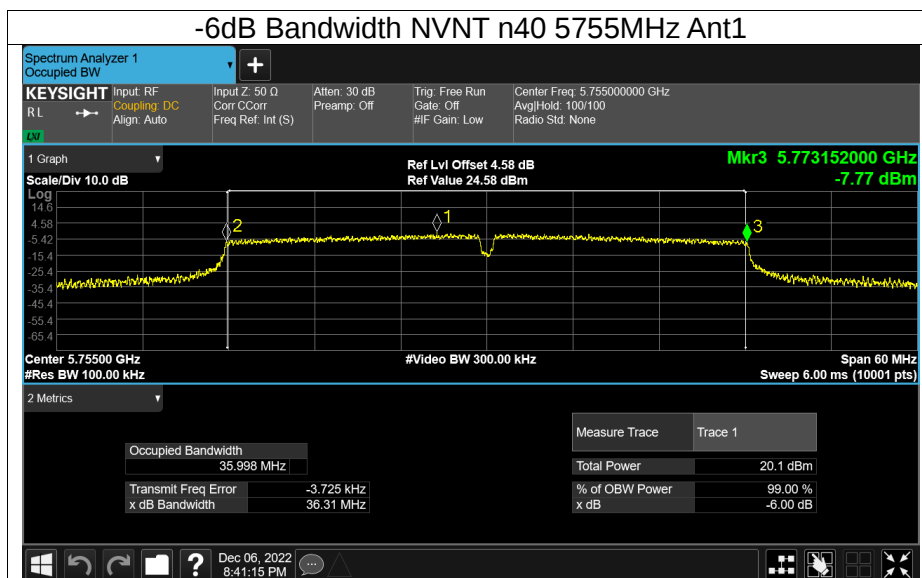


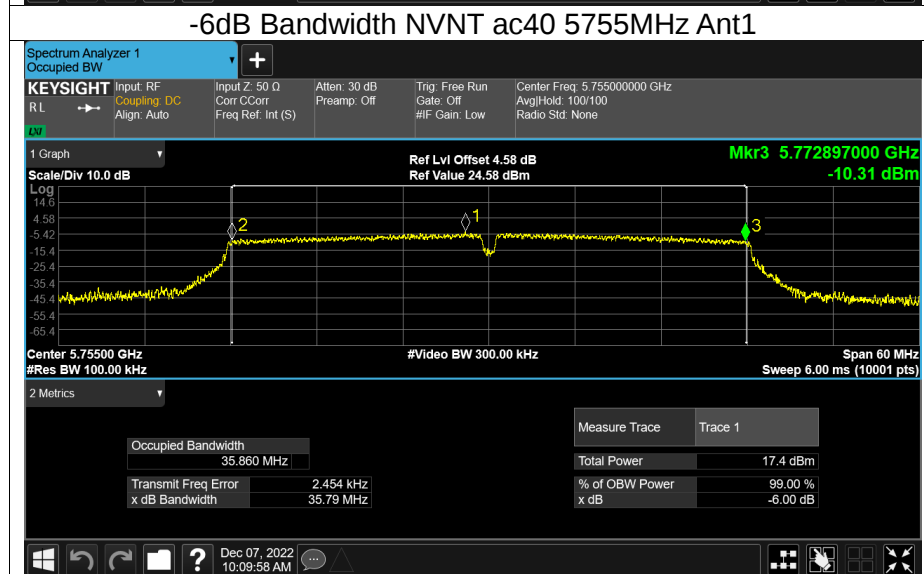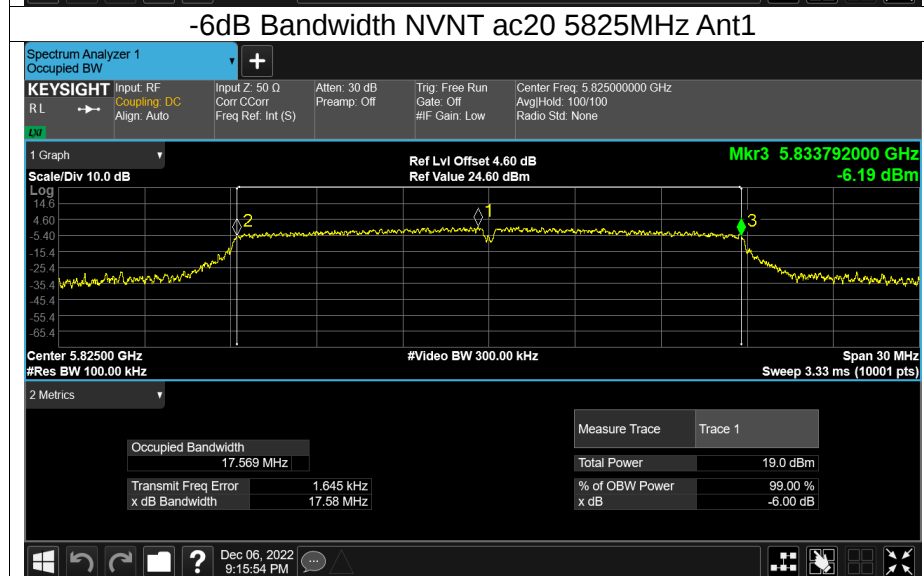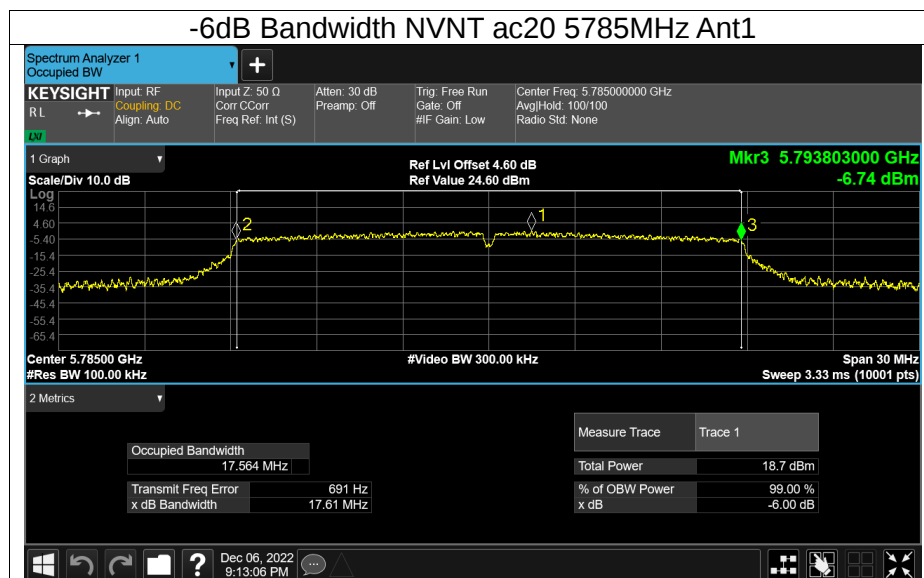

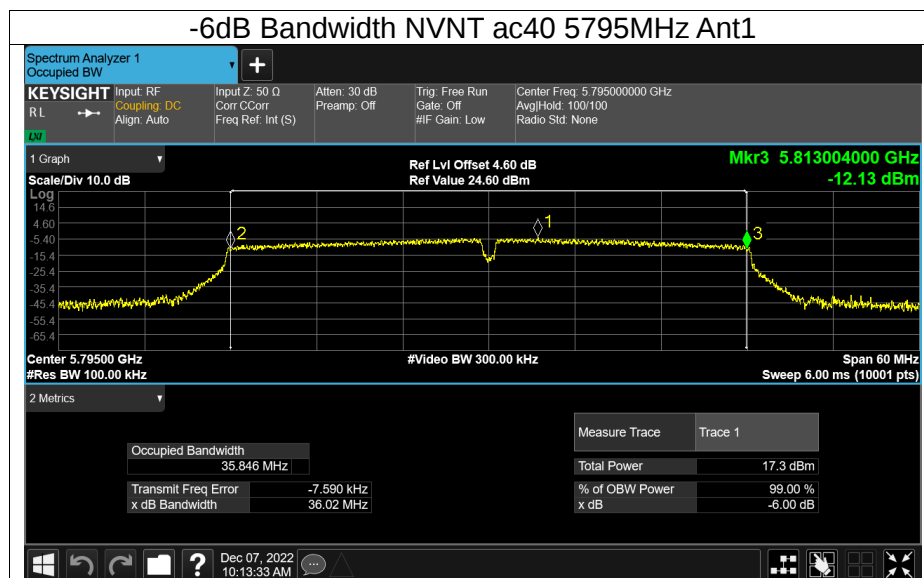

APPENDIX II:PHOTOS OF TEST SETUP


Radiated Spurious Emission Test Setup Photo - Below 1GHz

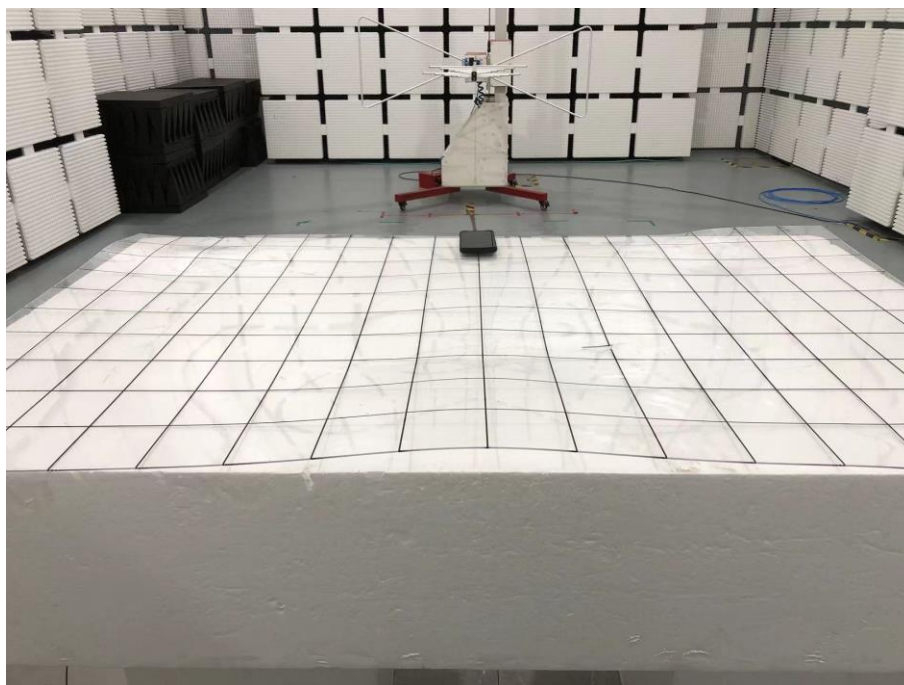

Radiated Spurious Emission Test Setup Photo - Above 1GHz



Conducted Emission Test Setup Photo

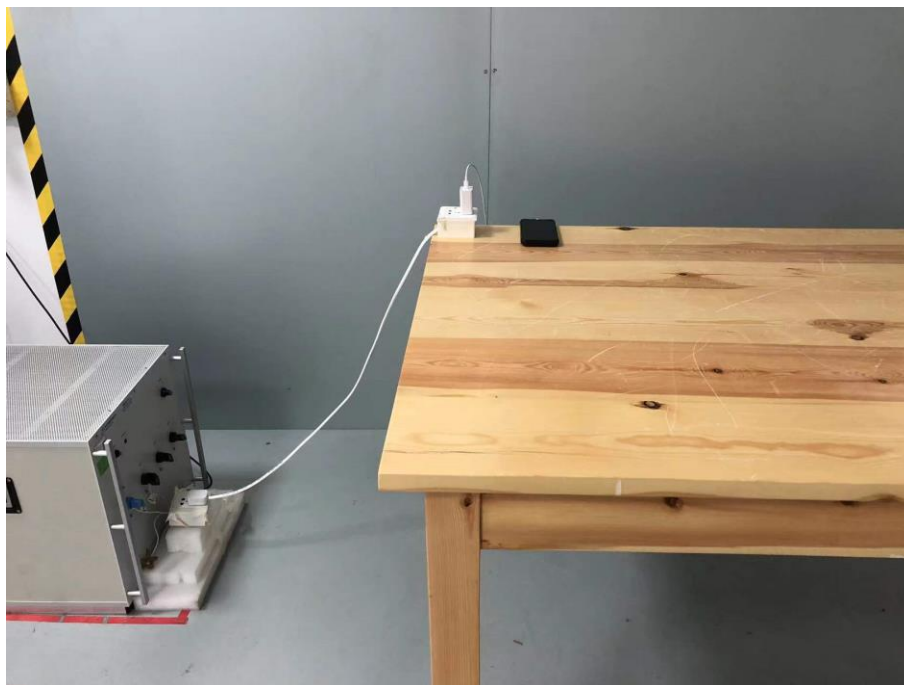

※※※※※END OF THE REPORT※※※※※