


Appendix I: Reference level measurement

Left earbud

Test Result

TestMode	Antenna	Freq(MHz)	Max.Point[MHz]	Result[dBm]
DH5	Ant1	2402	2401.84	-9.29
DH5	Ant1	2441	2441.03	-9.70
DH5	Ant1	2480	2479.84	-9.64
2DH5	Ant1	2402	2401.83	-9.20
2DH5	Ant1	2441	2440.83	-9.24
2DH5	Ant1	2480	2479.83	-9.29

Test Graphs

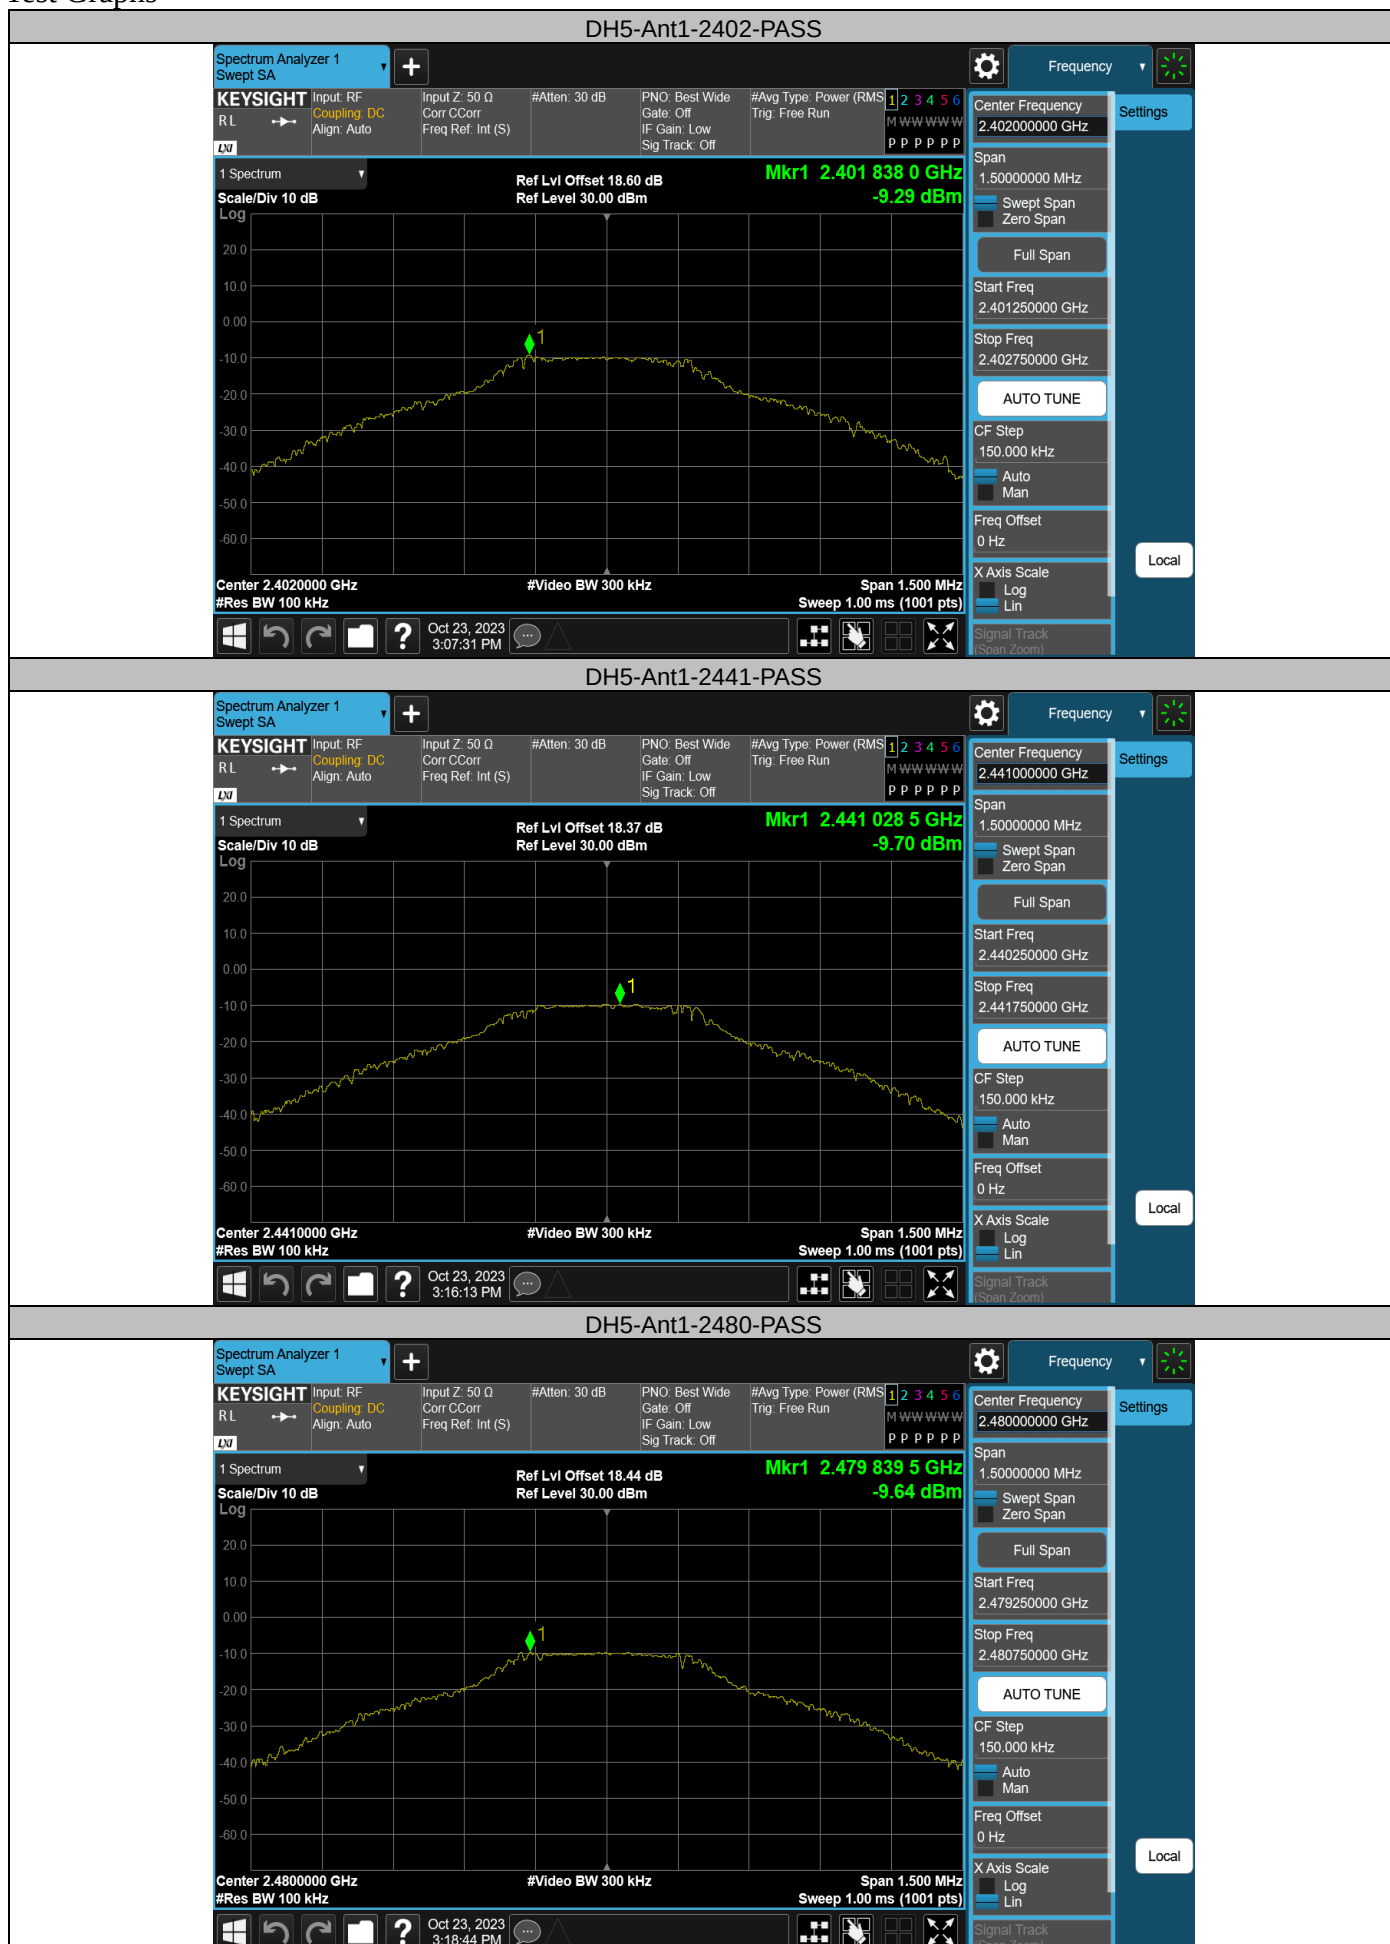




Right earbud

Test Result

TestMode	Antenna	Freq(MHz)	Max.Point[MHz]	Result[dBm]
DH5	Ant1	2402	2402.00	-9.70
DH5	Ant1	2441	2440.85	-9.34
DH5	Ant1	2480	2479.84	-9.63
2DH5	Ant1	2402	2401.84	-9.22
2DH5	Ant1	2441	2440.99	-9.32
2DH5	Ant1	2480	2479.85	-9.28

Test Graphs

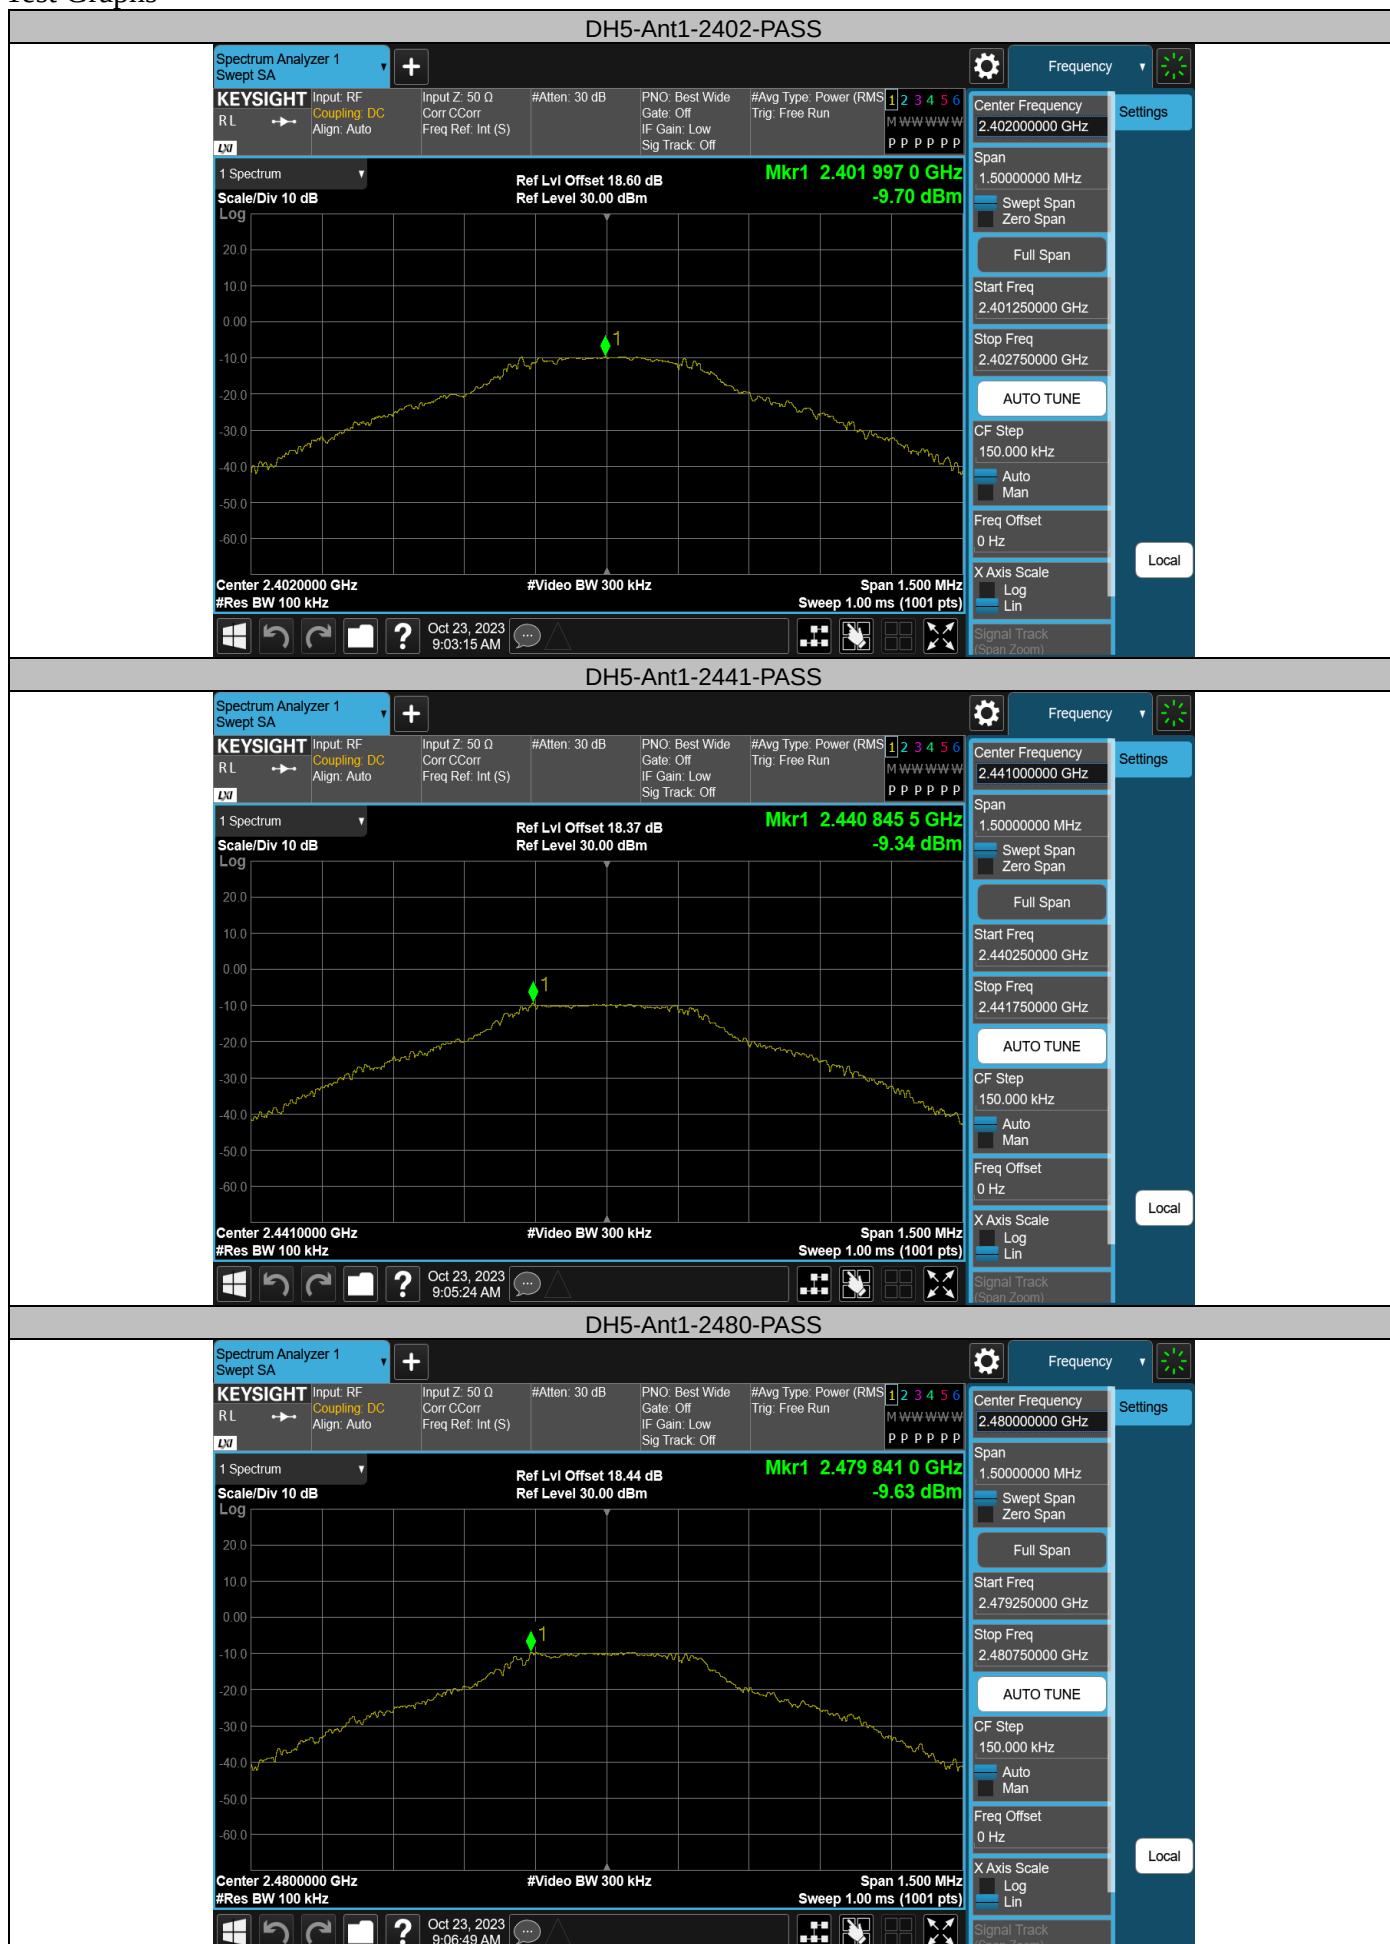




14. TEST SETUP PHOTO


Conducted Test



Radiated Test (Below 1GHz)

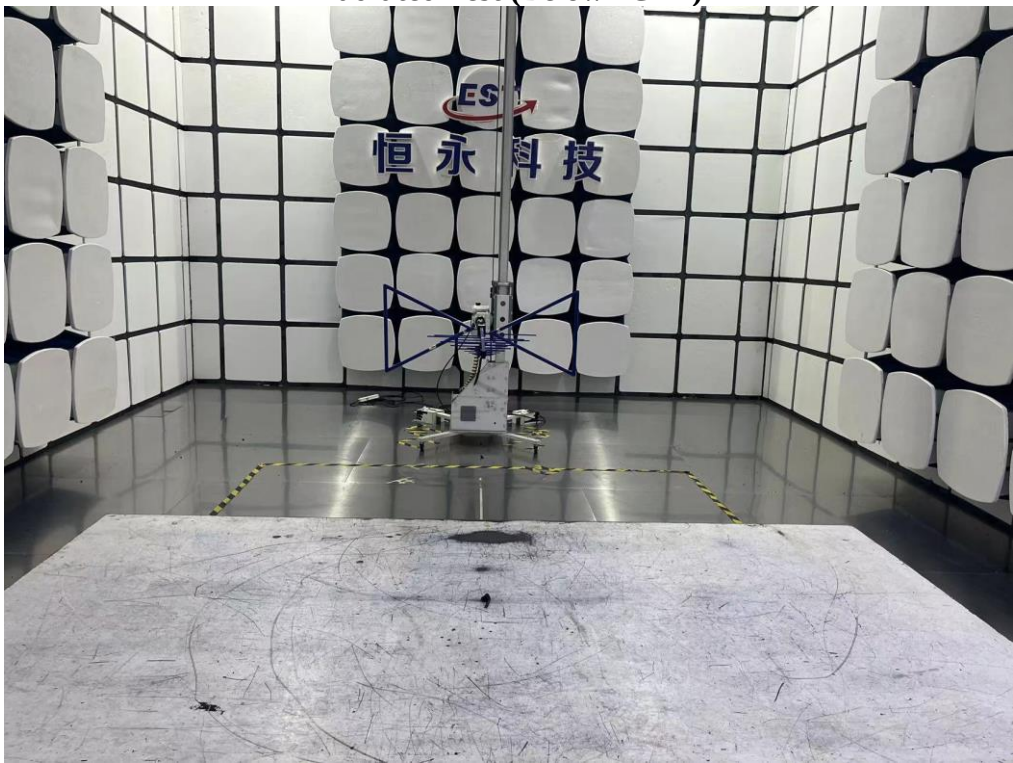


Left earbud

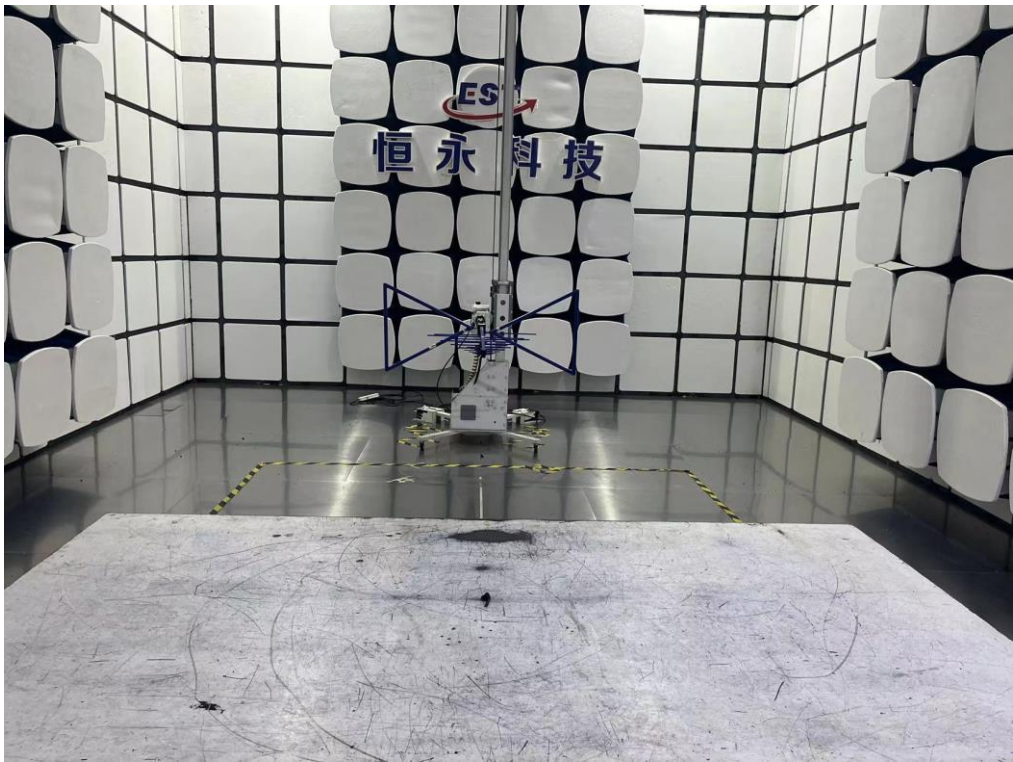


Right earbud

Radiated Test (Above 1GHz)

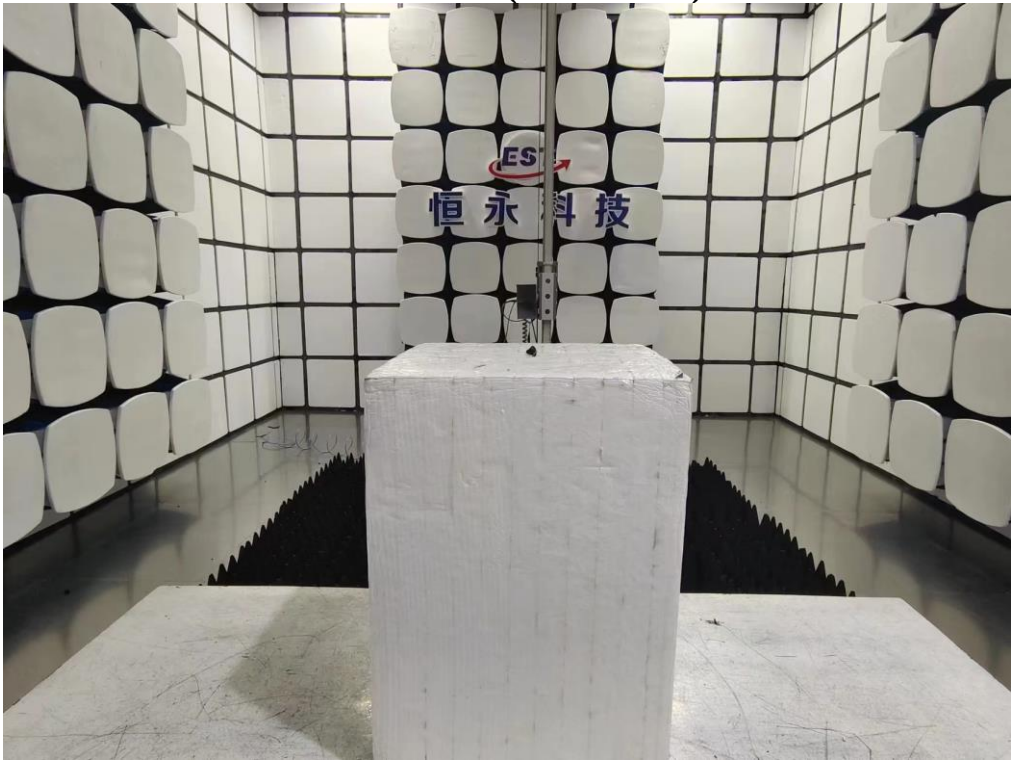

Left earbud

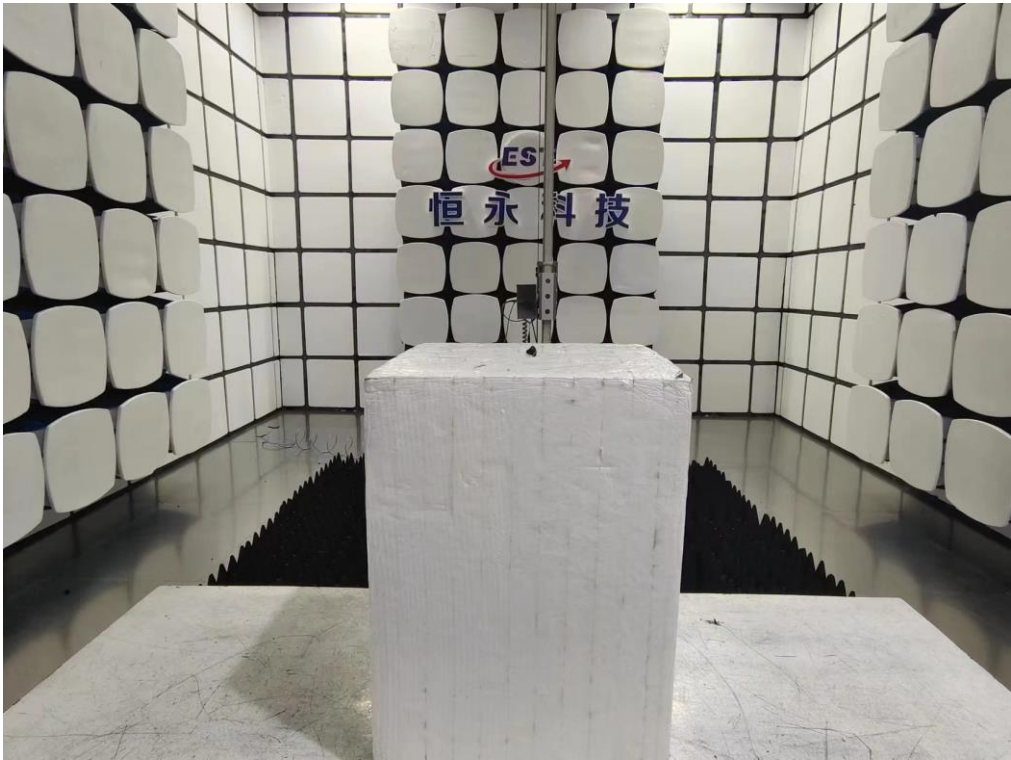

Right earbud

15. EUT PHOTO

External Photos
M/N: Defunc TRUE LITE



External Photos
M/N: Defunc TRUE LITE



External Photos
M/N: Defunc TRUE LITE



External Photos
M/N: Defunc TRUE LITE



External Photos
M/N: Defunc TRUE LITE



External Photos
M/N: Defunc TRUE LITE




External Photos
M/N: Defunc TRUE LITE





Internal Photos
M/N: Defunc TRUE LITE





Internal Photos
M/N: Defunc TRUE LITE

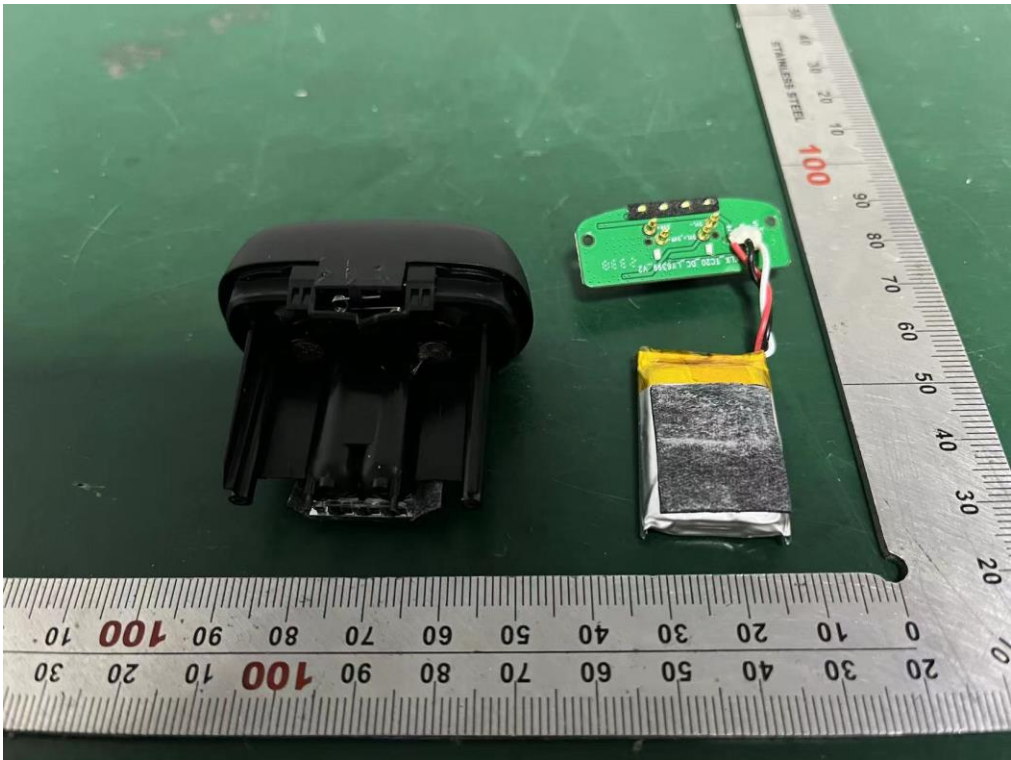



Internal Photos
M/N: Defunc TRUE LITE

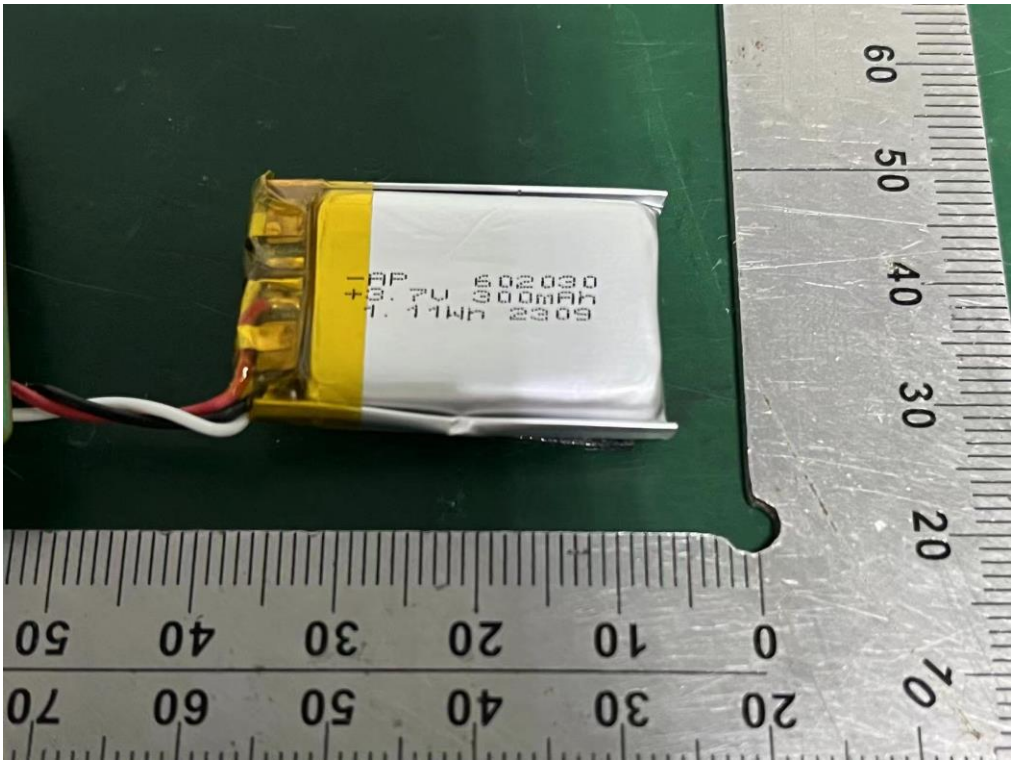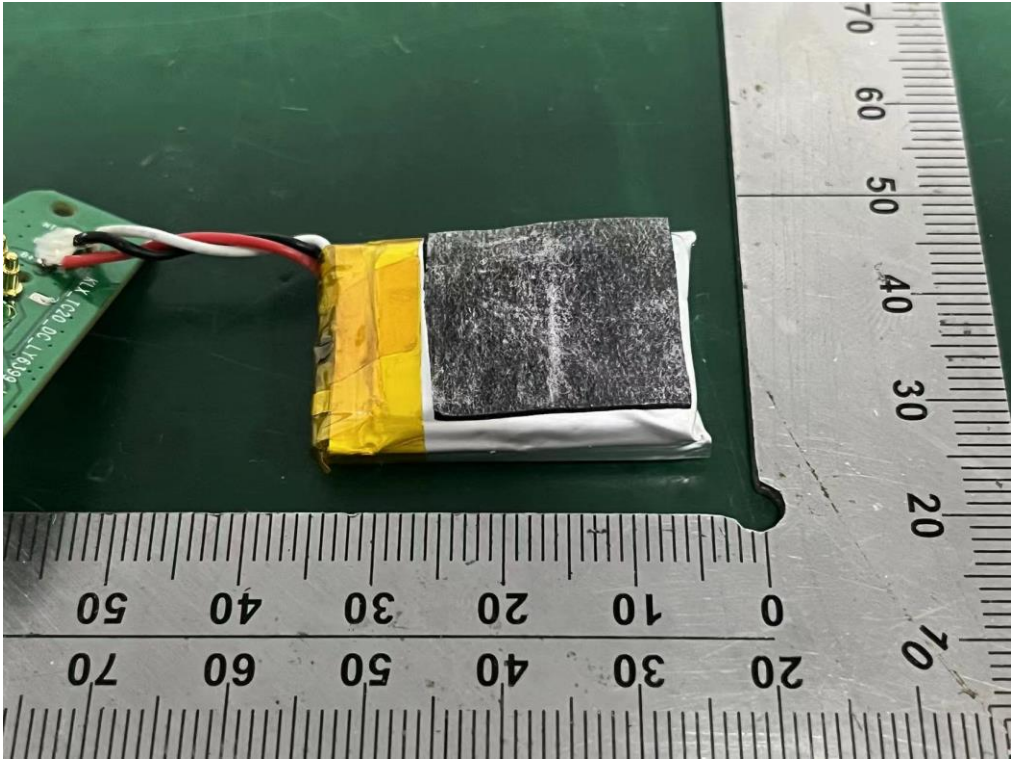



Internal Photos
M/N: Defunc TRUE LITE

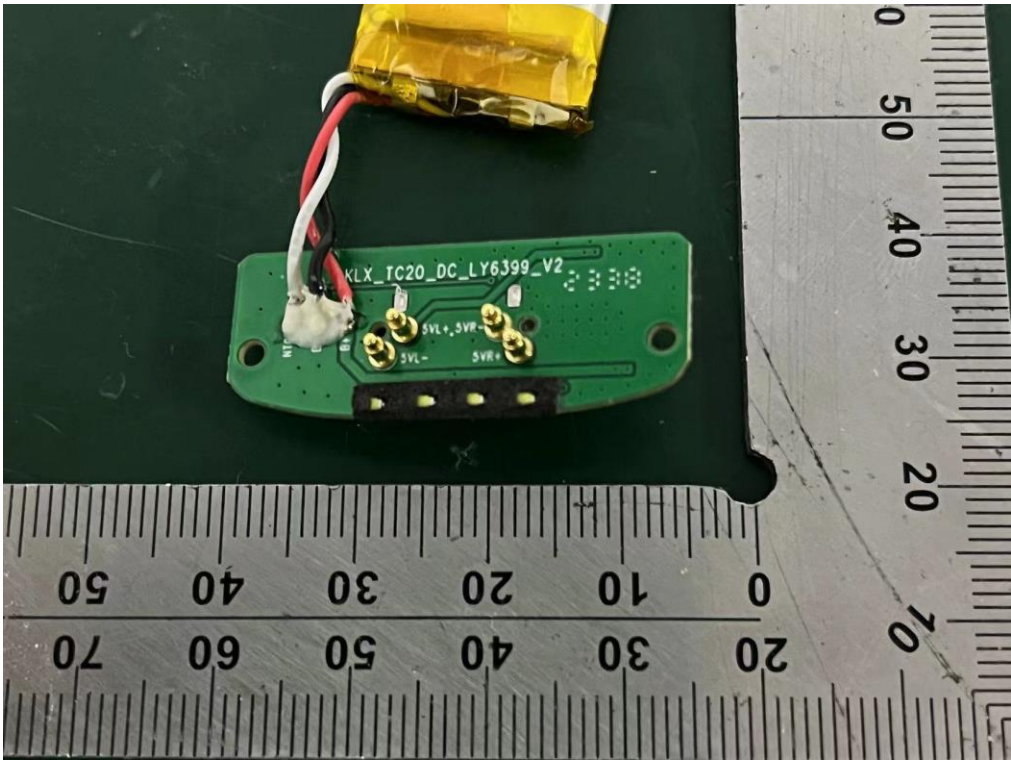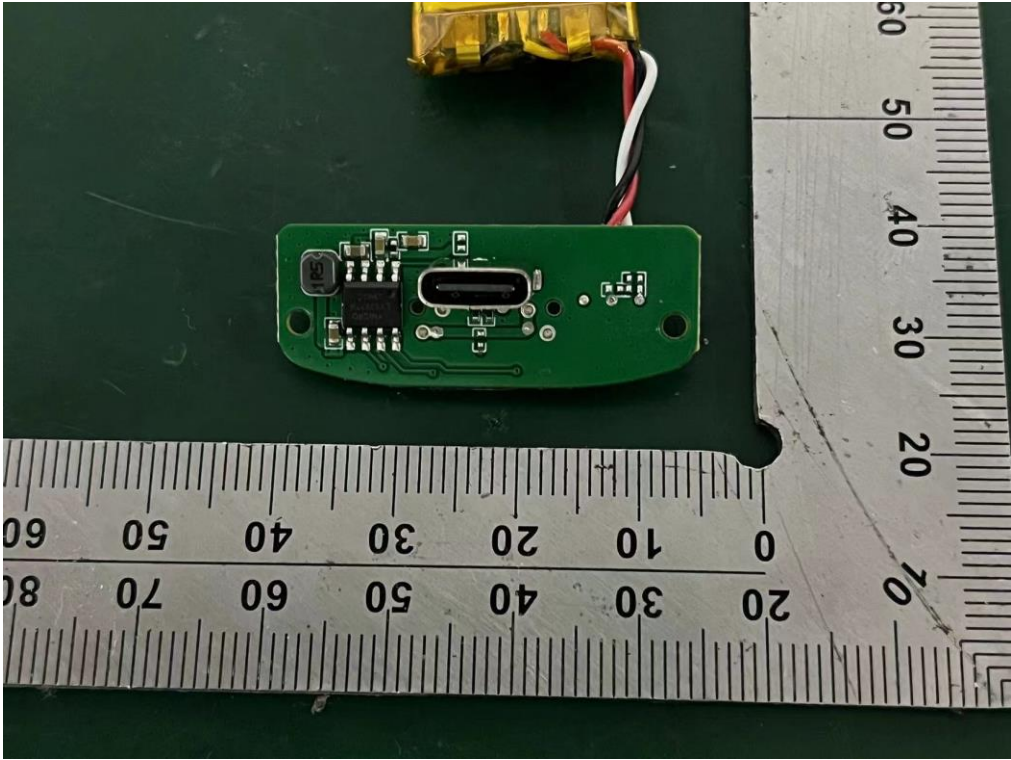


Internal Photos
M/N: Defunc TRUE LITE

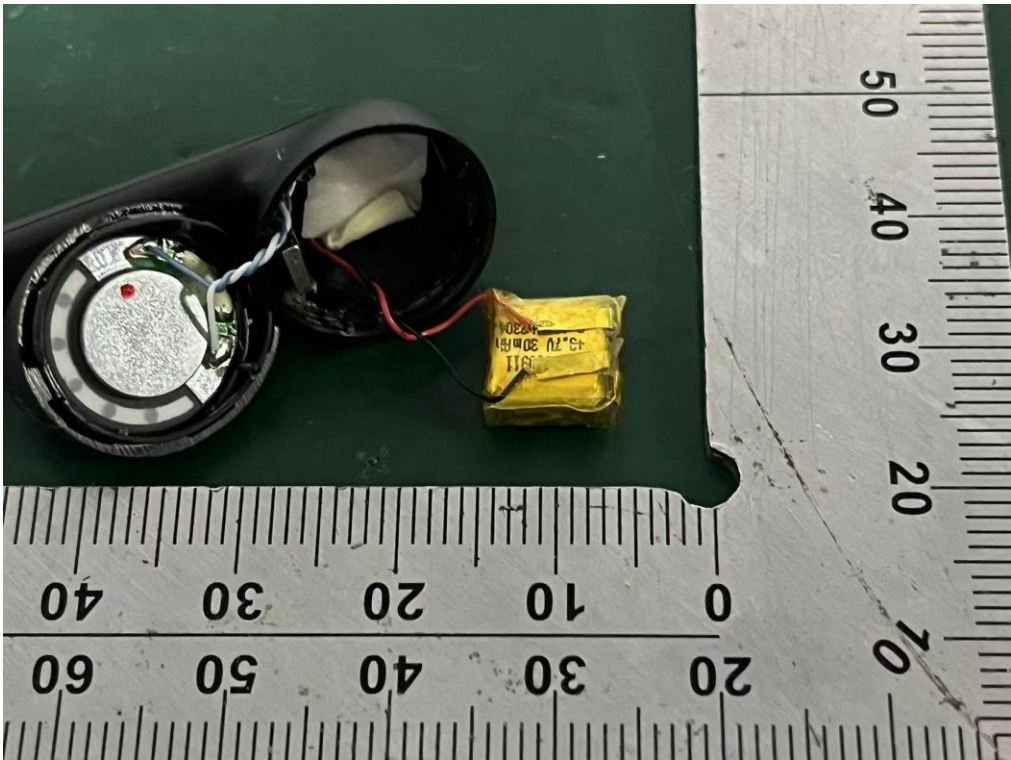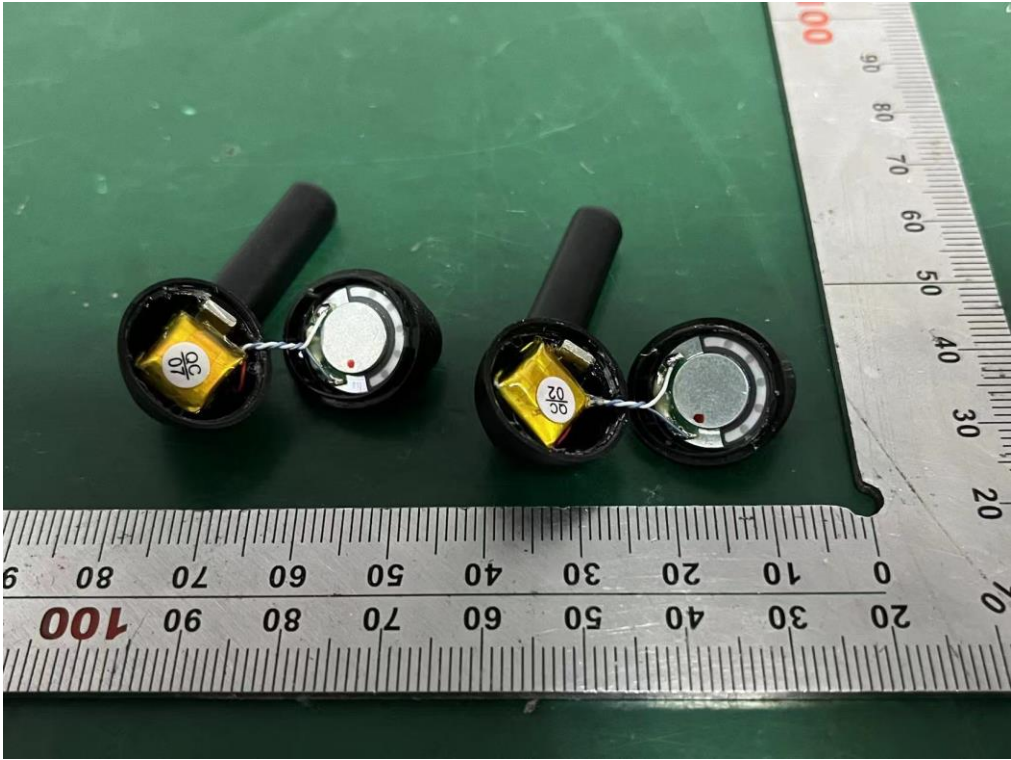



Internal Photos
M/N: Defunc TRUE LITE

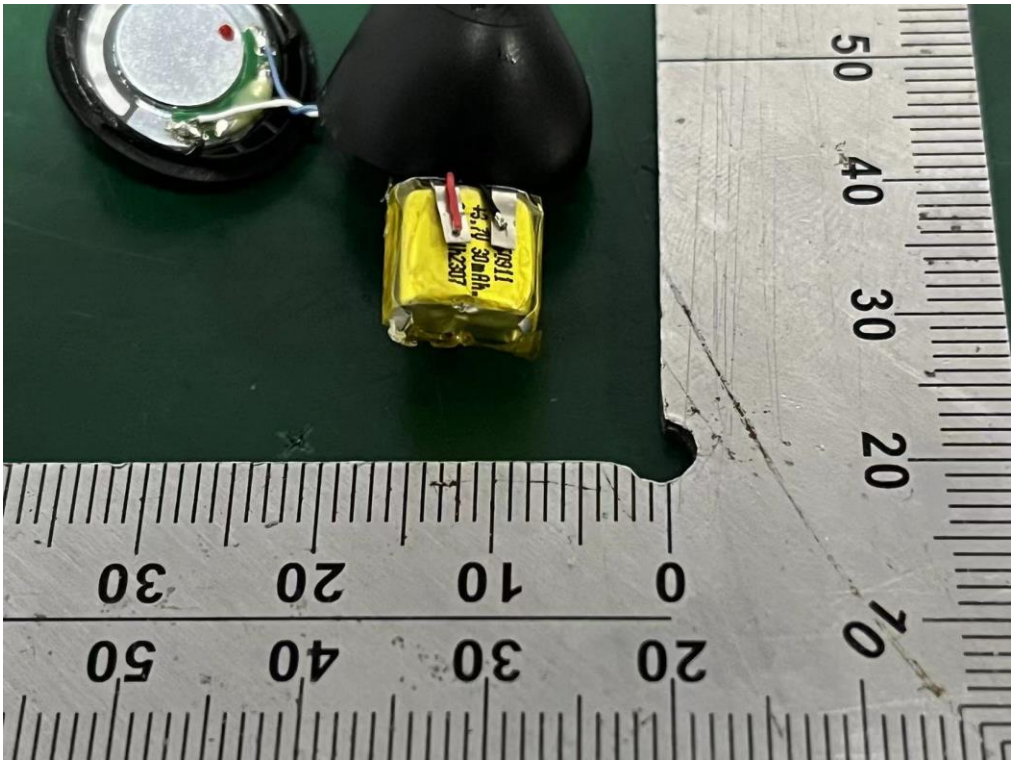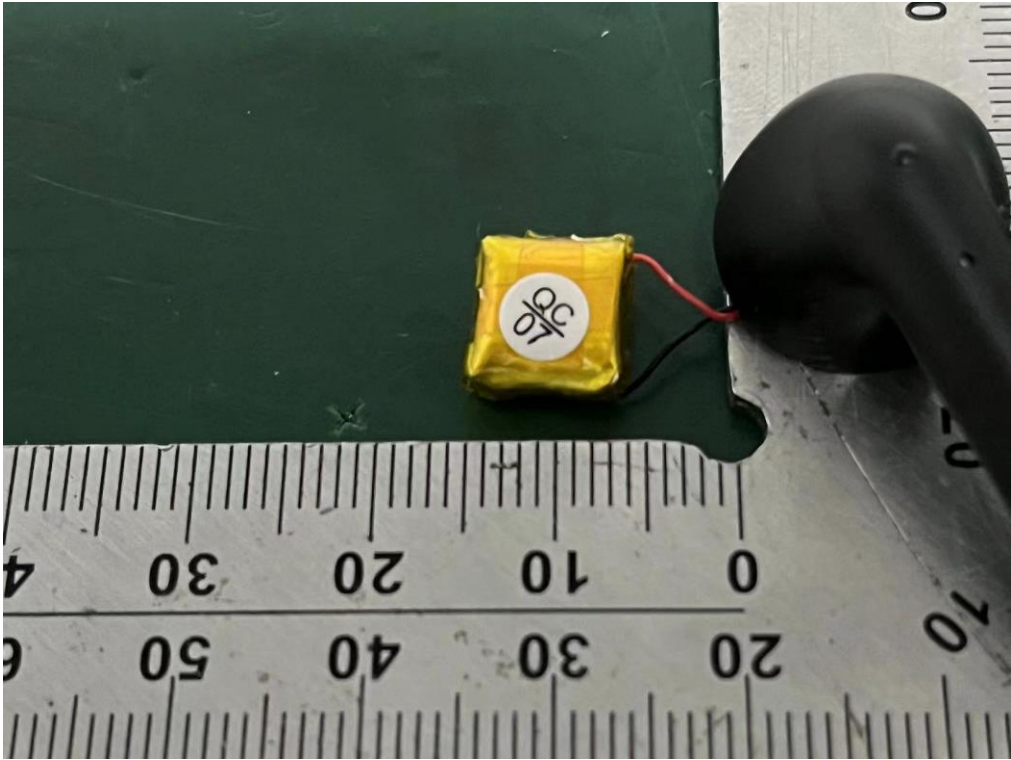

Internal Photos
M/N: Defunc TRUE LITE

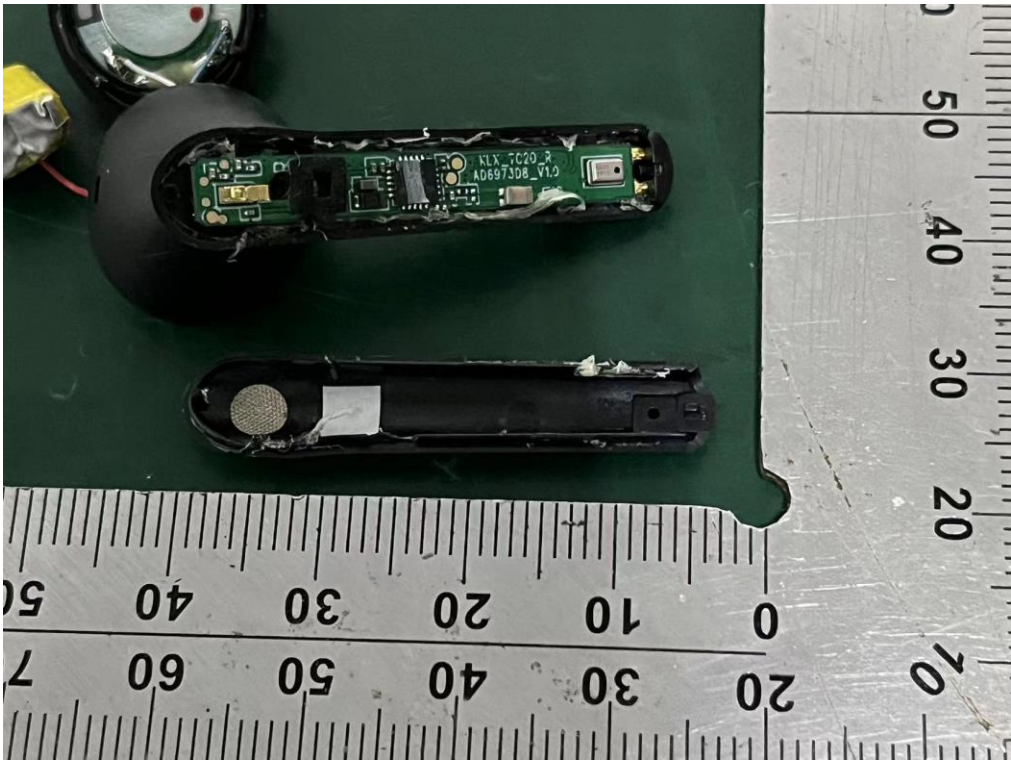


Internal Photos
M/N: Defunc TRUE LITE

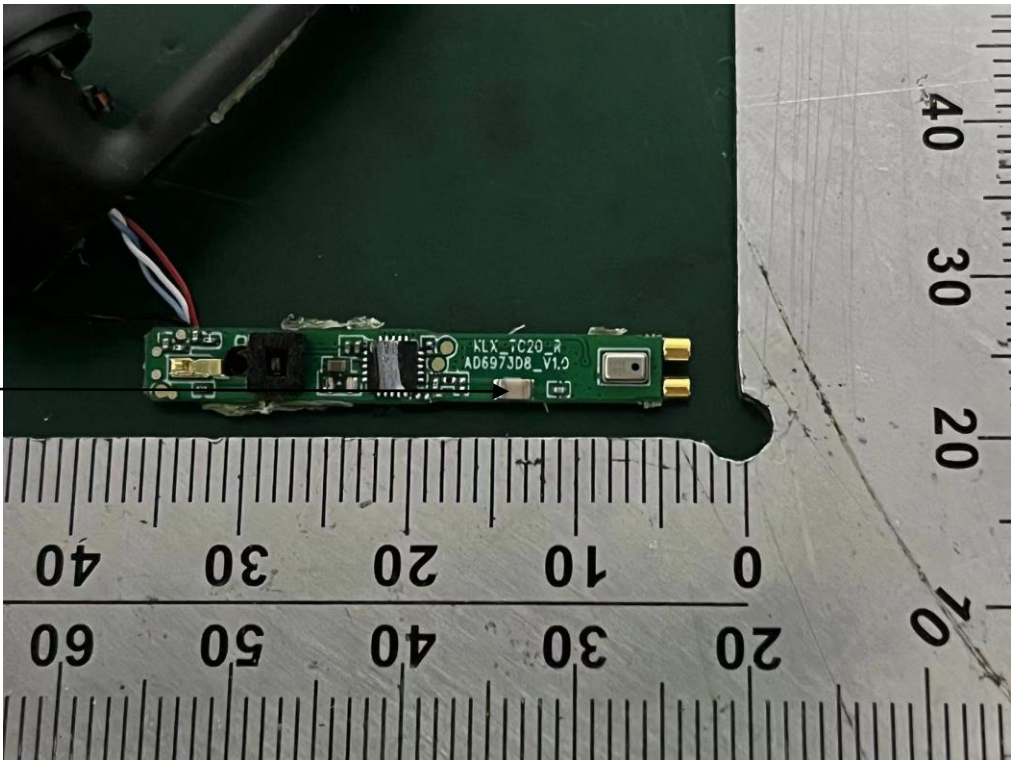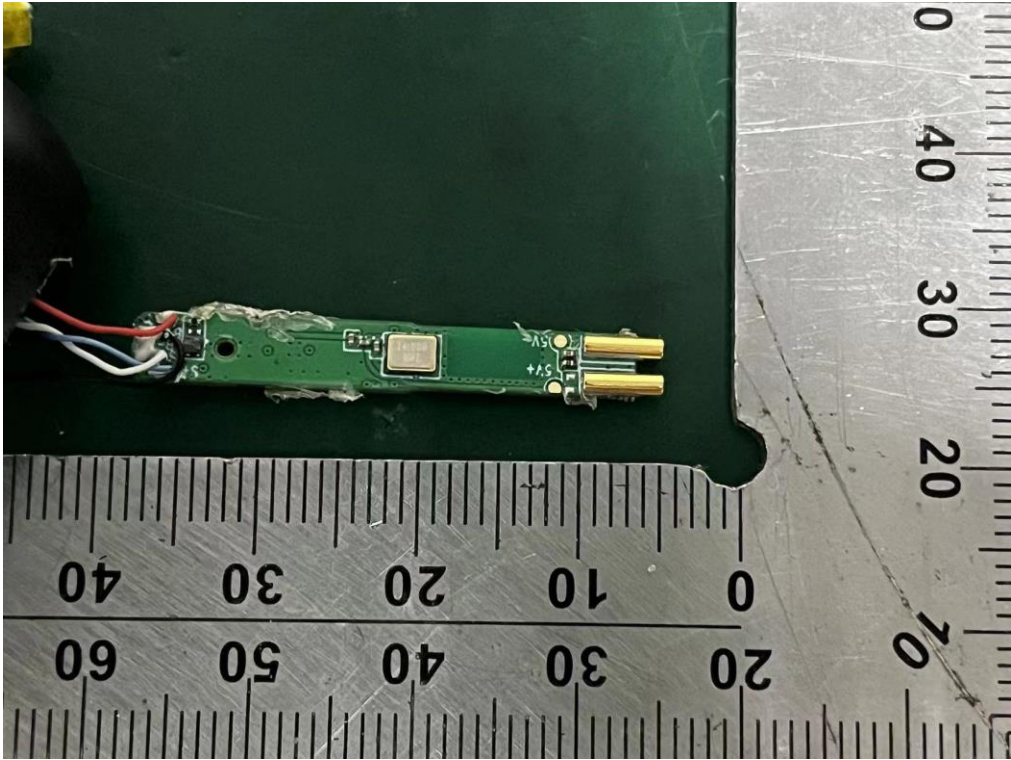


Left earbuds
Antenna

Internal Photos
M/N: Defunc TRUE LITE

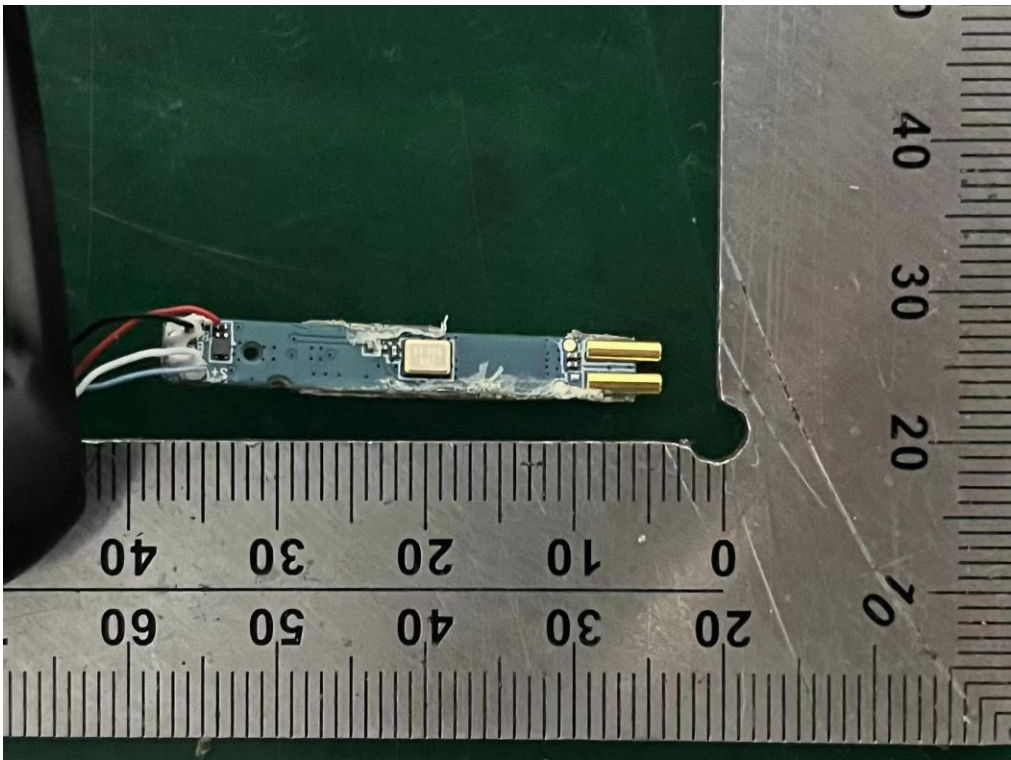

Internal Photos
M/N: Defunc TRUE LITE

Right earbuds
Antenna

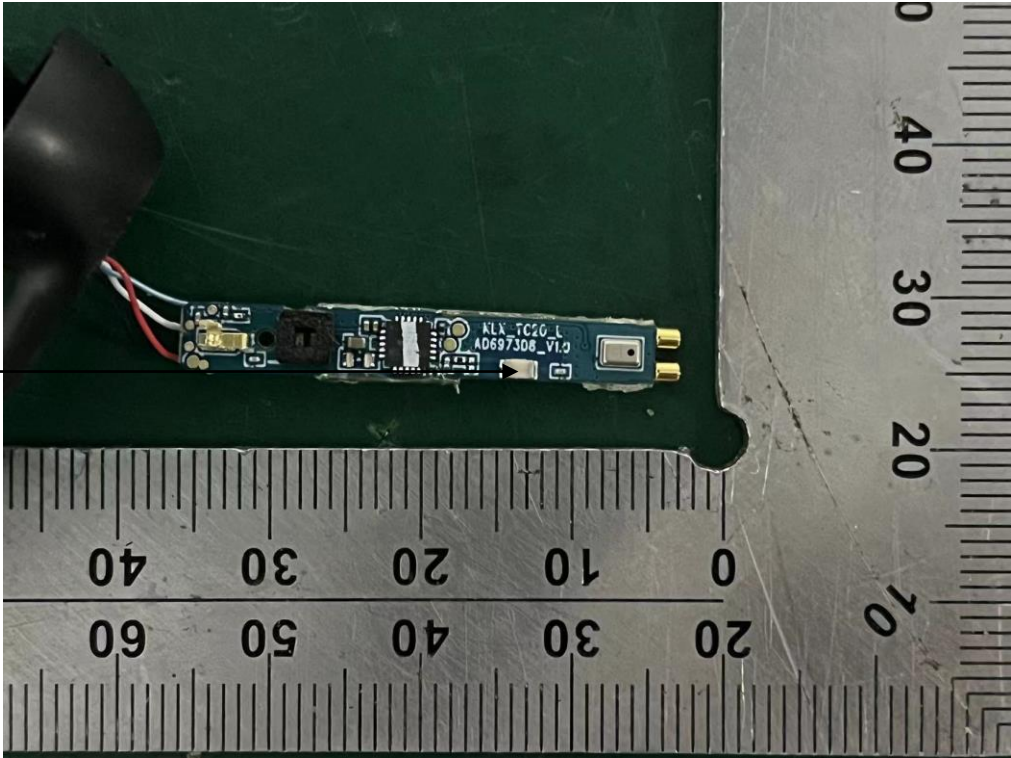

End of Test Report