



Radiated Emission Measurement


Operator: Kai
Temperature:23.4 °C
Humidity:59.0 %

File :1_BT_TX 2402MHz

Data :#1

Date: 2023/11/29
Time: 下午 05:26:55

80.0 dBuV/m

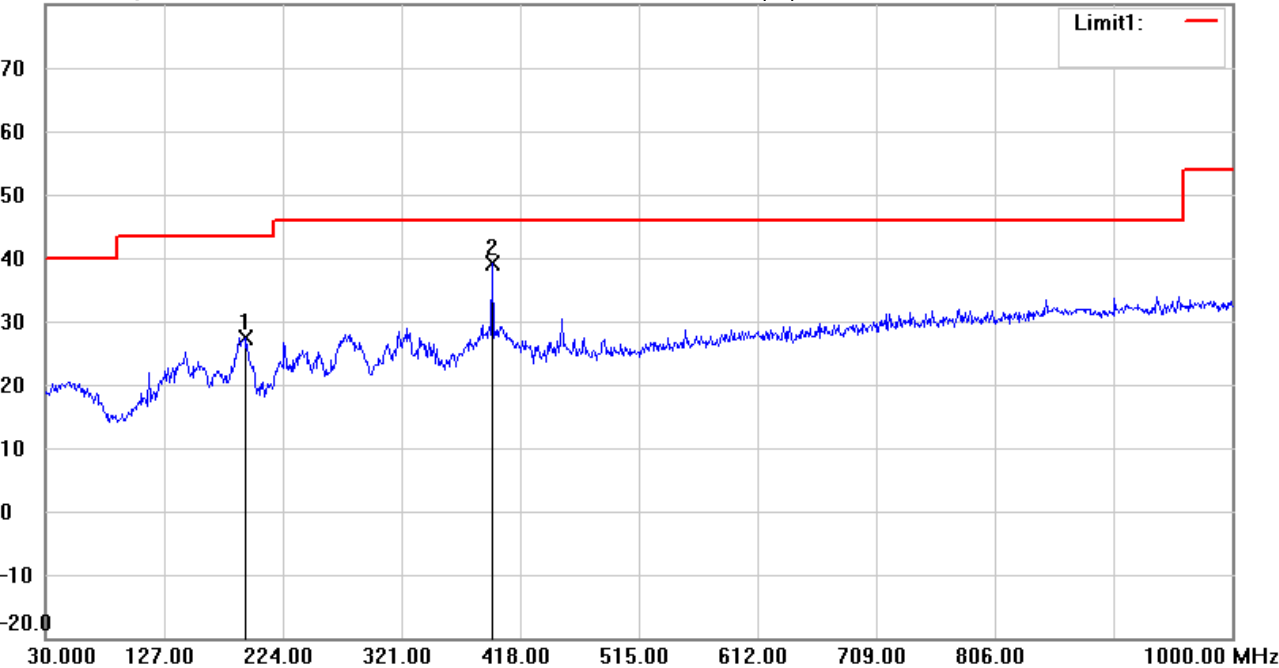

Site : Chamber
Condition : FCC_part 15 RE-Class C_30-1000MHz
EUT : W6M22311-23090
M/N:
Test Mode : TX 2402MHz
Note :

Polarization: Horizontal
Power : 120 Va.c.
Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	192.9600	41.65	peak	-14.16	27.49	43.50	100	117	-16.01	
*	395.2050	47.92	peak	-8.85	39.07	46.00	100	202	-6.93	



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :1_BT_TX 2402MHz

Data :#2


Date: 2023/11/29

Temperature:23.4 °C

80.0 dBuV/m

Time: 下午 05:27:45

Humidity:59.0 %

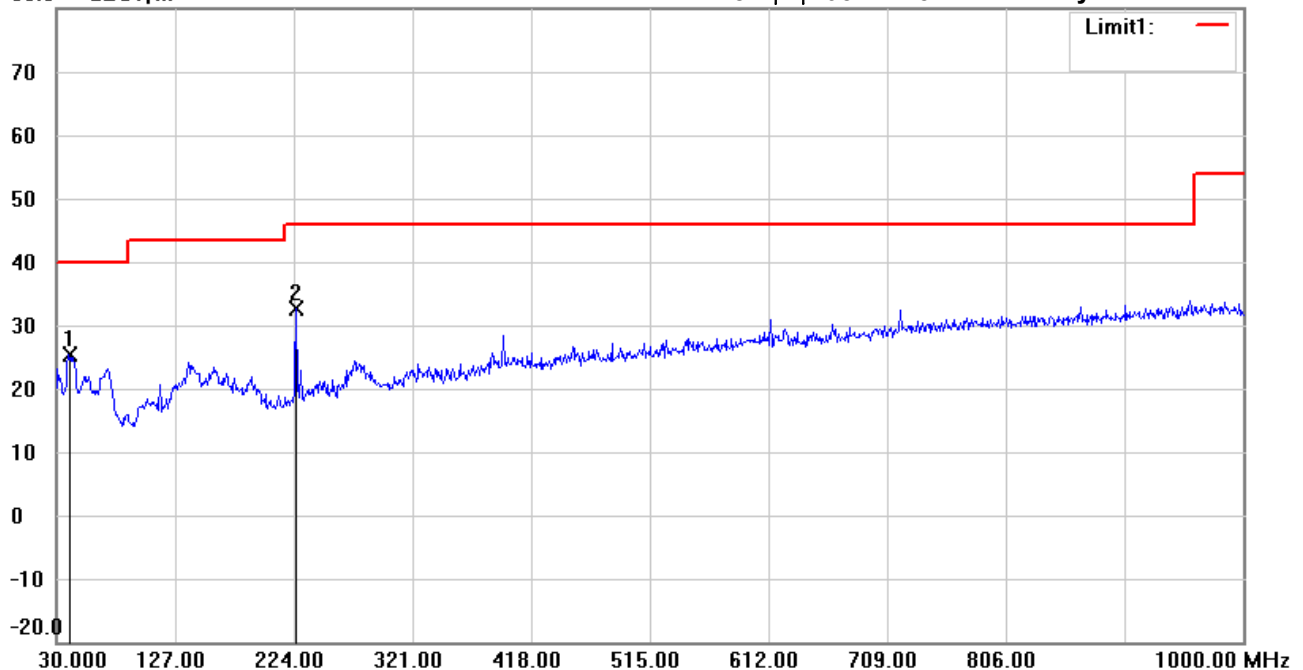

Site : Chamber

Condition : FCC_part 15 RE-Class C_30-1000MHz

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	40.1850	38.10	peak	-12.71	25.39	40.00	100	357	-14.61	
*	225.9400	46.82	peak	-14.13	32.69	46.00	100	207	-13.31	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:12:29

Humidity:59.0 %

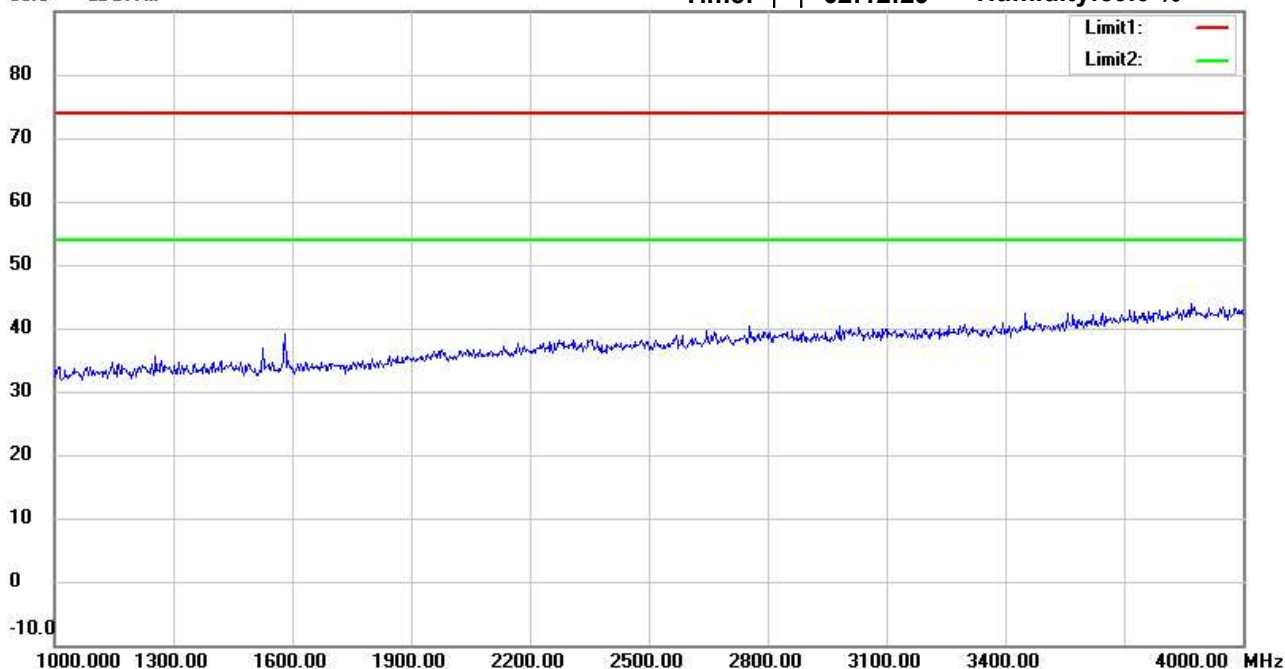

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:16:45

Humidity:59.0 %

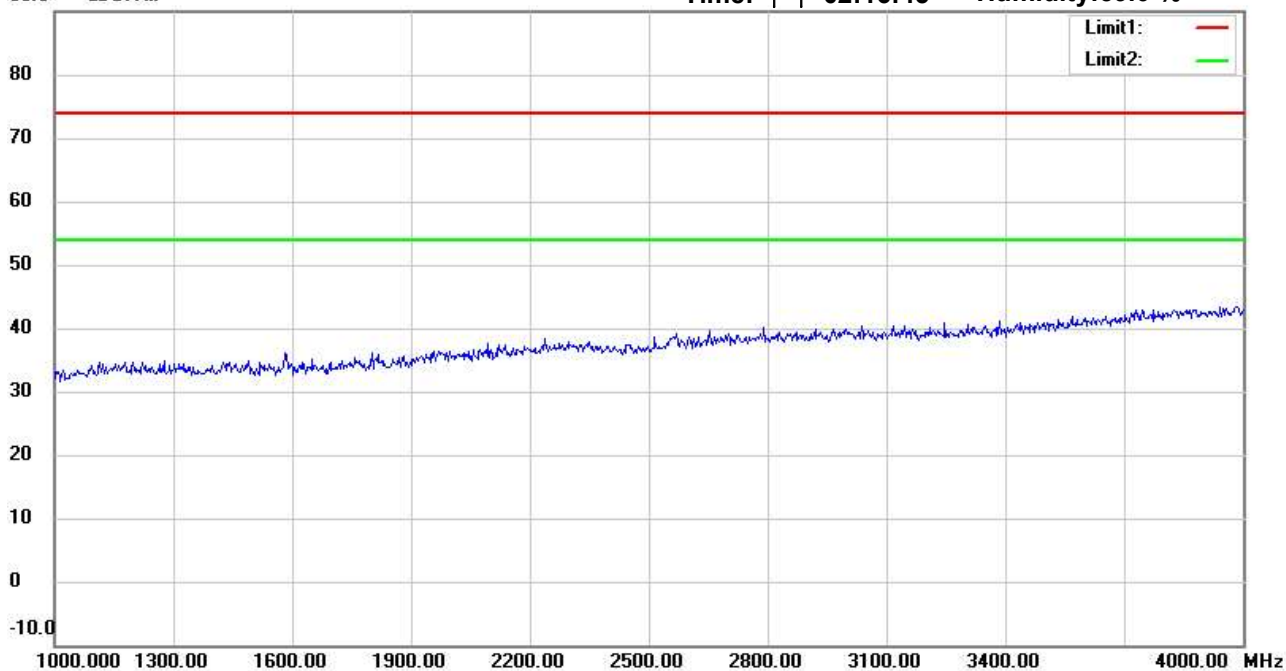

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:13:18

Humidity: 59.0 %

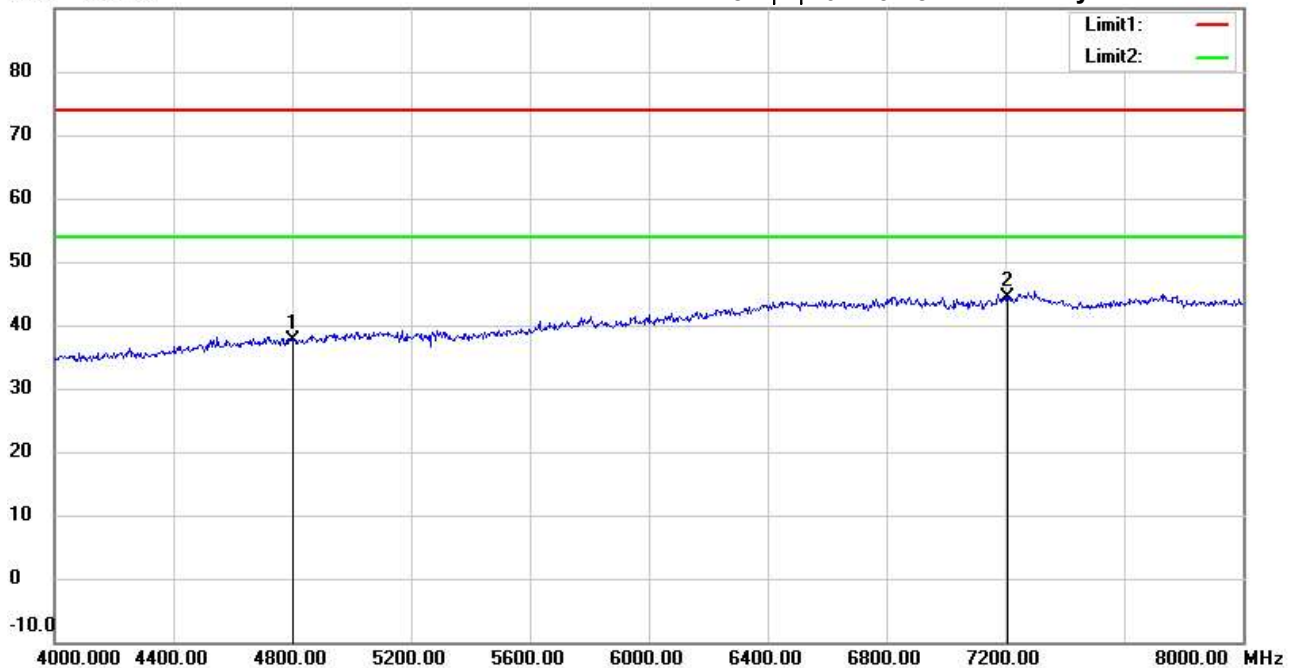

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4804.000	32.68	peak	5.03	37.71	74.00	150	193	-36.29	
*	7206.000	32.99	peak	11.38	44.37	74.00	150	268	-29.63	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #7


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:17:34

Humidity: 59.0 %

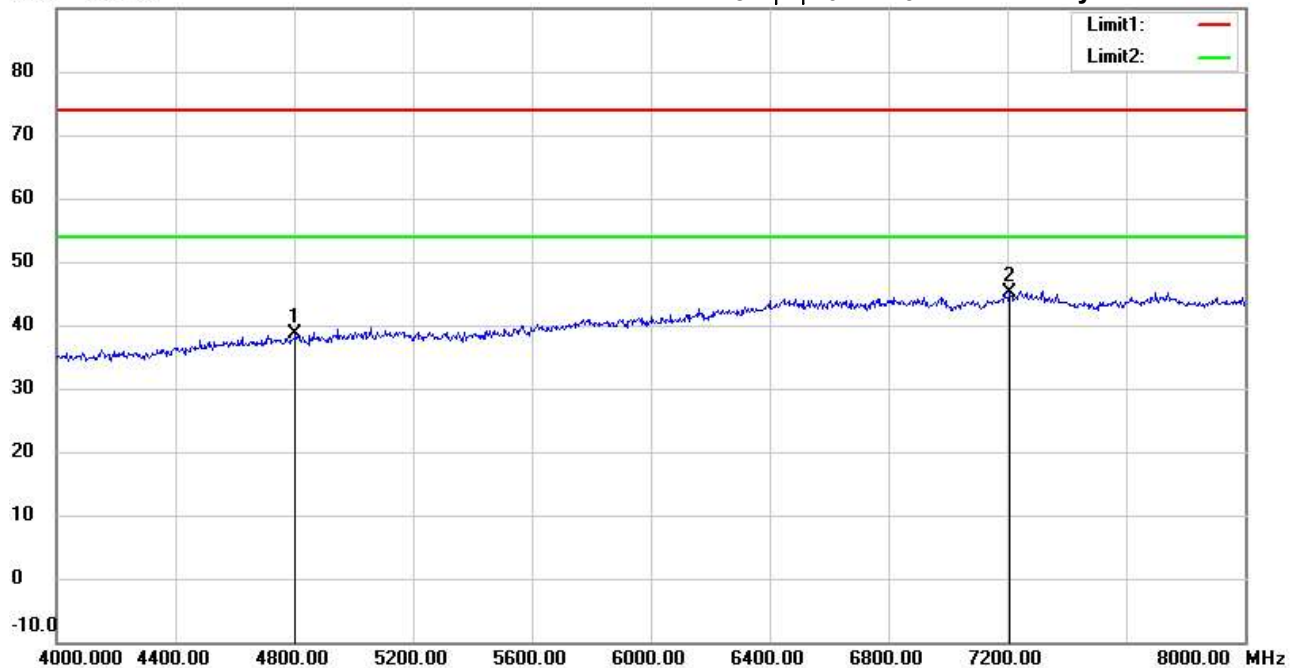

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4804.000	33.52	peak	5.03	38.55	74.00	150	252	-35.45	
*	7206.000	33.74	peak	11.38	45.12	74.00	150	241	-28.88	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:14:16

Humidity: 59.0 %

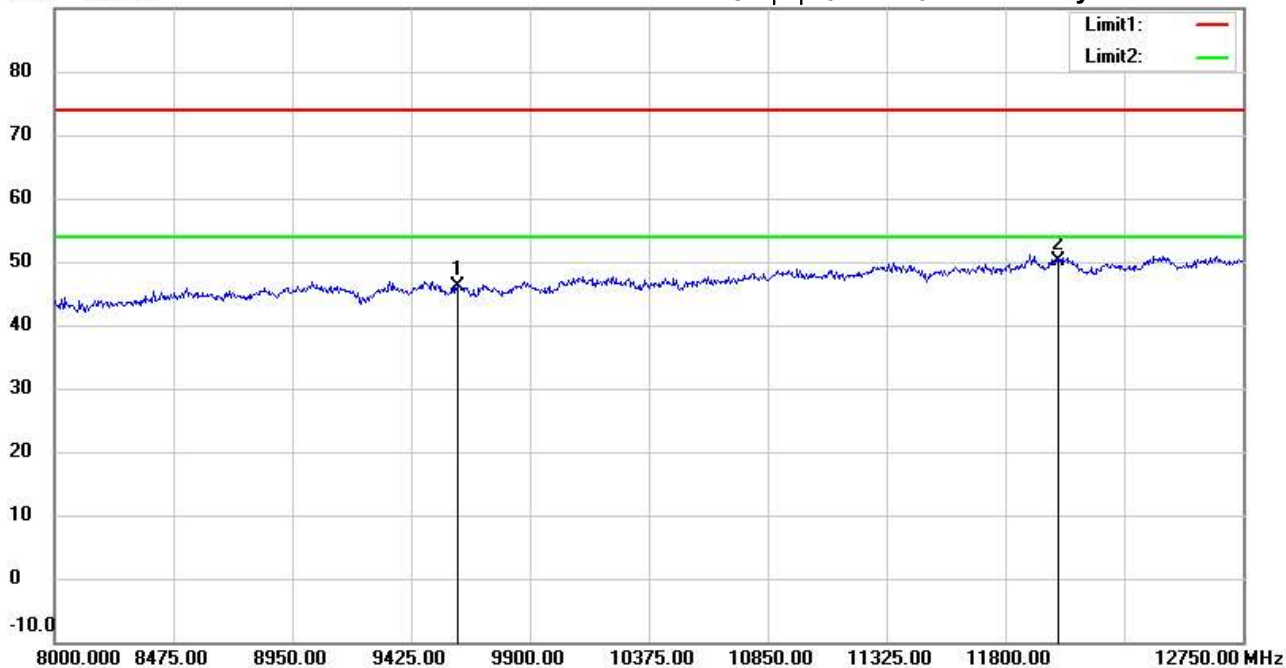

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9608.000	32.85	peak	13.39	46.24	74.00	150	300	-27.76	
*	12010.000	32.95	peak	17.28	50.23	74.00	150	336	-23.77	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:18:26

Humidity: 59.0 %

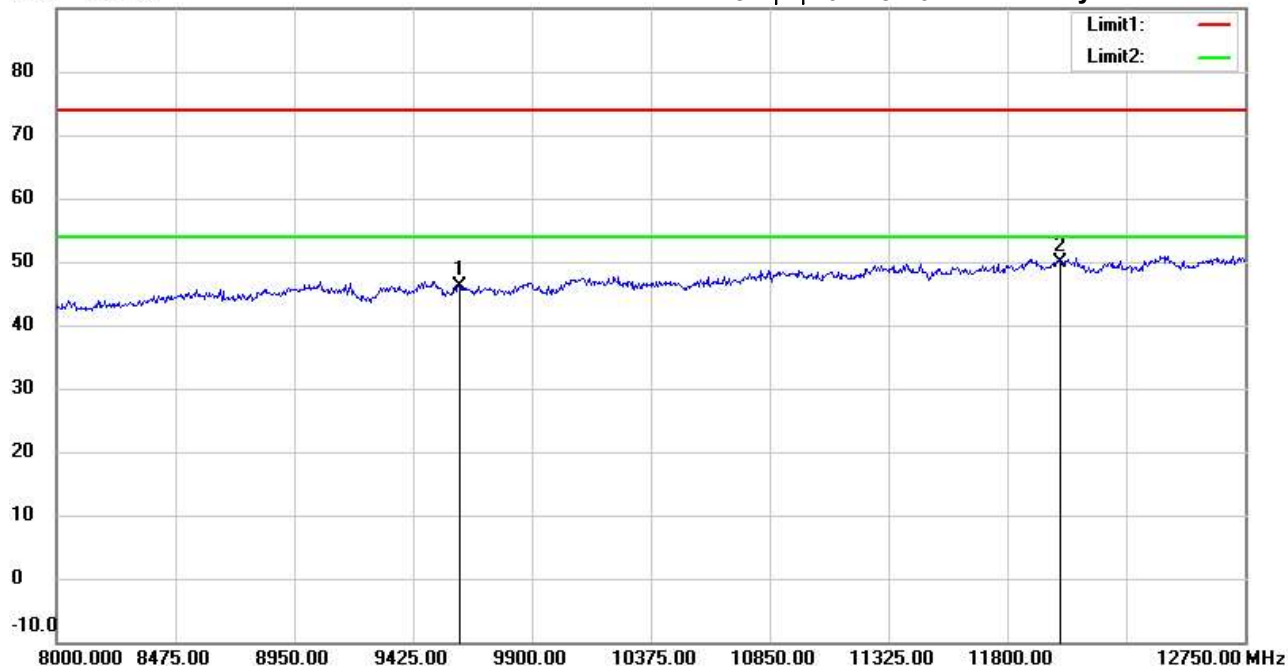

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Vertical

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9608.000	32.70	peak	13.39	46.09	74.00	150	100	-27.91	
*	12010.000	32.54	peak	17.28	49.82	74.00	150	25	-24.18	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #4


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:14:33

Humidity: 59.0 %

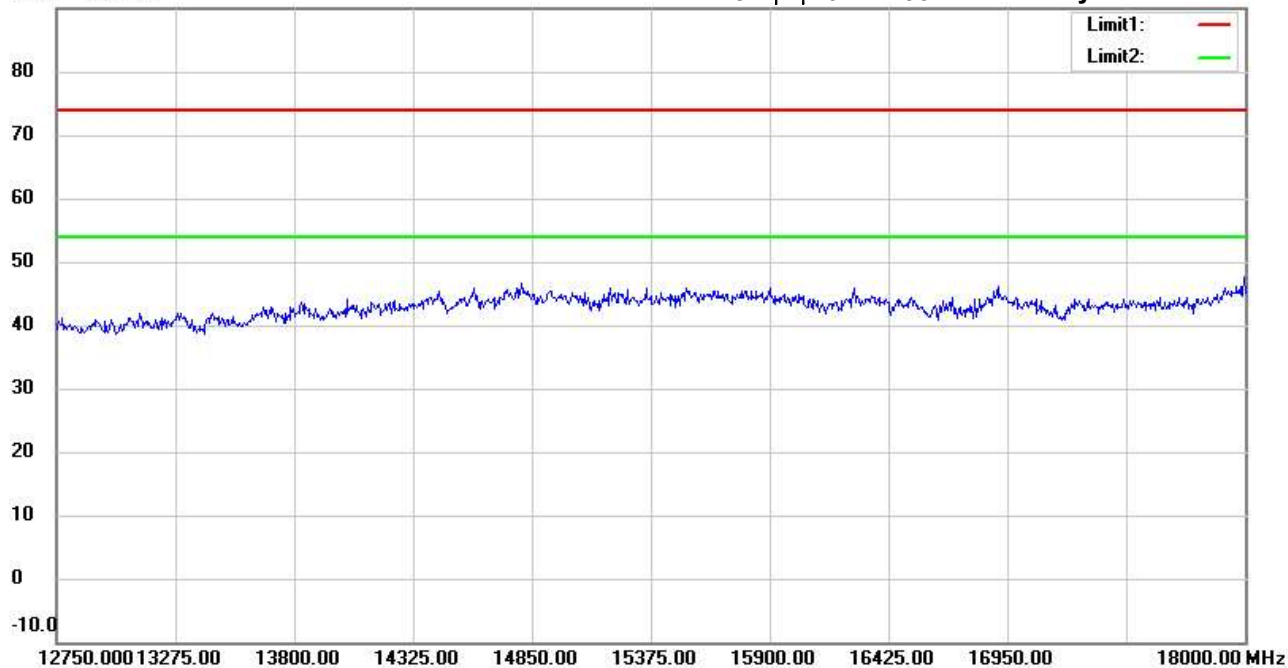

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:18:43

Humidity:59.0 %

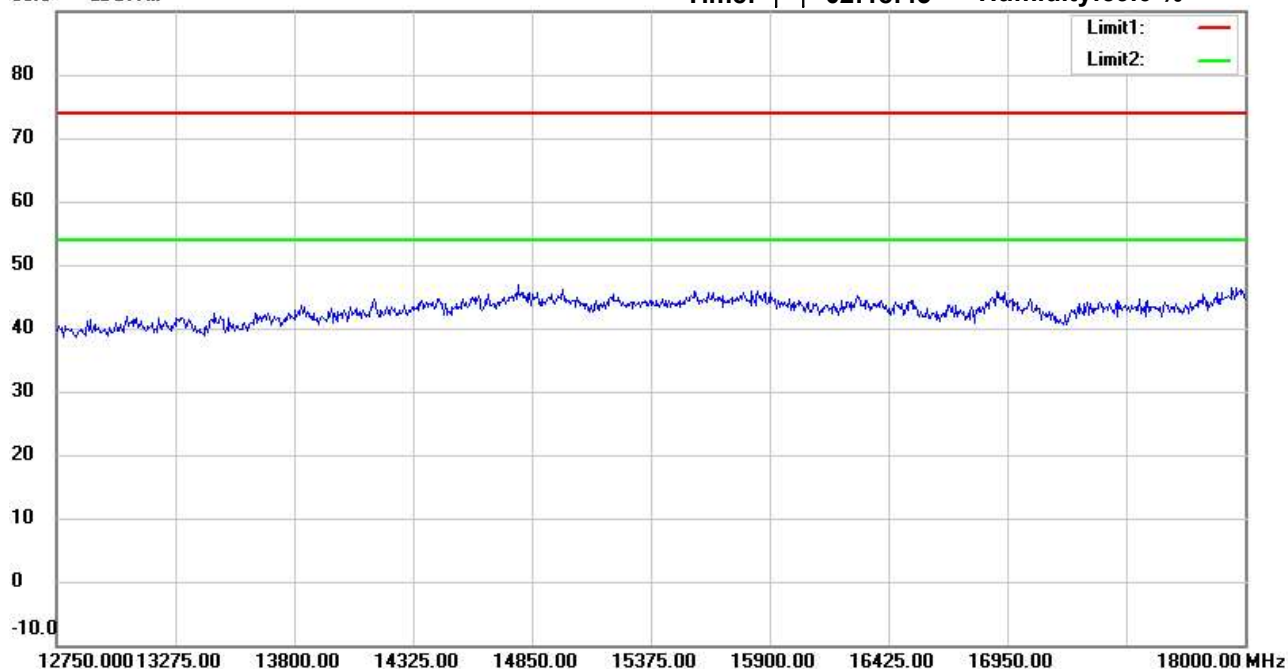

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:14:43

Humidity:59.0 %

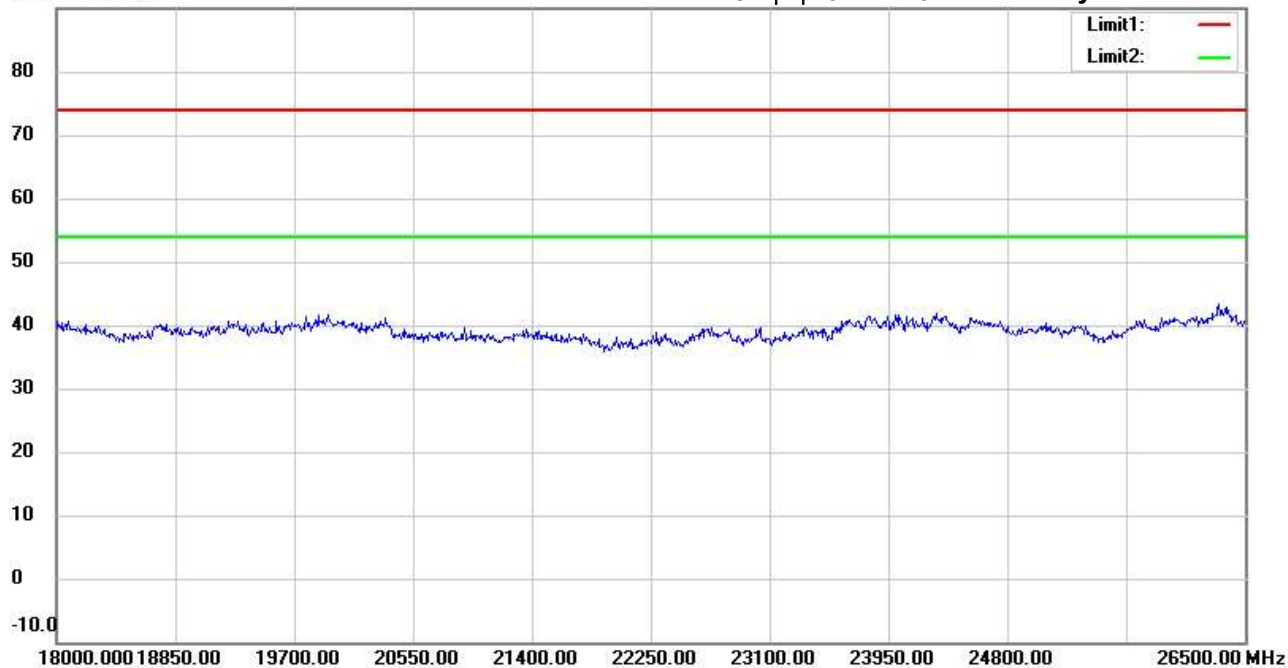

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#10


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:18:53

Humidity:59.0 %

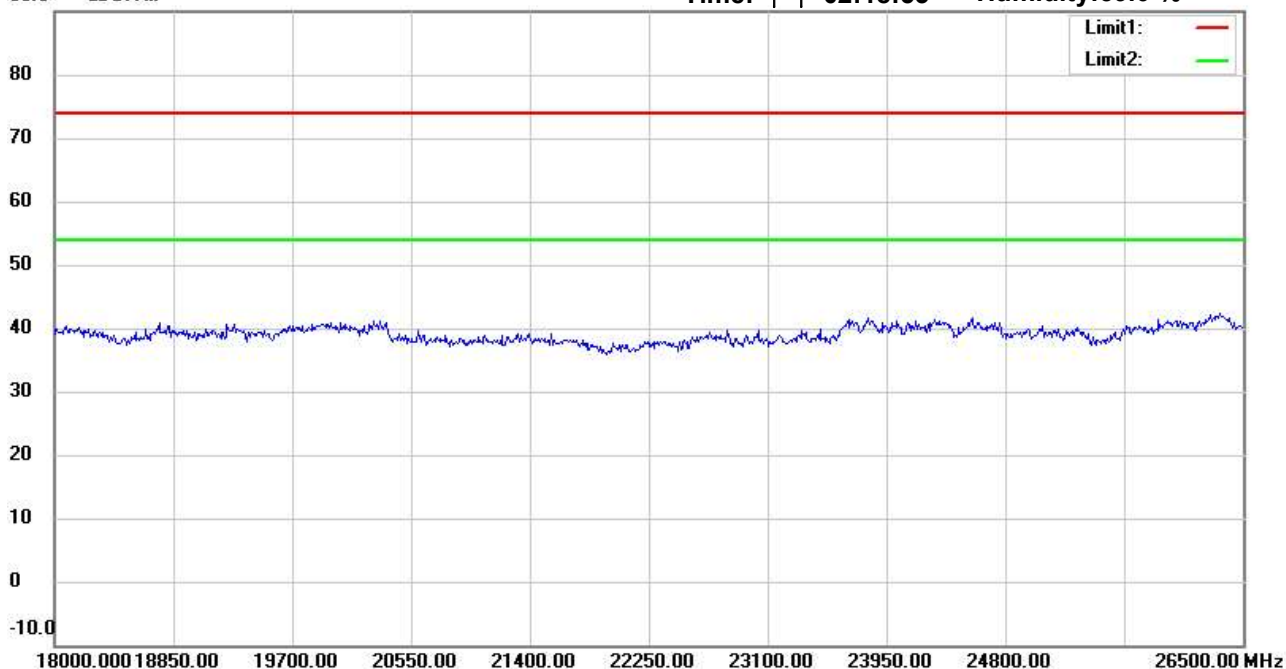

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:21:33

Humidity:59.0 %

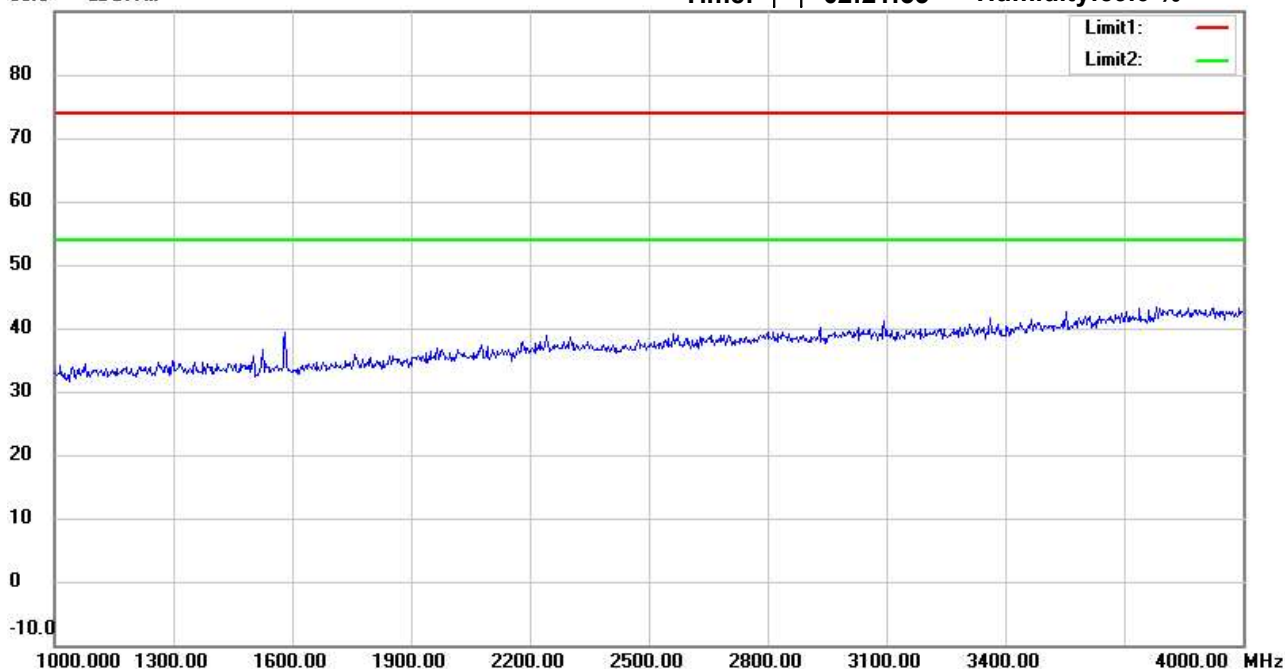

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:24:34

Humidity:59.0 %

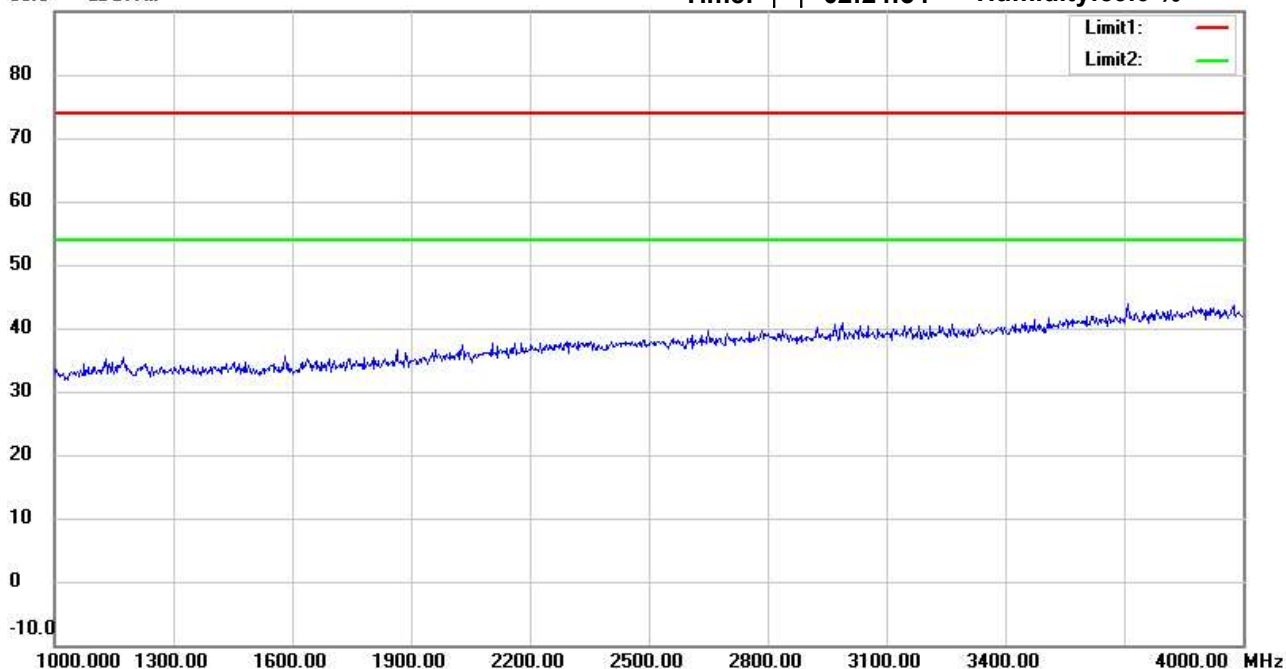

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:22:22

Humidity: 59.0 %

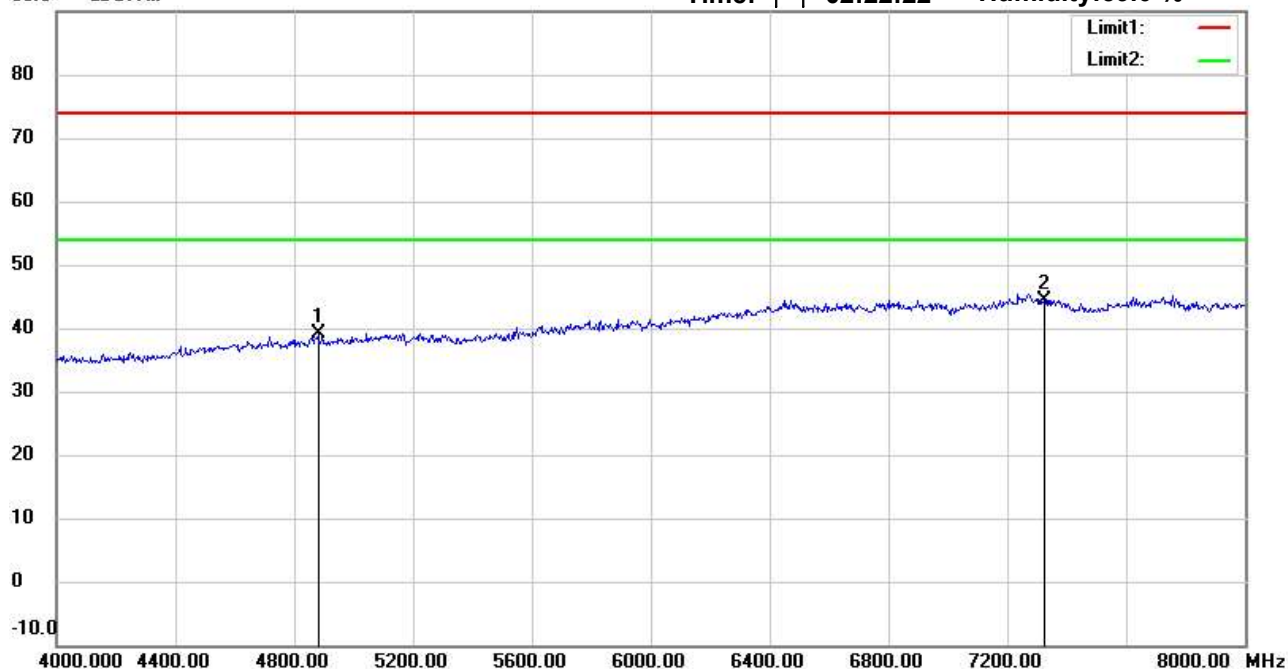

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4882.000	33.89	peak	5.23	39.12	74.00	150	48	-34.88	
*	7323.000	32.72	peak	11.65	44.37	74.00	150	198	-29.63	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #7


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:25:24

Humidity: 59.0 %

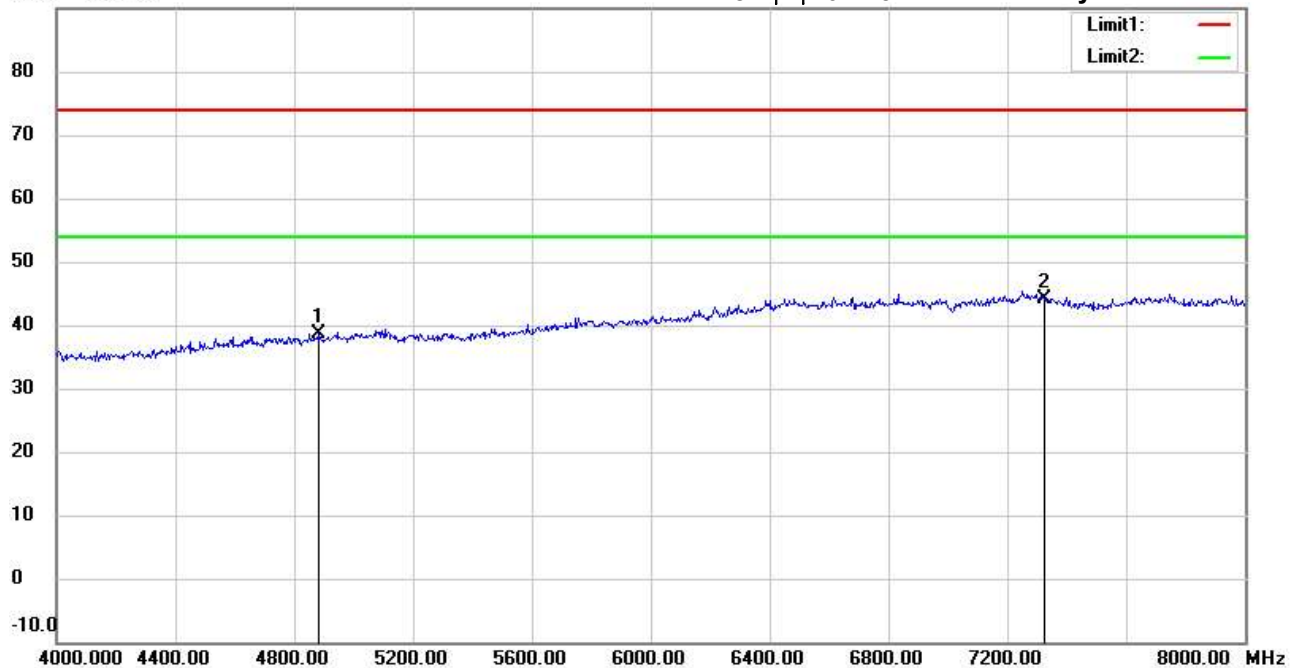

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4882.000	33.28	peak	5.23	38.51	74.00	150	213	-35.49	
*	7323.000	32.54	peak	11.65	44.19	74.00	150	316	-29.81	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:23:17

Humidity: 59.0 %

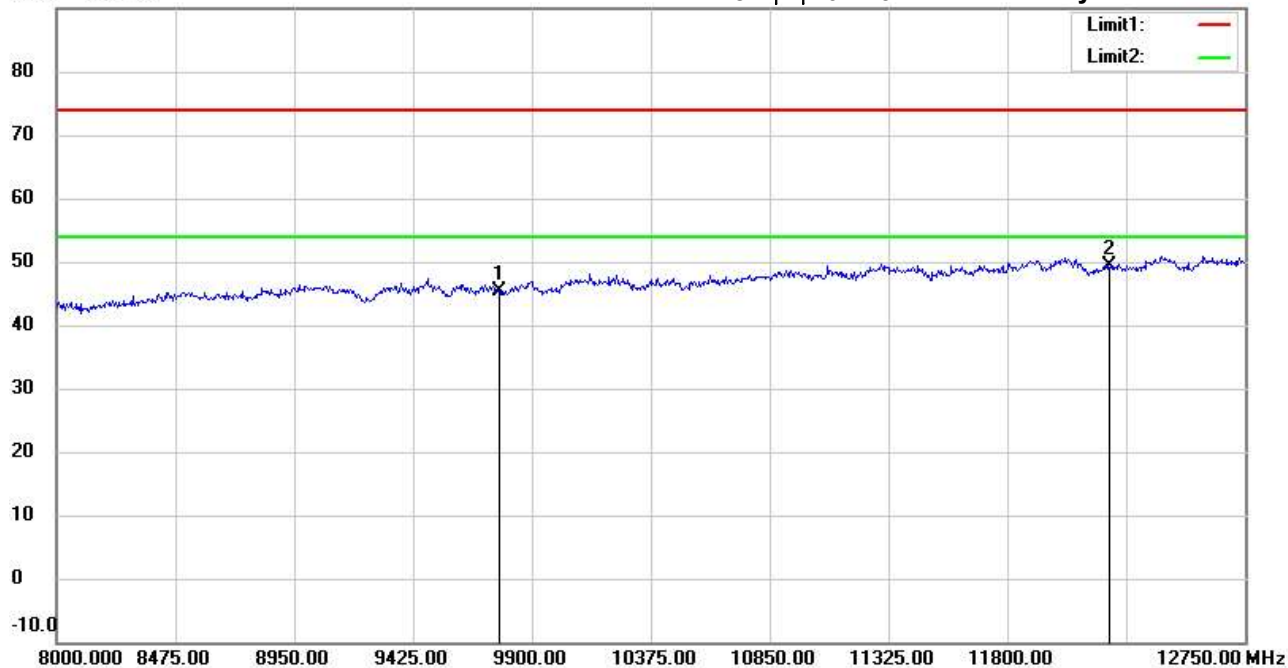

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9764.000	31.66	peak	13.76	45.42	74.00	150	246	-28.58	
*	12205.000	32.32	peak	17.00	49.32	74.00	150	127	-24.68	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:26:11

Humidity: 59.0 %

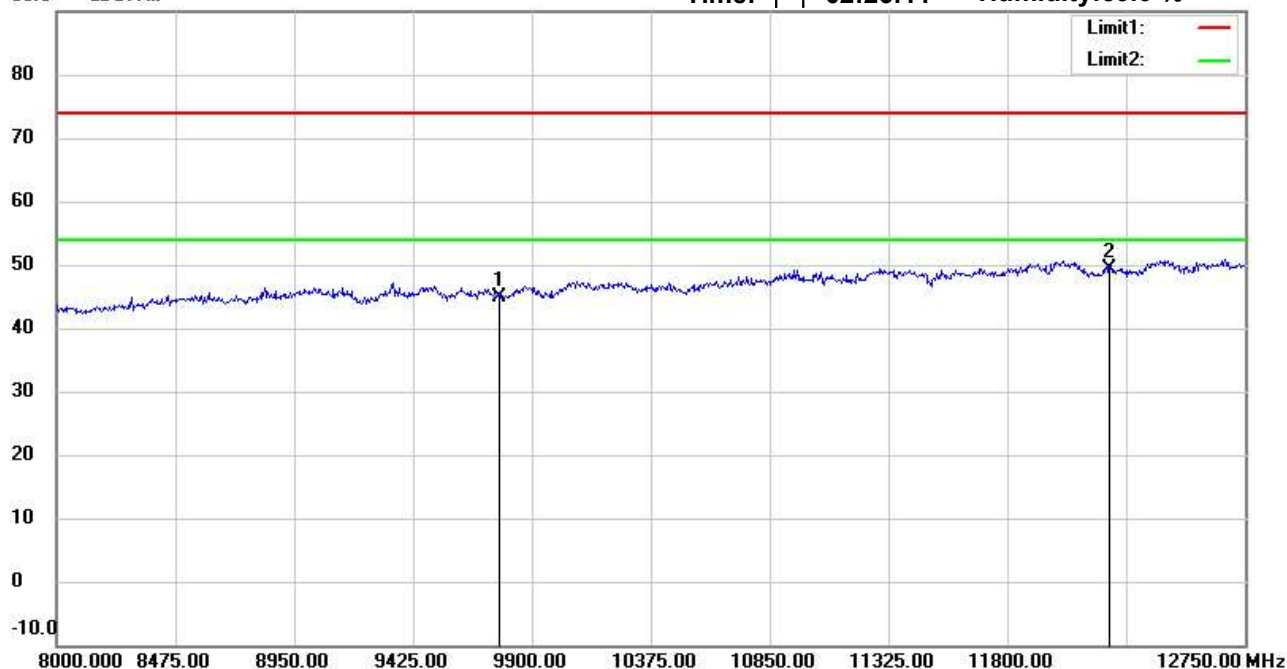

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9764.000	31.20	peak	13.76	44.96	74.00	150	167	-29.04	
*	12205.000	32.27	peak	17.00	49.27	74.00	150	121	-24.73	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:23:33

Humidity:59.0 %

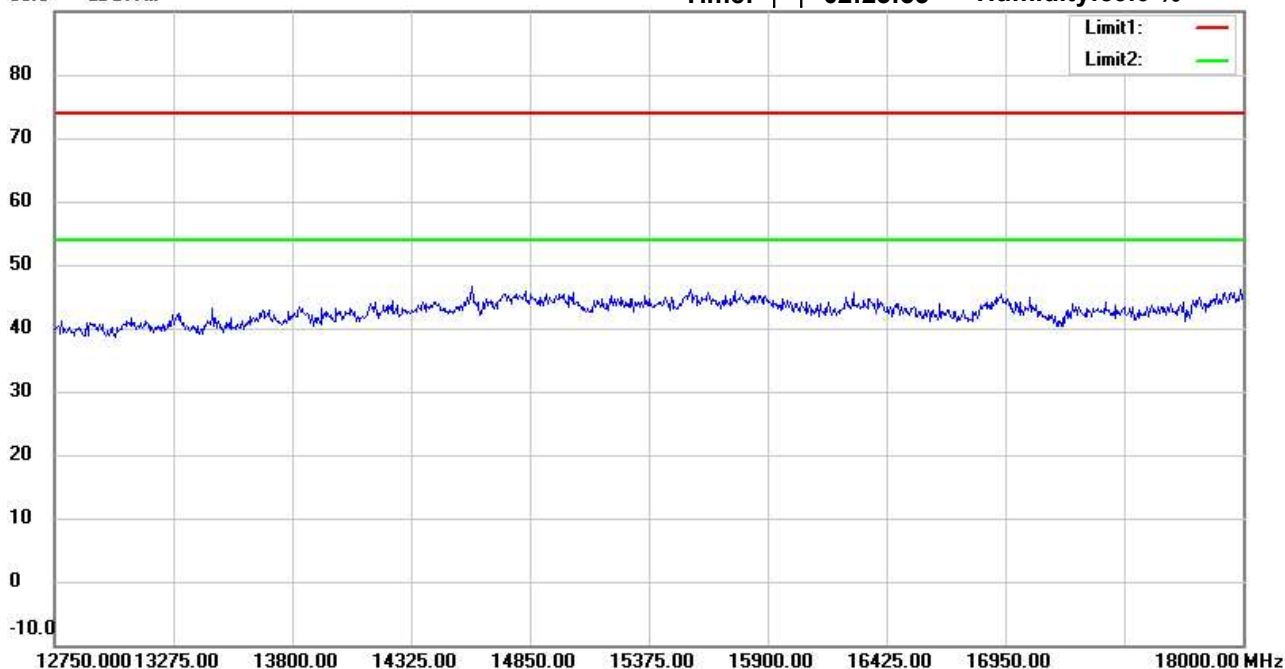

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:26:27

Humidity:59.0 %

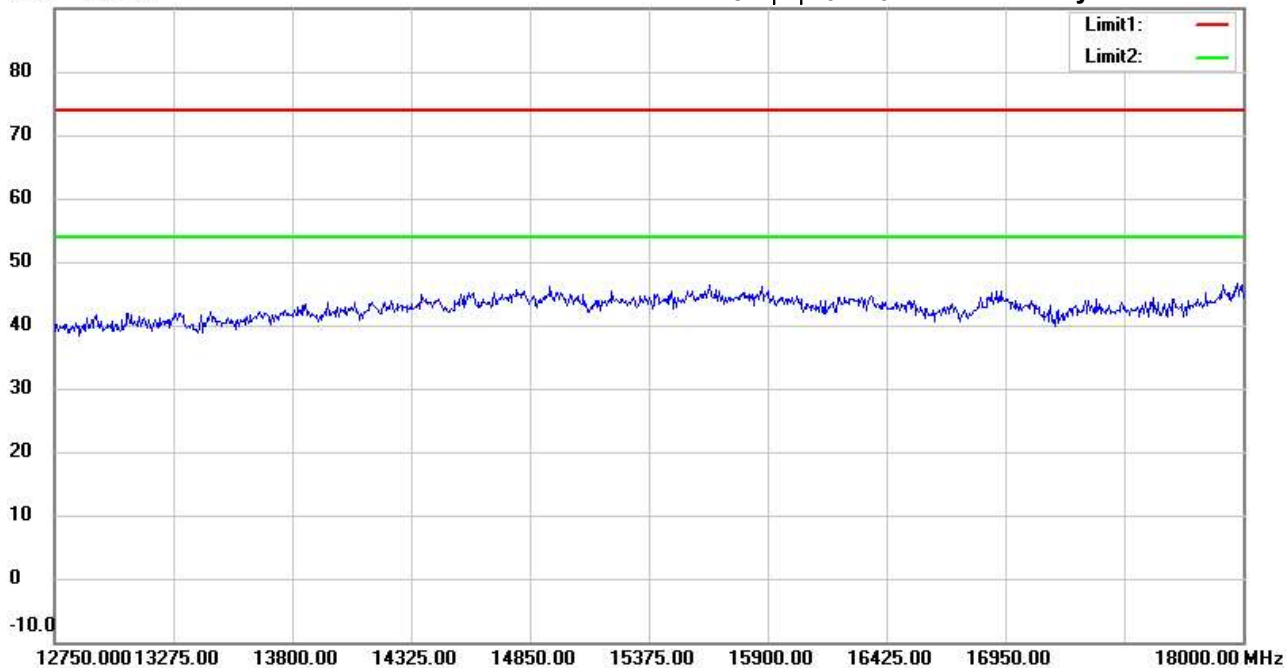

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #5


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:23:44

Humidity: 59.0 %

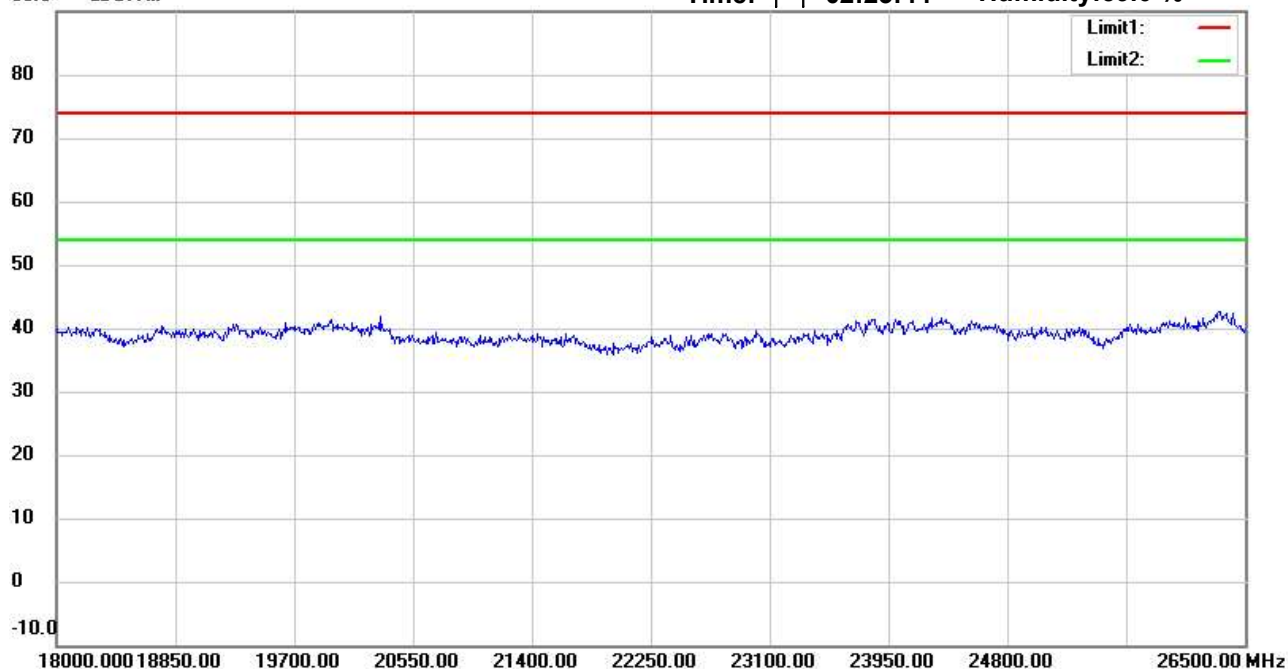

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#10


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:26:38

Humidity:59.0 %

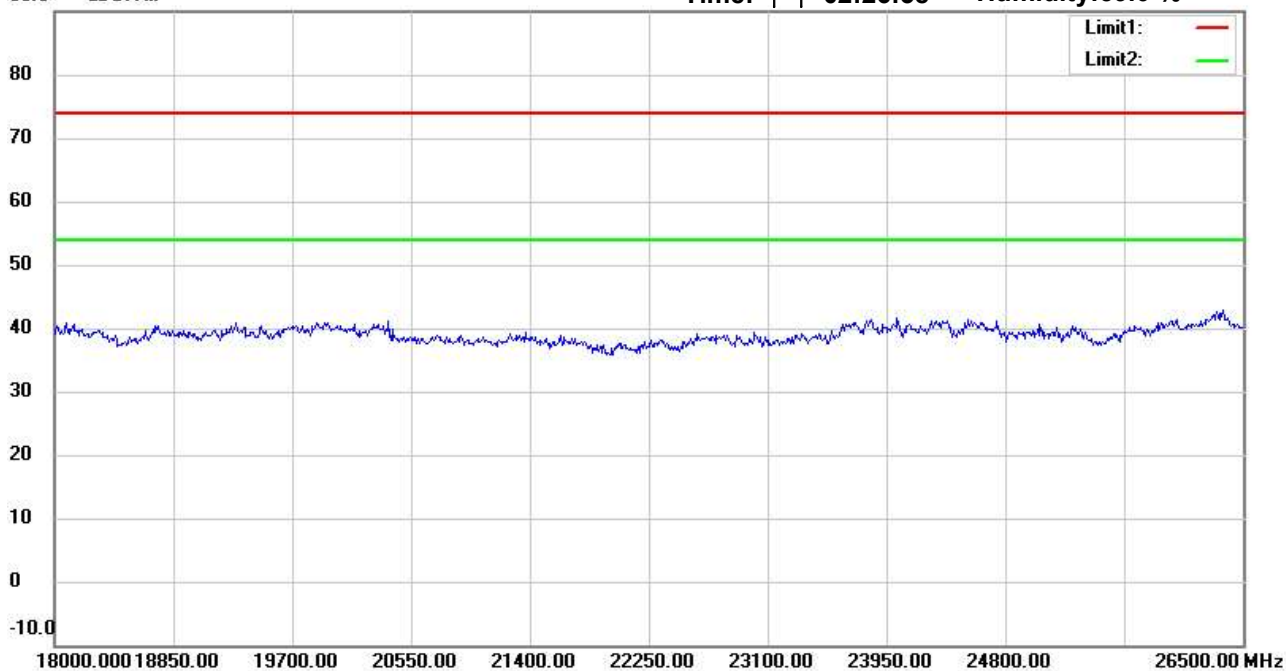

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2441MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:29:19

Humidity:59.0 %

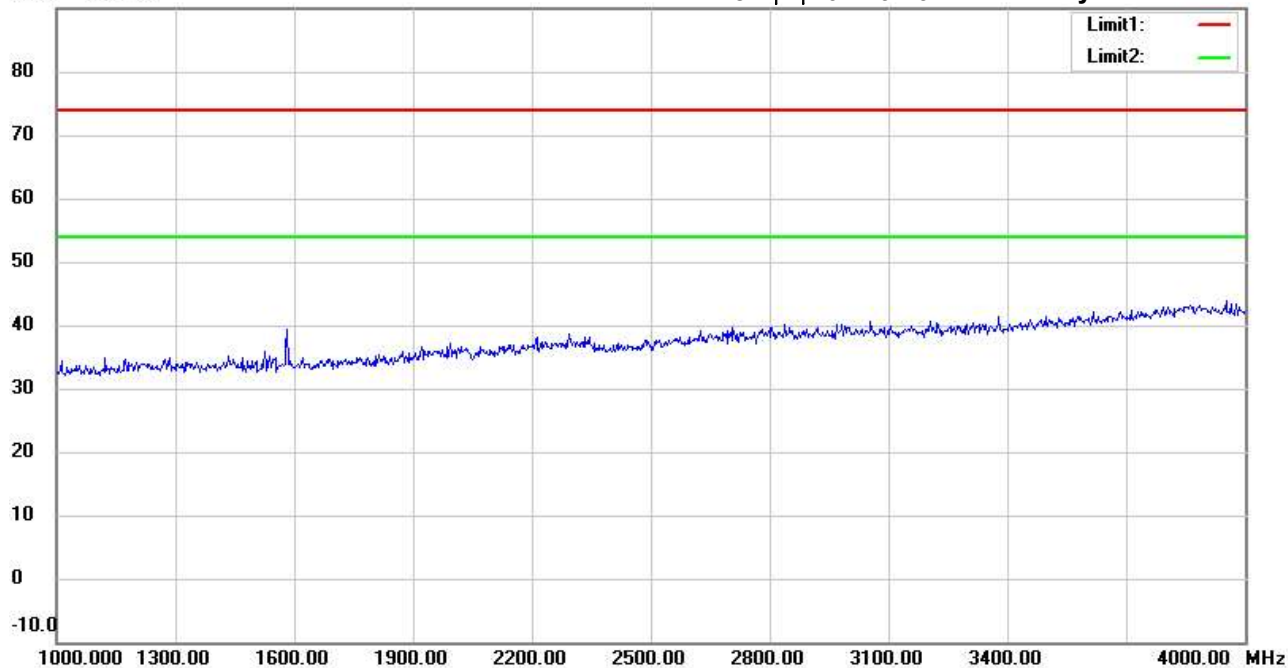

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:32:21

Humidity:59.0 %

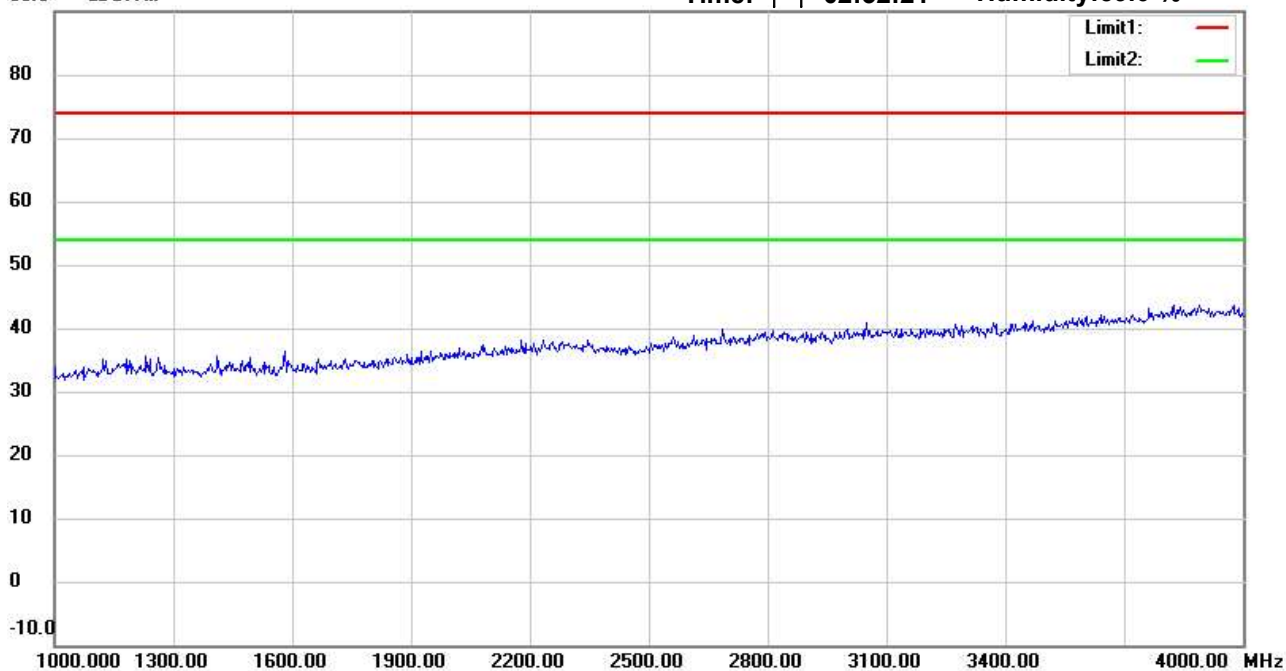

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:30:08

Humidity: 59.0 %

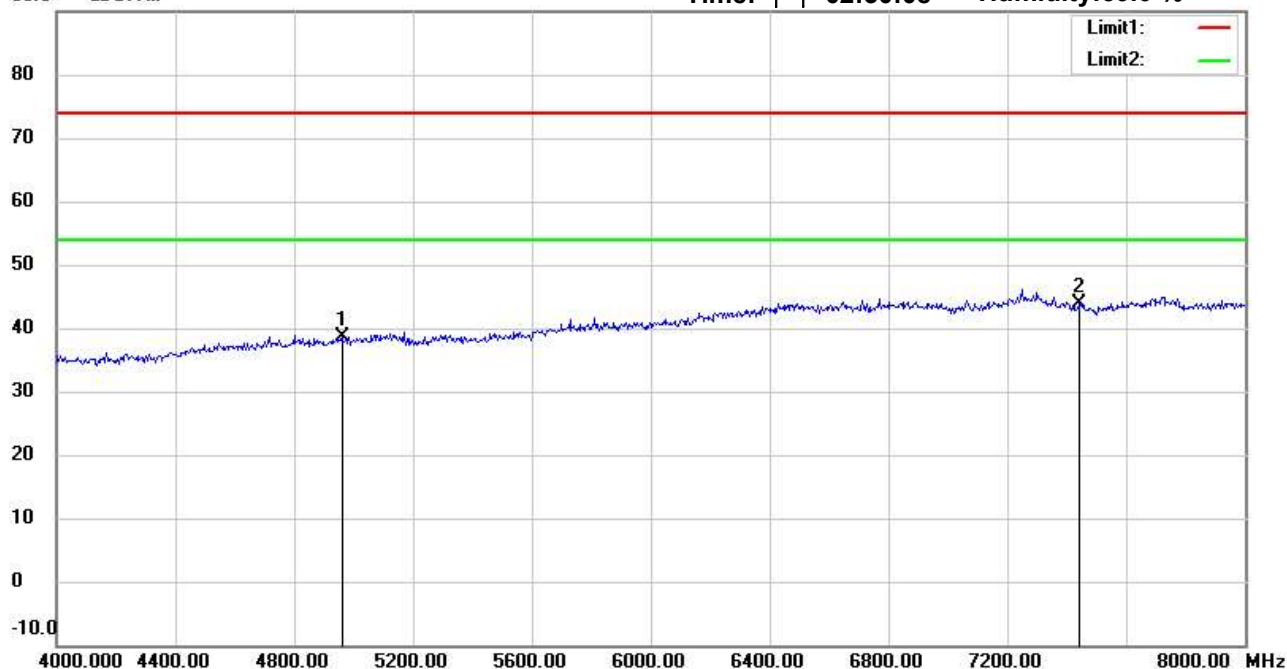

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4960.000	33.00	peak	5.53	38.53	74.00	150	25	-35.47	
*	7440.000	32.35	peak	11.41	43.76	74.00	150	153	-30.24	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 02:33:10

Humidity:59.0 %

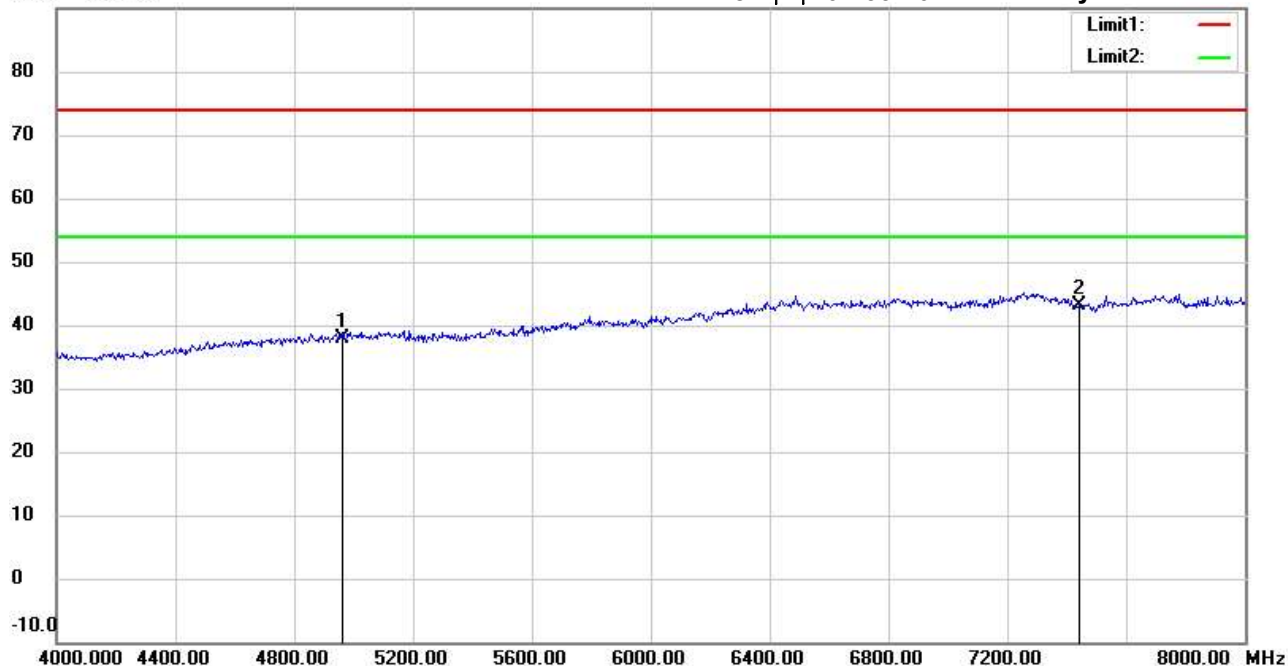

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4960.000	32.39	peak	5.53	37.92	74.00	150	91	-36.08	
*	7440.000	31.66	peak	11.41	43.07	74.00	150	85	-30.93	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:31:03

Humidity: 59.0 %

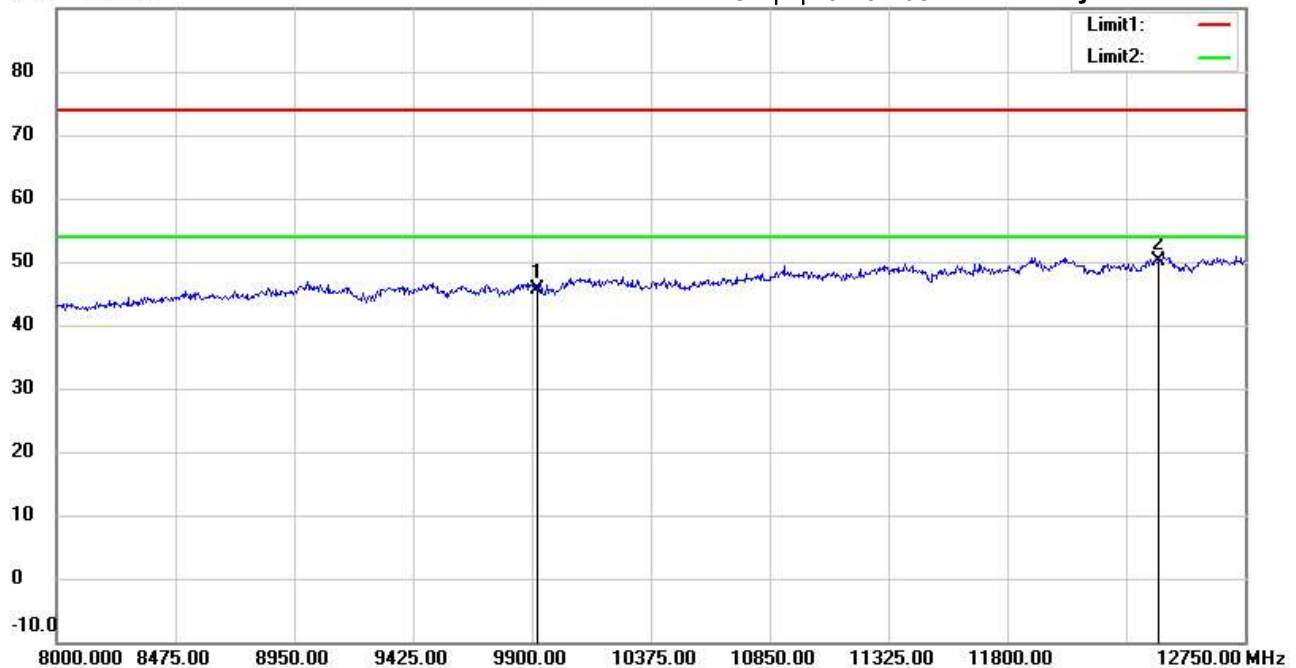

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9920.000	31.60	peak	14.00	45.60	74.00	150	175	-28.40	
*	12400.000	32.61	peak	17.55	50.16	74.00	150	340	-23.84	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 02:33:58

Humidity: 59.0 %

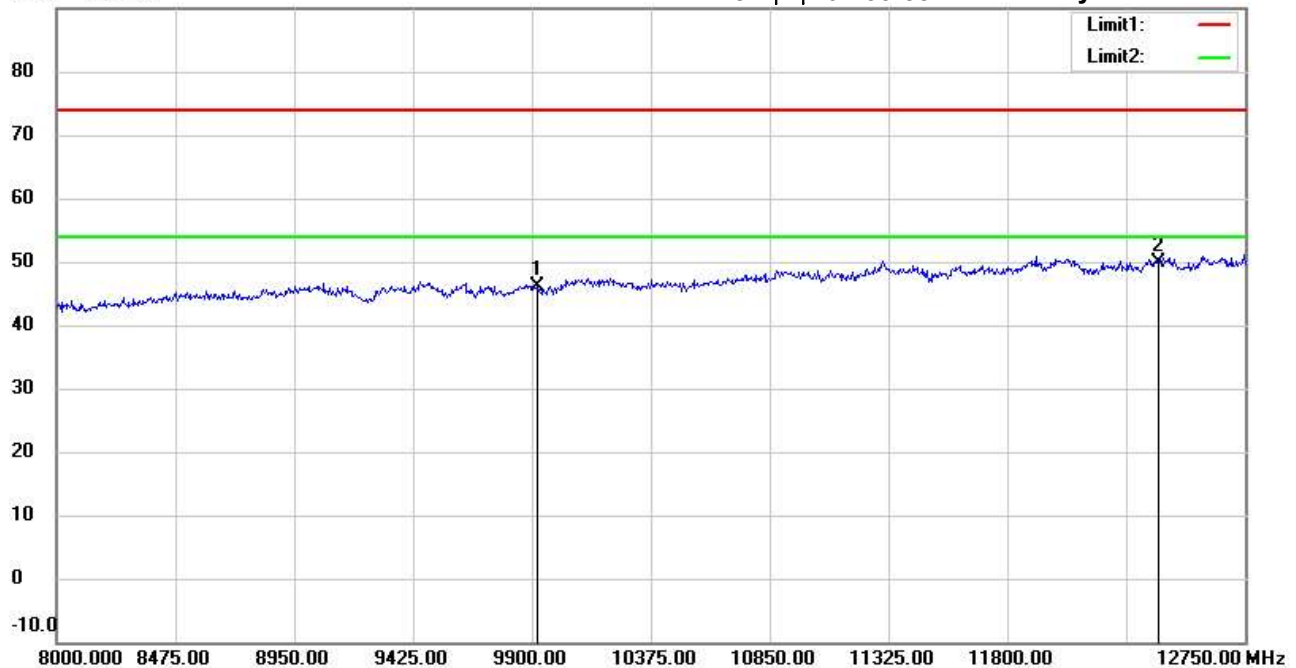

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9920.000	32.06	peak	14.00	46.06	74.00	150	20	-27.94	
*	12400.000	32.41	peak	17.55	49.96	74.00	150	328	-24.04	

*:Maximum data x:Over limit !:over margin