



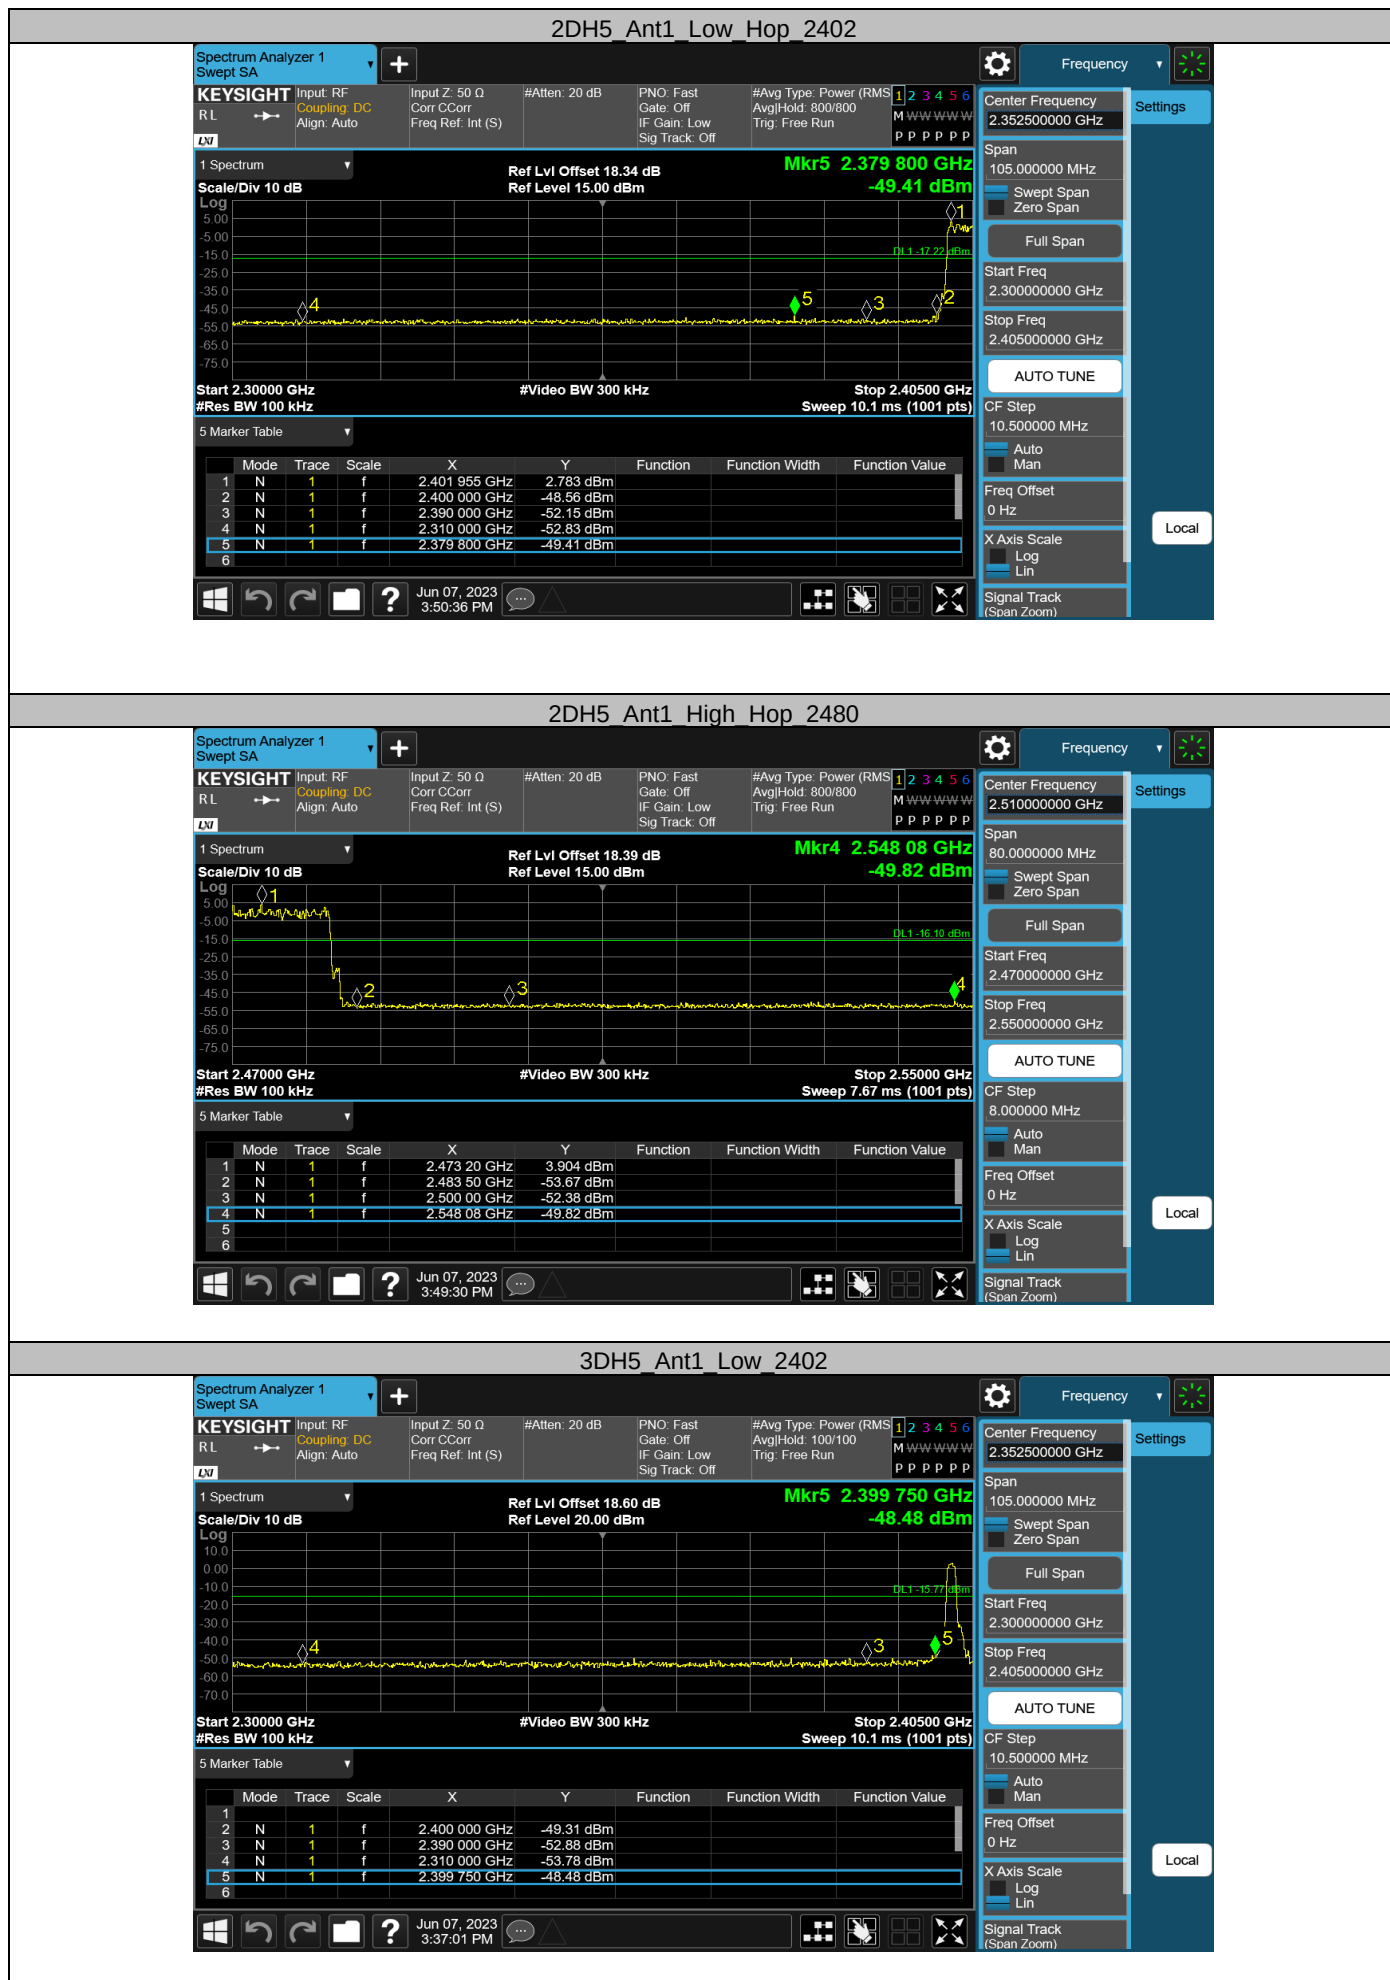


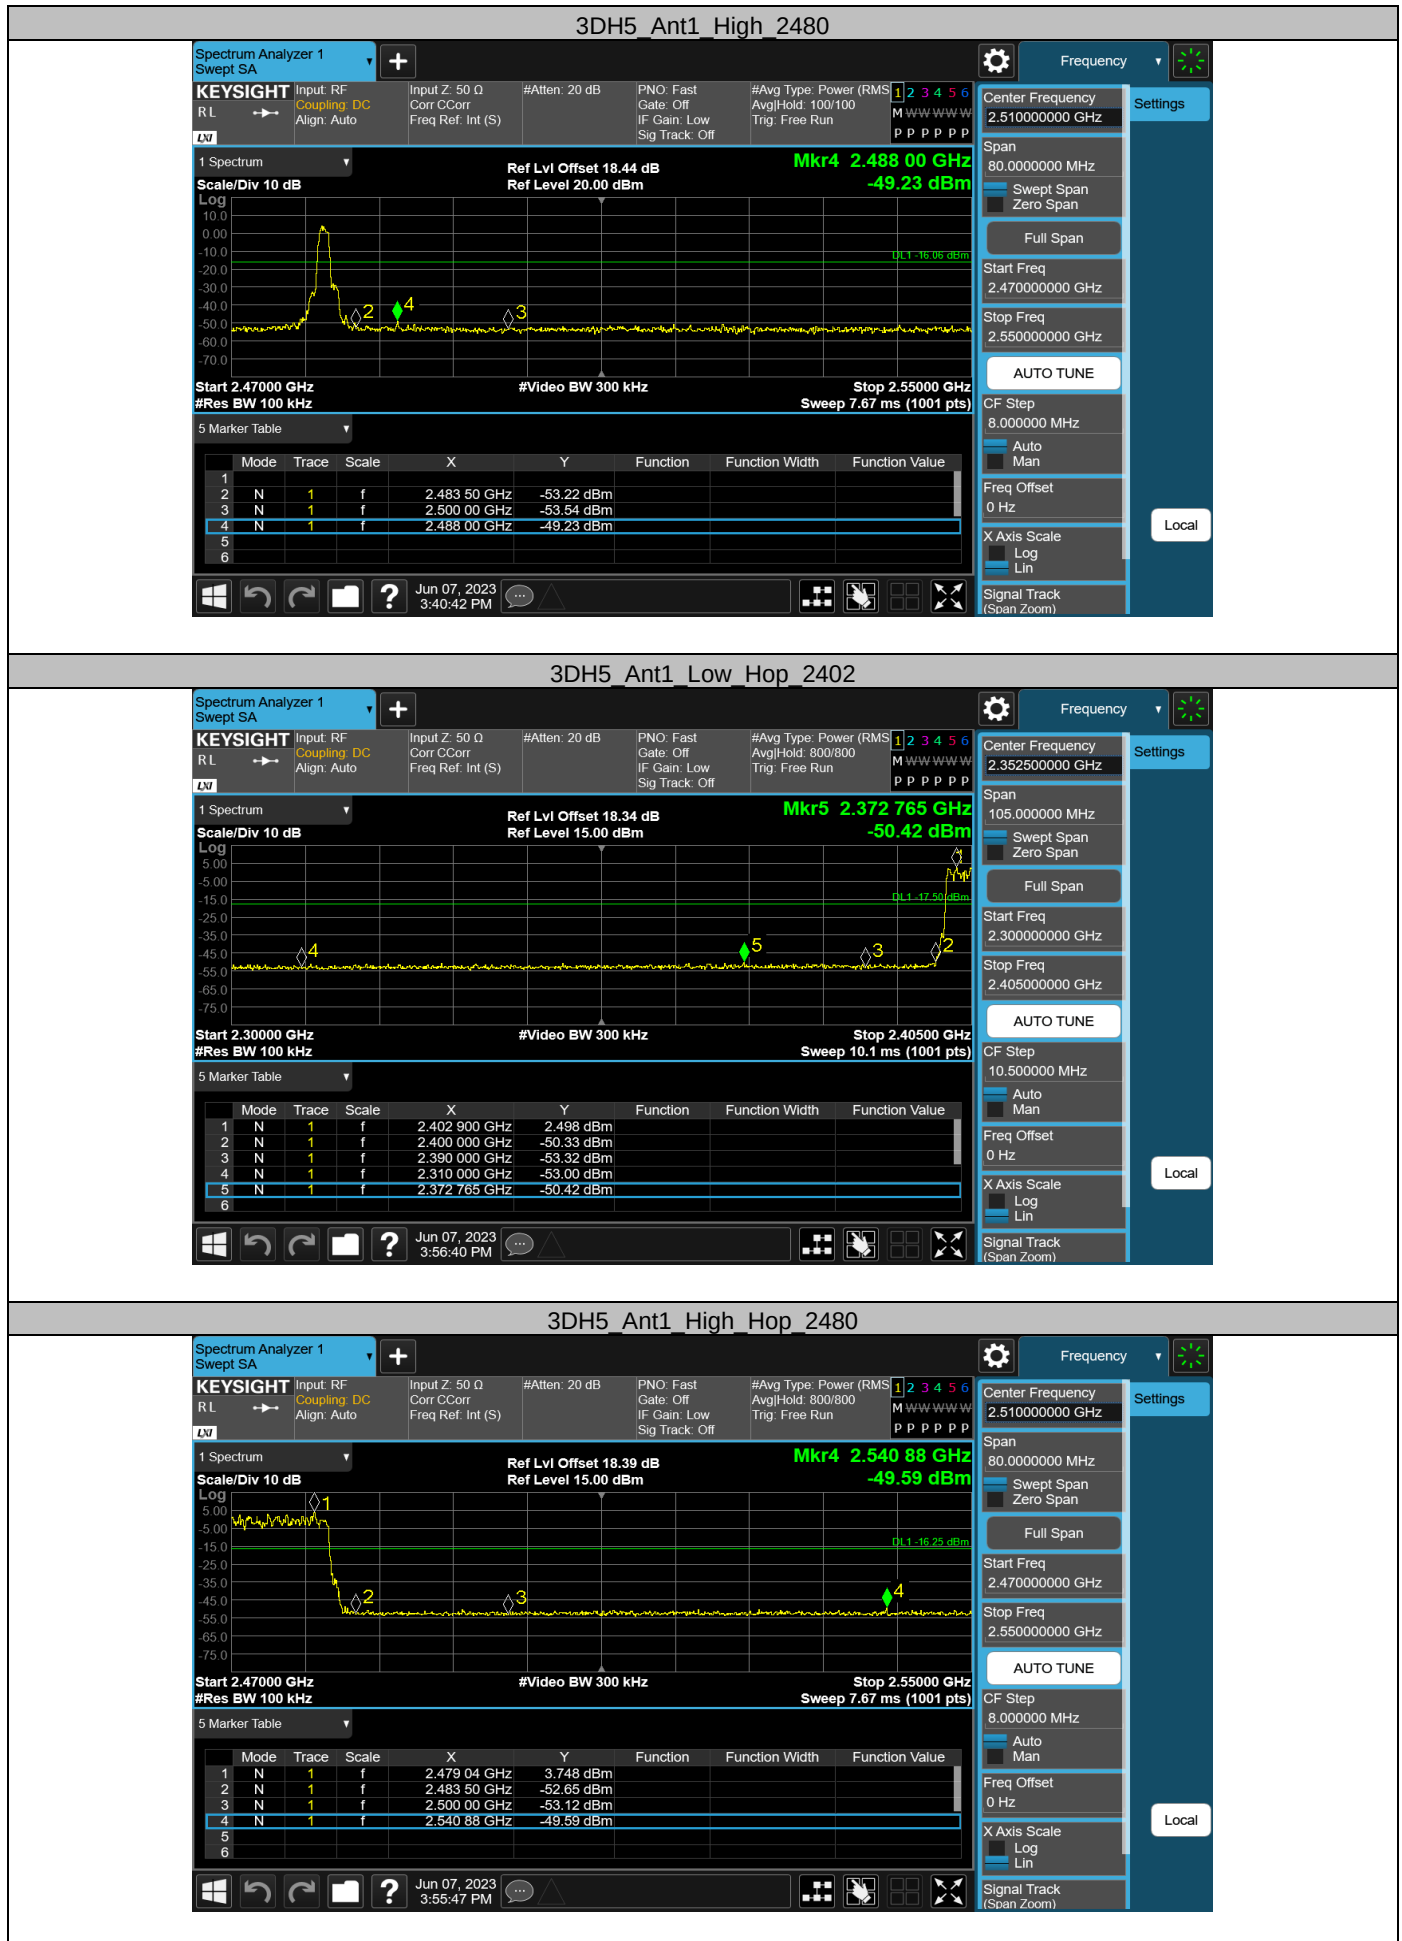



Appendix H: Conducted Spurious Emission Test Result

Test Mode	Antenna	Freq(MHz)	Freq Range [MHz]	Ref Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	30~26500	8.43	-41.63	≤ -11.57	PASS
		2441	30~26500	7.89	-42.31	≤ -12.11	PASS
		2480	30~26500	8.21	-41.9	≤ -11.79	PASS
2DH5	Ant1	2402	30~26500	2.93	-41.99	≤ -17.07	PASS
		2441	30~26500	1.72	-42.39	≤ -18.28	PASS
		2480	30~26500	3.04	-42.89	≤ -16.96	PASS
3DH5	Ant1	2402	30~26500	4.23	-42.55	≤ -15.77	PASS
		2441	30~26500	3.85	-42.64	≤ -16.15	PASS
		2480	30~26500	3.94	-42.44	≤ -16.06	PASS

Test Graphs

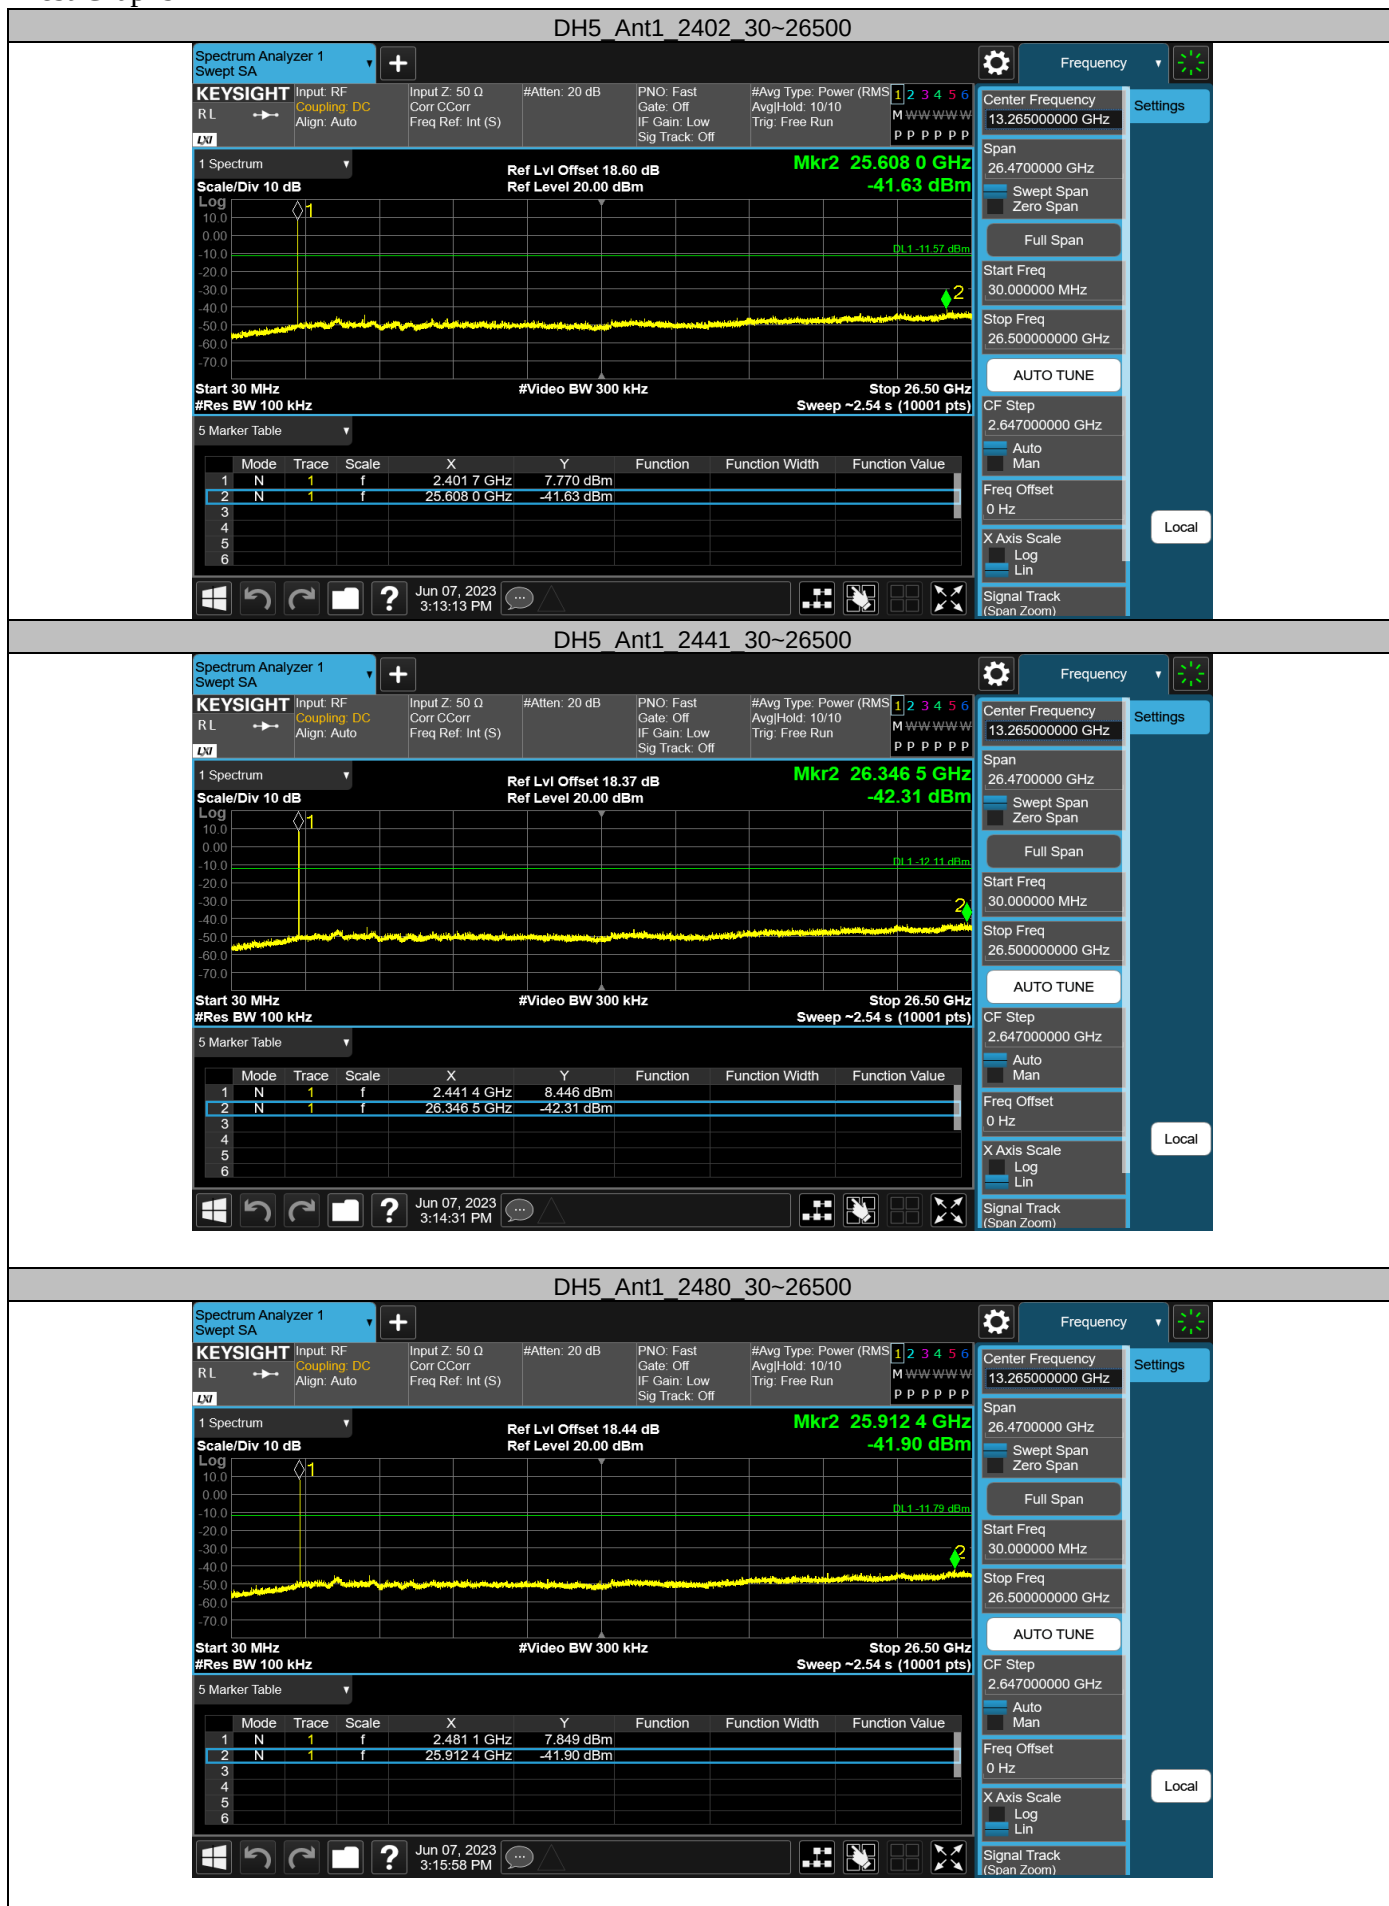


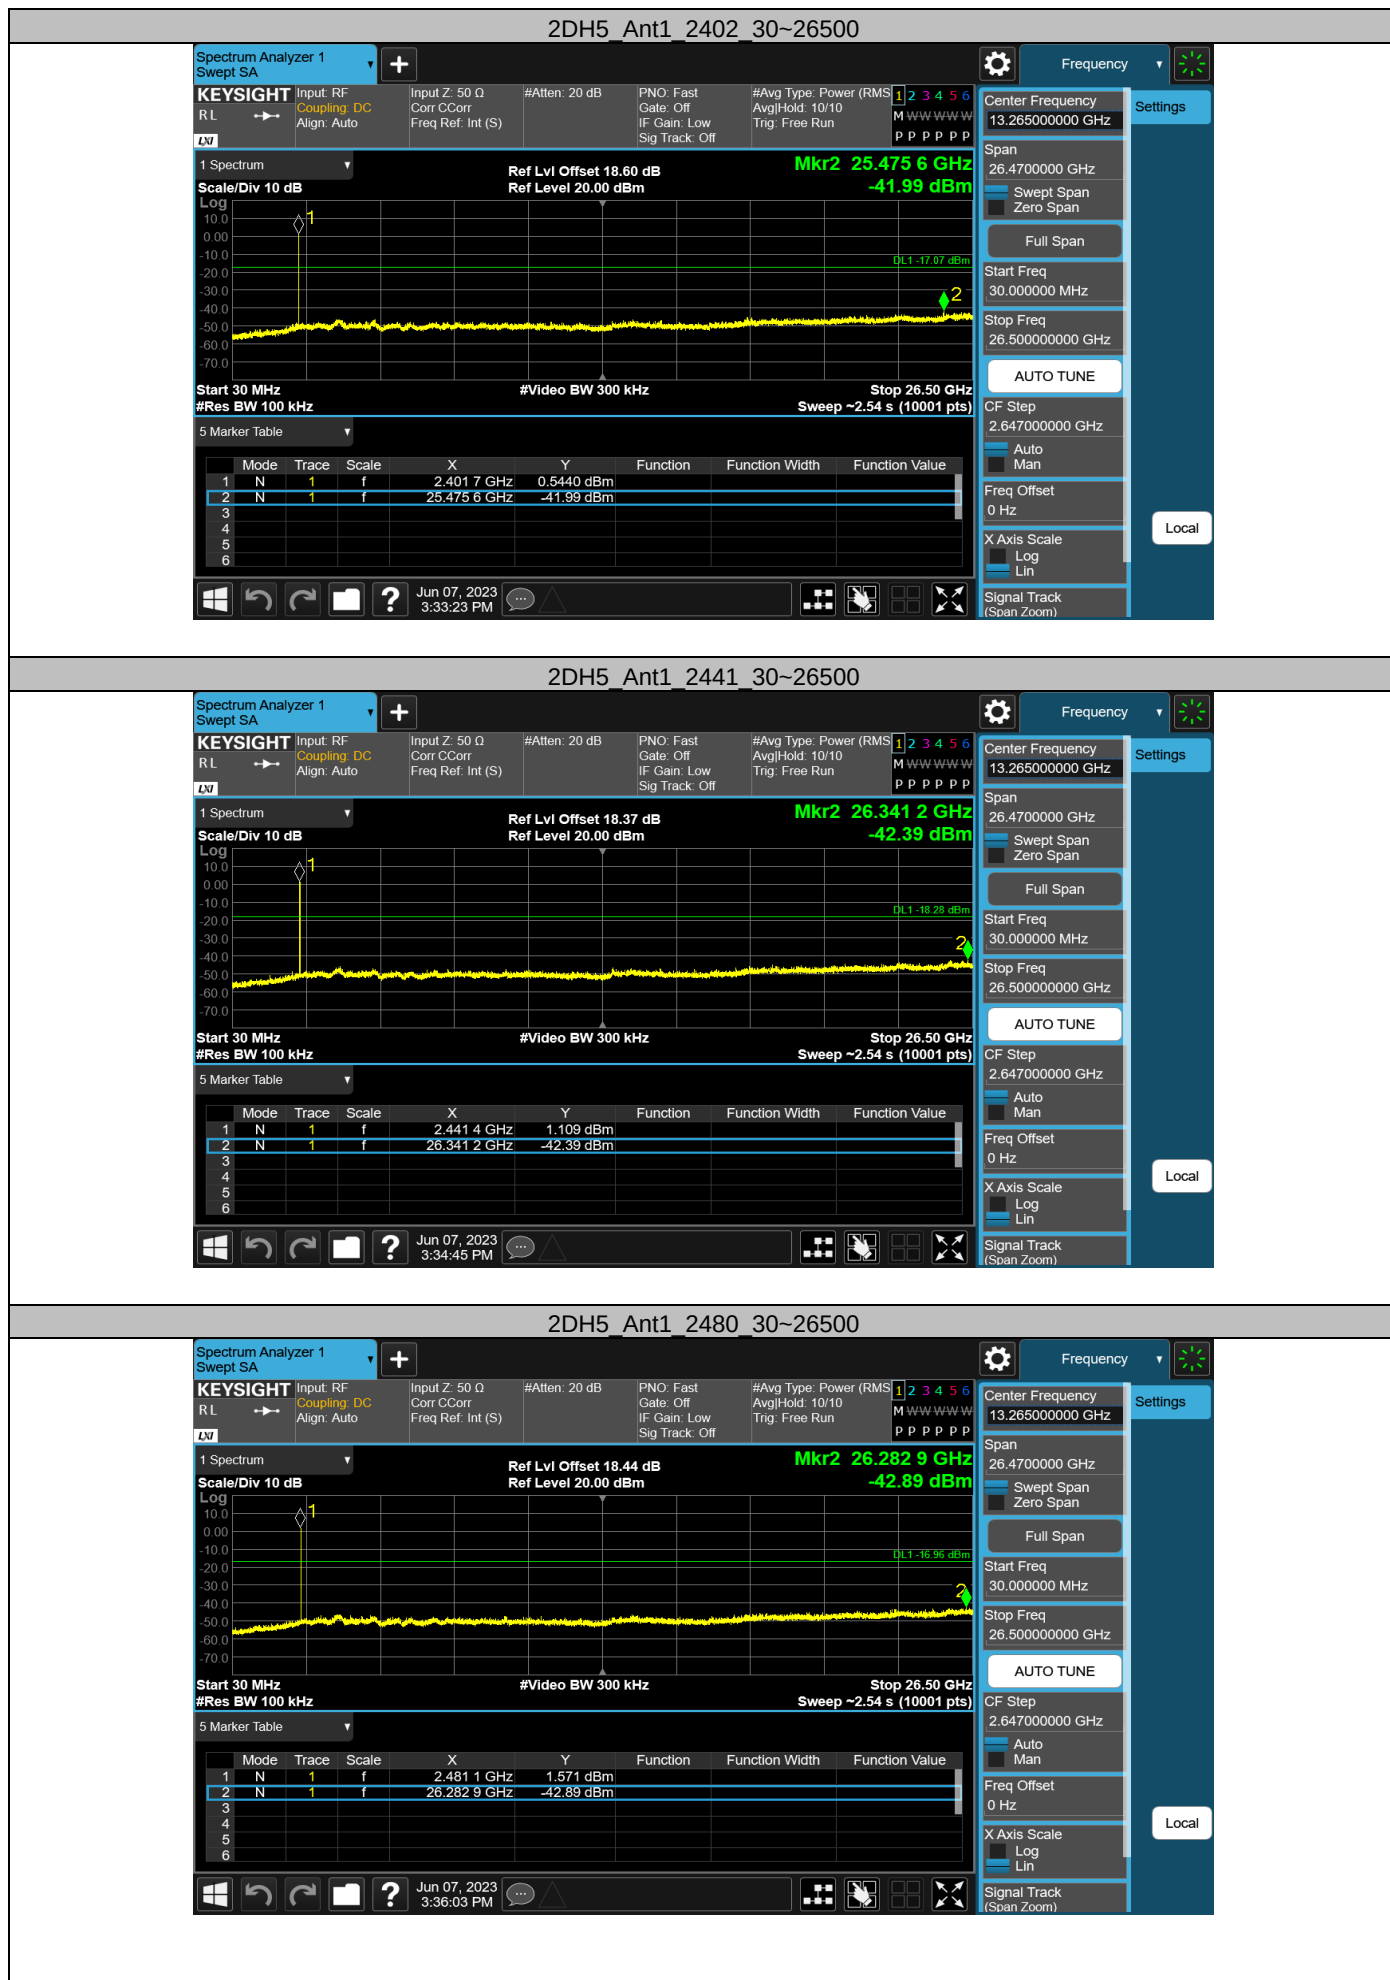

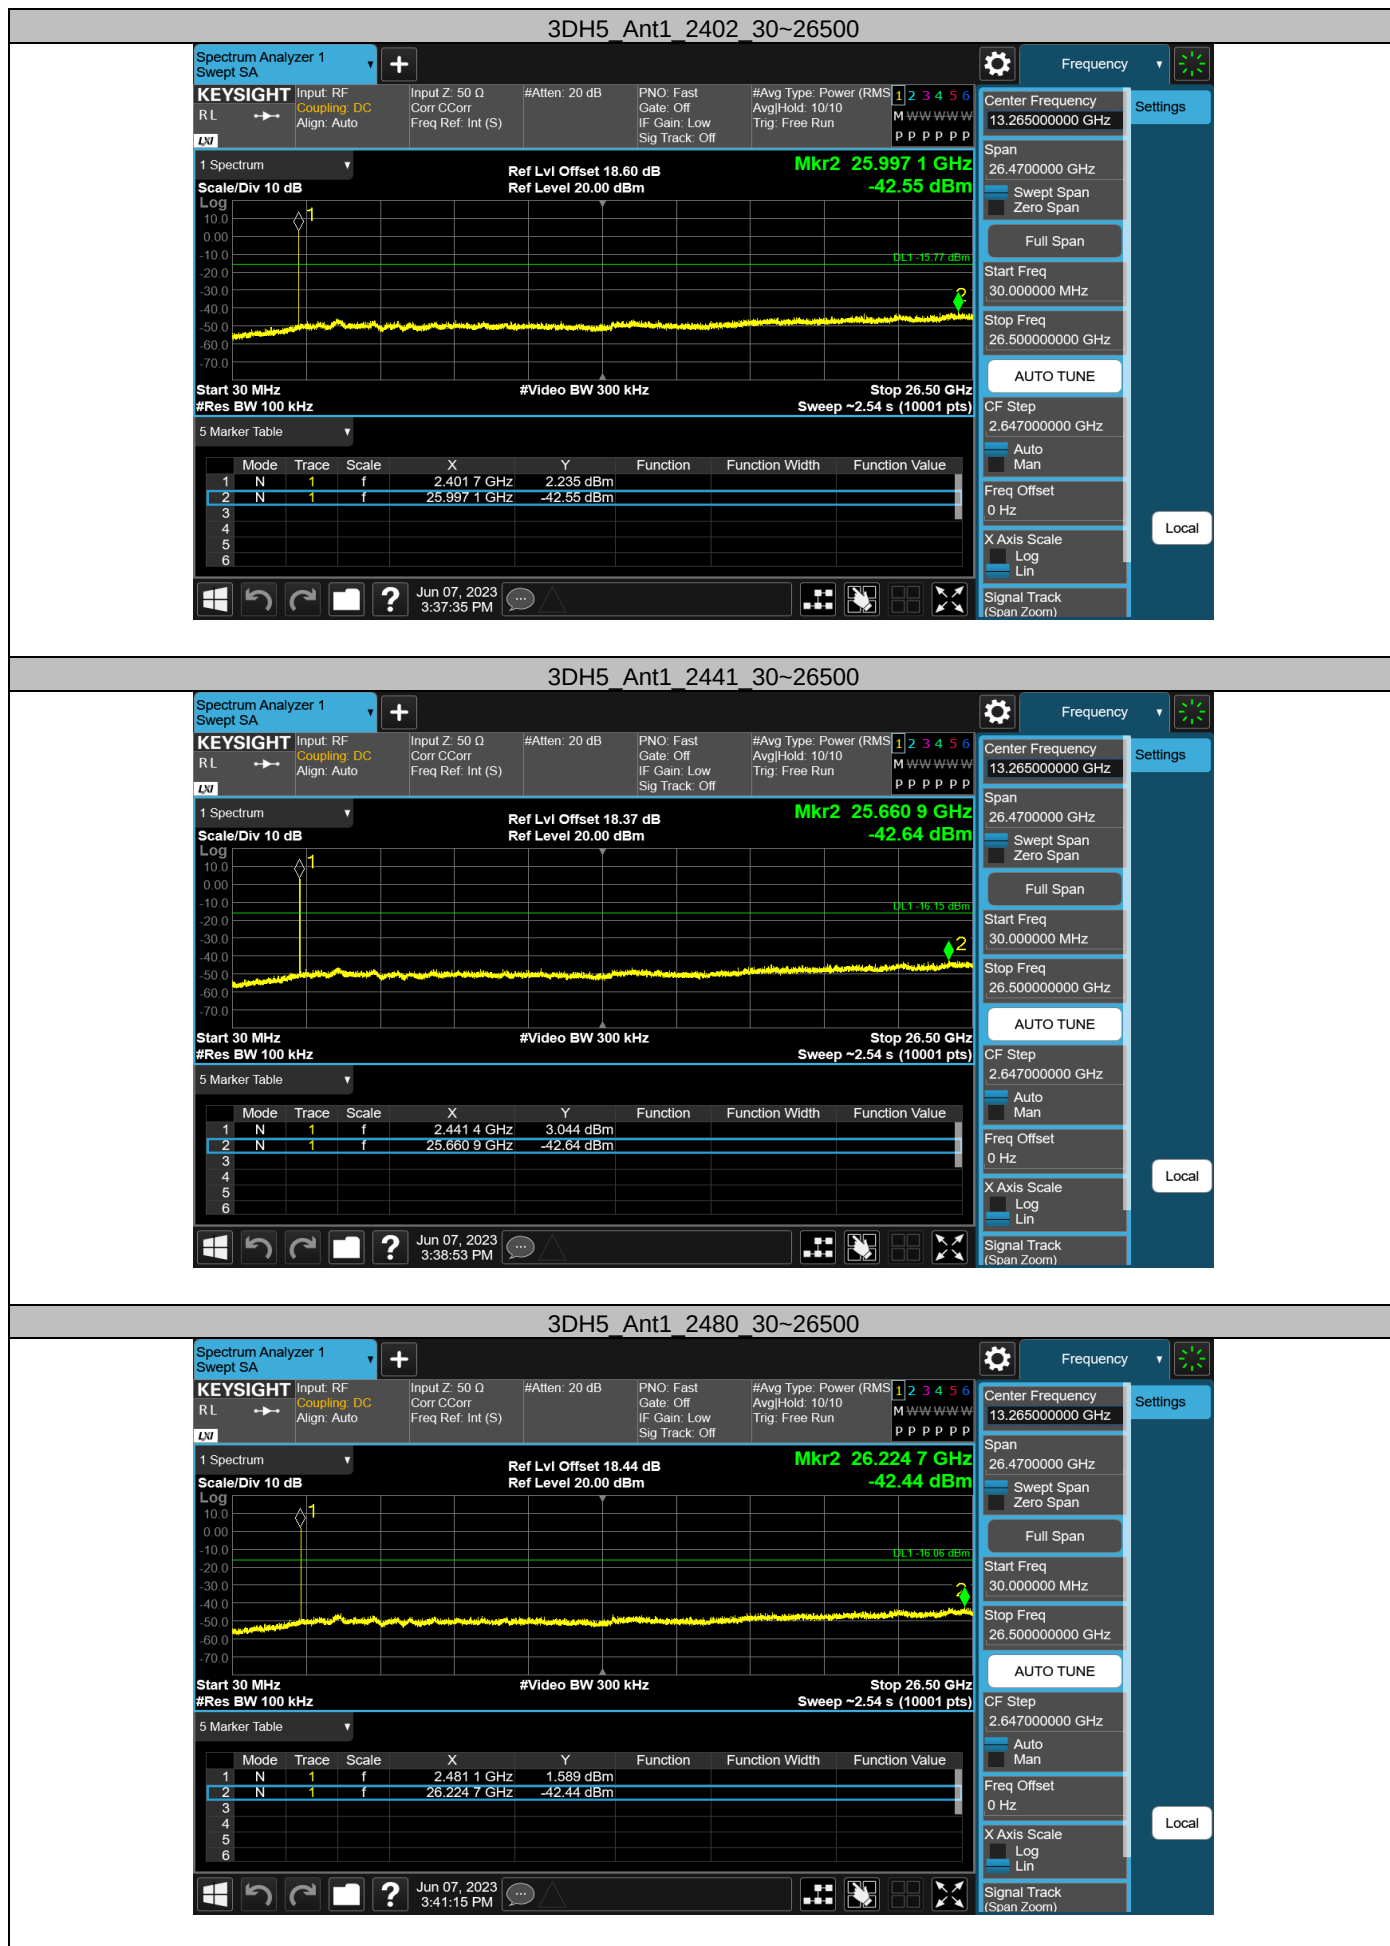


14. TEST SETUP PHOTO


Conducted Test

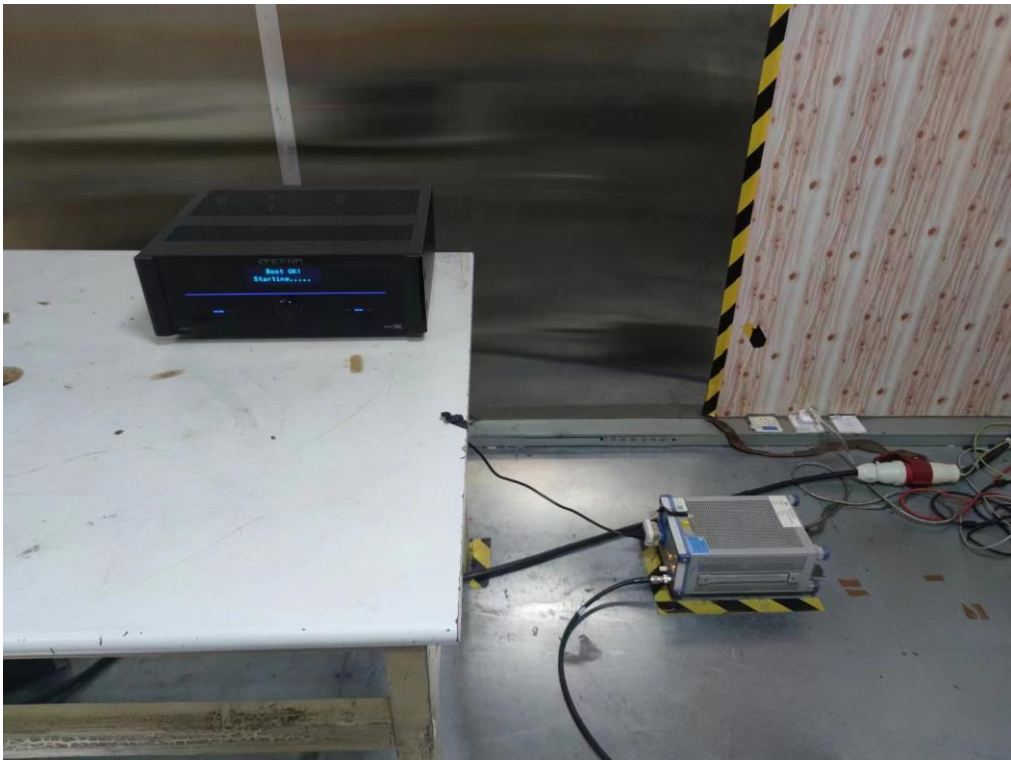

Radiated Test (Below 1GHz)

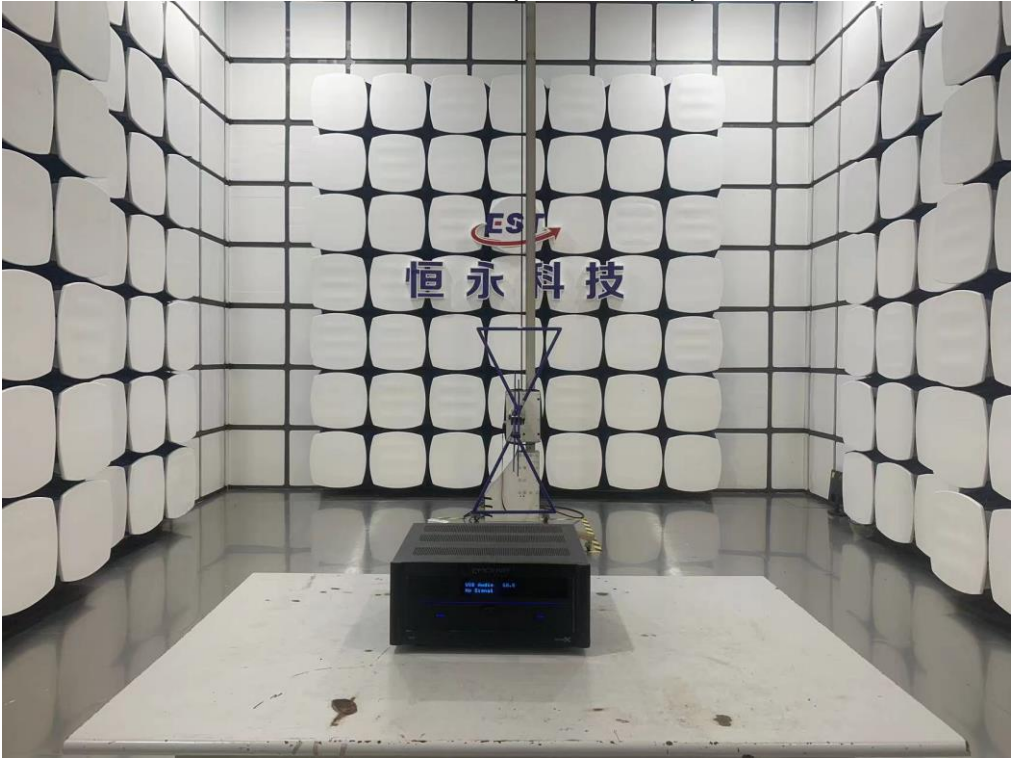

Radiated Test (Above 1GHz)


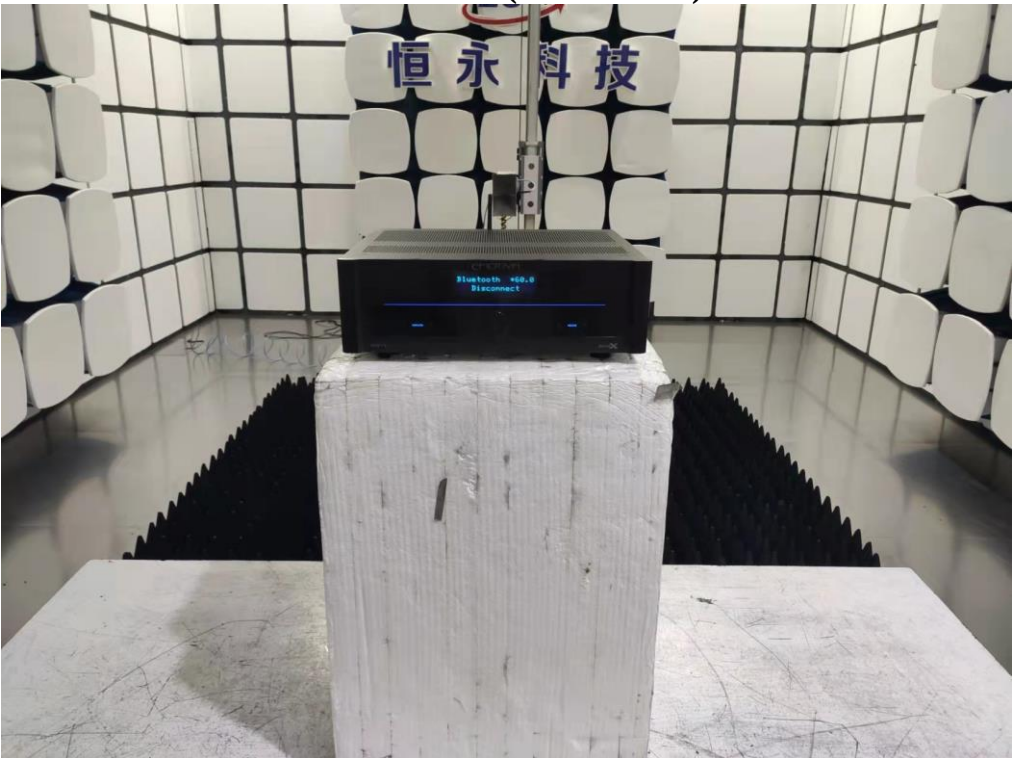


15. EUT PHOTO


External Photos
M/N: BASX MR1L



External Photos
M/N: BASX MR1L

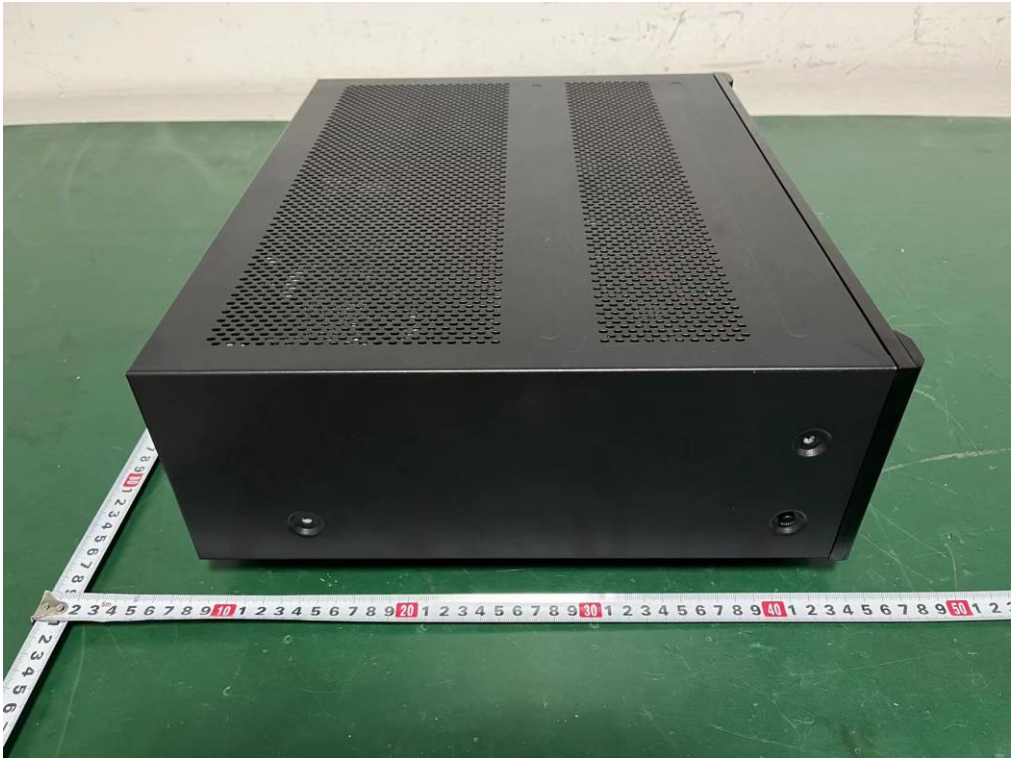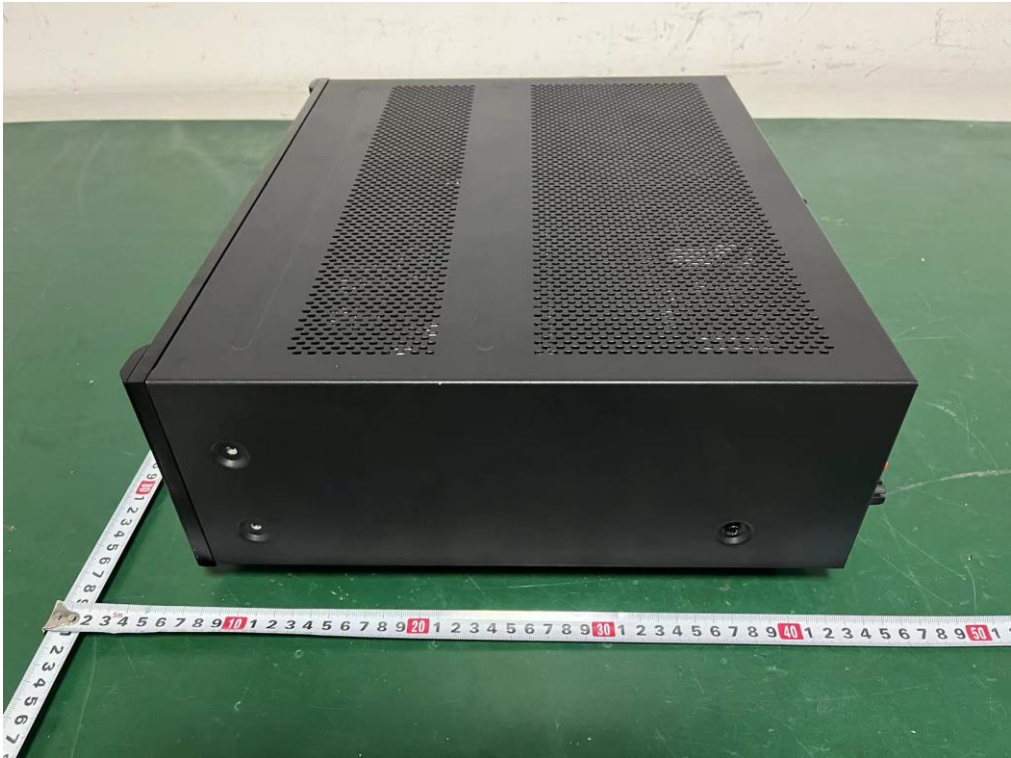

External Photos
M/N: BASX MR1L

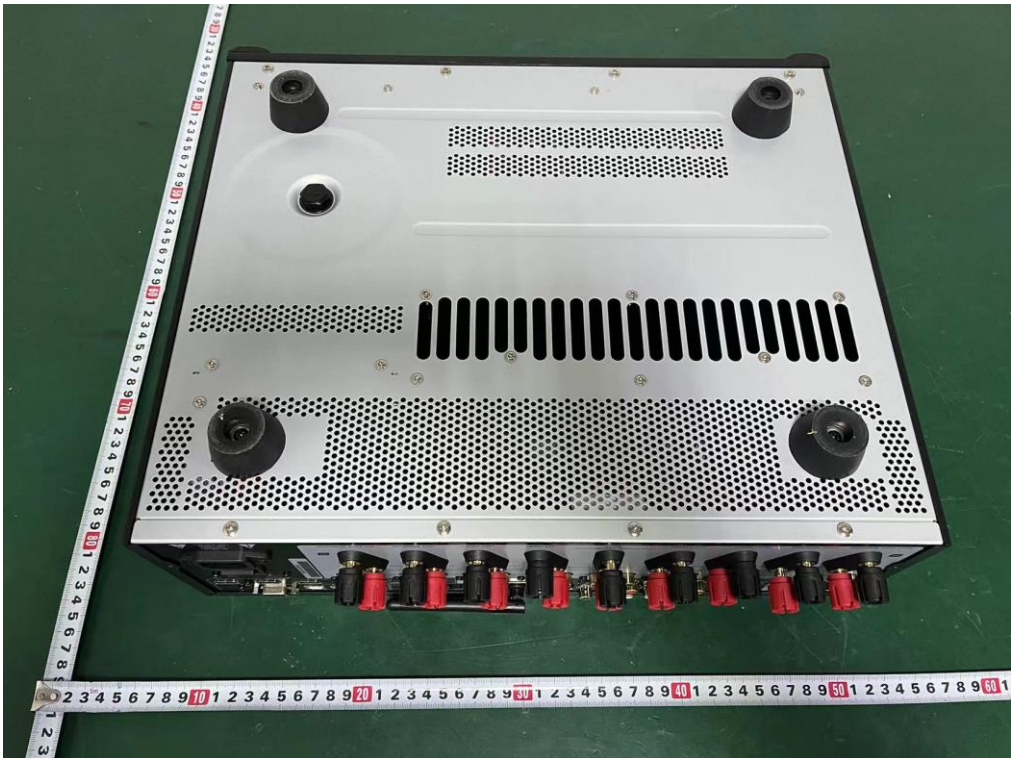



External Photos
M/N: BASX MR1L





Bluetooth
Antenna





Internal Photos
M/N: BASX MR1L

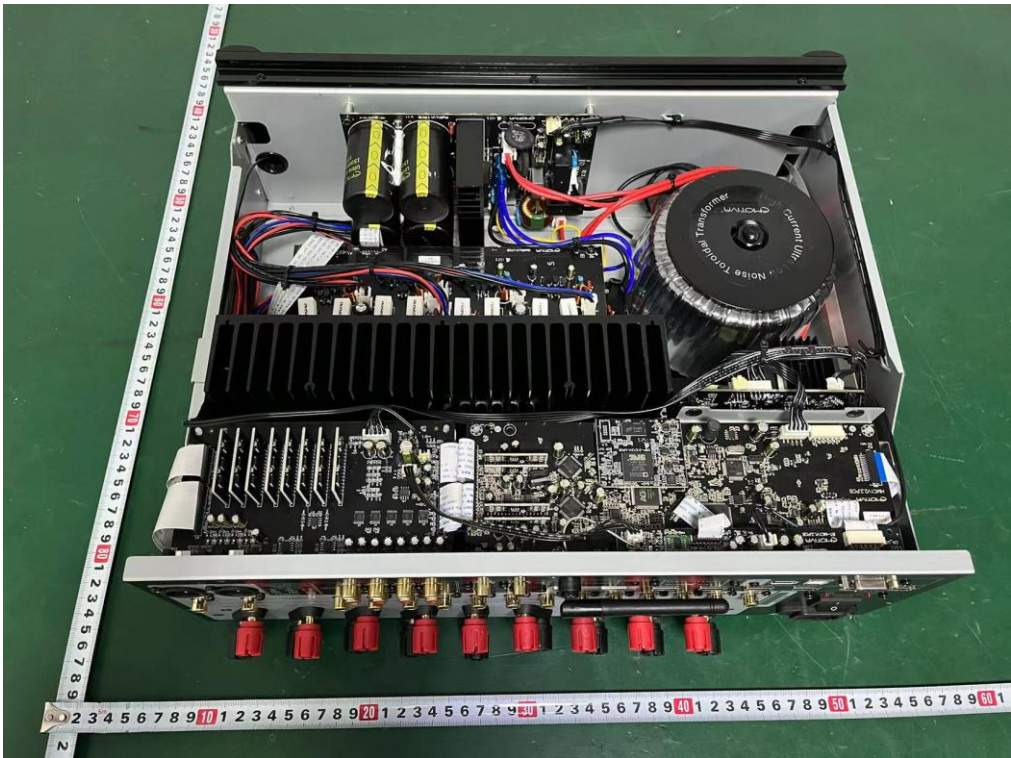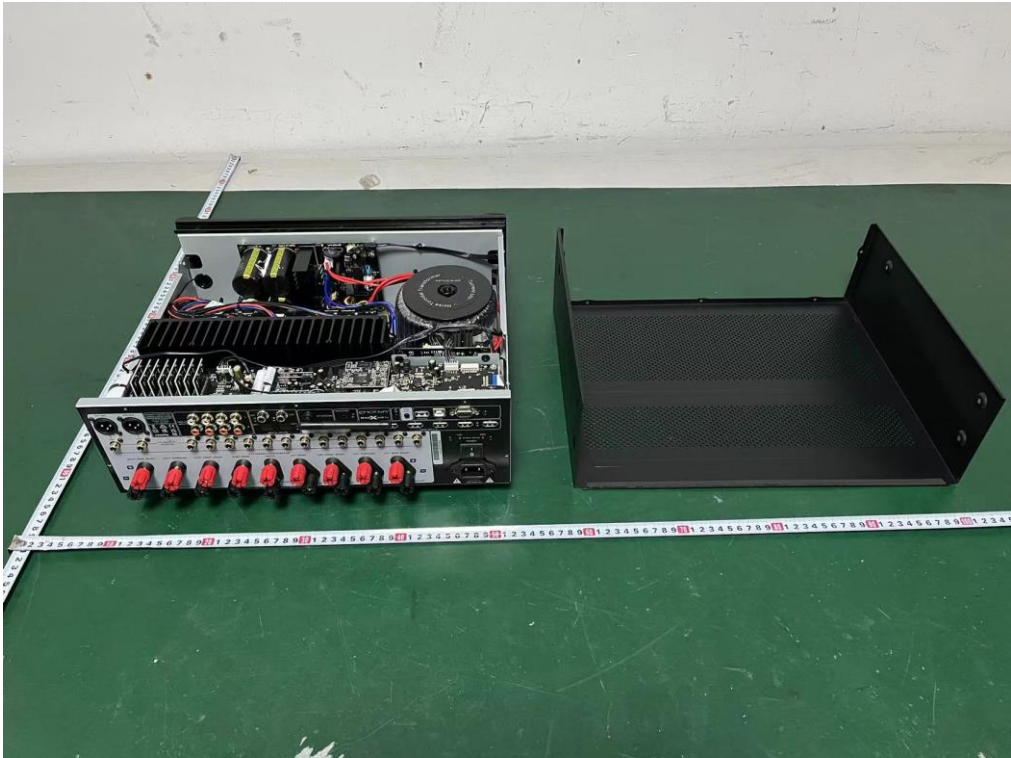



Internal Photos
M/N: BASX MR1L

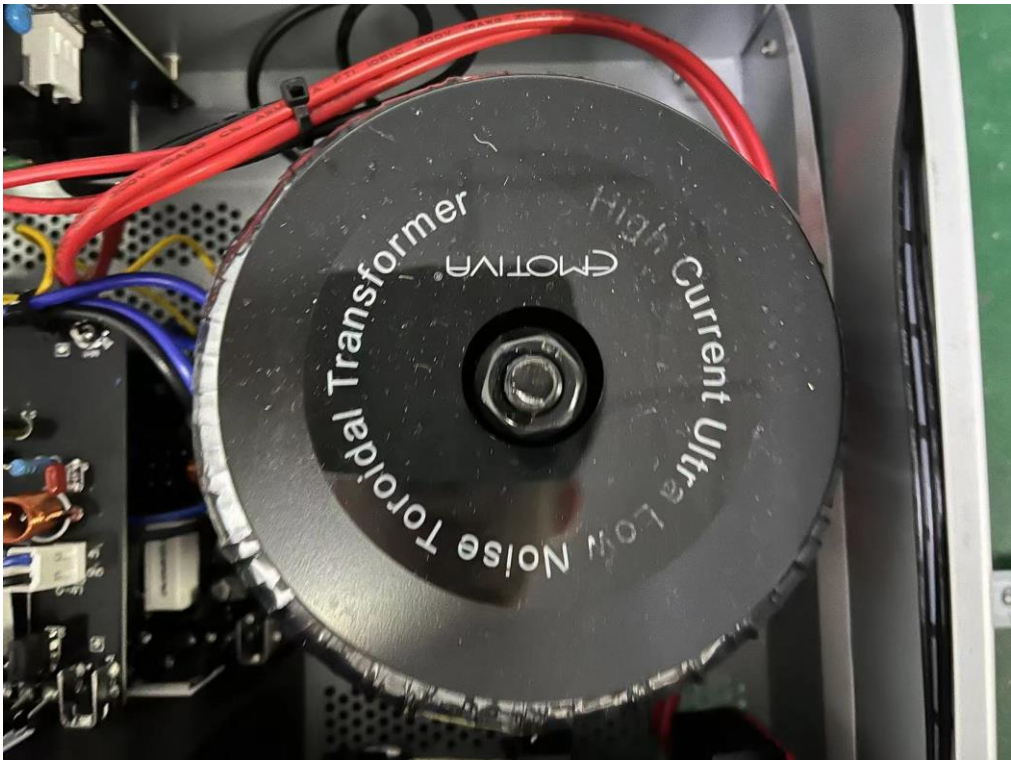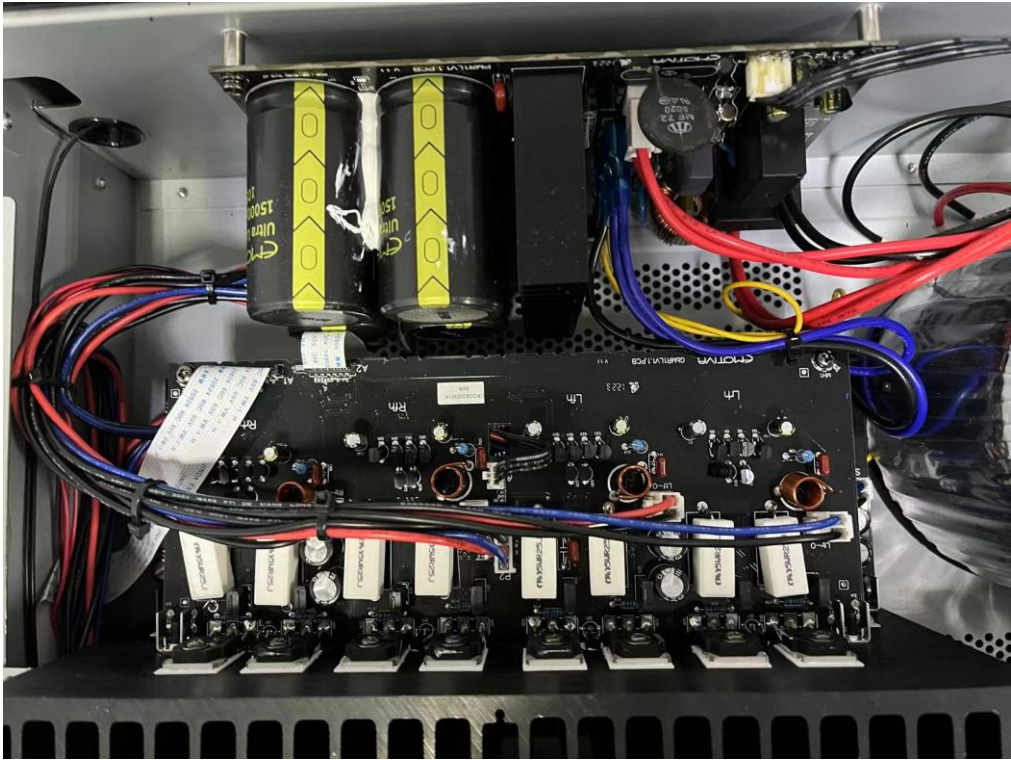



Internal Photos
M/N: BASX MR1L

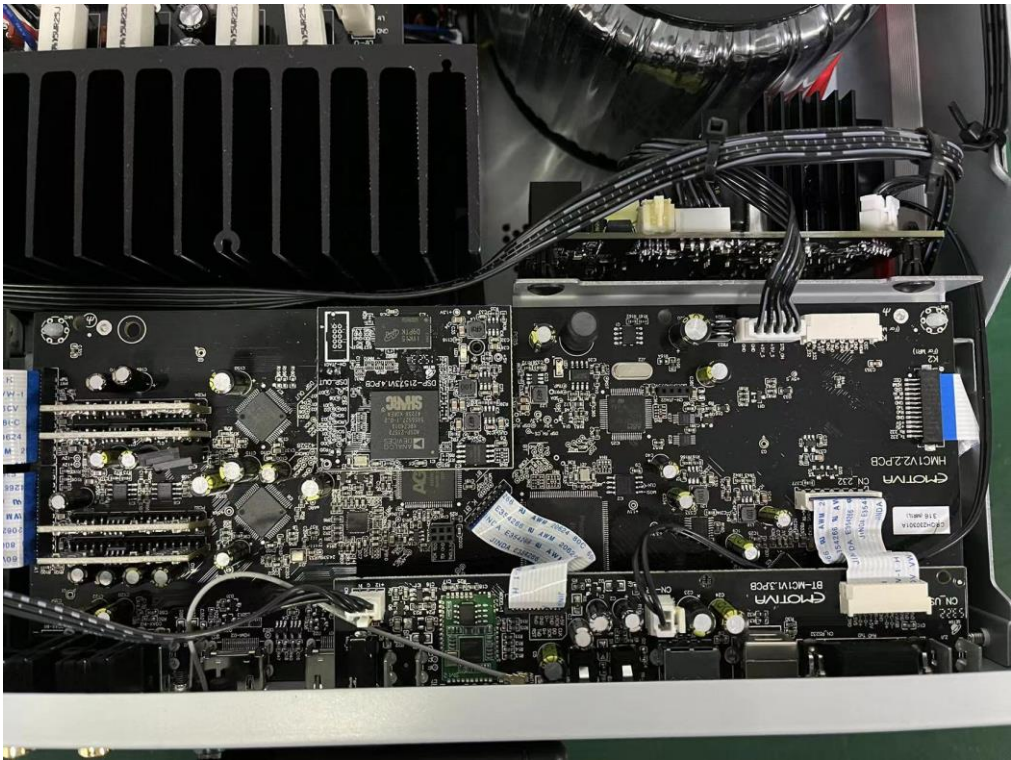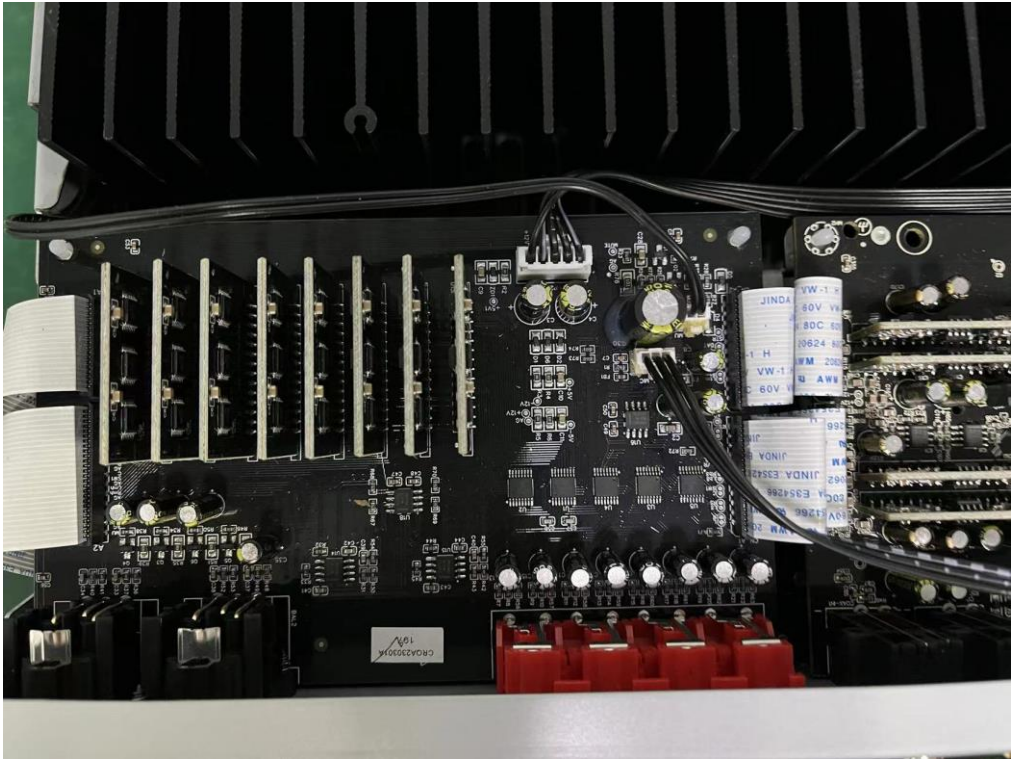



Internal Photos
M/N: BASX MR1L

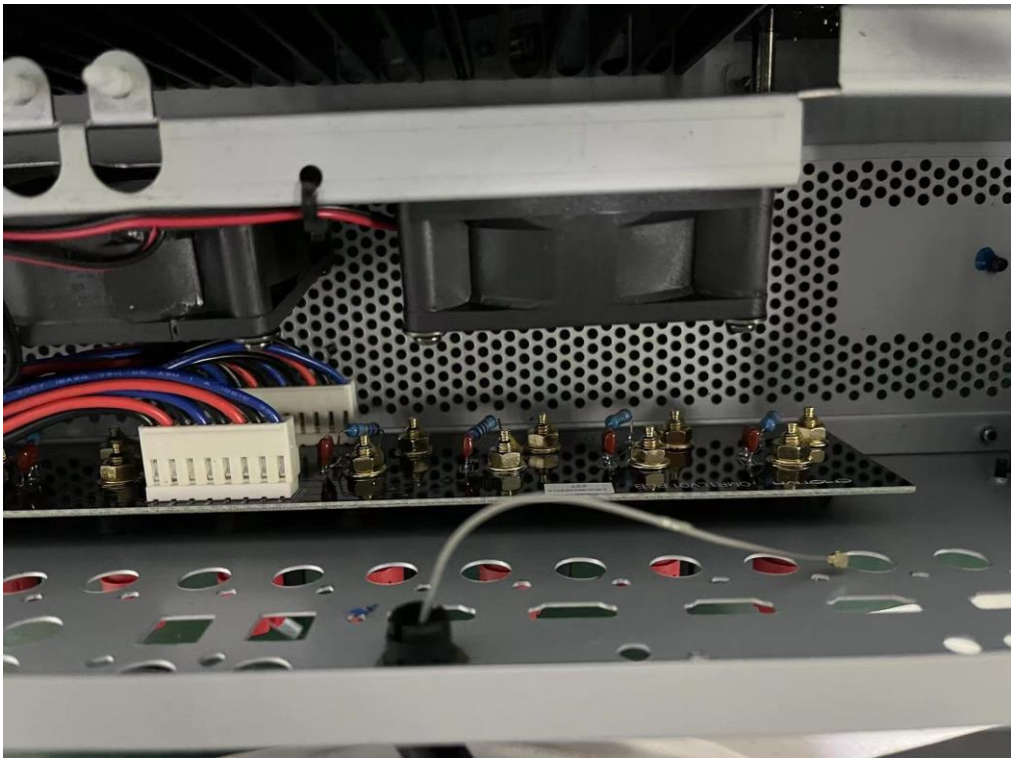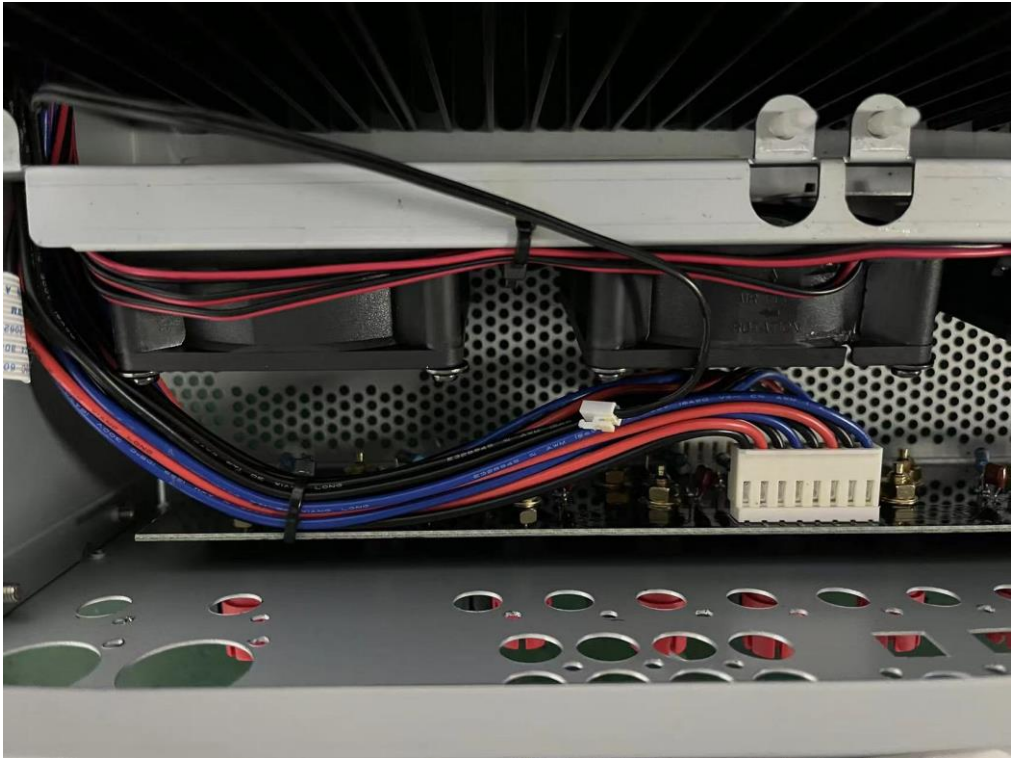



Internal Photos
M/N: BASX MR1L

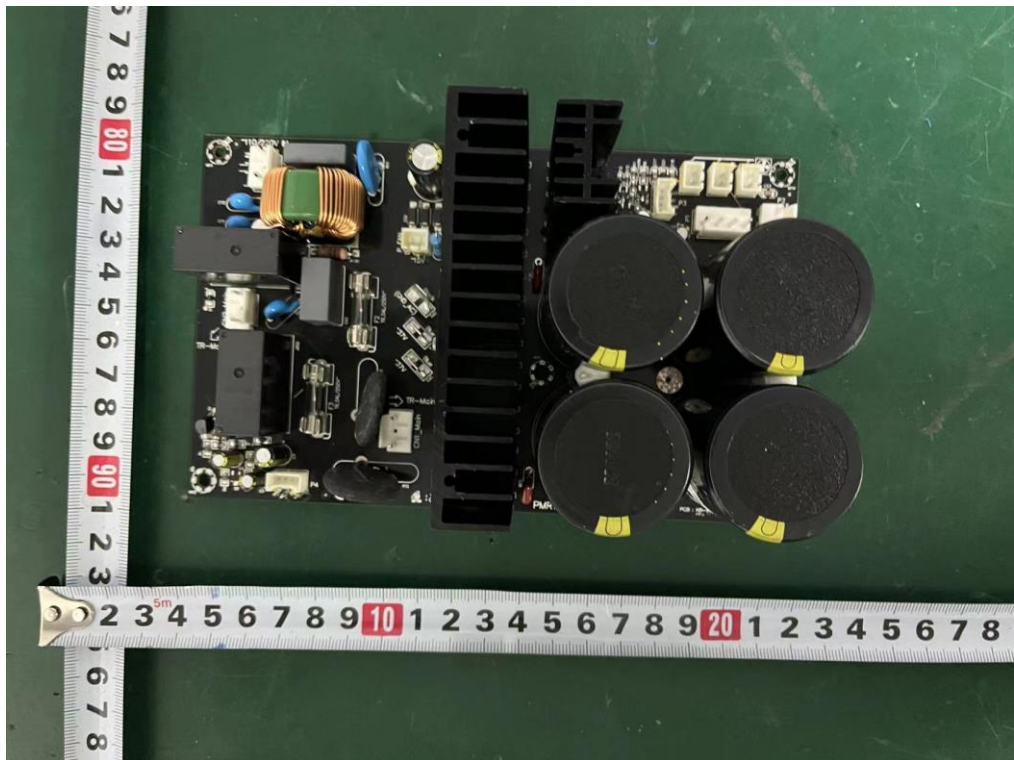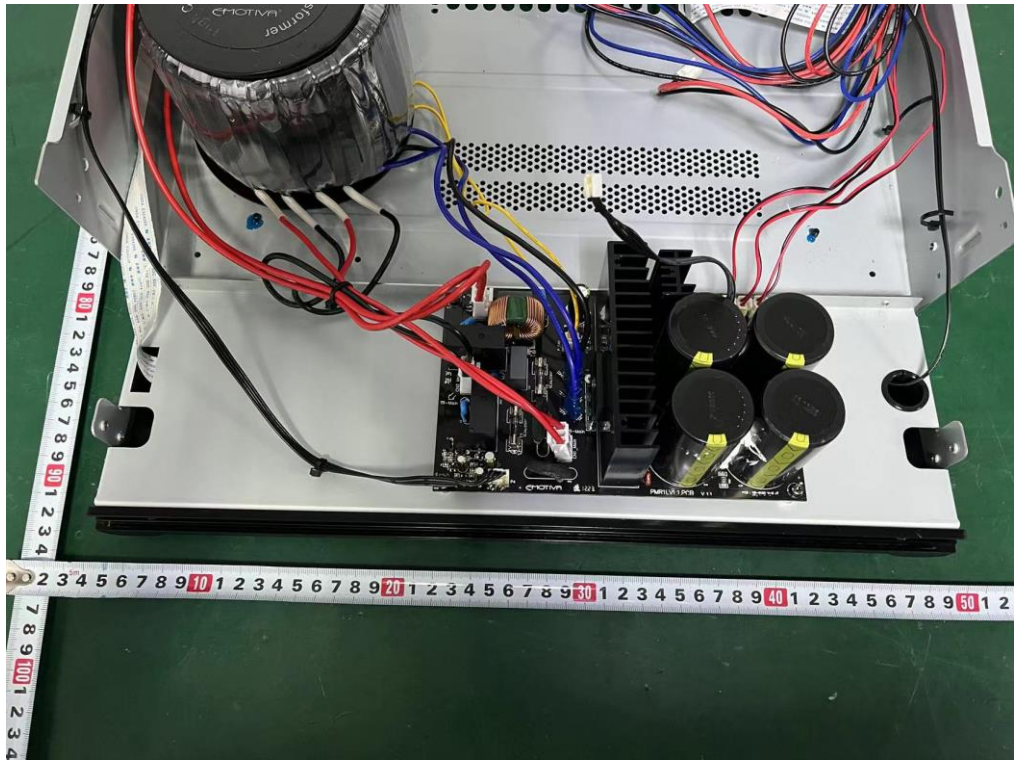



Internal Photos
M/N: BASX MR1L

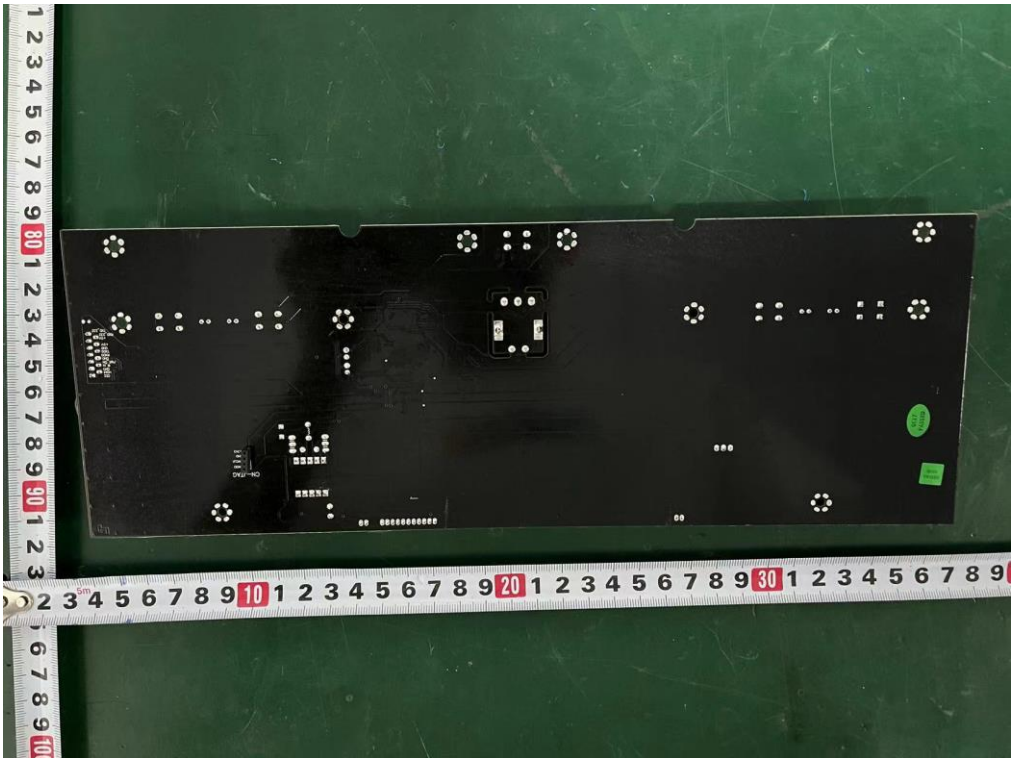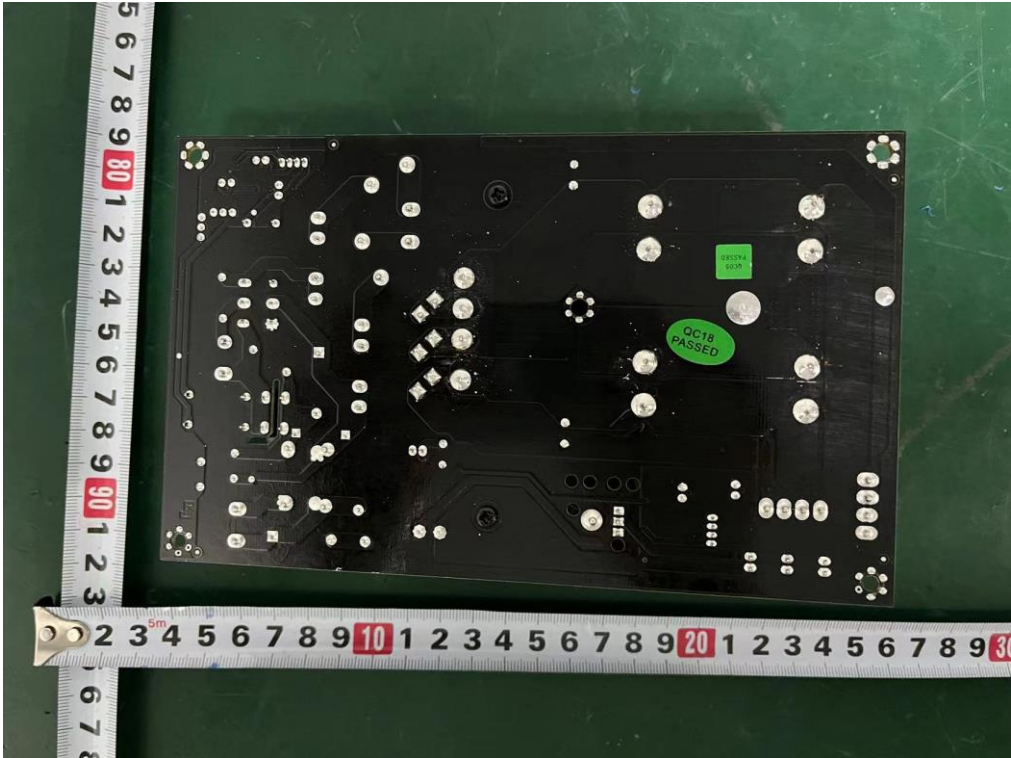


Internal Photos
M/N: BASX MR1L

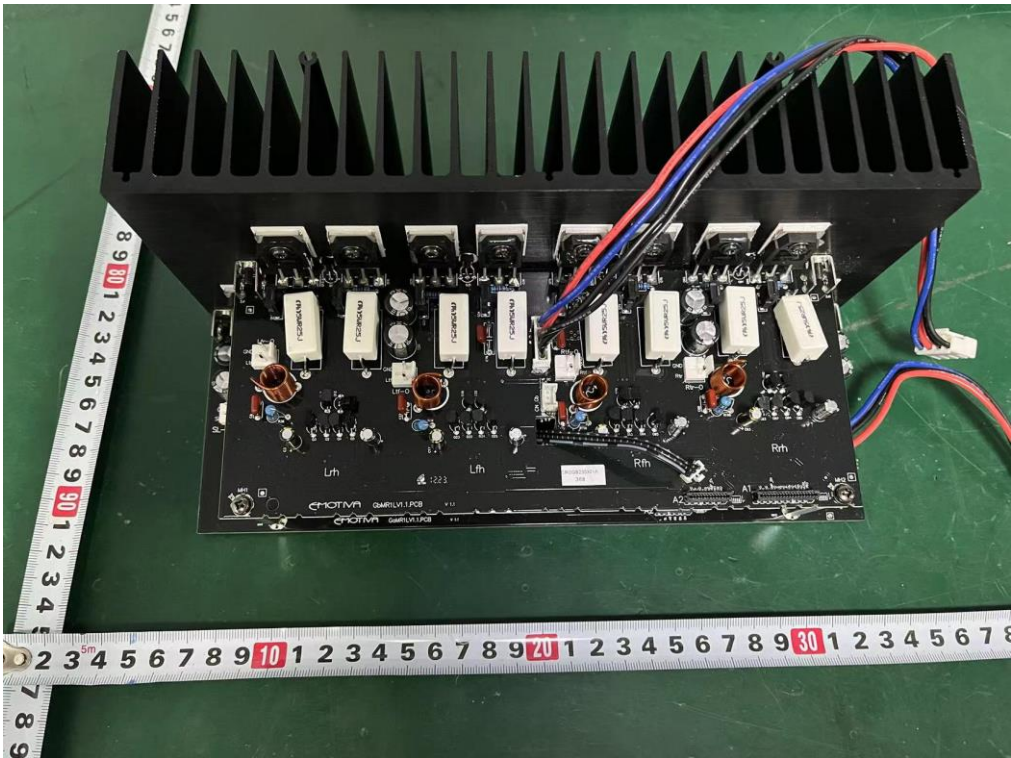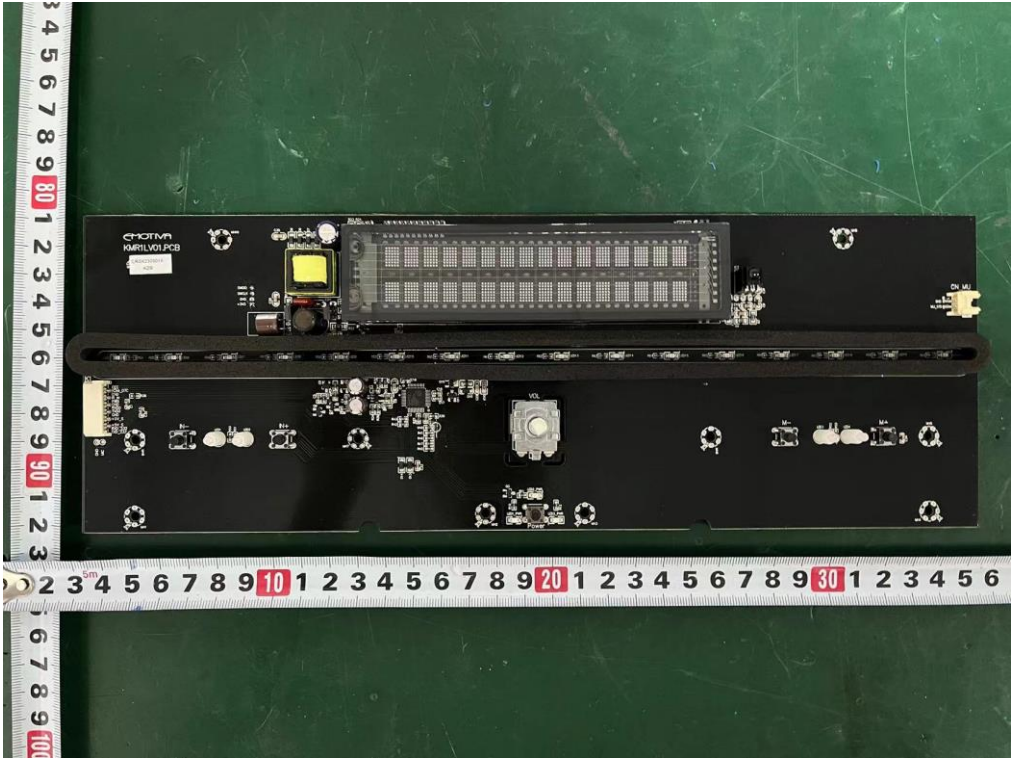



Internal Photos
M/N: BASX MR1L

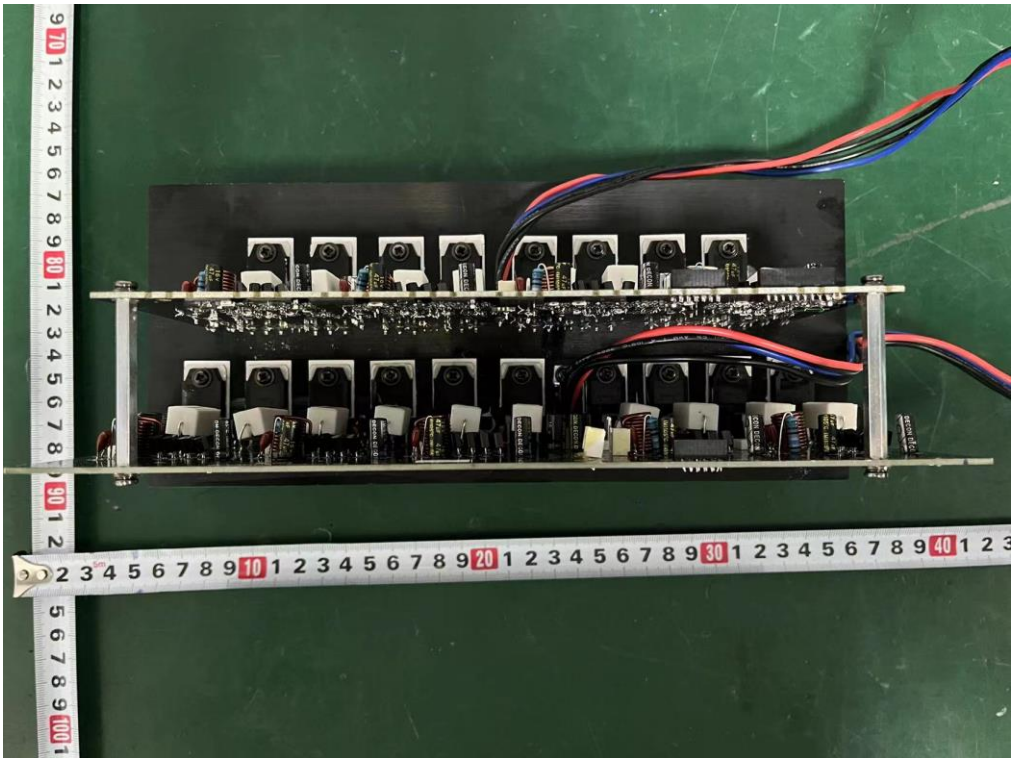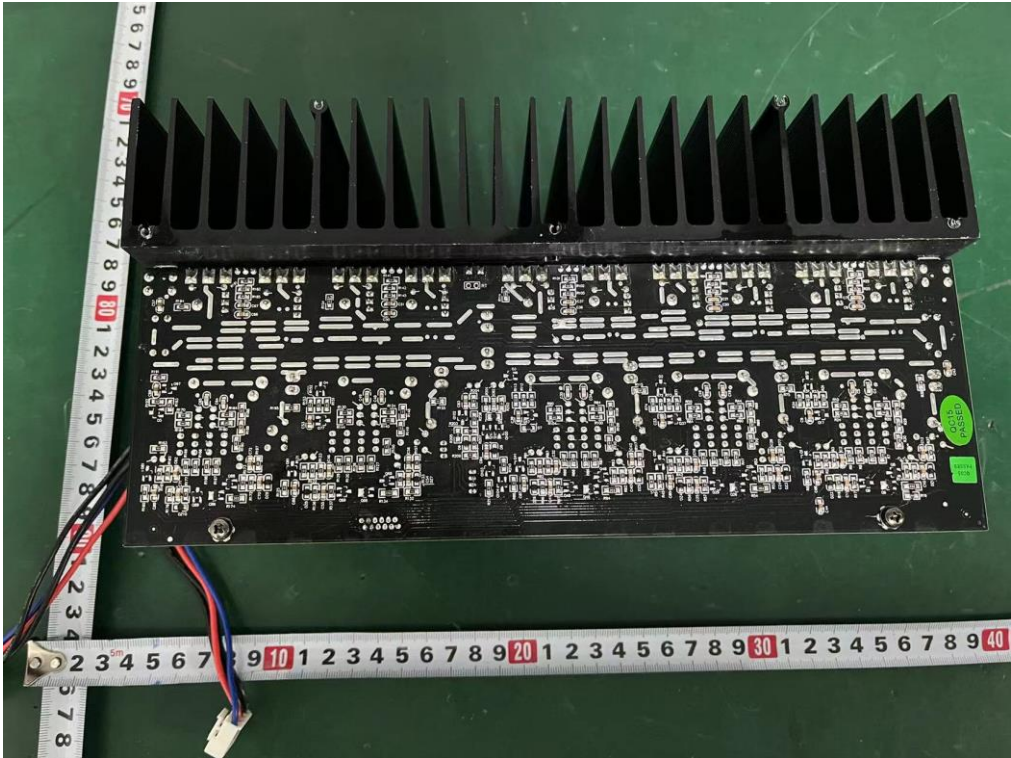



Internal Photos
M/N: BASX MR1L

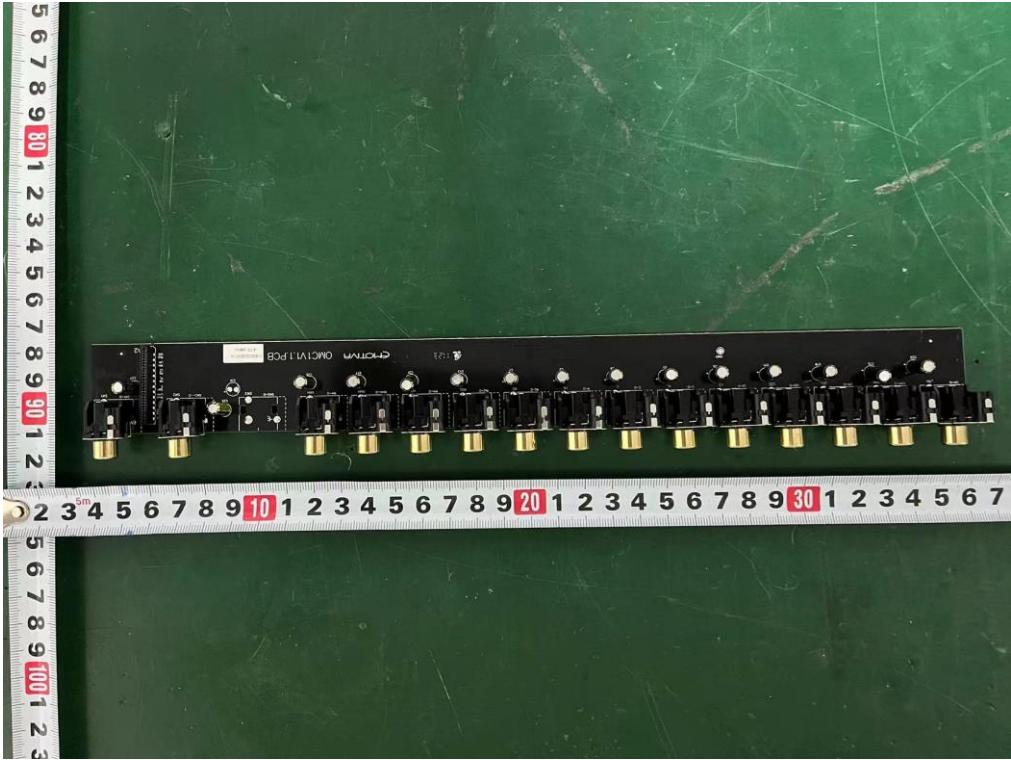



Internal Photos
M/N: BASX MR1L

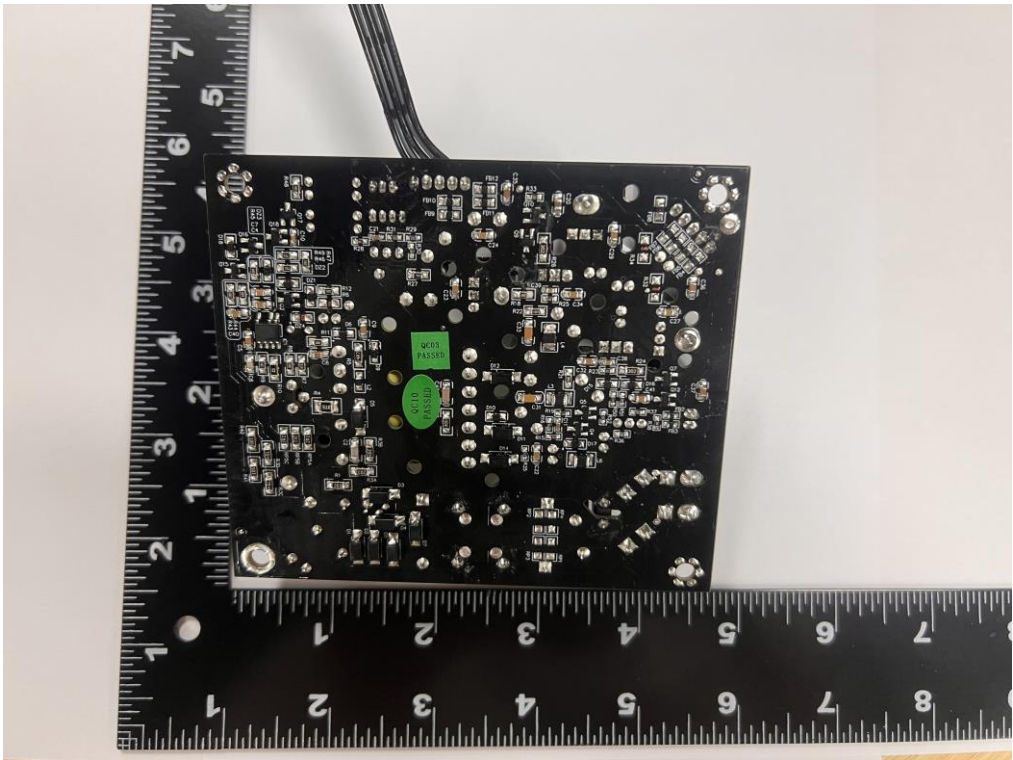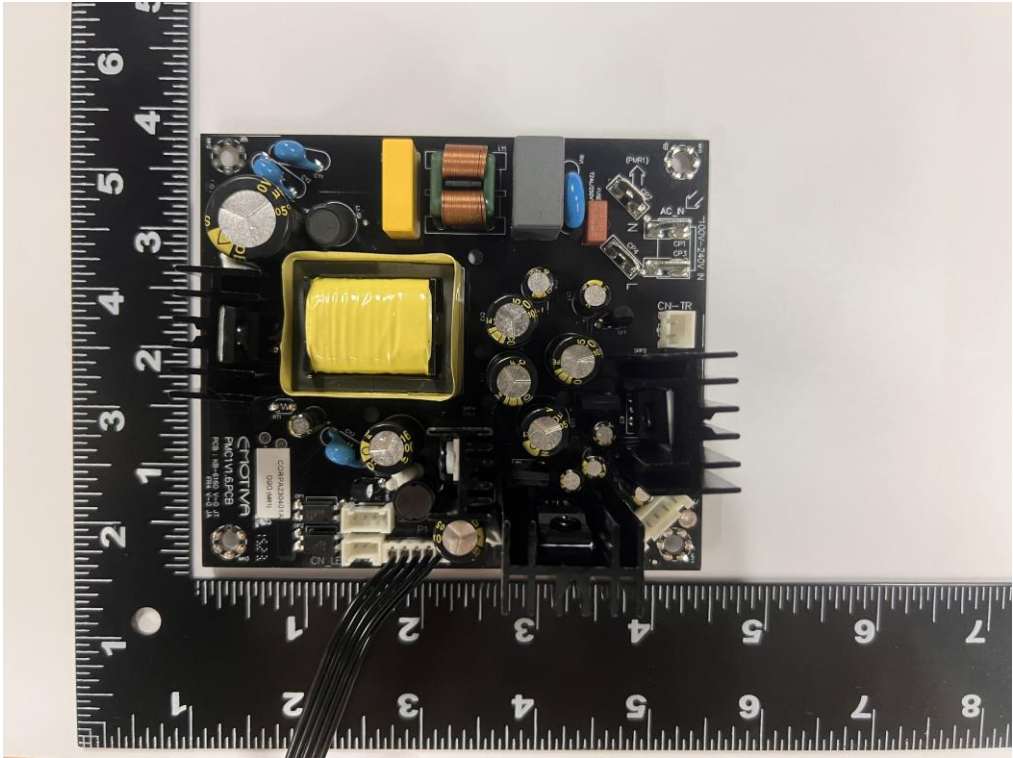



Internal Photos
M/N: BASX MR1L

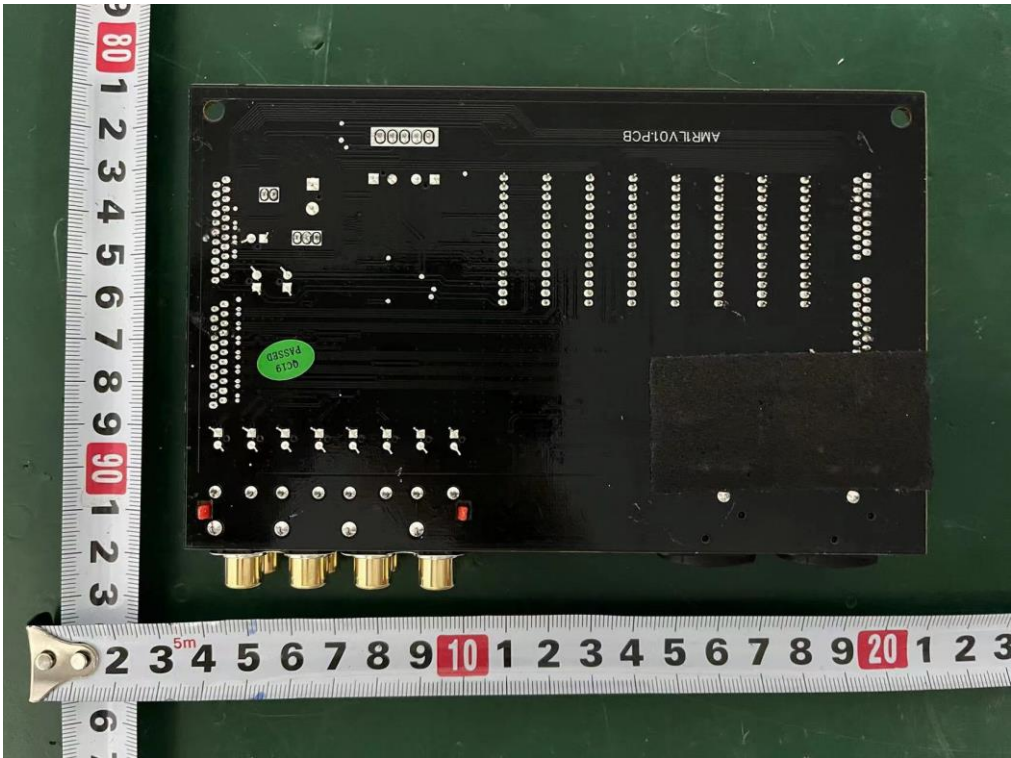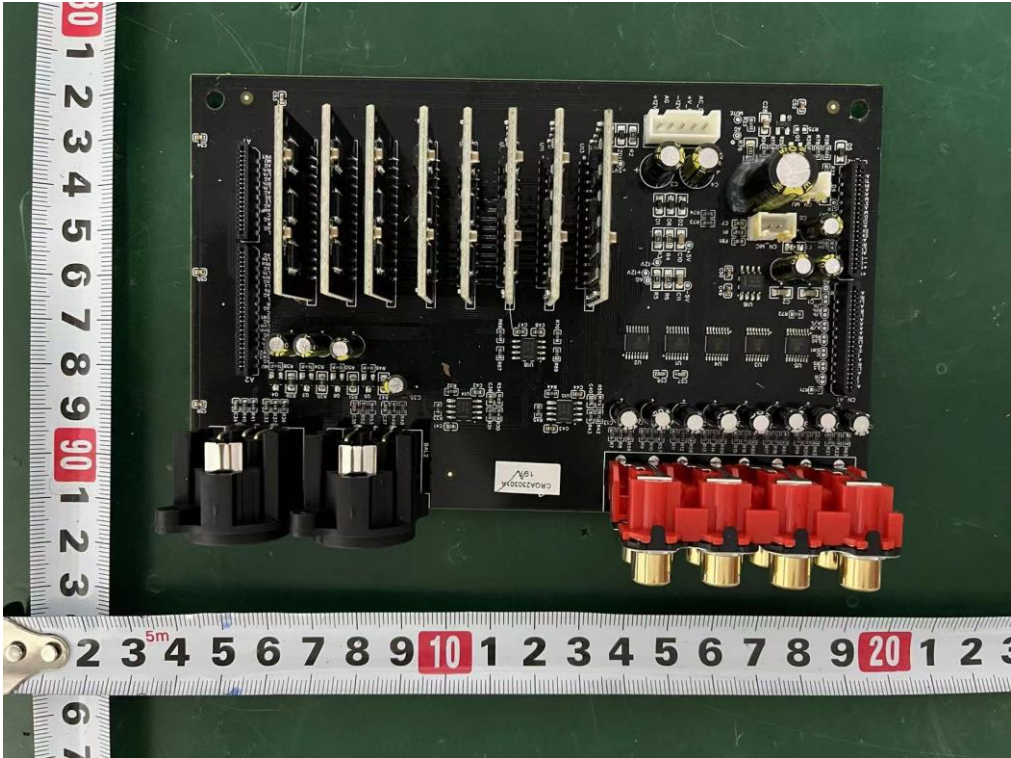



Internal Photos
M/N: BASX MR1L

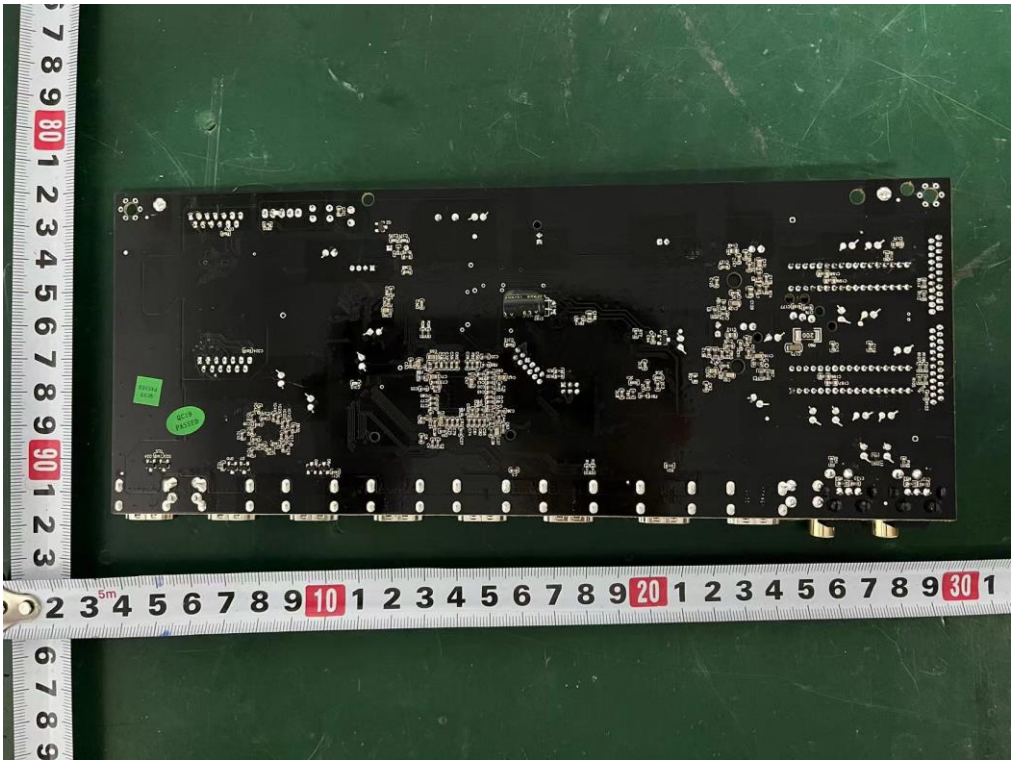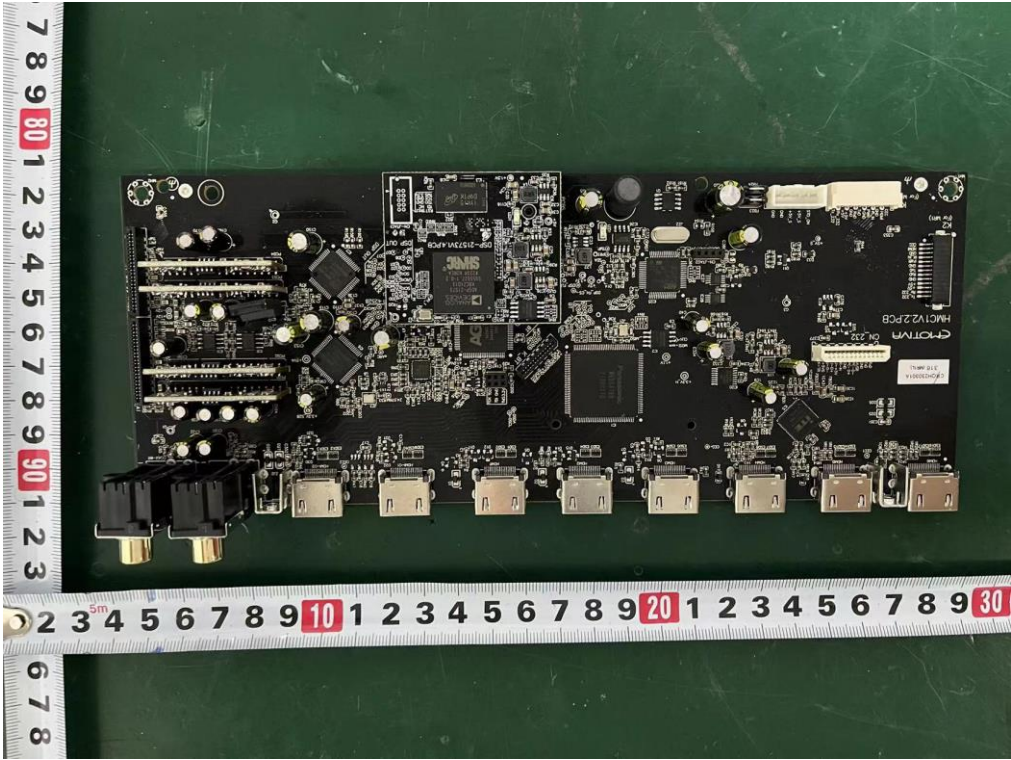

Internal Photos
M/N: BASX MR1L

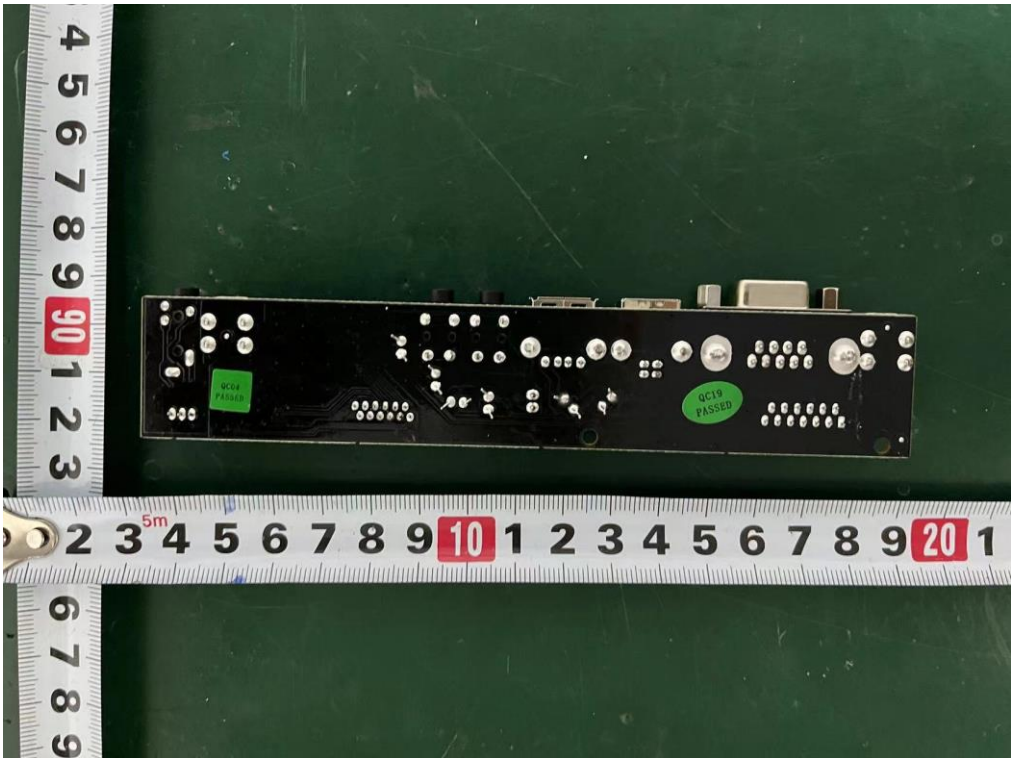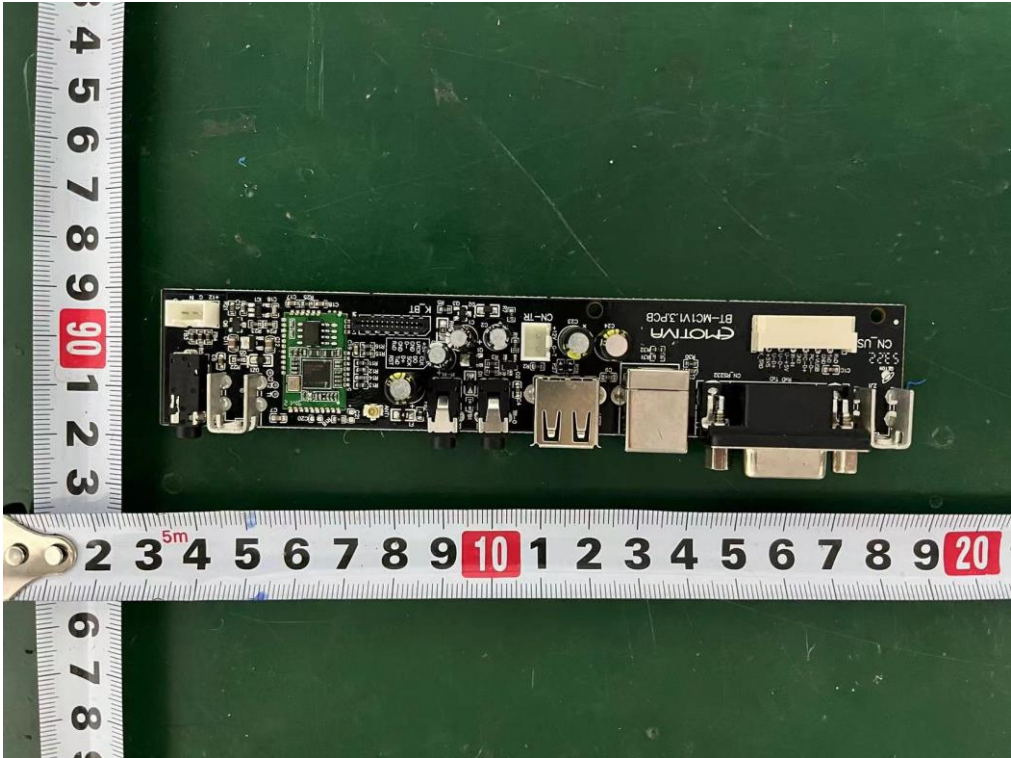

Internal Photos
M/N: BASX MR1L

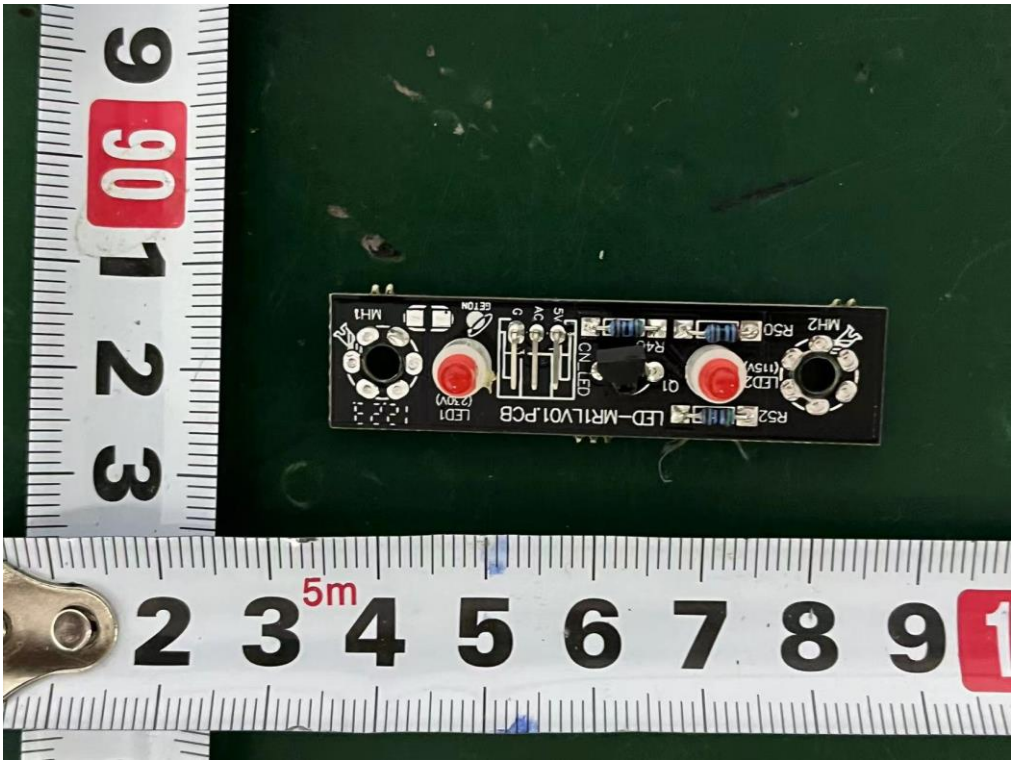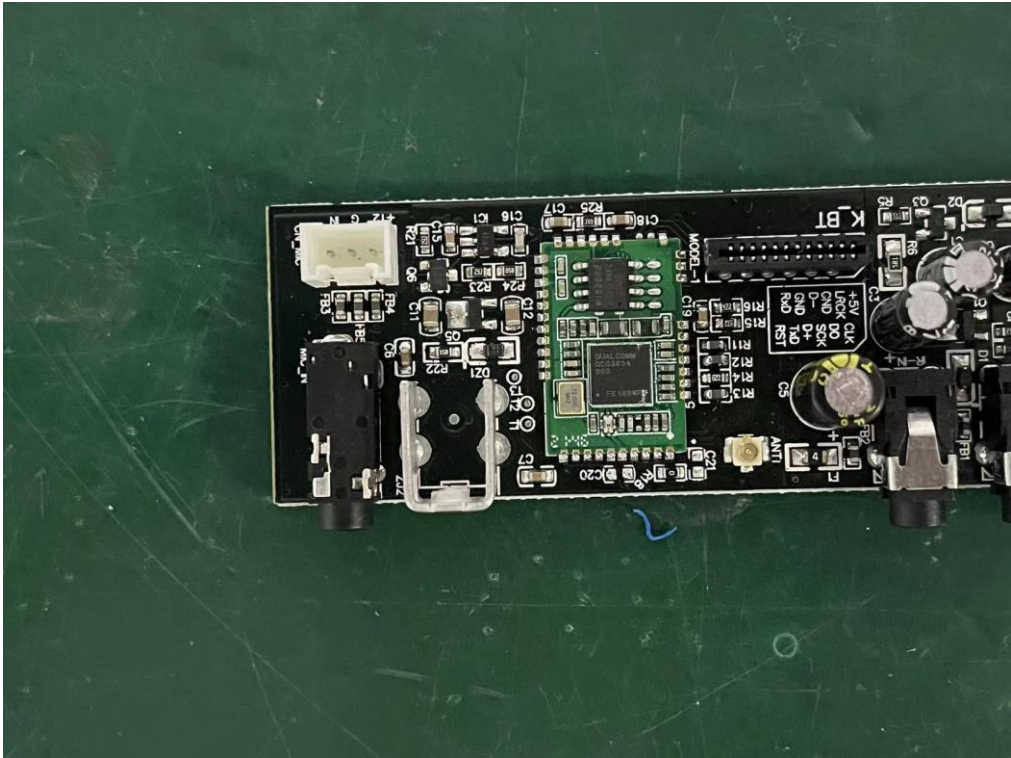

Internal Photos
M/N: BASX MR1L



End of Test Report