

TEST REPORT

Report No.: SHE23100070-02DE


Date: 2023-12-05

Page 59 of 77

Figure 39: Time of Occupancy, 2441MHz, GFSK DH5



Figure 40: Time of Occupancy, 2441MHz, $\pi/4$ -DQPSK DH1

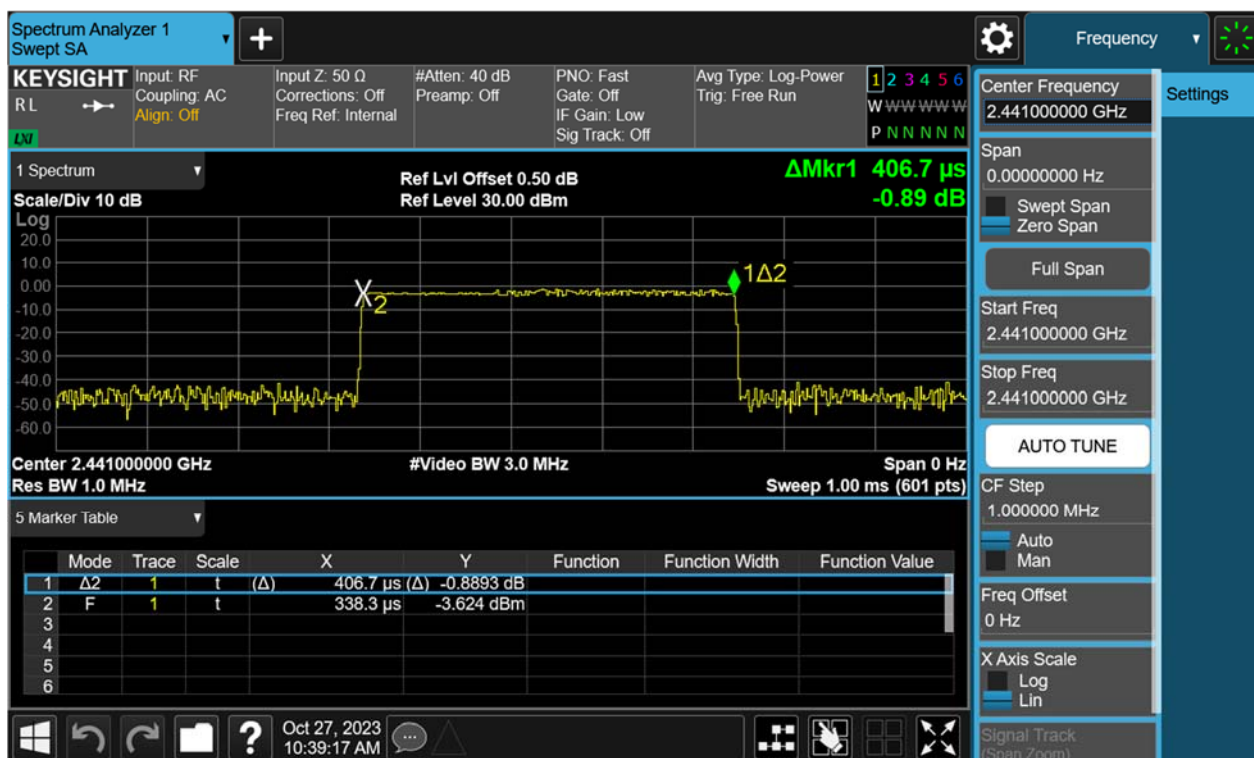

TEST REPORT

Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 60 of 77

Figure 41: Time of Occupancy, 2441MHz, $\pi/4$ -DQPSK DH3

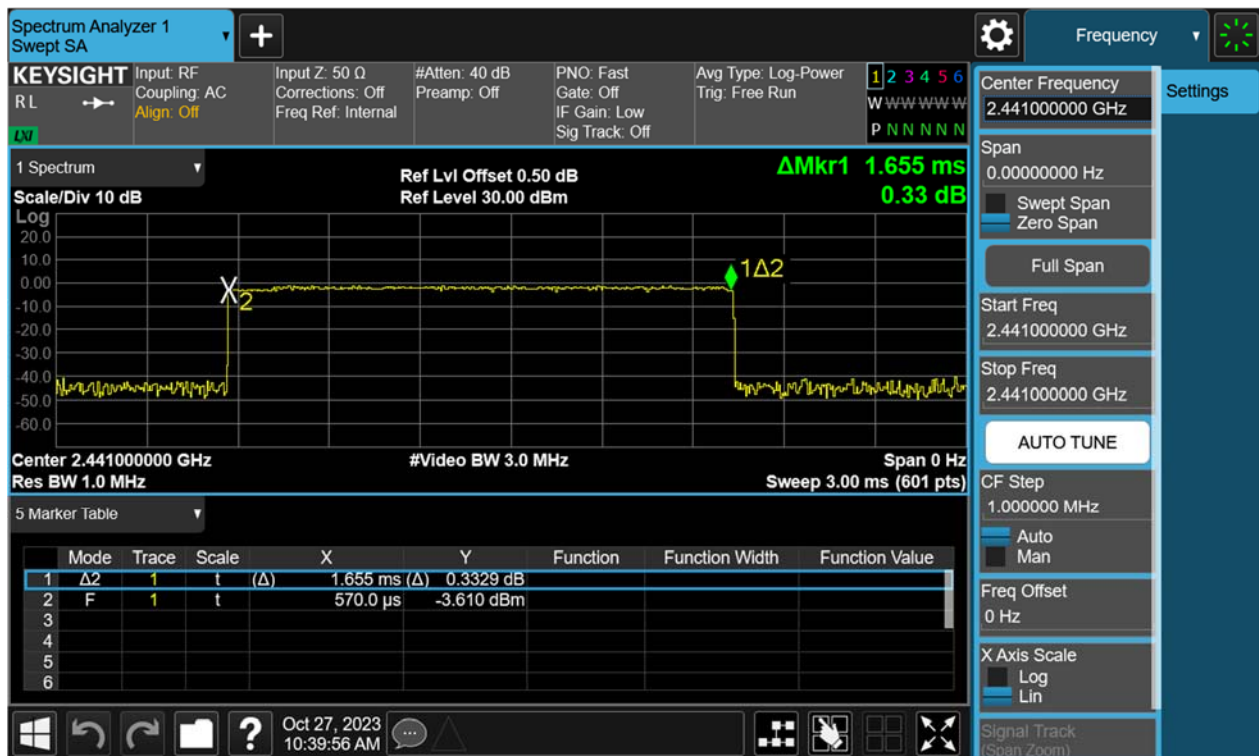


Figure 42: Time of Occupancy, 2441MHz, $\pi/4$ -DQPSK DH5



TEST REPORT

Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 61 of 77

Figure 43: Time of Occupancy, 2441MHz, 8-DPSK DH1


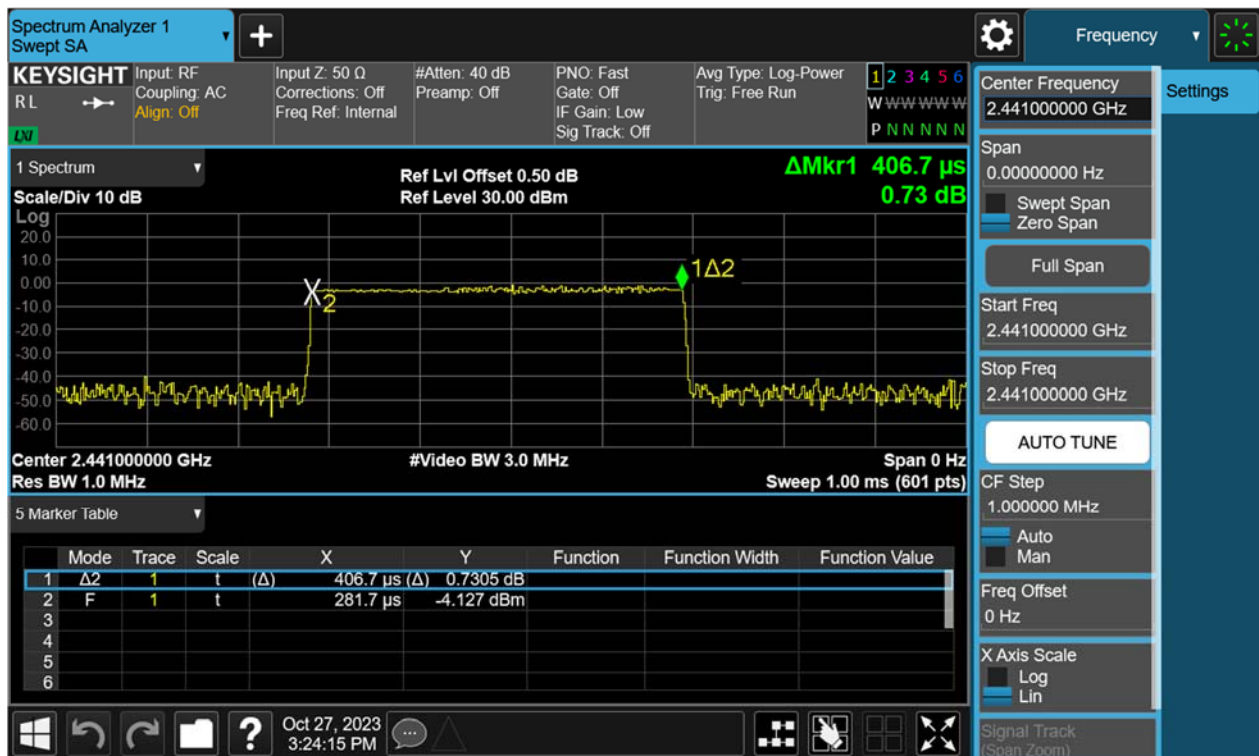



Figure 44: Time of Occupancy, 2441MHz, 8-DPSK DH3

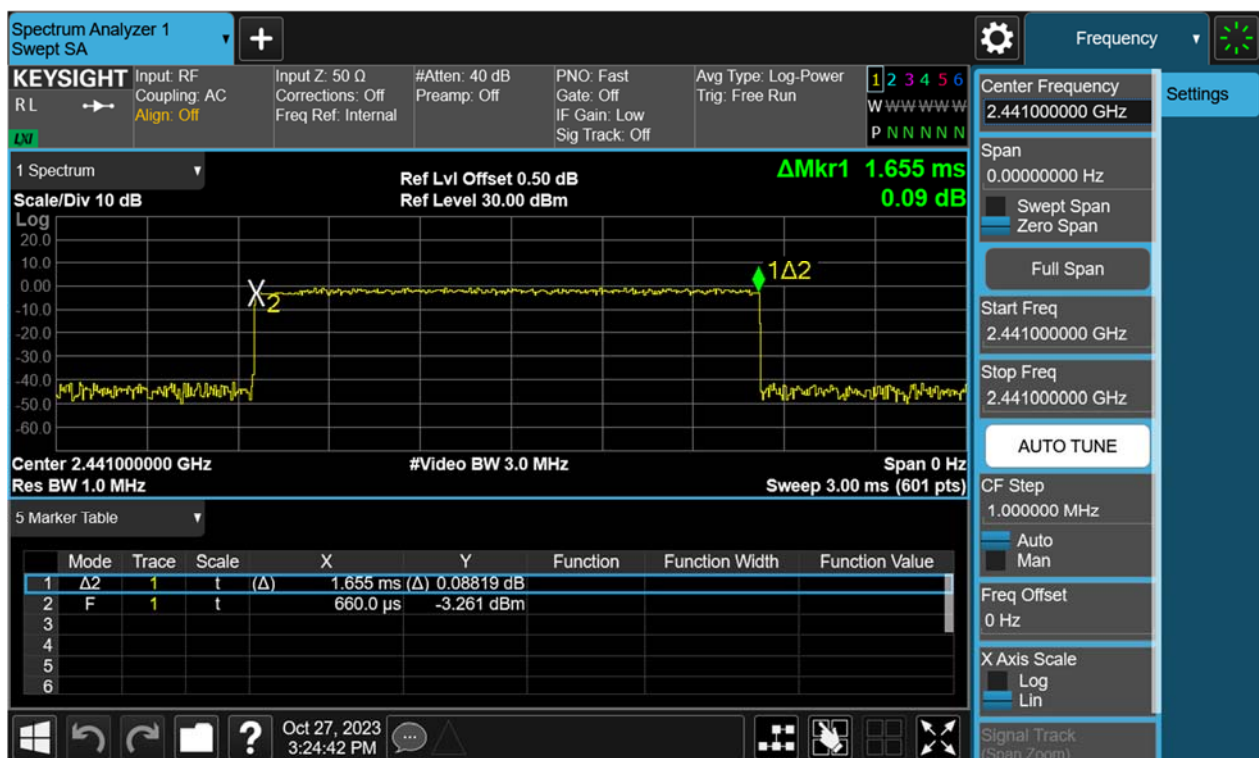

TEST REPORT

Report No.: SHE23100070-02DE Date: 2023-12-05 Page 62 of 77

Figure 45: Time of Occupancy, 2441MHz, 8-DPSK DH5

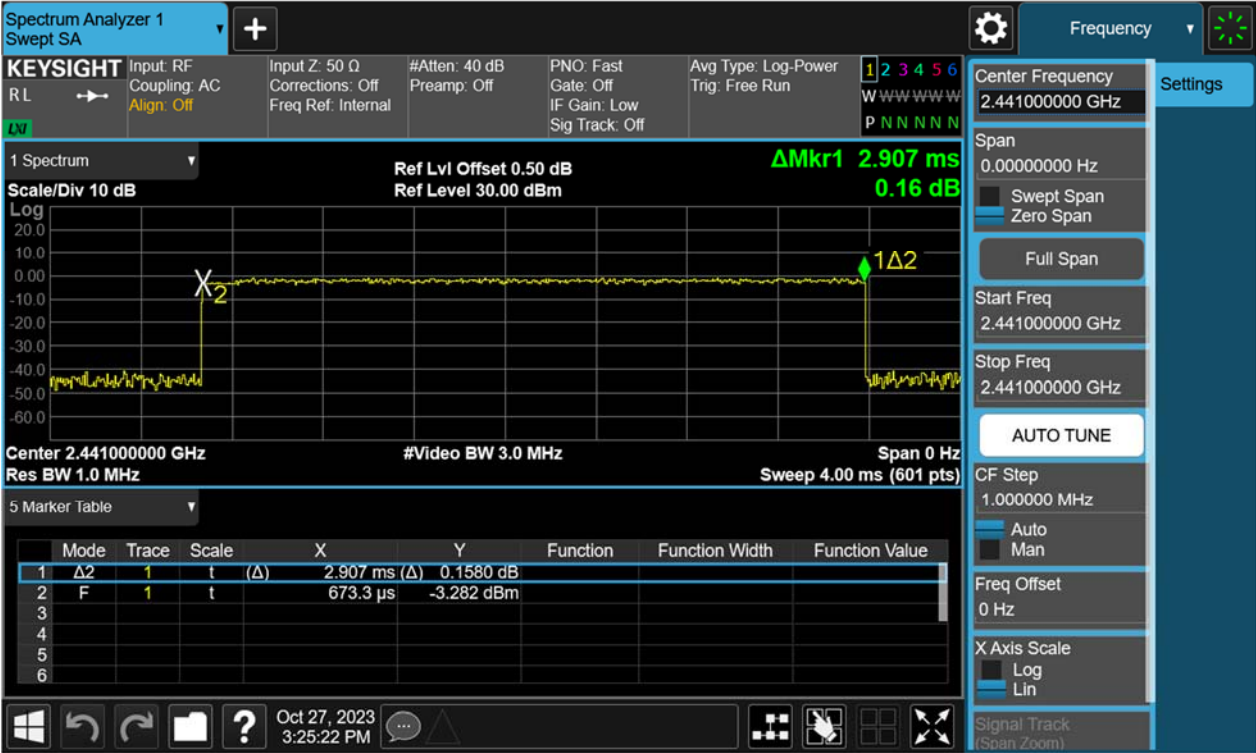

TEST REPORT

Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 63 of 77

4.2 Mains Emissions

4.2.1 Conducted Emission on AC Mains

RESULT:

PASS

Test standard	: FCC Part 15.207(a), RSS-Gen 8.8
Requirement	: ANSI C63.10-2013, Clause 6.2
Kind of test site	: Shielded room

Test setup

Input Voltage	: which received AC 120V, 60Hz Power
Operation Mode	: A.1.a
Earthing	: Connected to GND
Ambient temperature	: 26°C
Relative humidity	: 49%

For details refer to following test plot.

TEST REPORT


Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 64 of 77

Note: The all configurations were tested respectively, Only the worst mode data of 8DPSK-hopping-DH5 was recorded in the test report.


Figure 46: Conducted Emission on AC Mains, L Phase

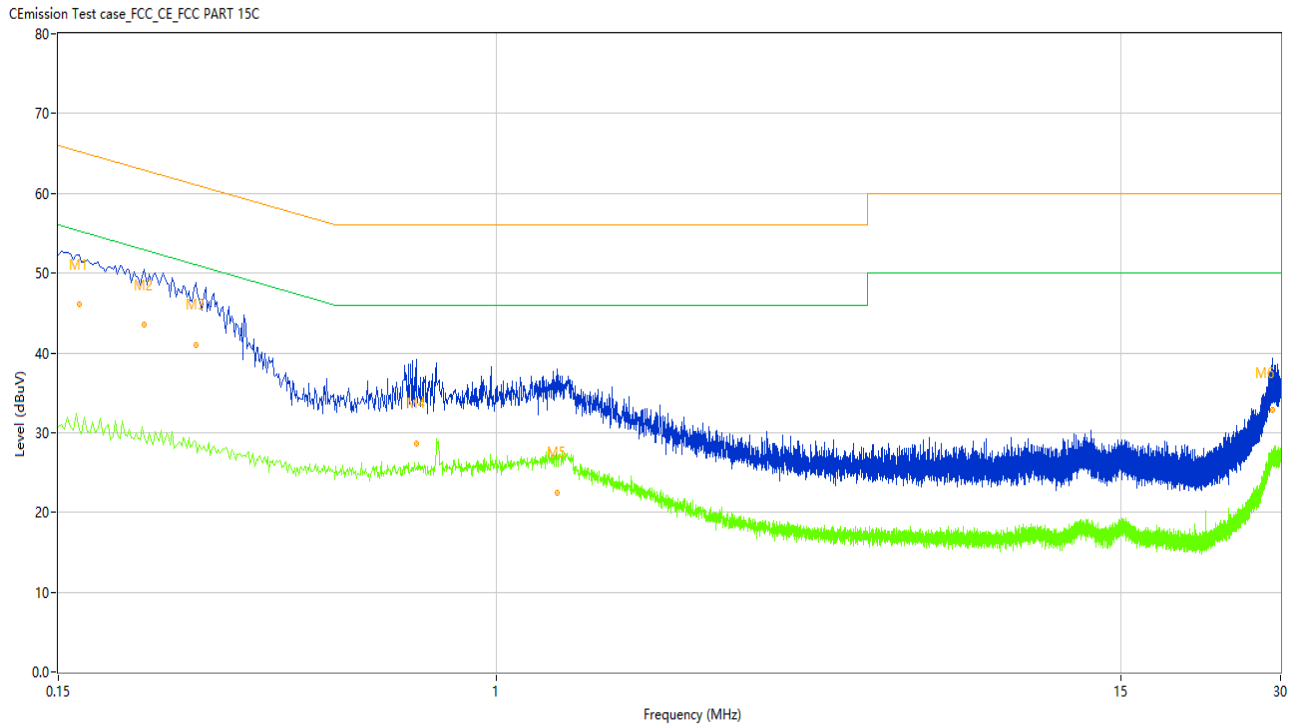

No.	Frequency (MHz)	Results (dBuV)	Factor (dB)	Limit (dBuV)	Margin (dB)	Detector	Line	Verdict
1	0.164	52.45	9.94	65.26	12.81	Peak	L	Pass
1*	0.164	46.18	9.94	65.26	19.08	QP	L	Pass
1**	0.164	30.34	9.94	55.26	24.92	AV	L	Pass
2	0.218	50.26	9.96	62.89	12.63	Peak	L	Pass
2*	0.218	43.49	9.96	62.89	19.40	QP	L	Pass
2**	0.218	29.34	9.96	52.89	23.55	AV	L	Pass
3	0.272	48.46	9.97	61.06	12.60	Peak	L	Pass
3*	0.272	40.97	9.97	61.06	20.09	QP	L	Pass
3**	0.272	28.75	9.97	51.06	22.31	AV	L	Pass
4	0.708	37.94	9.95	56.00	18.06	Peak	L	Pass
4*	0.708	28.66	9.95	56.00	27.34	QP	L	Pass
4**	0.708	25.65	9.95	46.00	20.35	AV	L	Pass
5	1.306	29.93	9.84	56.00	26.07	Peak	L	Pass
5*	1.306	22.48	9.84	56.00	33.52	QP	L	Pass
5**	1.306	27.04	9.84	46.00	18.96	AV	L	Pass
6	29.038	39.30	8.96	60.00	20.70	Peak	L	Pass
6*	29.038	32.77	8.96	60.00	27.23	QP	L	Pass
6**	29.038	27.73	8.96	50.00	22.27	AV	L	Pass

TEST REPORT

Figure 47: Conducted Emission on AC Mains, N Phase

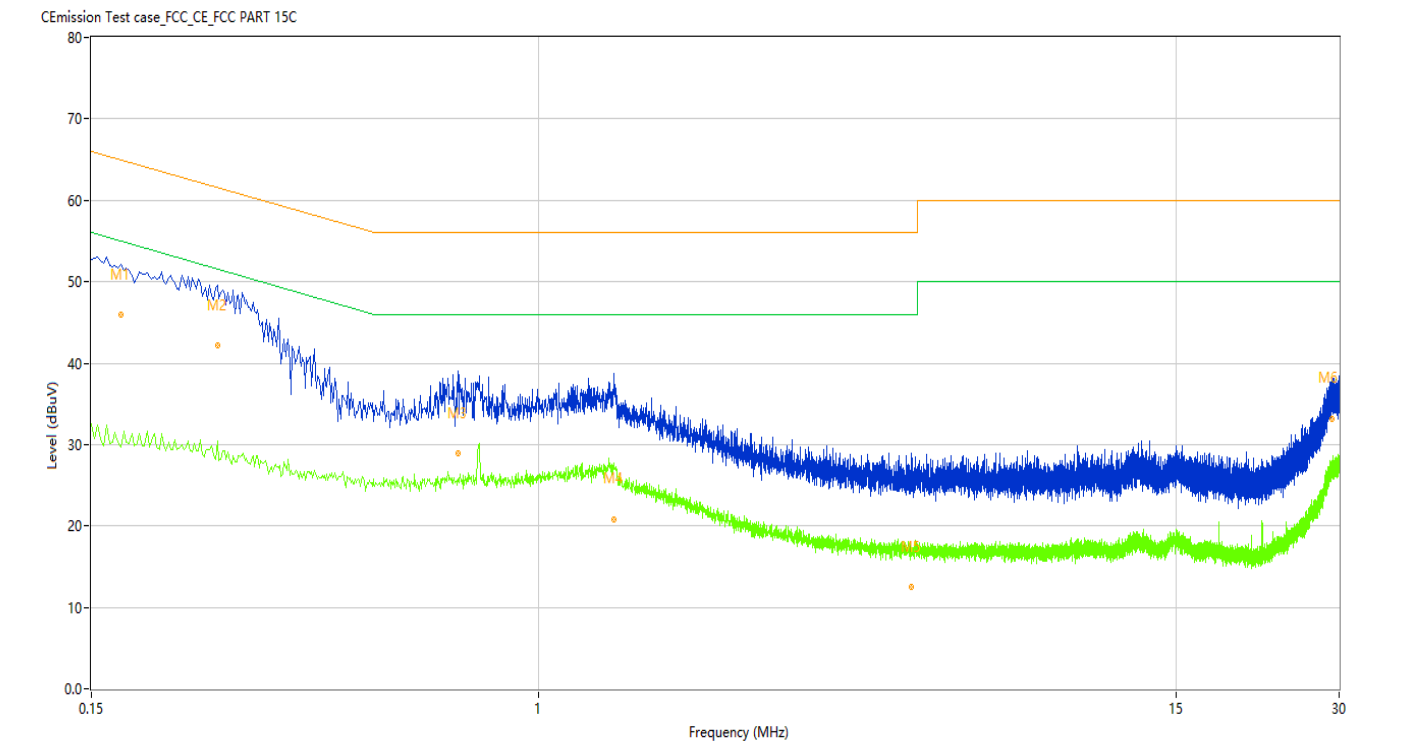

No.	Frequency (MHz)	Results (dBuV)	Factor (dB)	Limit (dBuV)	Margin (dB)	Detector	Line	Verdict
1	0.170	52.10	10.03	64.96	12.86	Peak	N	Pass
1*	0.170	45.94	10.03	64.96	19.02	QP	N	Pass
1**	0.170	29.75	10.03	54.96	25.21	AV	N	Pass
2	0.256	49.26	10.06	61.56	12.30	Peak	N	Pass
2*	0.256	42.21	10.06	61.56	19.35	QP	N	Pass
2**	0.256	30.42	10.06	51.56	21.14	AV	N	Pass
3	0.712	38.14	10.04	56.00	17.86	Peak	N	Pass
3*	0.712	28.91	10.04	56.00	27.09	QP	N	Pass
3**	0.712	25.84	10.04	46.00	20.16	AV	N	Pass
4	1.378	28.66	9.94	56.00	27.34	Peak	N	Pass
4*	1.378	20.76	9.94	56.00	35.24	QP	N	Pass
4**	1.378	26.97	9.94	46.00	19.03	AV	N	Pass
5	4.878	20.23	9.74	56.00	35.77	Peak	N	Pass
5*	4.878	12.50	9.74	56.00	43.50	QP	N	Pass
5**	4.878	17.32	9.74	46.00	28.68	AV	N	Pass
6	29.050	39.70	9.05	60.00	20.30	Peak	N	Pass
6*	29.050	33.22	9.05	60.00	26.78	QP	N	Pass
6**	29.050	27.54	9.05	50.00	22.46	AV	N	Pass

TEST REPORT


Report No.: SHE23100070-02DE

Date: 2023-12-05


Page 66 of 77

5 Appendixes

5.1 Photographs of the Sample

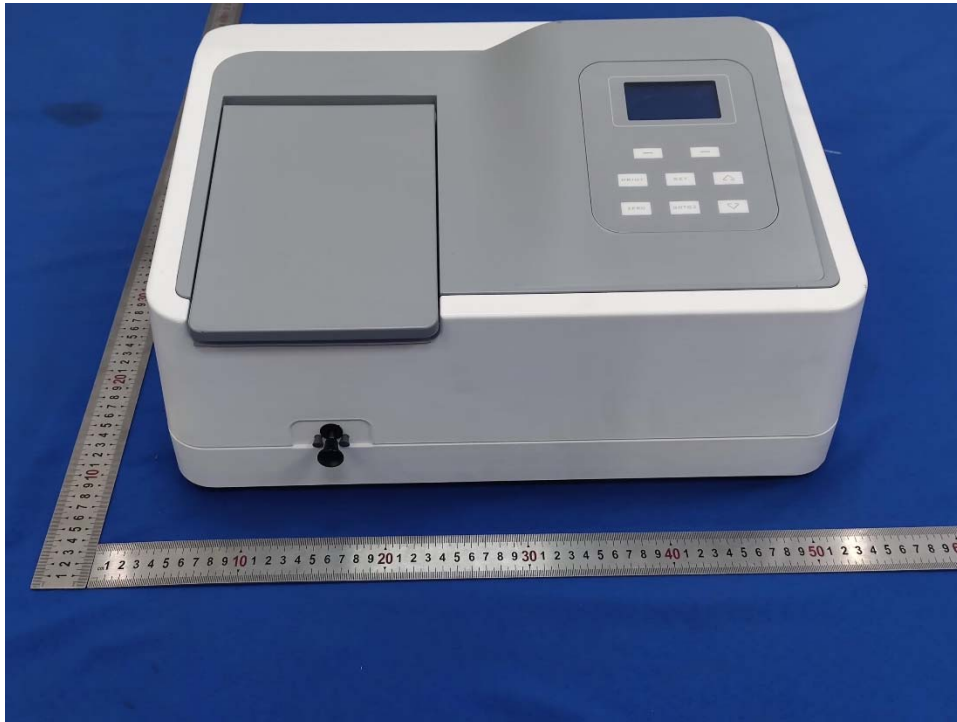

Front of the sample

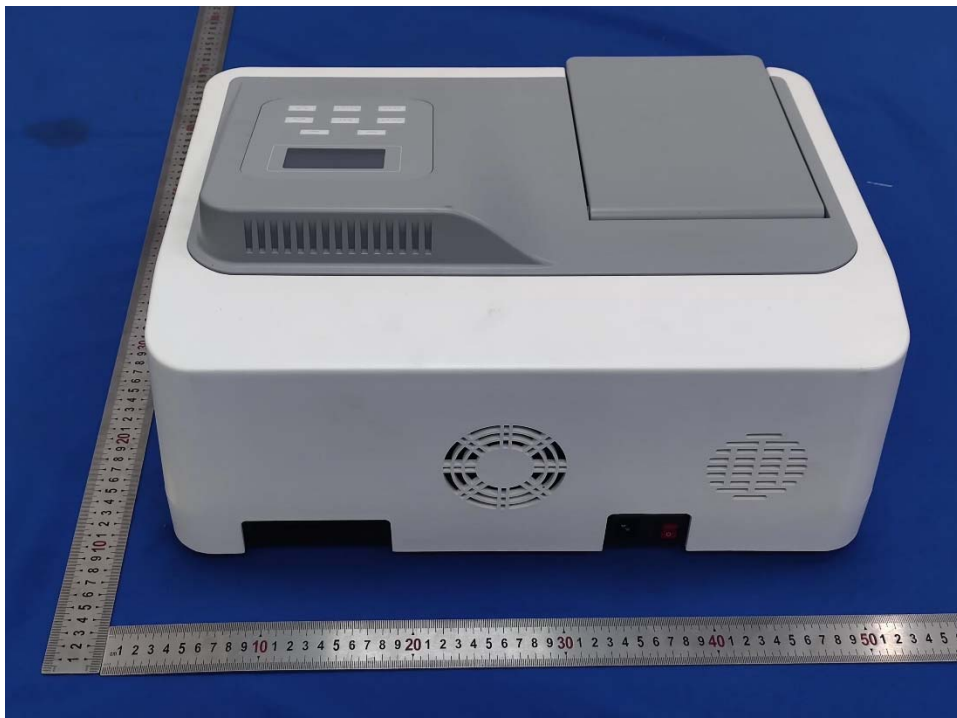


Rear of the sample

TEST REPORT

Report No.: SHE23100070-02DE Date: 2023-12-05 Page 67 of 77



Left of the sample

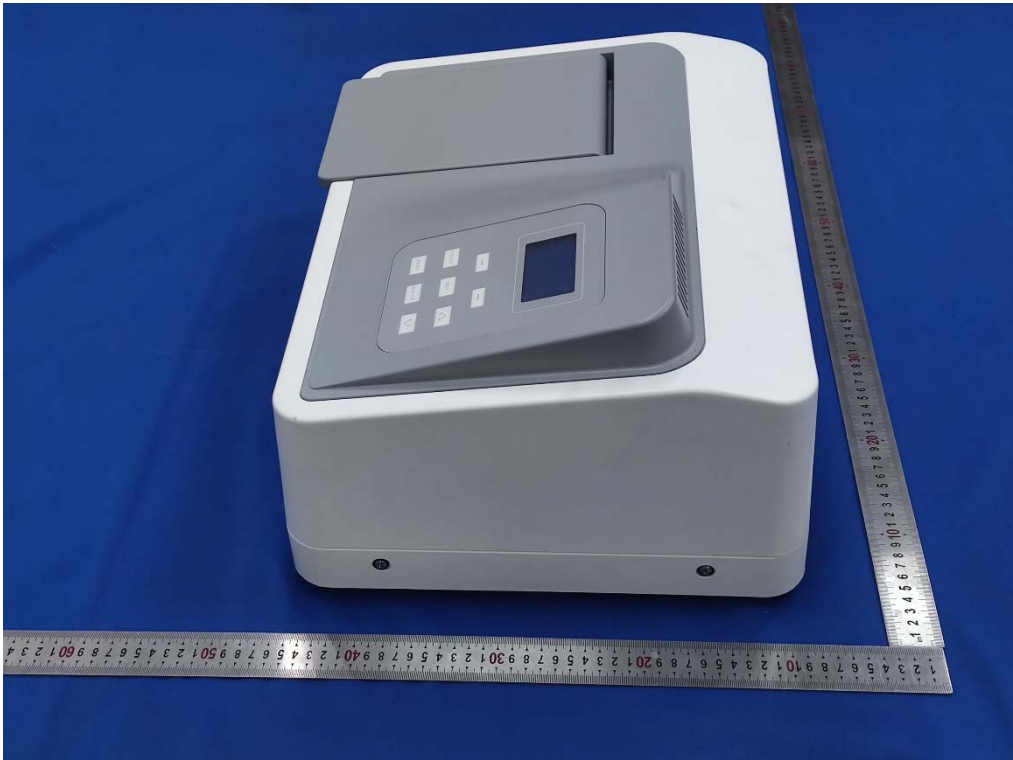


Right of the sample

TEST REPORT

Report No.: SHE23100070-02DE Date: 2023-12-05 Page 68 of 77



Top of the sample

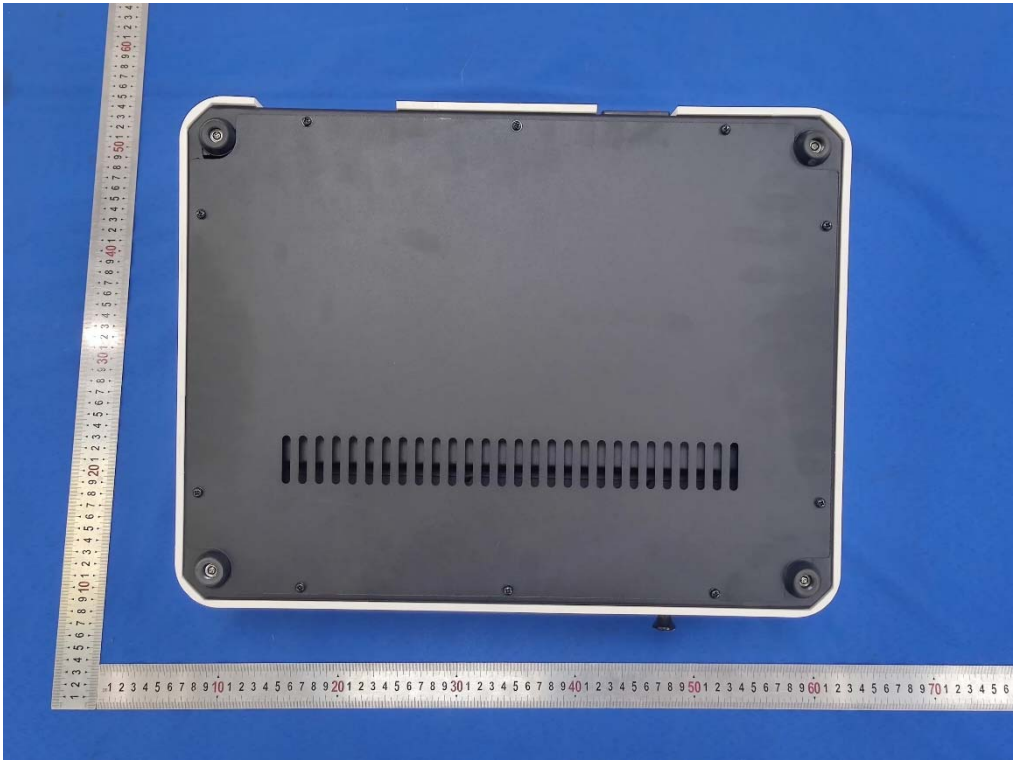

Bottom of the sample

TEST REPORT

Report No.:

SHE23100070-02DE


Date:

2023-12-05

Page 69 of 77




Open-1 of the sample

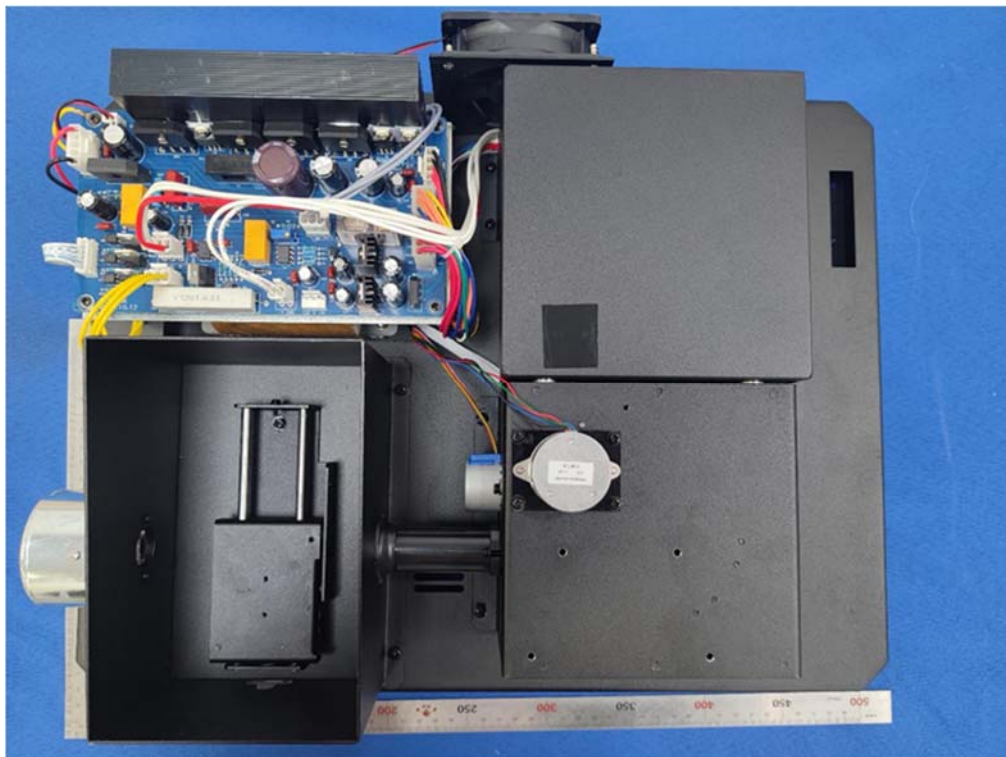


Open-2 of the sample

TEST REPORT

Report No.: SHE23100070-02DE Date: 2023-12-05 Page 70 of 77

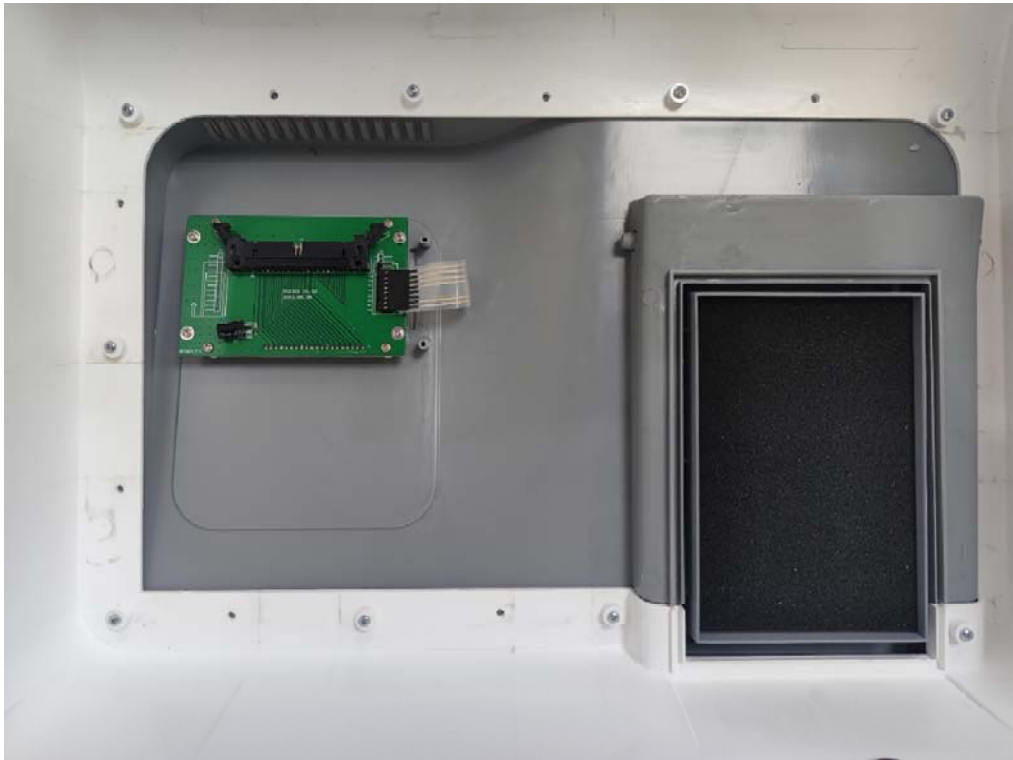

Open-3 of the sample

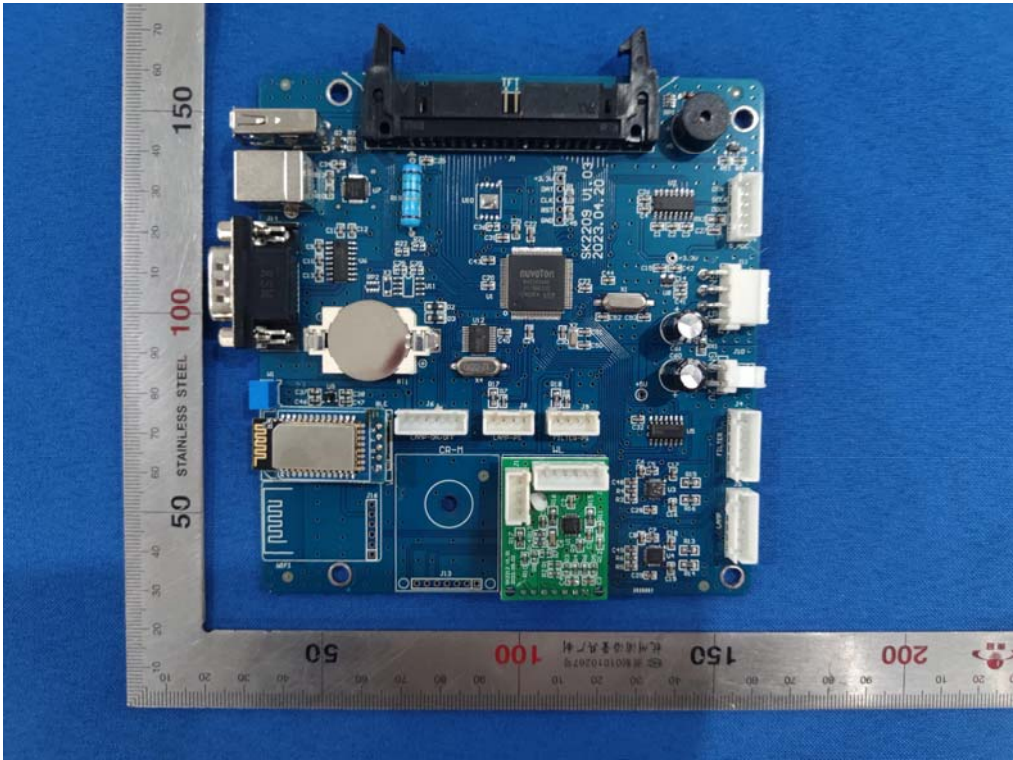

Internal-1 of the sample

TEST REPORT


Report No.:

SHE23100070-02DE


Date:

2023-12-05

Page 71 of 77

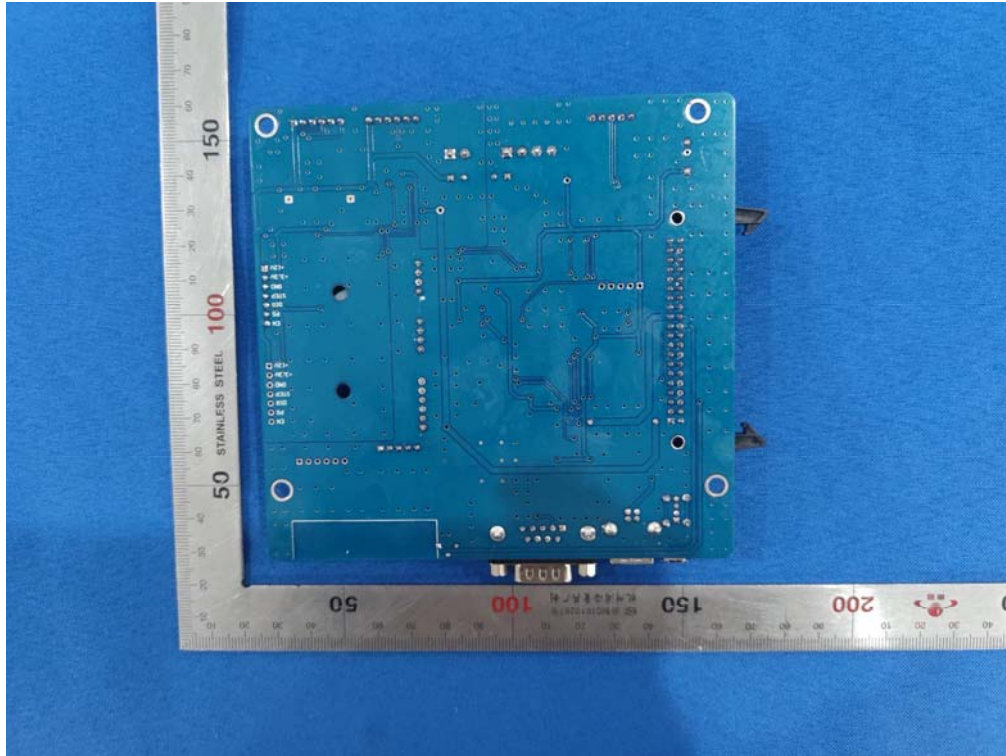

Internal-2 of the sample

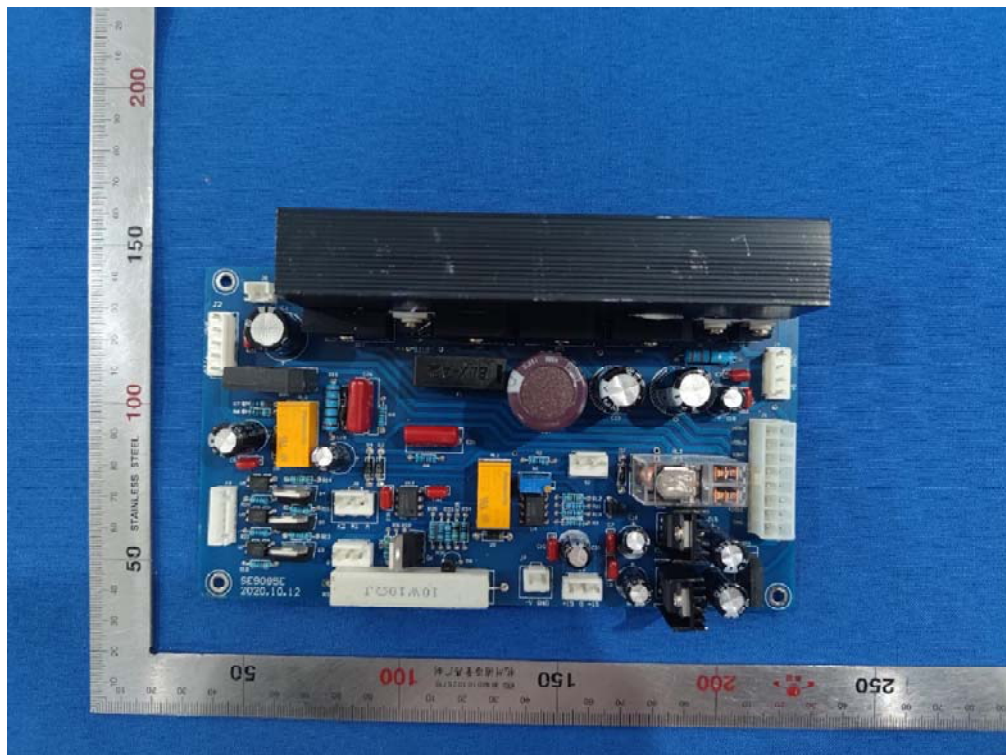

Internal-3 of the sample

TEST REPORT


Report No.:

SHE23100070-02DE


Date:

2023-12-05

Page 72 of 77

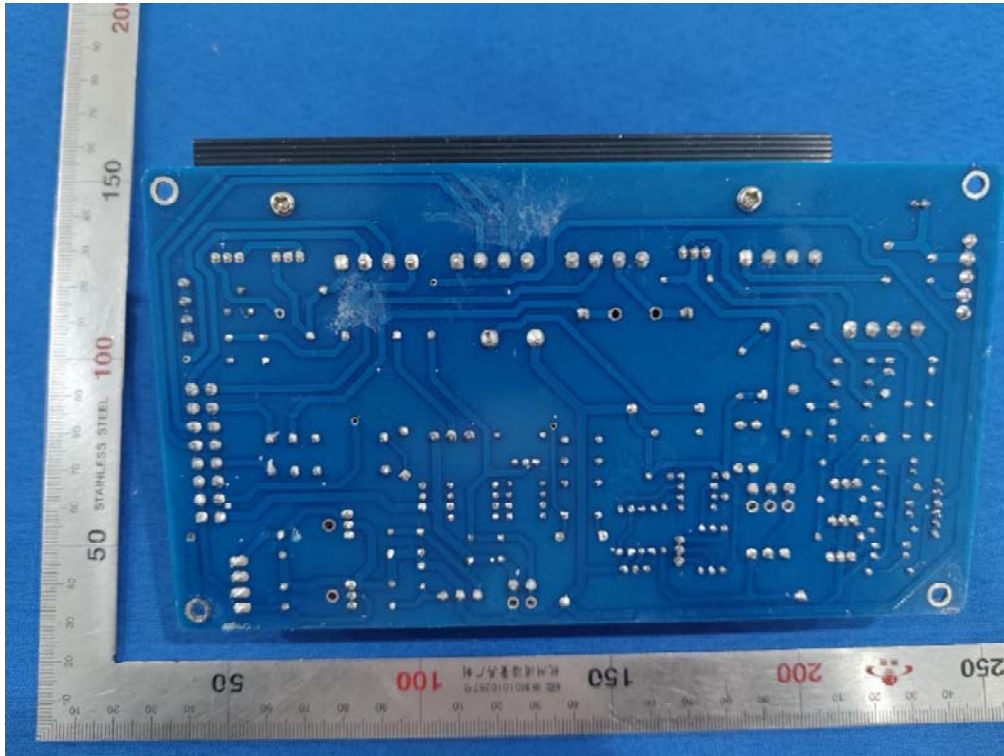

Internal-4 of the sample

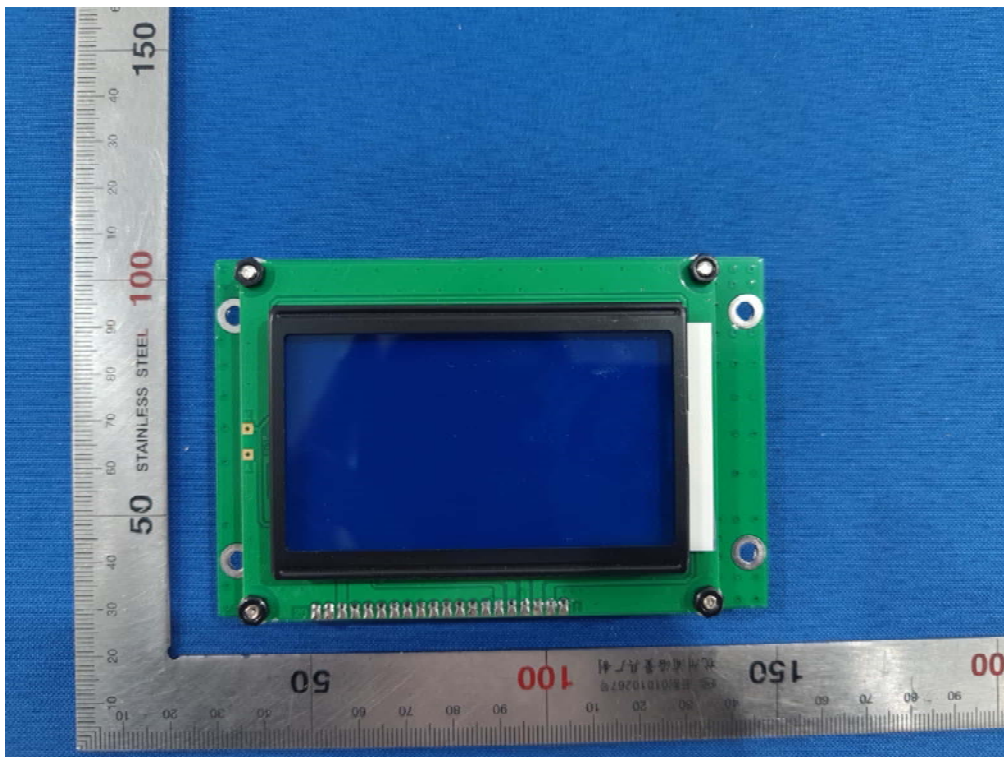


Internal-5 of the sample

TEST REPORT


Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 73 of 77

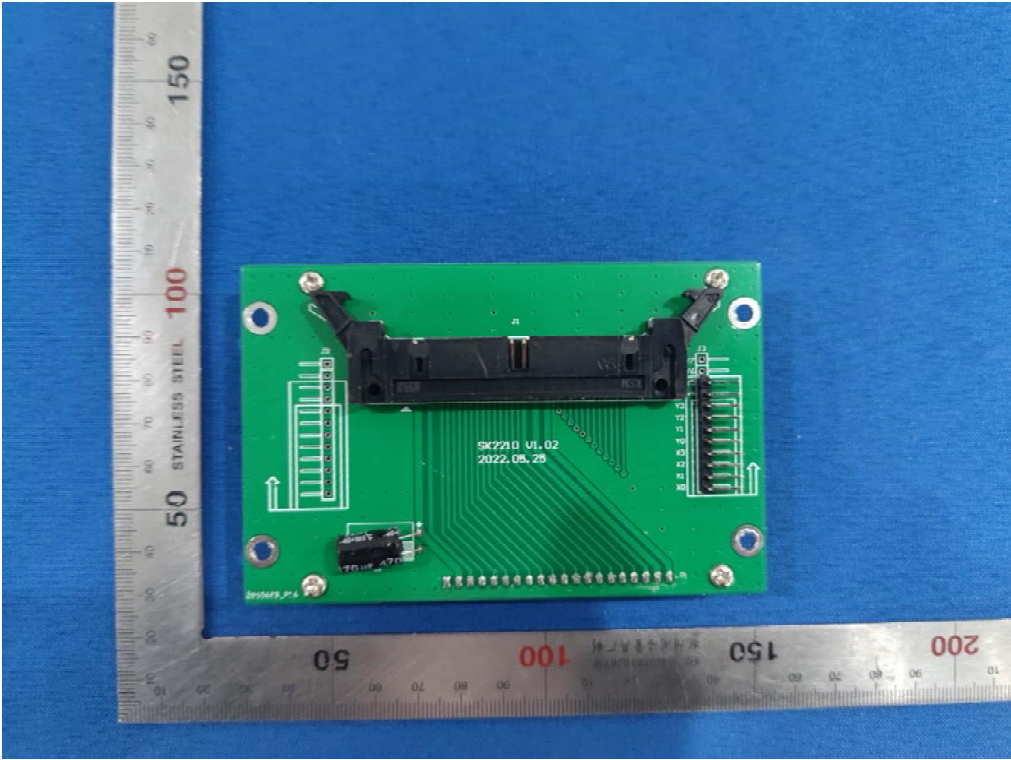


Internal-6 of the sample

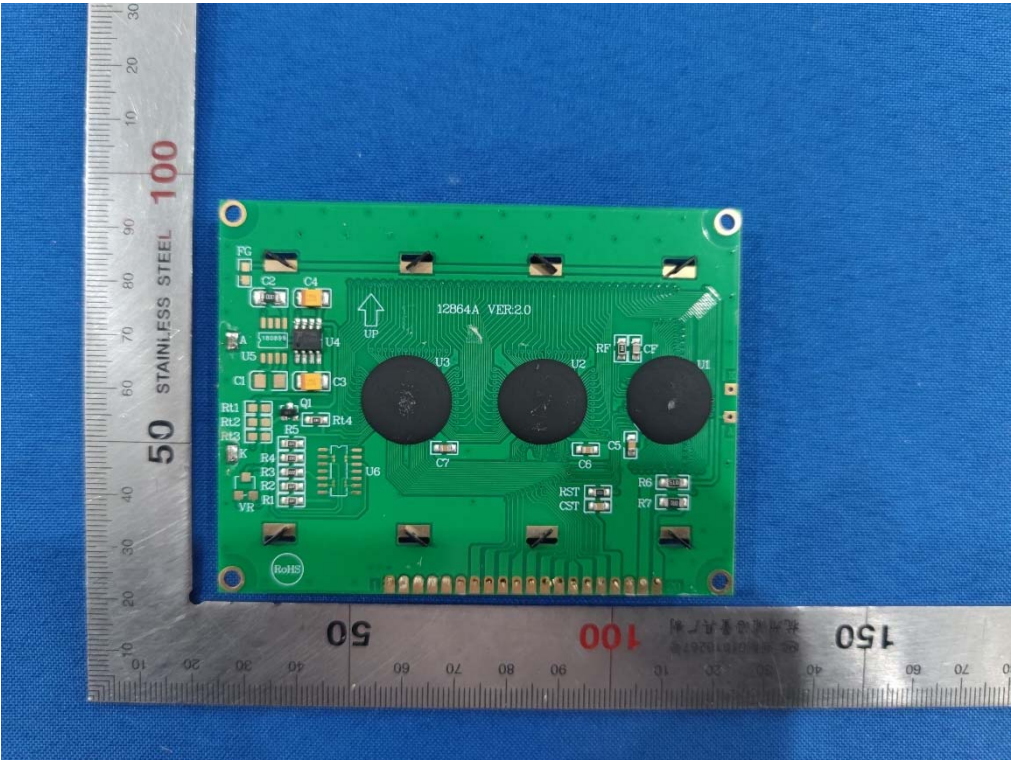


Internal-7 of the sample

TEST REPORT

Report No.: SHE23100070-02DE Date: 2023-12-05 Page 74 of 77

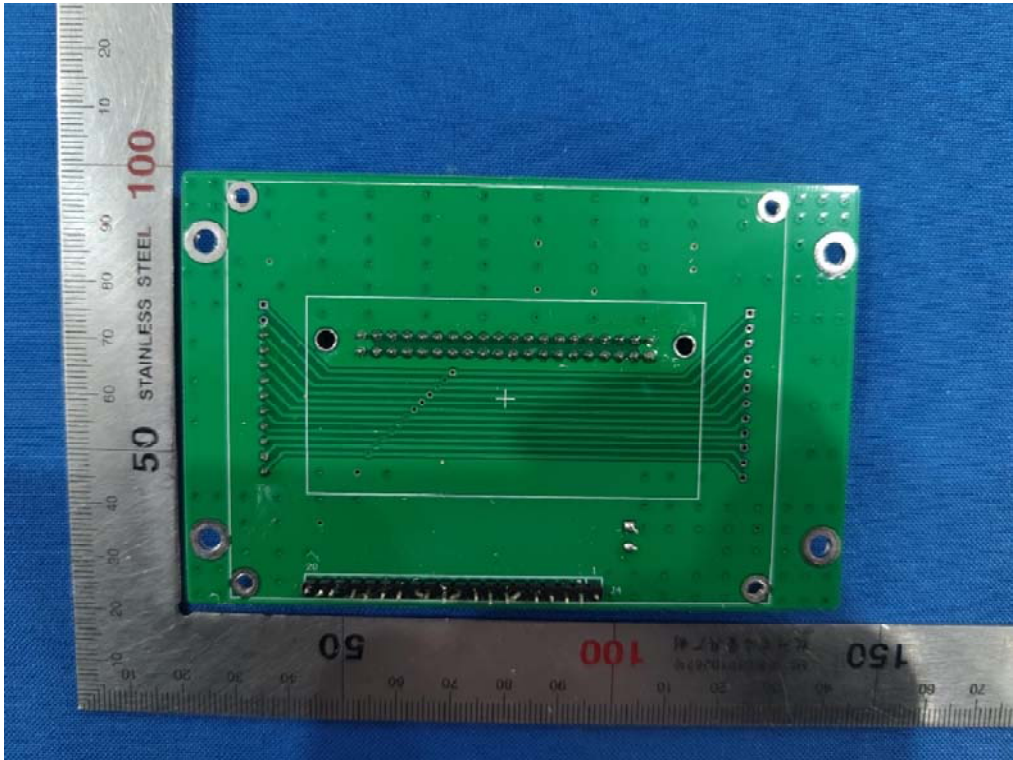


Internal-8 of the sample

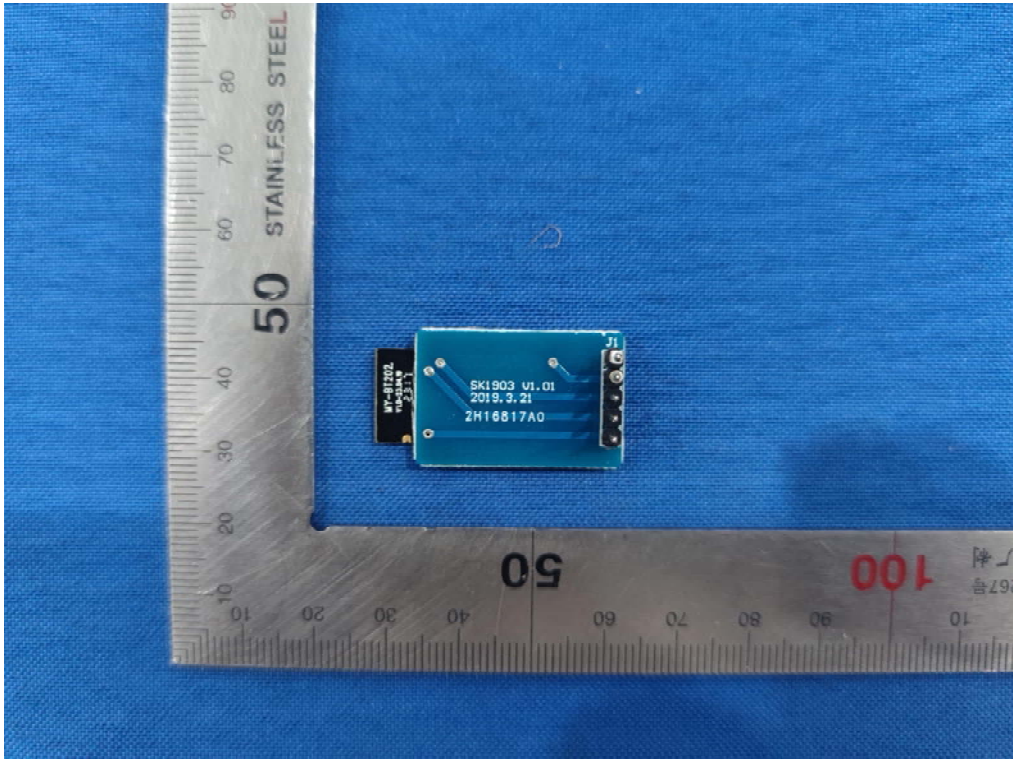


Internal-9 of the sample

TEST REPORT

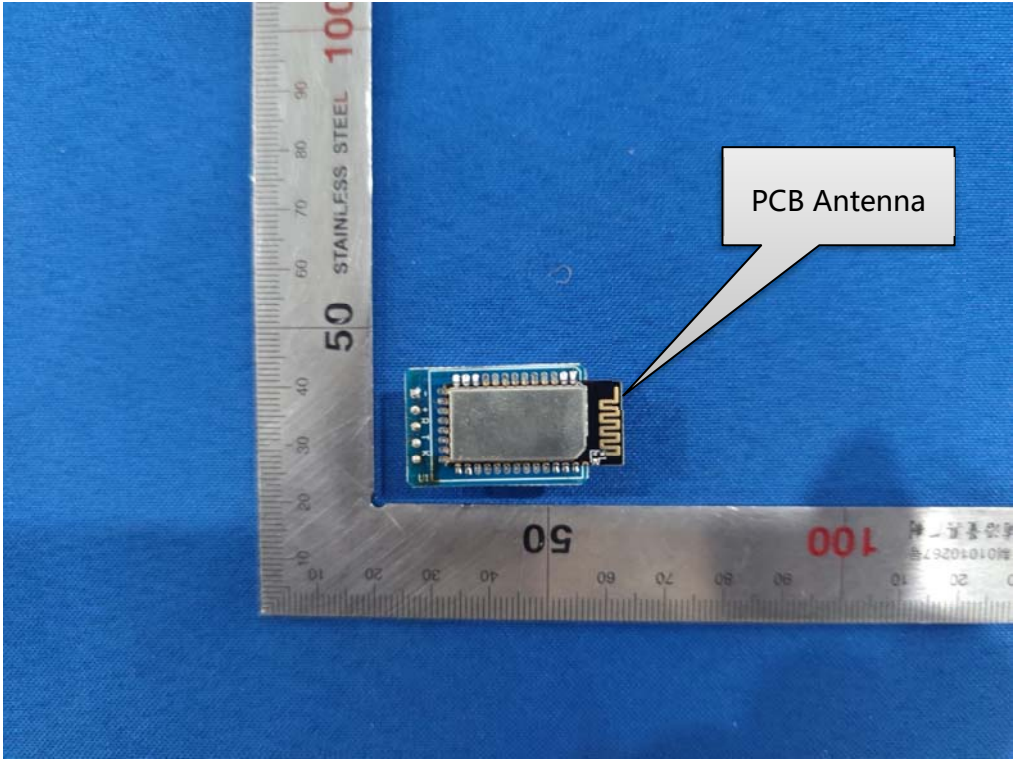

Internal-10 of the sample

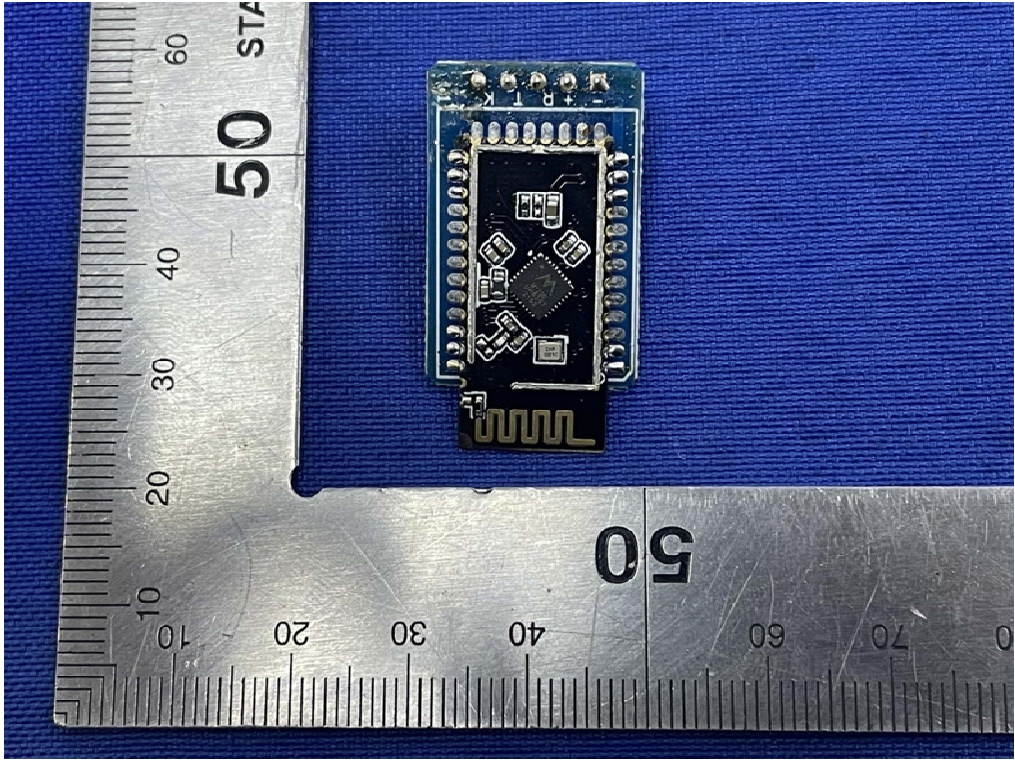

Internal-11 of the sample

TEST REPORT

Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 76 of 77

5.2 Set-up for Conducted Emission on AC Mains



5.3 Set-up for Conducted RF test at Antenna Port




TEST REPORT

Report No.: SHE23100070-02DE

Date: 2023-12-05

Page 77 of 77

5.4 Set-up for Radiated Spurious Emissions below 1GHz

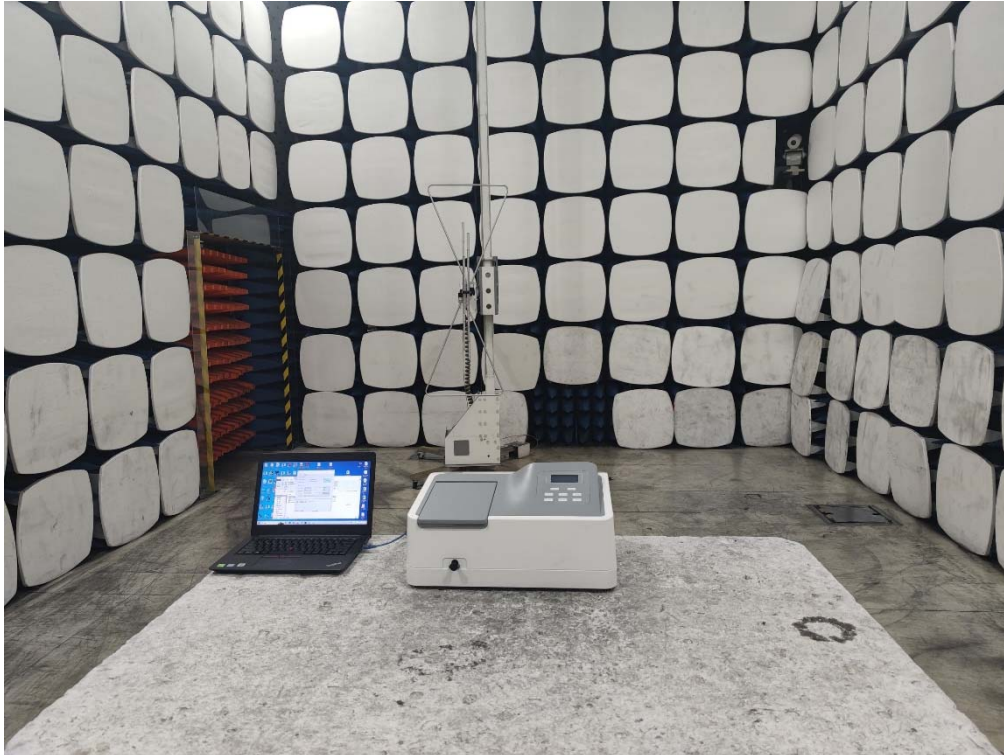

5.5 Set-up for Radiated Spurious Emissions above 1GHz



End of the report