







Test Graphs

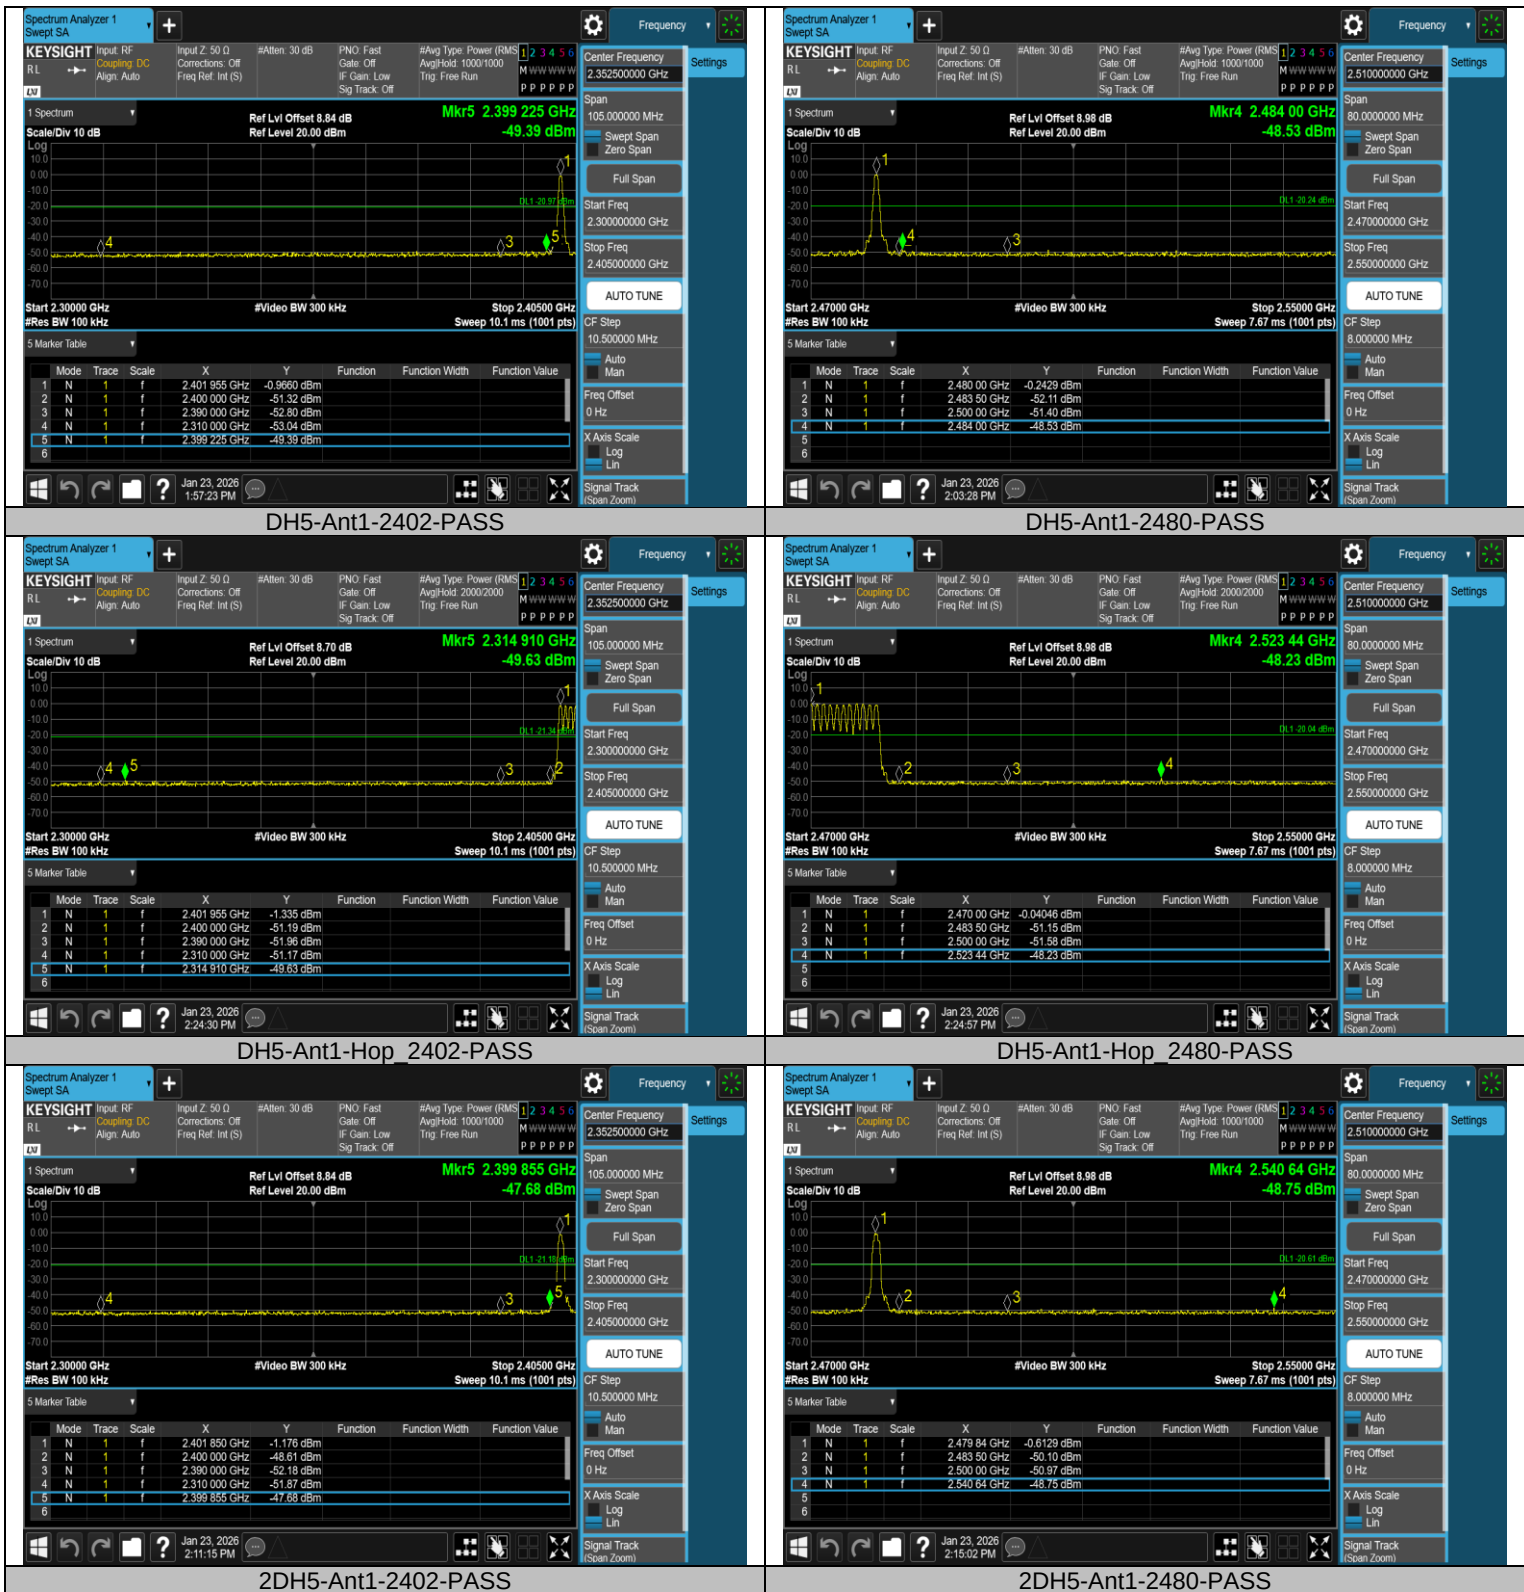

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

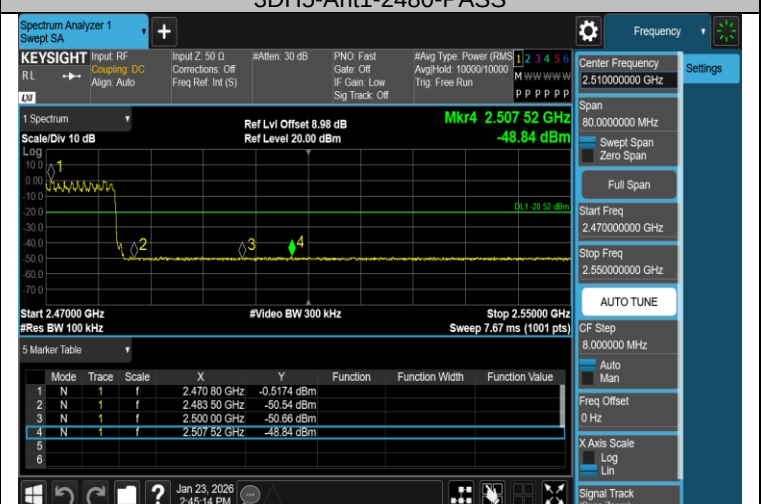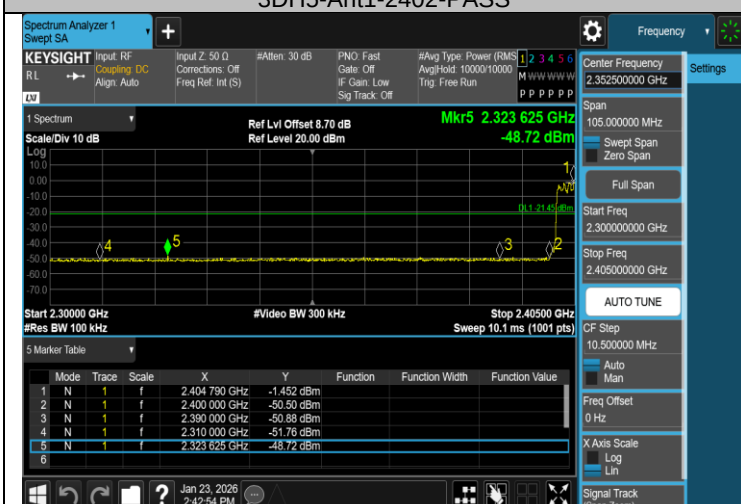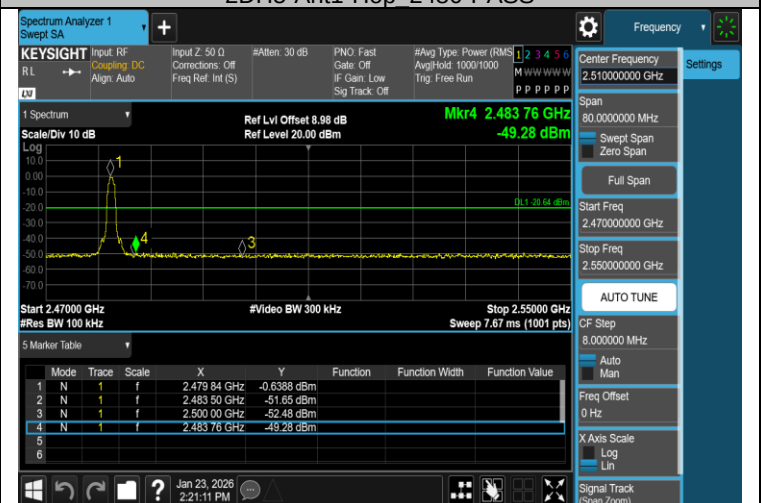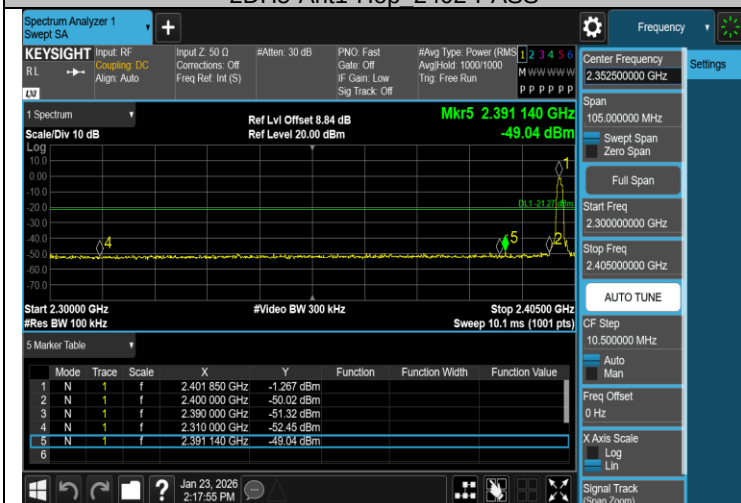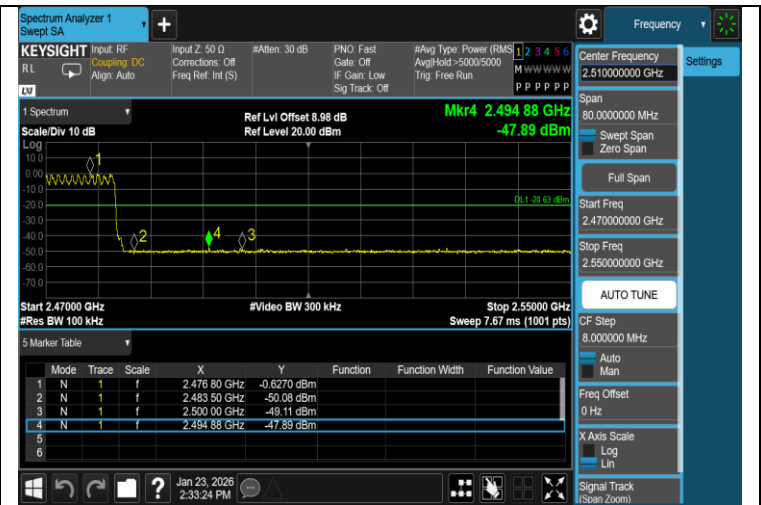

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Appendix H: Conducted Spurious Emission


Test Result

TestMode	Antenna	Channel [MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-1.17	-1.17	---	PASS
DH5	Ant1	2402	30~1000	-1.17	-62.18	≤-21.17	PASS
DH5	Ant1	2402	1000~26500	-1.17	-33.4	≤-21.17	PASS
DH5	Ant1	2441	0~Reference	-1.40	-1.40	---	PASS
DH5	Ant1	2441	30~1000	-1.40	-62.16	≤-21.4	PASS
DH5	Ant1	2441	1000~26500	-1.40	-34.24	≤-21.4	PASS
DH5	Ant1	2480	0~Reference	-0.60	-0.60	---	PASS
DH5	Ant1	2480	30~1000	-0.60	-61.6	≤-20.6	PASS
DH5	Ant1	2480	1000~26500	-0.60	-36.94	≤-20.6	PASS
2DH5	Ant1	2402	0~Reference	-1.29	-1.29	---	PASS
2DH5	Ant1	2402	30~1000	-1.29	-61.35	≤-21.29	PASS
2DH5	Ant1	2402	1000~26500	-1.29	-35.3	≤-21.29	PASS
2DH5	Ant1	2441	0~Reference	-1.48	-1.48	---	PASS
2DH5	Ant1	2441	30~1000	-1.48	-61.45	≤-21.48	PASS
2DH5	Ant1	2441	1000~26500	-1.48	-33.2	≤-21.48	PASS
2DH5	Ant1	2480	0~Reference	-0.71	-0.71	---	PASS
2DH5	Ant1	2480	30~1000	-0.71	-62.09	≤-20.71	PASS
2DH5	Ant1	2480	1000~26500	-0.71	-36.79	≤-20.71	PASS
3DH5	Ant1	2402	0~Reference	-1.24	-1.24	---	PASS
3DH5	Ant1	2402	30~1000	-1.24	-61.88	≤-21.24	PASS
3DH5	Ant1	2402	1000~26500	-1.24	-39.55	≤-21.24	PASS
3DH5	Ant1	2441	0~Reference	-1.43	-1.43	---	PASS
3DH5	Ant1	2441	30~1000	-1.43	-61.95	≤-21.43	PASS
3DH5	Ant1	2441	1000~26500	-1.43	-32.3	≤-21.43	PASS
3DH5	Ant1	2480	0~Reference	-0.67	-0.67	---	PASS
3DH5	Ant1	2480	30~1000	-0.67	-61.42	≤-20.67	PASS
3DH5	Ant1	2480	1000~26500	-0.67	-37.66	≤-20.67	PASS

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Test Graphs

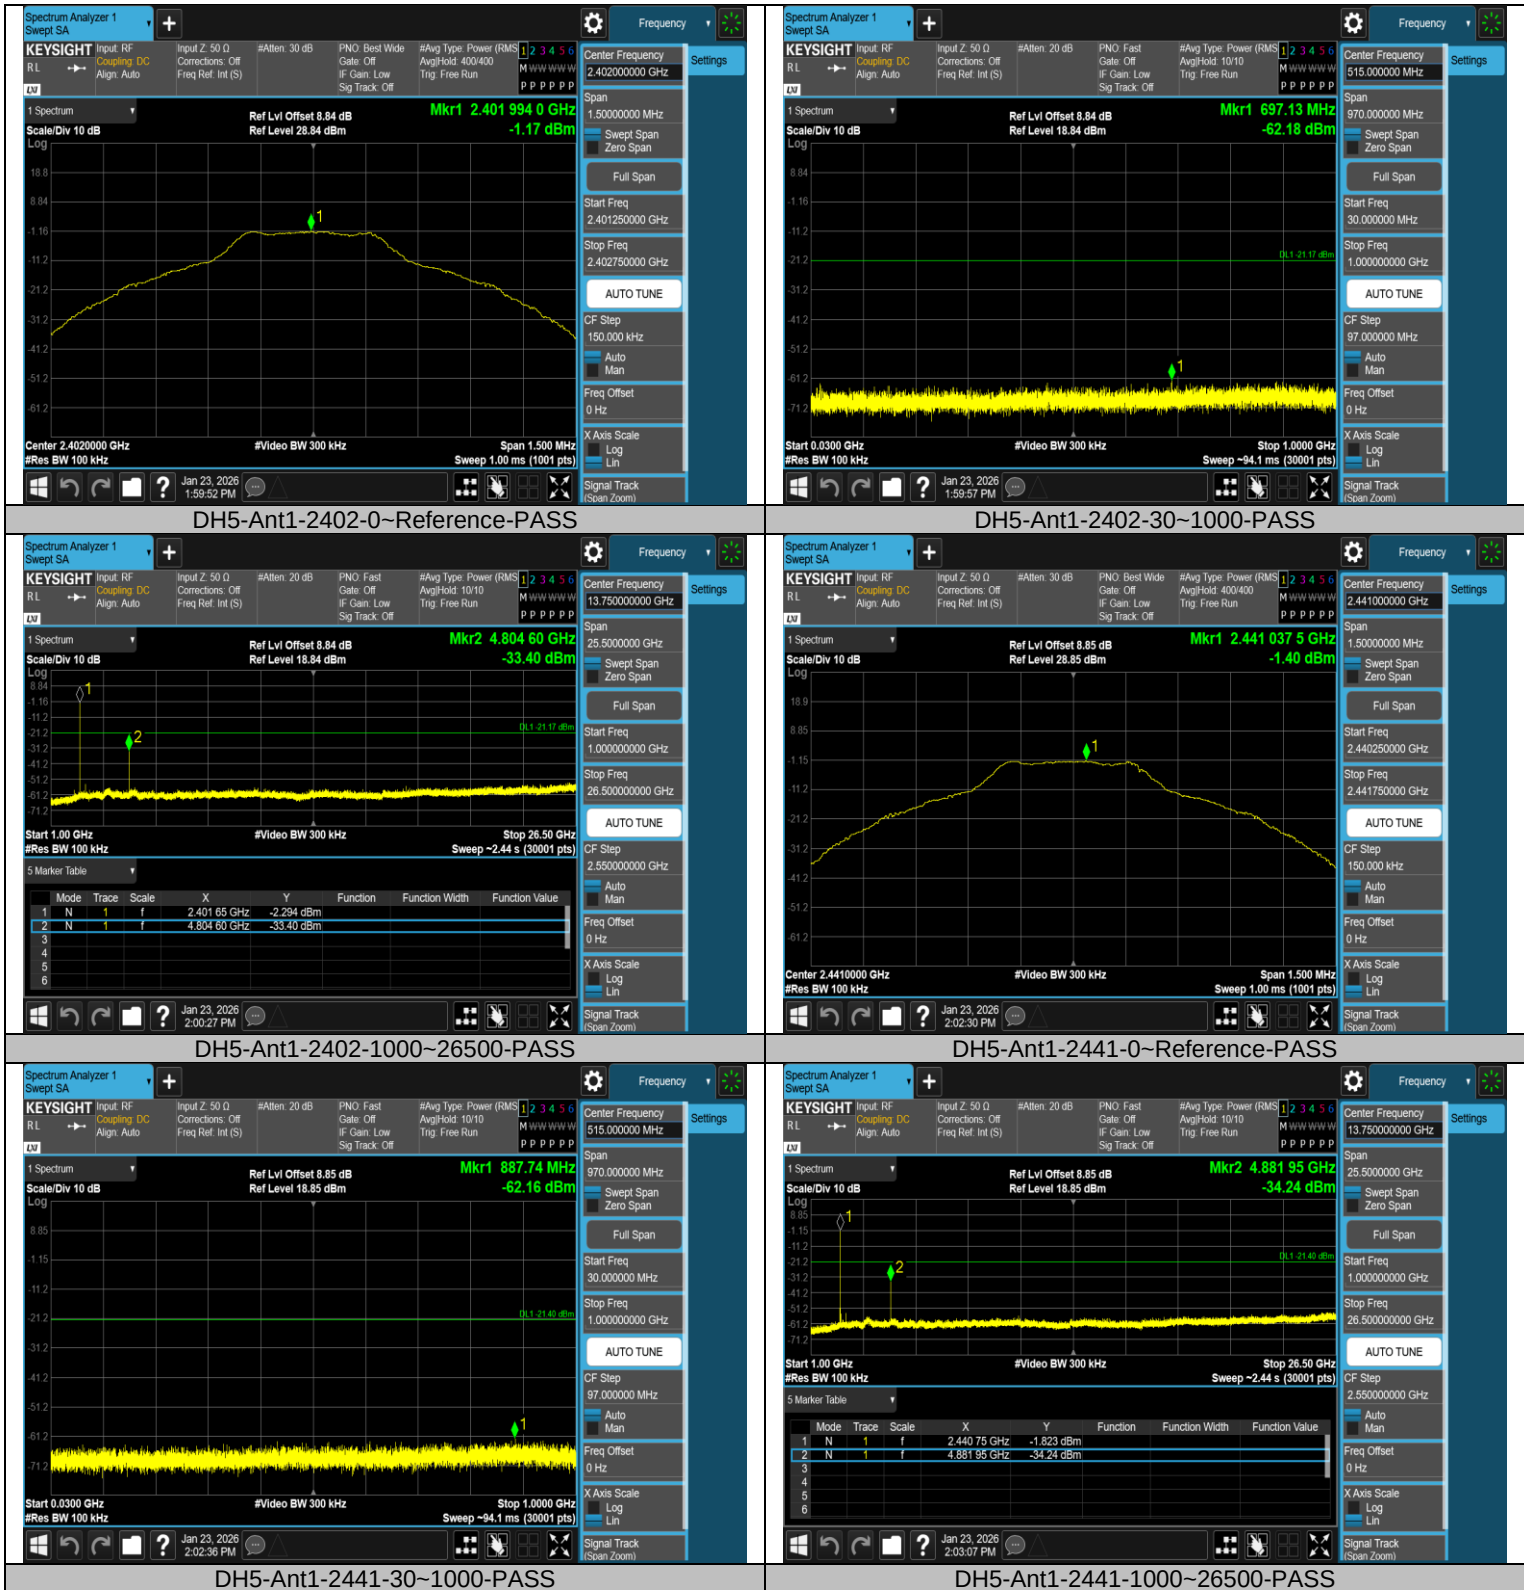

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China




DH5-Ant1-2480-0~Reference-PASS




DH5-Ant1-2480-30~1000-PASS



DH5-Ant1-2480-1000~26500-PASS

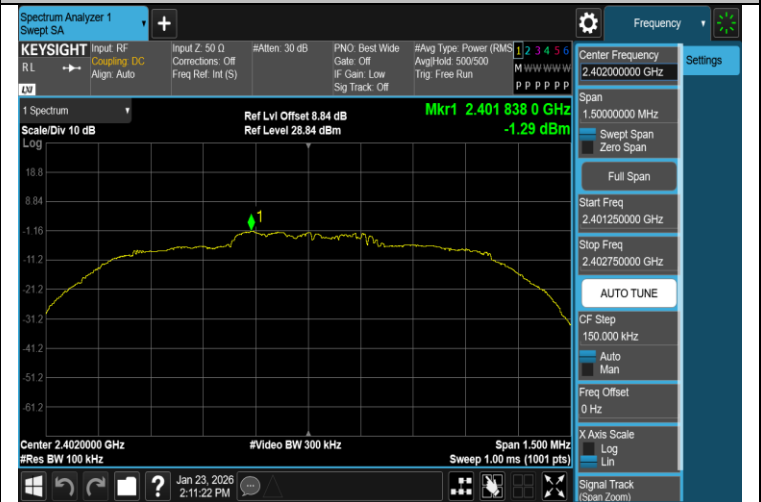

2DH5-Ant1-2402-0~Reference-PASS

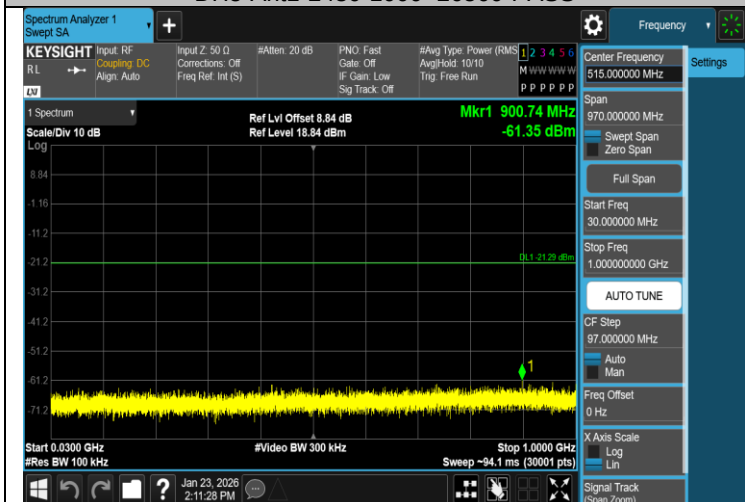

2DH5-Ant1-2402-30~1000-PASS




2DH5-Ant1-2402-1000~26500-PASS

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.




Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

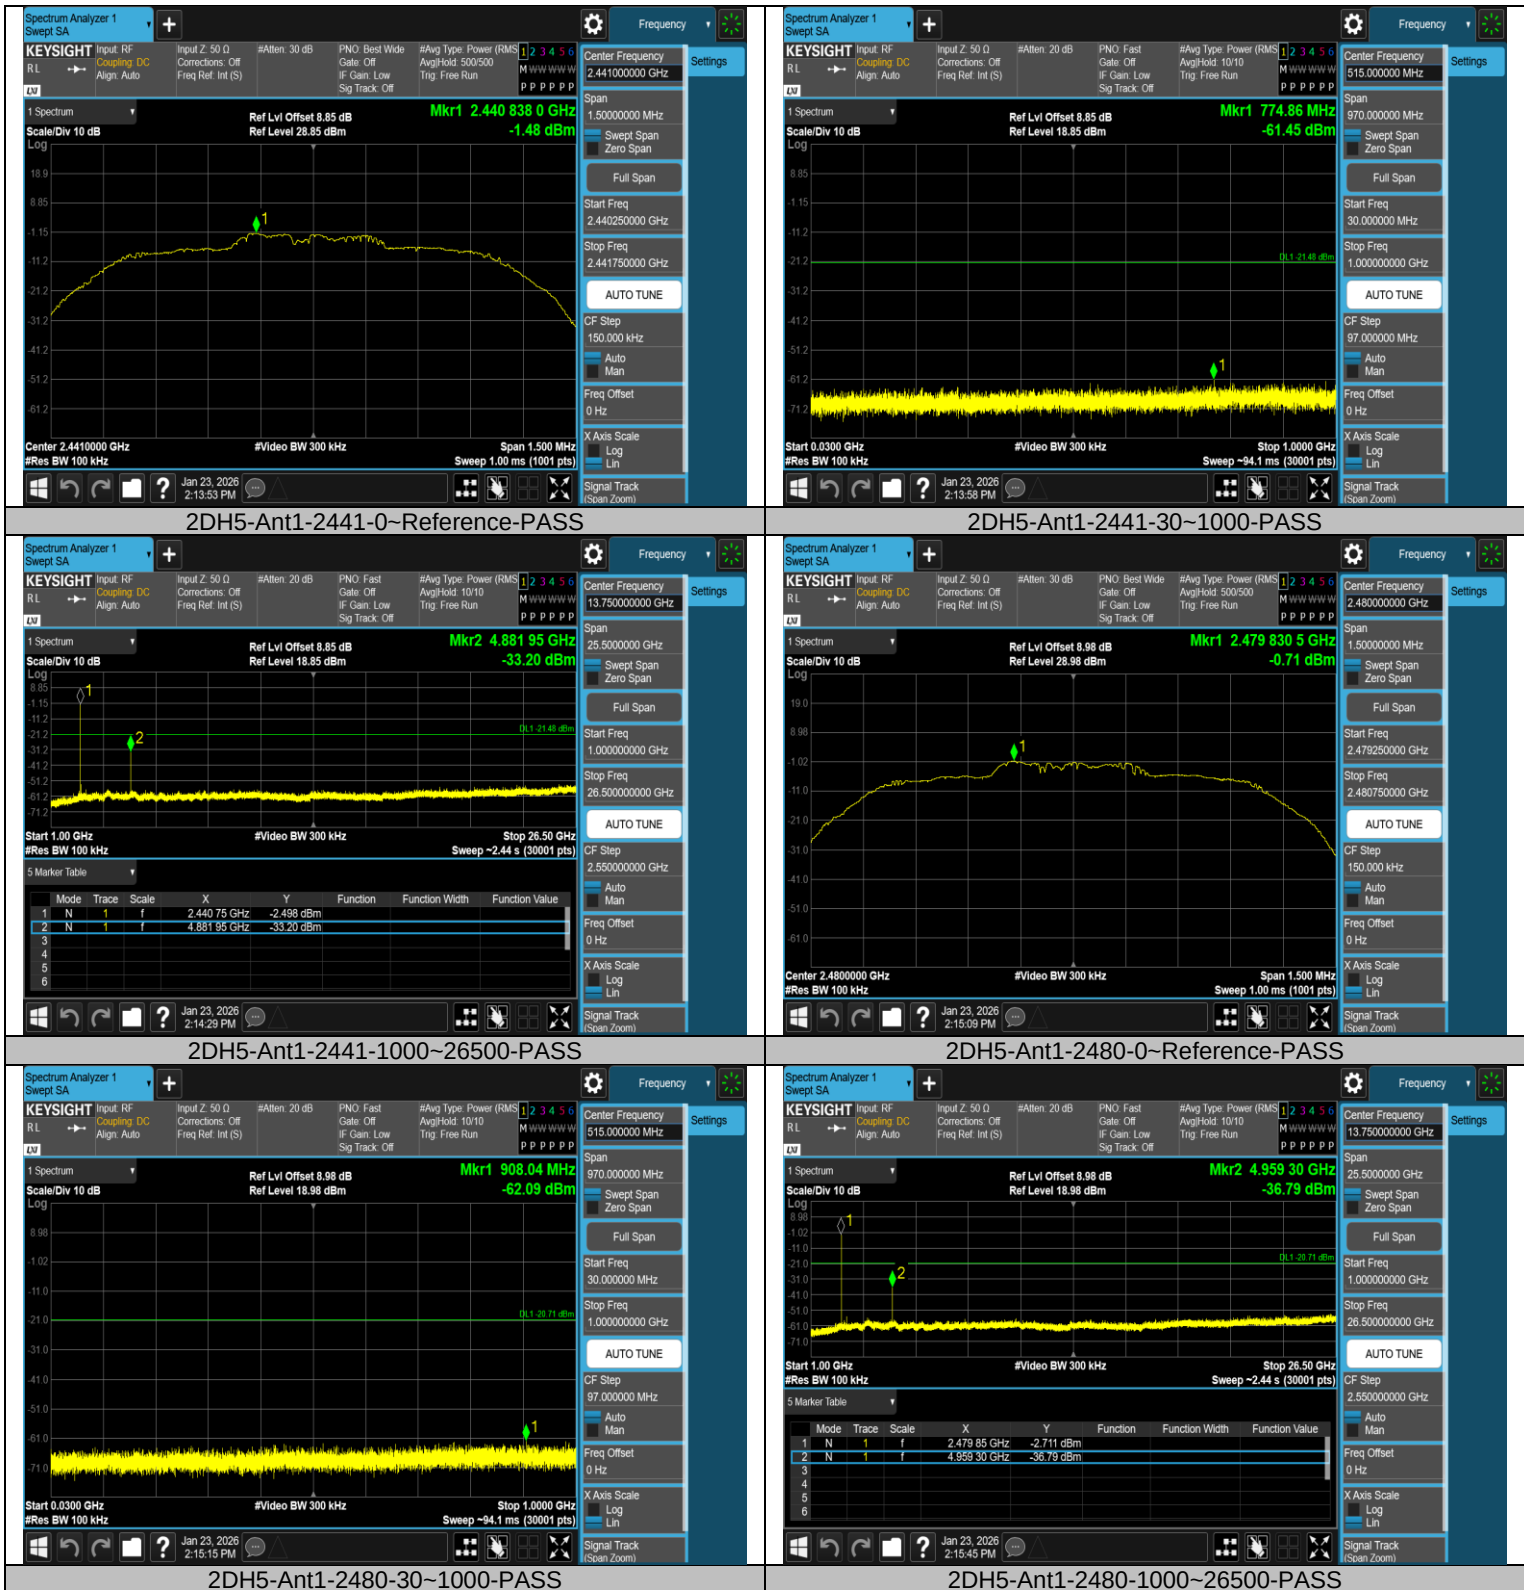

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.



Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

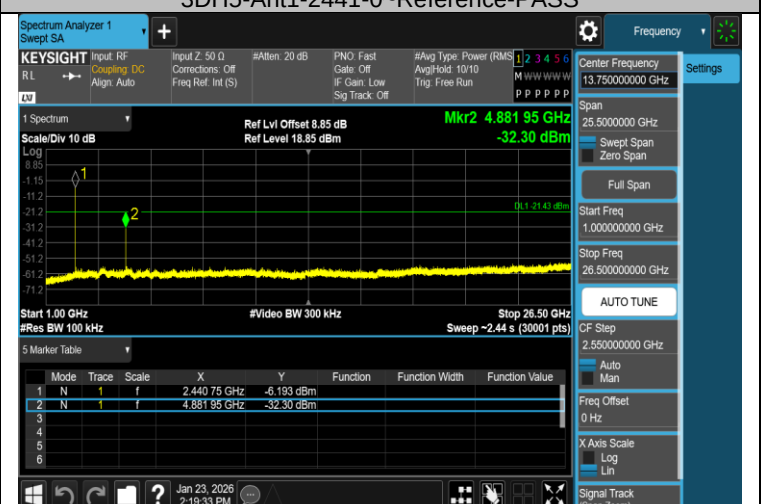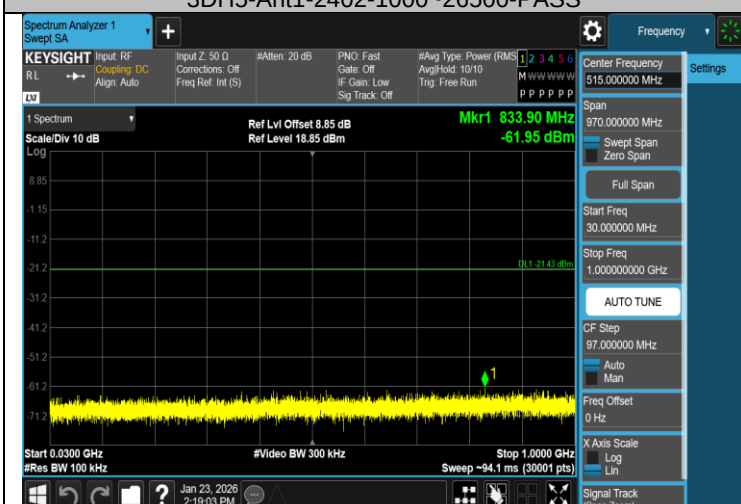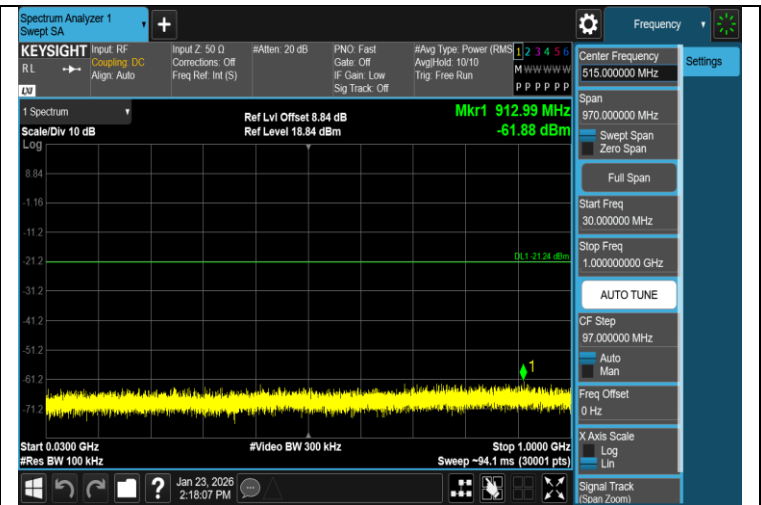

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

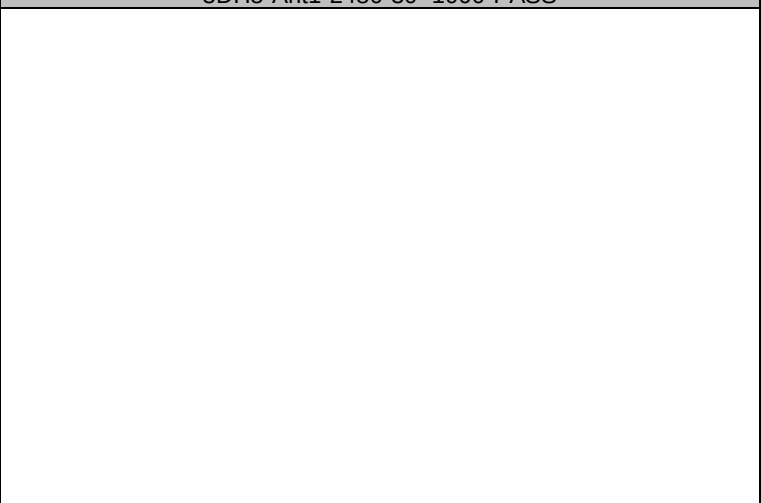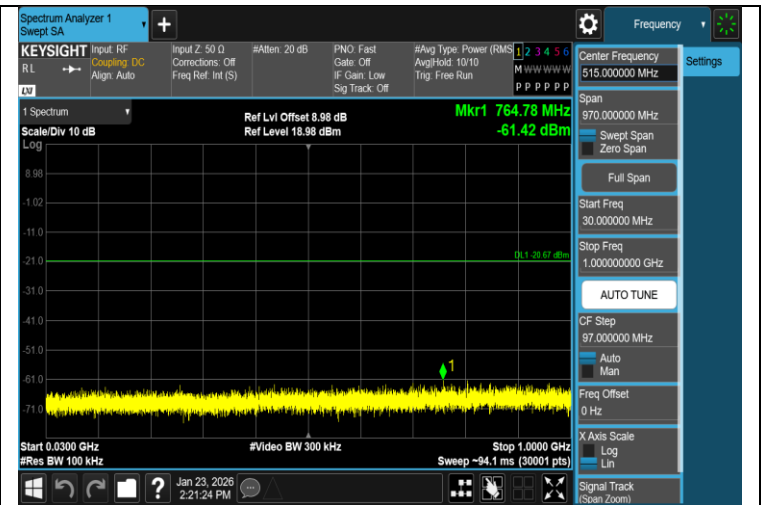

Appendix I: Duty Cycle


Test Result

TestMode	Antenna	Channel [MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.90	3.75	77.33	1.12
DH5	Ant1	2441	2.90	3.75	77.33	1.12
DH5	Ant1	2480	2.90	3.75	77.33	1.12
2DH5	Ant1	2402	2.90	3.75	77.33	1.12
2DH5	Ant1	2441	2.91	3.75	77.60	1.10
2DH5	Ant1	2480	2.91	3.75	77.60	1.10
3DH5	Ant1	2402	2.91	3.75	77.60	1.10
3DH5	Ant1	2441	2.91	3.75	77.60	1.10
3DH5	Ant1	2480	2.90	3.75	77.33	1.12


Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China


Test Graphs

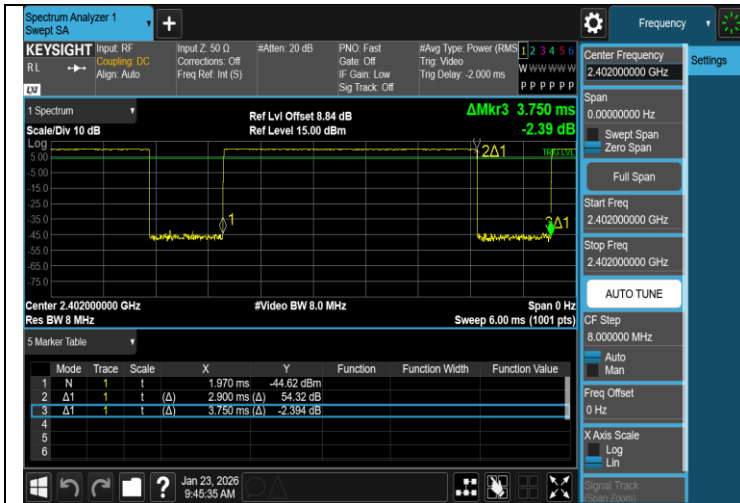


NTNV-DH5-Ant1-2402

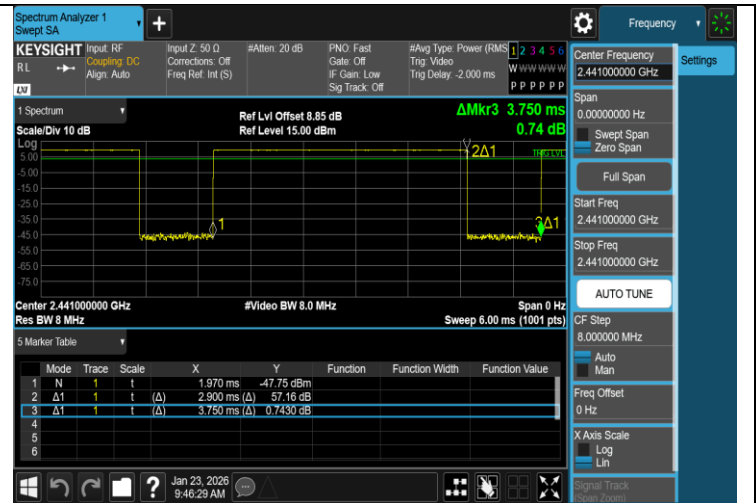


NTNV-DH5-Ant1-2441

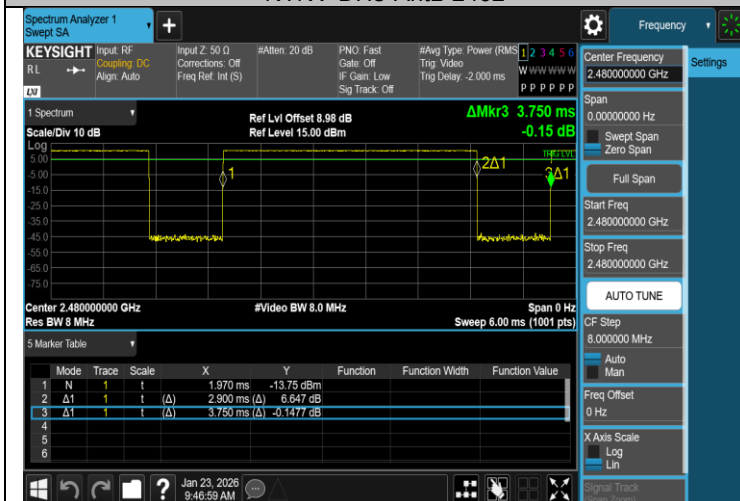


NTNV-DH5-Ant1-2480

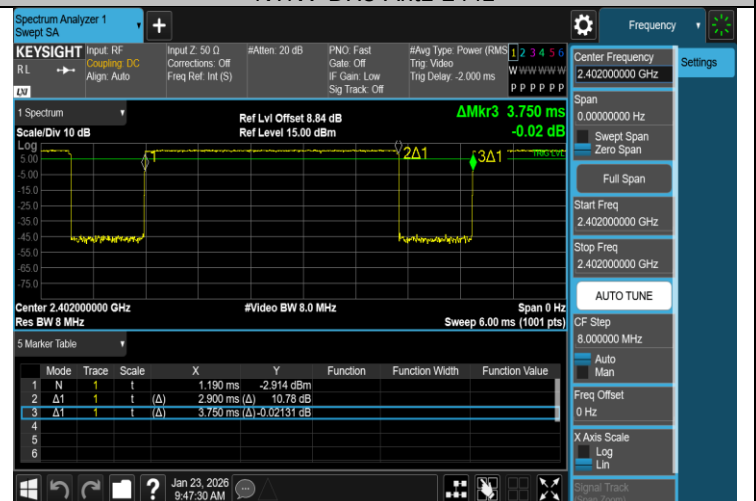

NTNV-2DH5-Ant1-2402

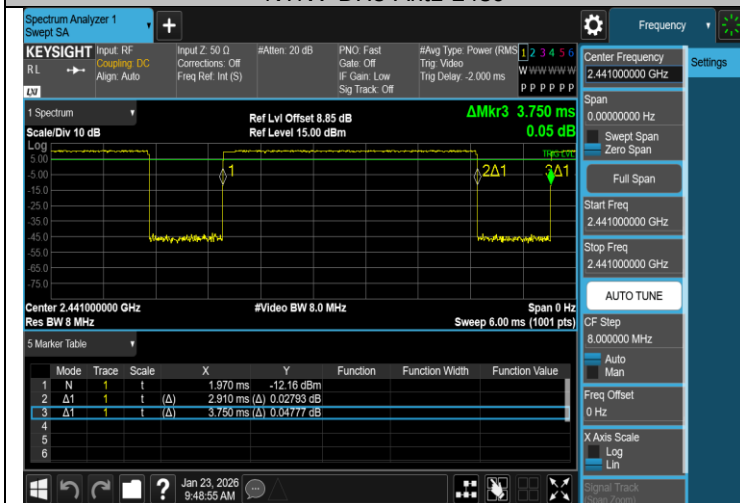

NTNV-2DH5-Ant1-2441

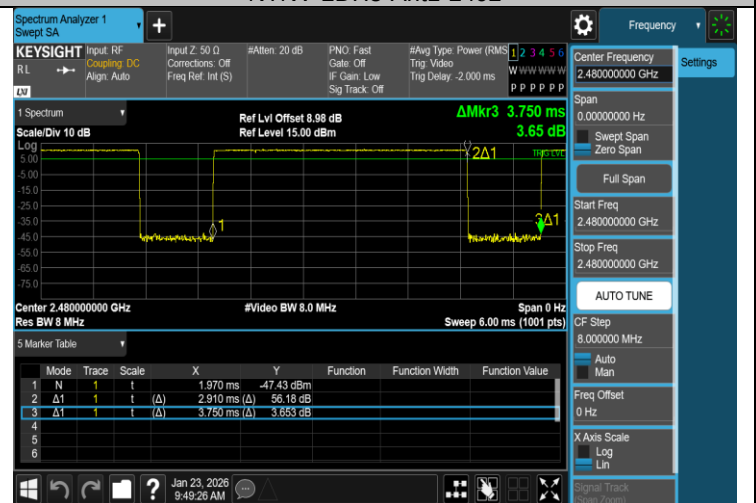


NTNV-2DH5-Ant1-2480


Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.


Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

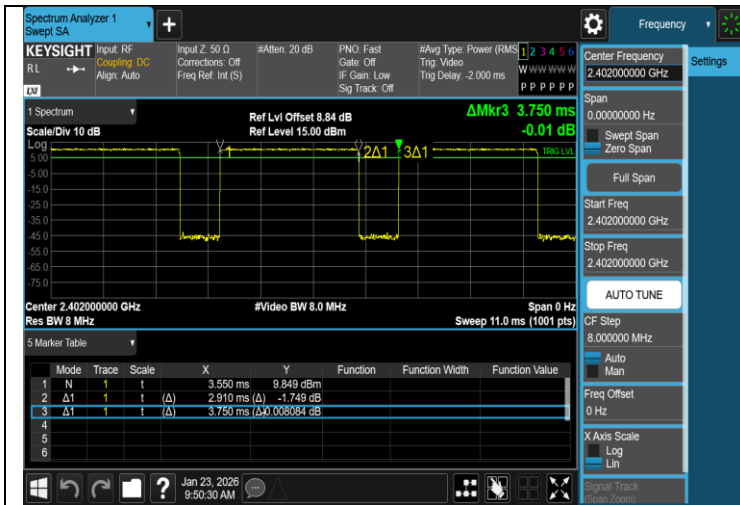

NTVN-3DH5-Ant1-2402

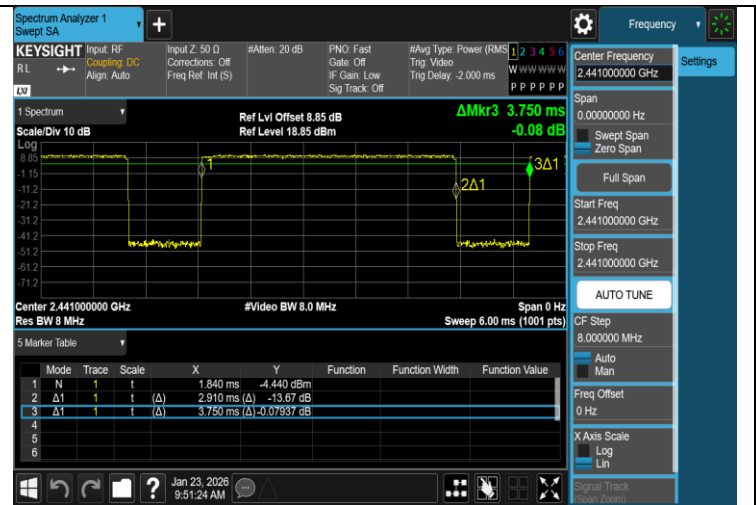

NTVN-3DH5-Ant1-2441

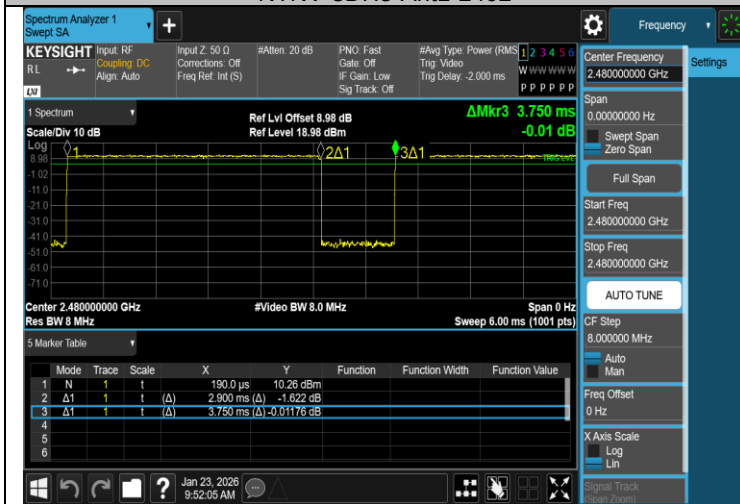

NTVN-3DH5-Ant1-2480

Appendix J: Emissions in Restricted Bands

The report only records the worst-case emission levels.

For radiated emissions in the frequency range of 9 kHz to 30 MHz, a preliminary scan was performed. Per FCC §15.31(o), emissions that were more than 20 dB below the applicable limit are not reported. For radiated emissions at frequencies above 1 GHz, per ANSI C63.10-2020, Section 6.6.4.3, Note 1, if the peak measured value complies with the average limit, an average measurement is not required. Therefore, for frequencies where the peak result complies with the average limit, average (AV) emission values may be omitted from the table below.


Y13 measurement

Below 1GHz

Mode:	Normal operation	Channel:	/
Antenna:	/	State:	/

Start of Test: 2026-02-06 10:03:09

Test Graph

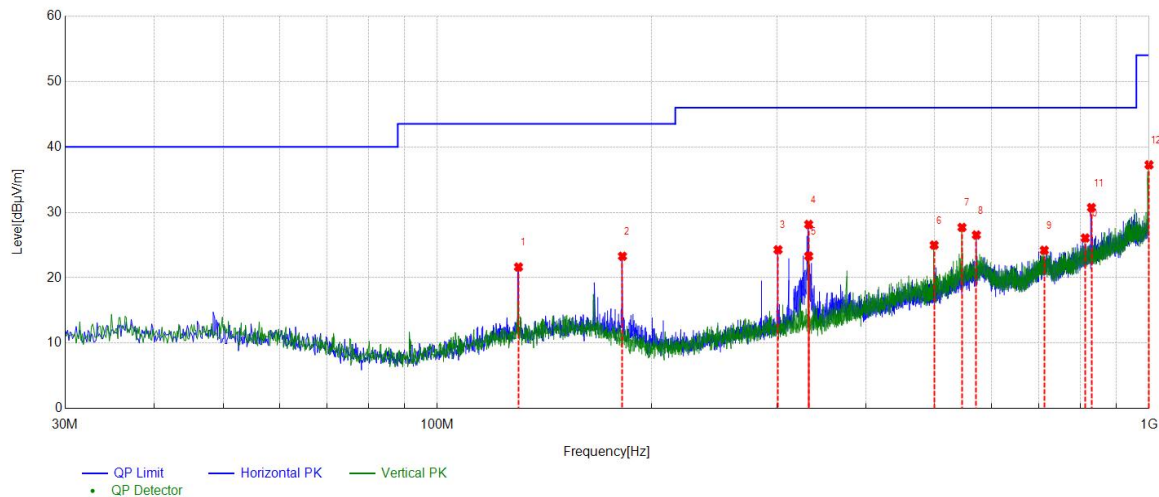

PK Suspected Data List


NO.	Freq. [MHz]	Reading [dBμV/m]	Factor [dB/m]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	130.0312	38.55	-16.91	21.64	43.50	21.86	100	330	Horizontal	PASS
2	182.0475	40.97	-17.68	23.29	43.50	20.21	100	159	Horizontal	PASS
3	301.1150	39.92	-15.64	24.28	46.00	21.72	100	283	Horizontal	PASS
4	332.5188	43.25	-15.10	28.15	46.00	17.85	100	349	Horizontal	PASS
5	332.5188	38.41	-15.10	23.31	46.00	22.69	100	350	Vertical	PASS
6	498.9950	36.61	-11.61	25.00	46.00	21.00	100	156	Vertical	PASS
7	546.0400	37.89	-10.19	27.70	46.00	18.30	100	320	Vertical	PASS
8	571.9875	35.94	-9.40	26.54	46.00	19.46	100	278	Horizontal	PASS
9	712.5162	30.79	-6.58	24.21	46.00	21.79	100	106	Vertical	PASS
10	813.5175	30.78	-4.70	26.08	46.00	19.92	100	139	Vertical	PASS
11	830.0075	35.12	-4.39	30.73	46.00	15.27	100	327	Horizontal	PASS
12	1000.0000	38.45	-1.19	37.26	54.00	16.74	100	208	Vertical	PASS

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.


Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Above 1GHz

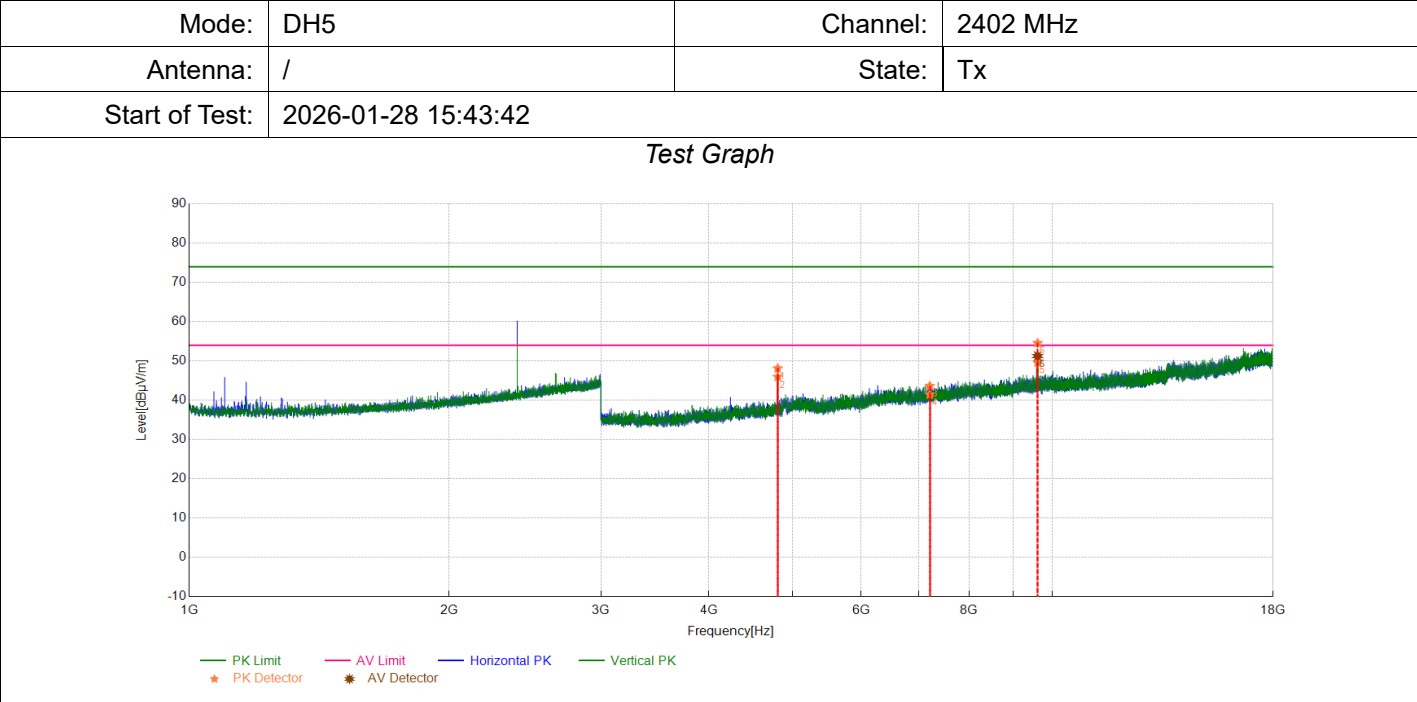

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	62.67	48.14	74.00	25.86			54.00		117.2	72.4	Vertical	PASS
2	4804.0000	-14.53	60.508	45.98	74.00	28.02			54.00		104.8	22.9	Horizontal	PASS
3	7206.0000	-9.40	53.05	43.65	74.00	30.35			54.00		150	232	Vertical	PASS
4	7206.0000	-9.40	50.89	41.49	74.00	32.51			54.00		150	176	Horizontal	PASS
5	9608.0000	-5.07	54.673	49.60	74.00	24.40			54.00		134.3	87	Horizontal	PASS
6	9608.0000	-5.07	59.66	54.59	74.00	19.41	56.332	51.26	54.00	2.74	128	108	Vertical	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

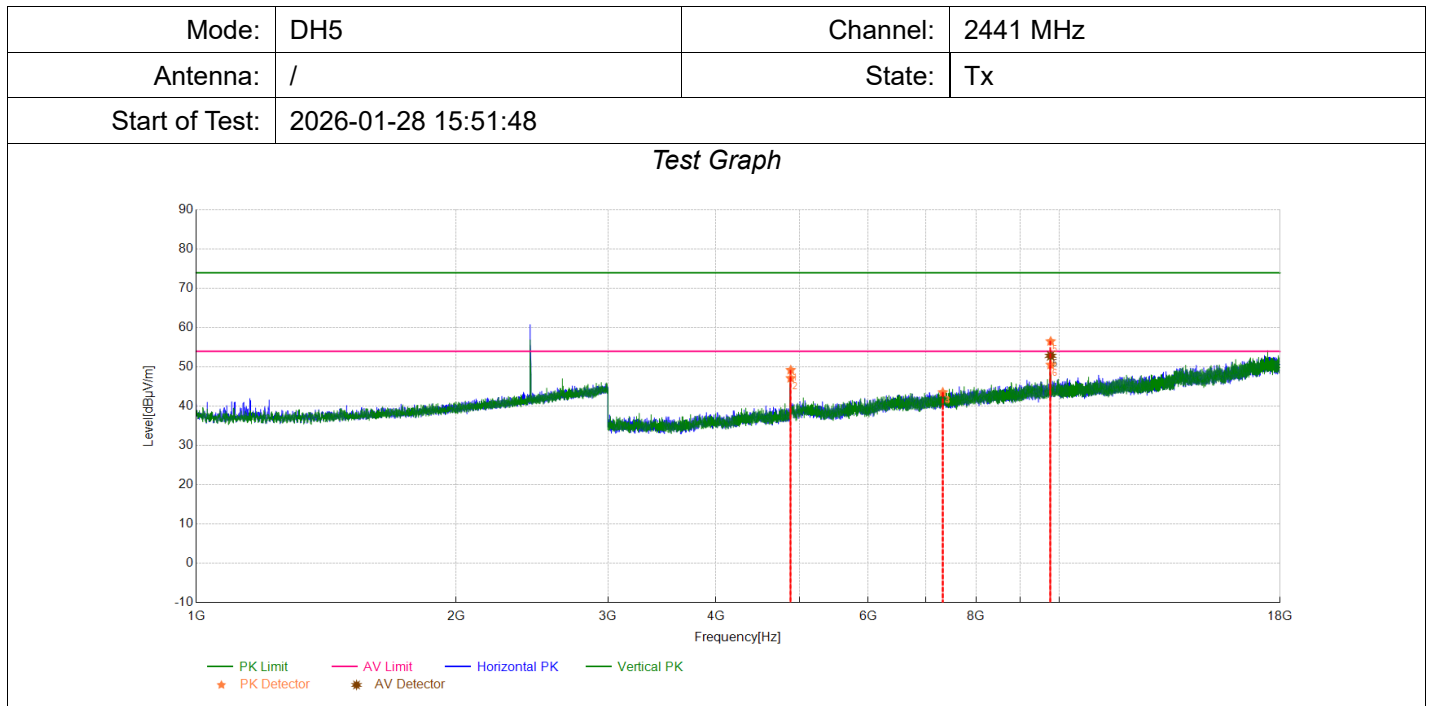


Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4882.0000	-14.00	63.235	49.24	74.00	24.76			54.00		117.2	72.4	Vertical	PASS
2	4882.0000	-14.00	61.156	47.16	74.00	26.84			54.00		104.8	22.9	Horizontal	PASS
3	7323.0000	-9.17	52.73	43.56	74.00	30.44			54.00		150	117	Horizontal	PASS
4	7323.0000	-9.17	52.58	43.41	74.00	30.59			54.00		150	240	Vertical	PASS
5	9764.0000	-4.62	61.17	56.55	74.00	17.45	57.481	52.86	54.00	1.14	128	108	Vertical	PASS
6	9764.0000	-4.62	55.176	50.56	74.00	23.44			54.00		134.3	87	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

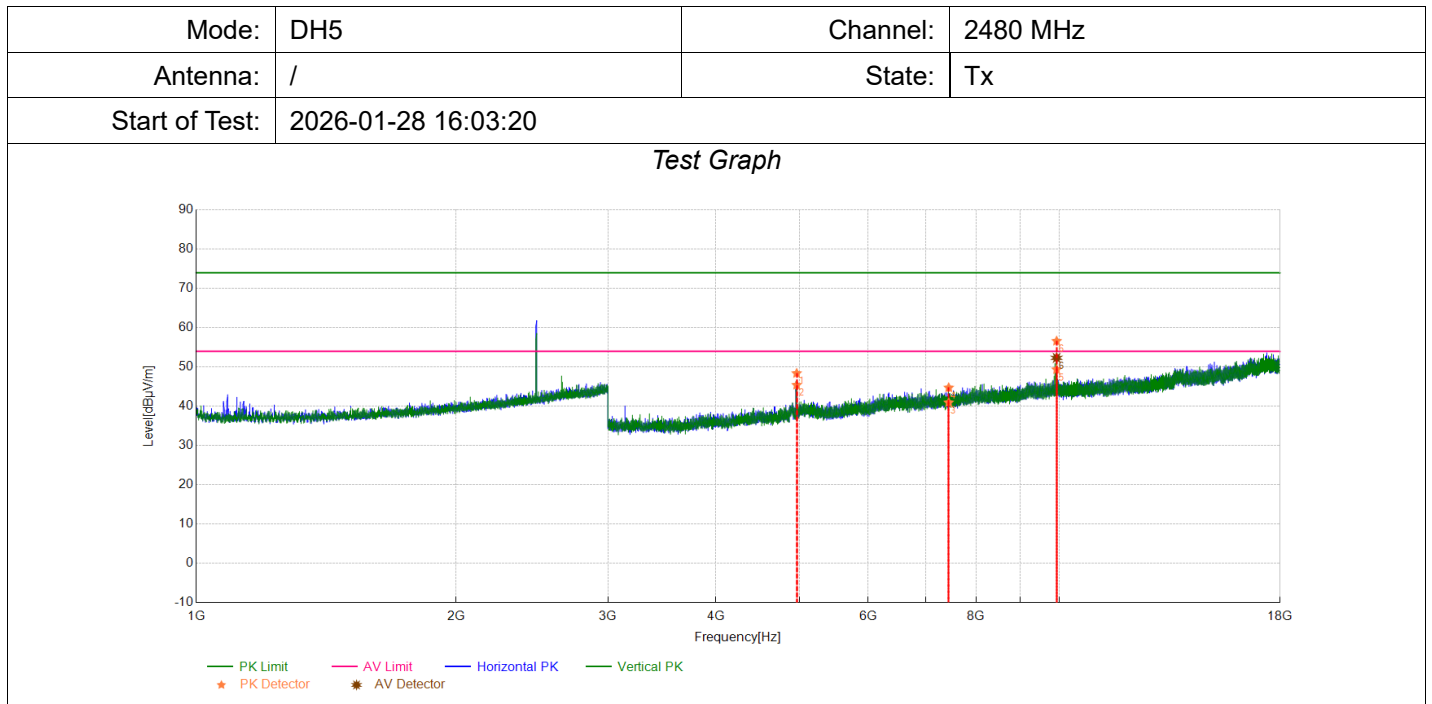

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	63.246	48.41	74.00	25.59			54.00		117.2	72.4	Vertical	PASS
2	4960.0000	-14.84	60.258	45.42	74.00	28.58			54.00		104.8	22.9	Horizontal	PASS
3	7440.0000	-8.89	49.85	40.96	74.00	33.04			54.00		150	108	Horizontal	PASS
4	7440.0000	-8.89	53.64	44.75	74.00	29.25			54.00		150	201	Vertical	PASS
5	9920.0000	-4.28	53.662	49.38	74.00	24.62			54.00		134.3	87	Horizontal	PASS
6	9920.0000	-4.28	60.901	56.62	74.00	17.38	56.611	52.33	54.00	1.67	128	108	Vertical	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

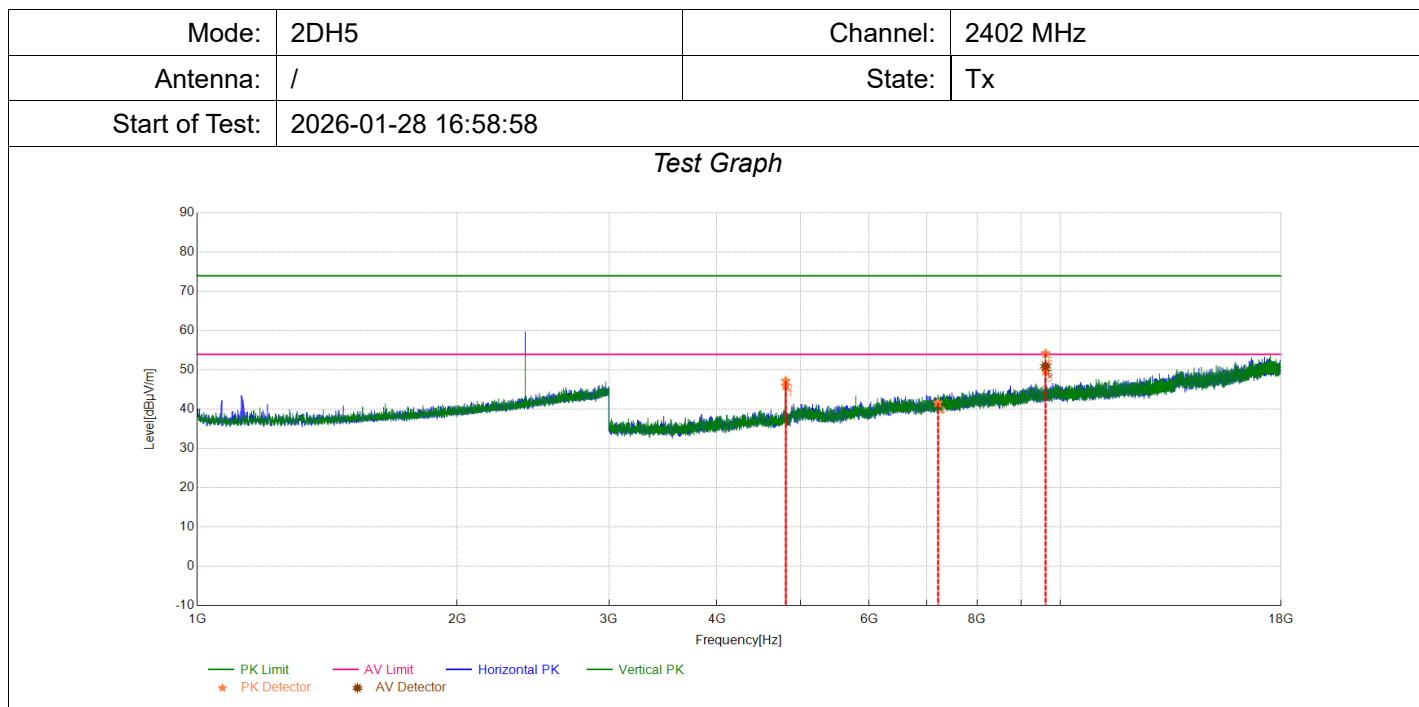

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	60.508	45.98	74.00	28.02			54.00		104.8	22.9	Horizontal	PASS
2	4804.0000	-14.53	61.784	47.25	74.00	26.75			54.00		117.2	72.4	Vertical	PASS
3	7206.0000	-9.40	51.04	41.64	74.00	32.36			54.00		150	258	Vertical	PASS
4	7206.0000	-9.40	50.86	41.46	74.00	32.54			54.00		150	101	Horizontal	PASS
5	9608.0000	-5.07	54.784	49.71	74.00	24.29			54.00		134.3	87	Horizontal	PASS
6	9608.0000	-5.07	59.294	54.22	74.00	19.78	56.03	50.96	54.00	3.04	128	108	Vertical	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-01-E04

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China