



Test Graphs

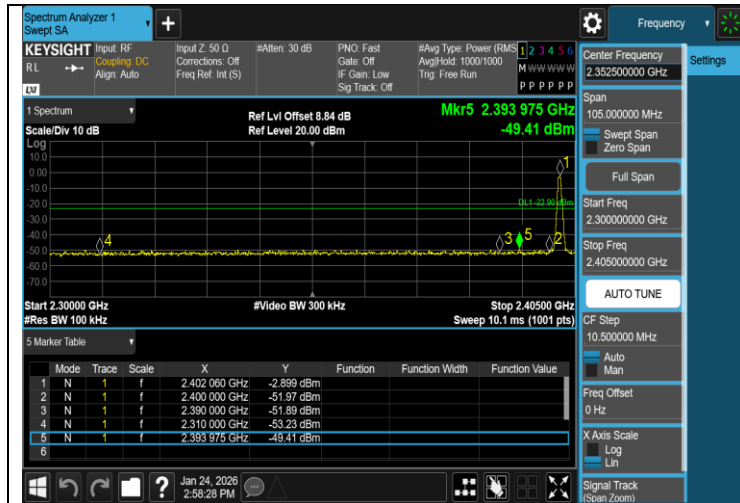

DH5-Ant1-2402-PASS

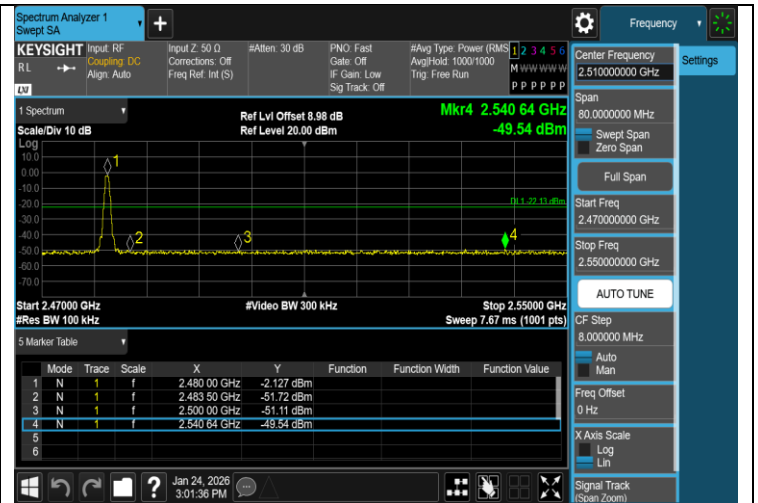


DH5-Ant1-2480-PASS




DH5-Ant1-Hop 2402-PASS



DH5-Ant1-Hop 2480-PASS

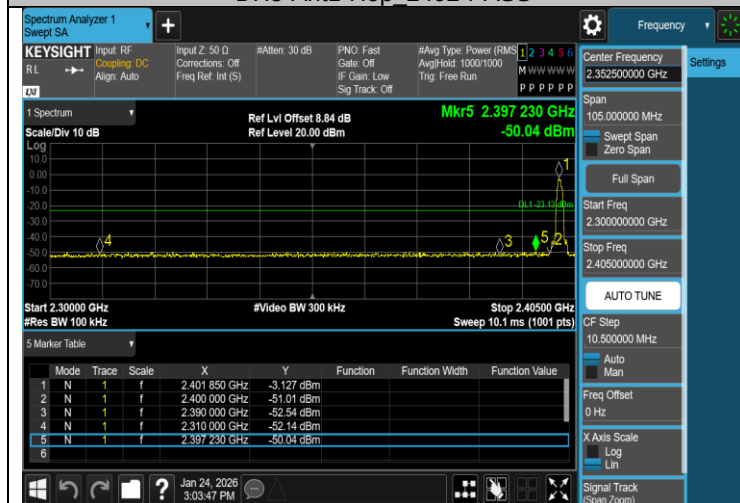

2DH5-Ant1-2402-PASS

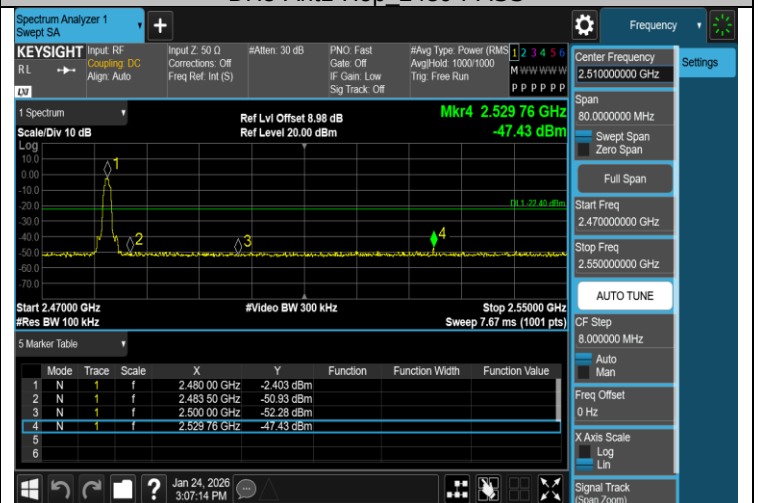


2DH5-Ant1-2480-PASS


Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

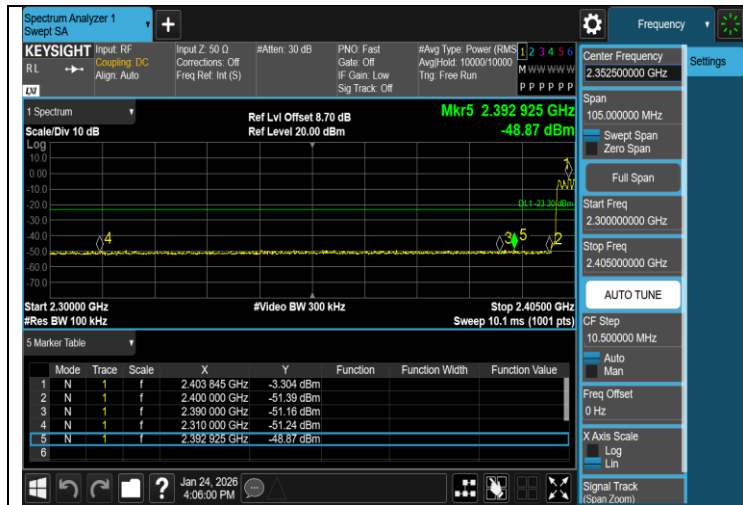


2DH5-Ant1-Hop_2402-PASS

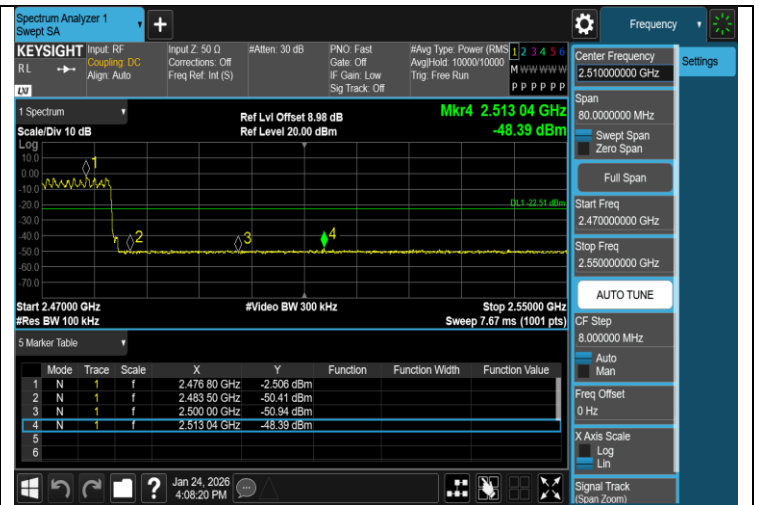

2DH5-Ant1-Hop_2480-PASS

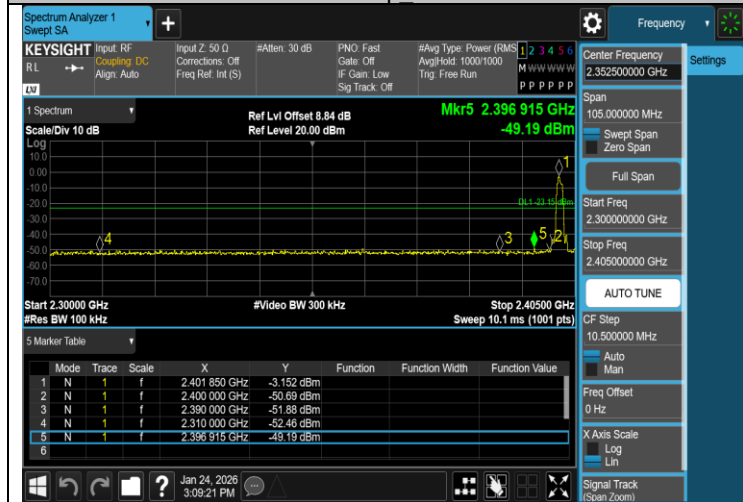

3DH5-Ant1-2402-PASS

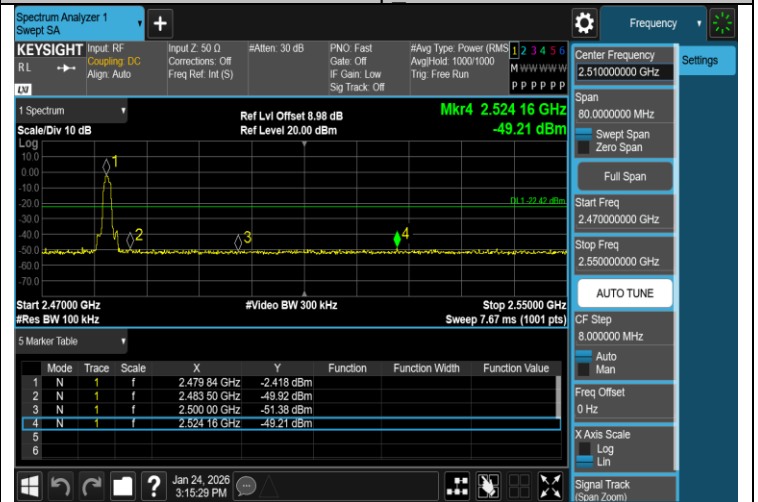

3DH5-Ant1-2480-PASS



3DH5-Ant1-Hop_2402-PASS



3DH5-Ant1-Hop_2480-PASS

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China


Appendix H: Conducted Spurious Emission

Test Result

TestMode	Antenna	Channel [MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-3.10	-3.10	---	PASS
DH5	Ant1	2402	30~1000	-3.10	-62.11	≤-23.1	PASS
DH5	Ant1	2402	1000~26500	-3.10	-37.58	≤-23.1	PASS
DH5	Ant1	2441	0~Reference	-3.25	-3.25	---	PASS
DH5	Ant1	2441	30~1000	-3.25	-62.61	≤-23.25	PASS
DH5	Ant1	2441	1000~26500	-3.25	-36	≤-23.25	PASS
DH5	Ant1	2480	0~Reference	-2.41	-2.41	---	PASS
DH5	Ant1	2480	30~1000	-2.41	-62.13	≤-22.41	PASS
DH5	Ant1	2480	1000~26500	-2.41	-33.86	≤-22.41	PASS
2DH5	Ant1	2402	0~Reference	-3.19	-3.19	---	PASS
2DH5	Ant1	2402	30~1000	-3.19	-61.43	≤-23.19	PASS
2DH5	Ant1	2402	1000~26500	-3.19	-42.37	≤-23.19	PASS
2DH5	Ant1	2441	0~Reference	-3.27	-3.27	---	PASS
2DH5	Ant1	2441	30~1000	-3.27	-62.32	≤-23.27	PASS
2DH5	Ant1	2441	1000~26500	-3.27	-36.83	≤-23.27	PASS
2DH5	Ant1	2480	0~Reference	-2.43	-2.43	---	PASS
2DH5	Ant1	2480	30~1000	-2.43	-61.17	≤-22.43	PASS
2DH5	Ant1	2480	1000~26500	-2.43	-39.93	≤-22.43	PASS
3DH5	Ant1	2402	0~Reference	-3.18	-3.18	---	PASS
3DH5	Ant1	2402	30~1000	-3.18	-62.03	≤-23.18	PASS
3DH5	Ant1	2402	1000~26500	-3.18	-38.3	≤-23.18	PASS
3DH5	Ant1	2441	0~Reference	-3.26	-3.26	---	PASS
3DH5	Ant1	2441	30~1000	-3.26	-61.46	≤-23.26	PASS
3DH5	Ant1	2441	1000~26500	-3.26	-40.44	≤-23.26	PASS
3DH5	Ant1	2480	0~Reference	-2.44	-2.44	---	PASS
3DH5	Ant1	2480	30~1000	-2.44	-62.03	≤-22.44	PASS
3DH5	Ant1	2480	1000~26500	-2.44	-39.94	≤-22.44	PASS

Test Report No.: EFGX26010180-IE-03-E04

Test Graphs

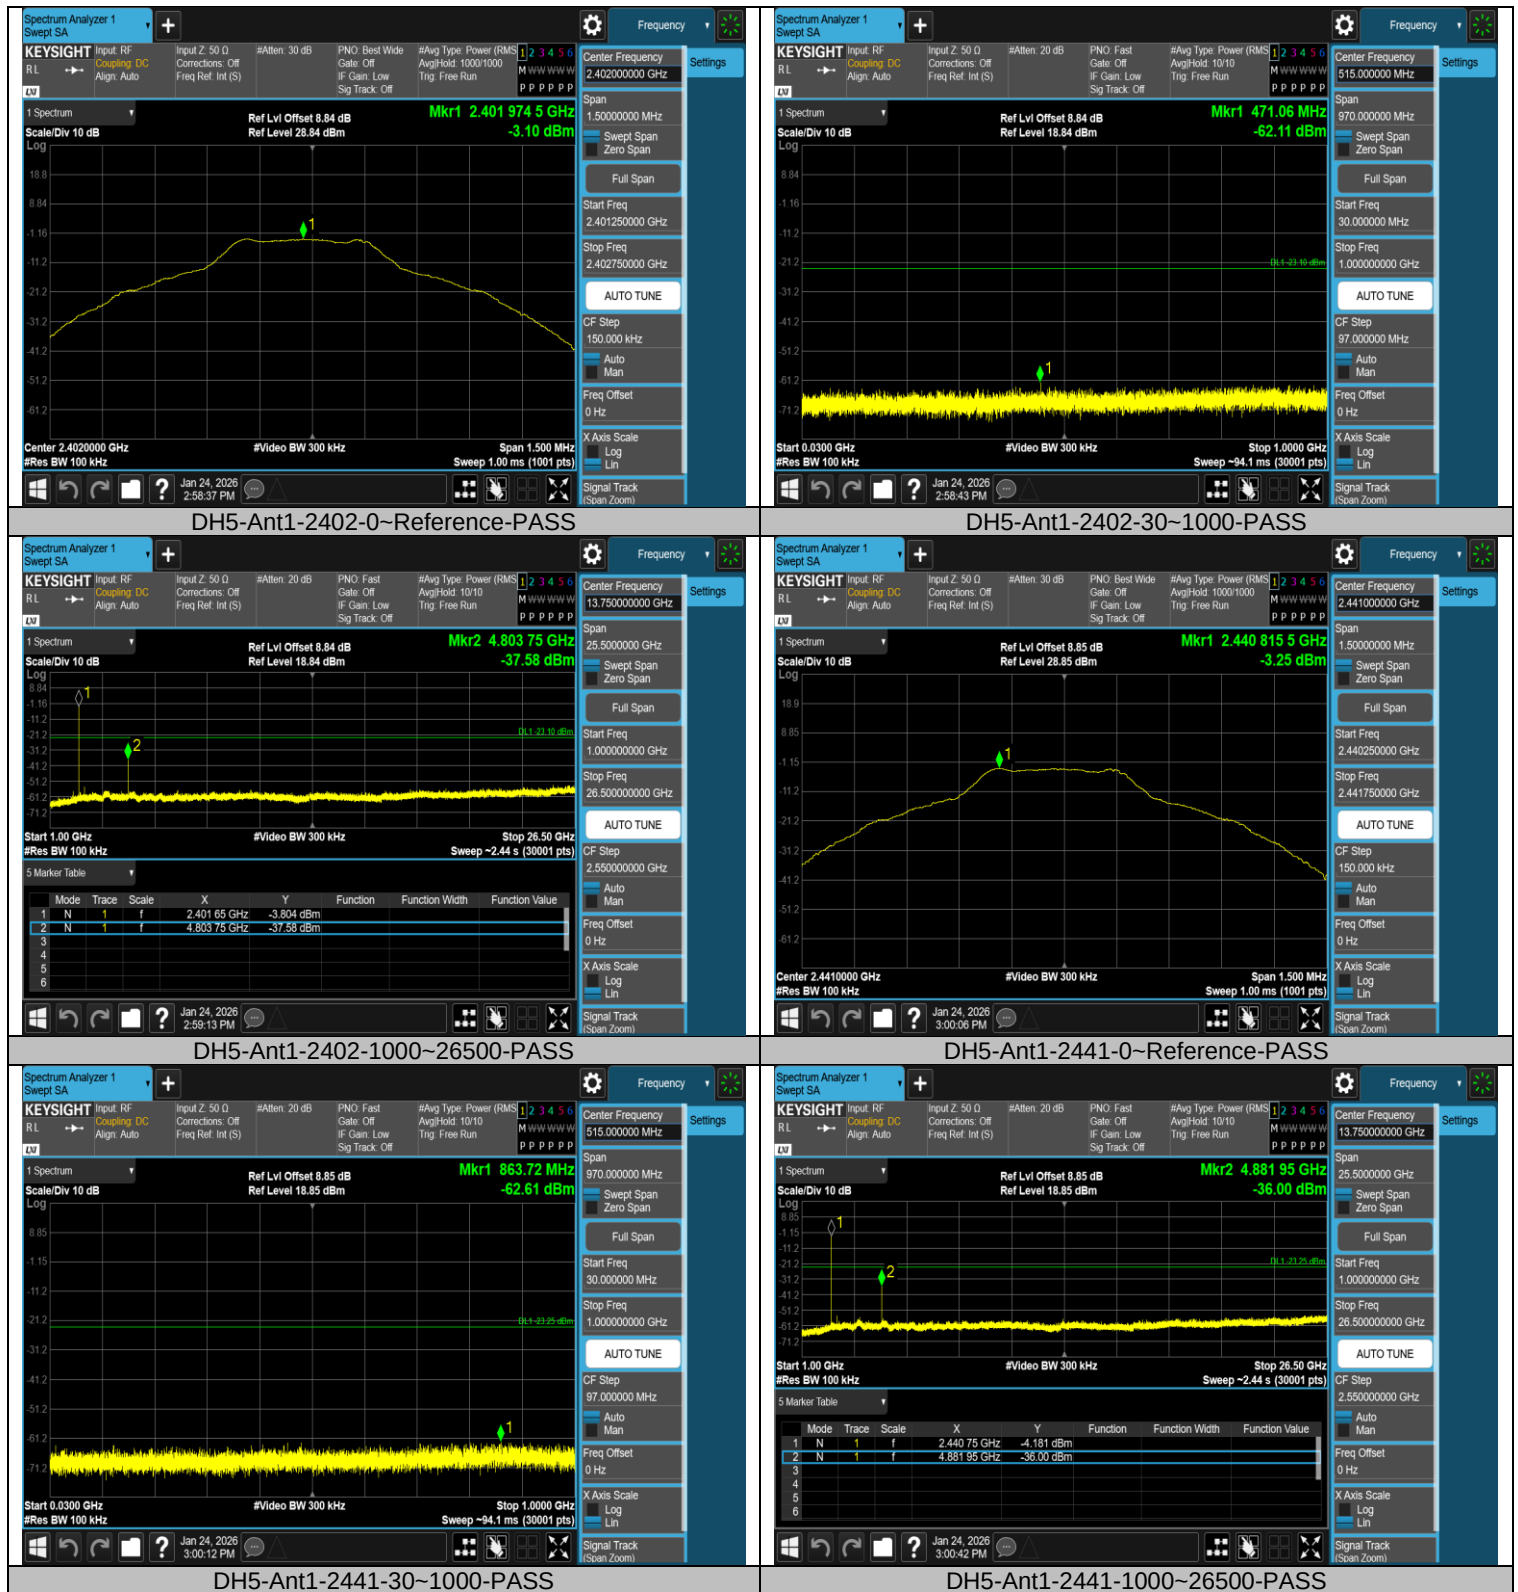


Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China



DH5-Ant1-2480-0~Reference-PASS

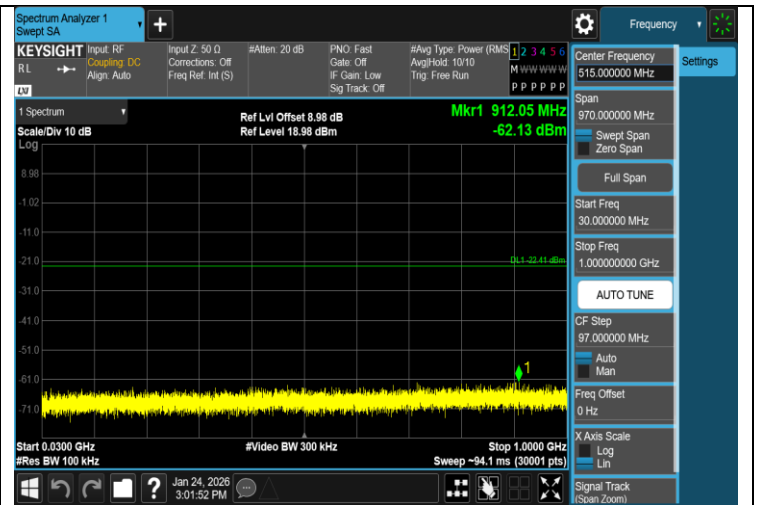


DH5-Ant1-2480-30~1000-PASS



DH5-Ant1-2480-1000~26500-PASS



2DH5-Ant1-2402-0~Reference-PASS

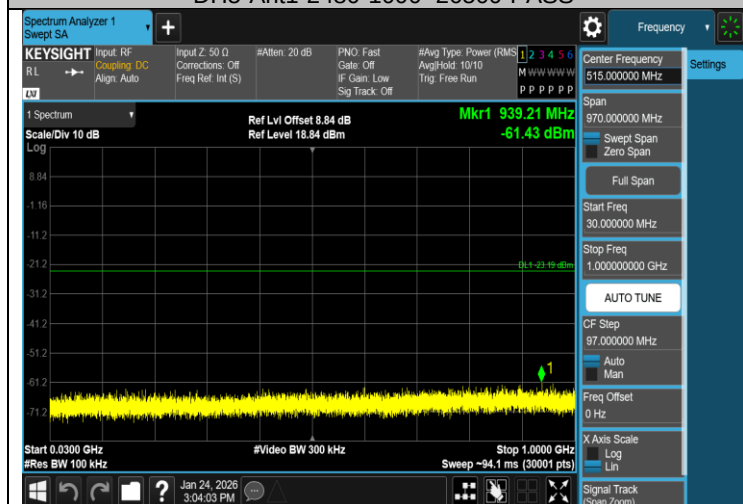




2DH5-Ant1-2402-30~1000-PASS



2DH5-Ant1-2402-1000~26500-PASS





Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

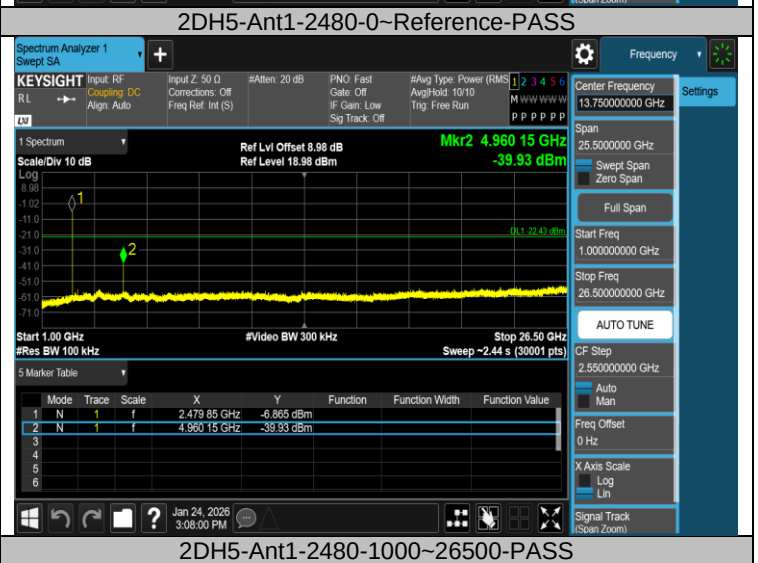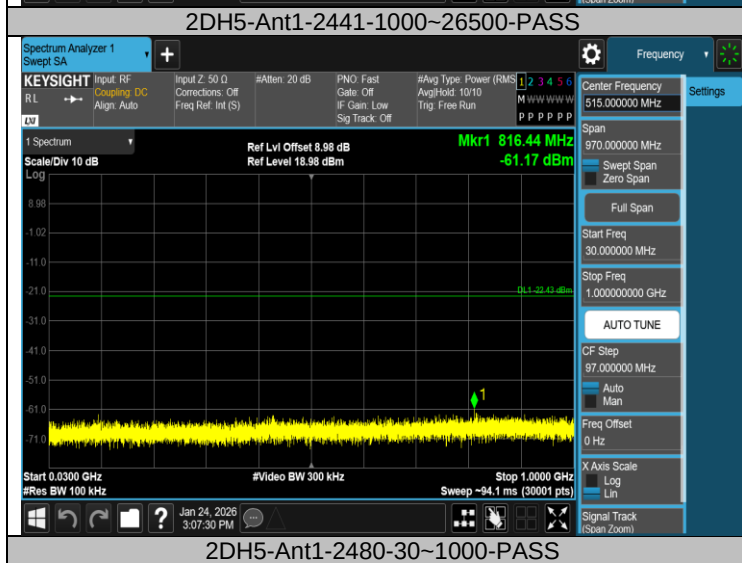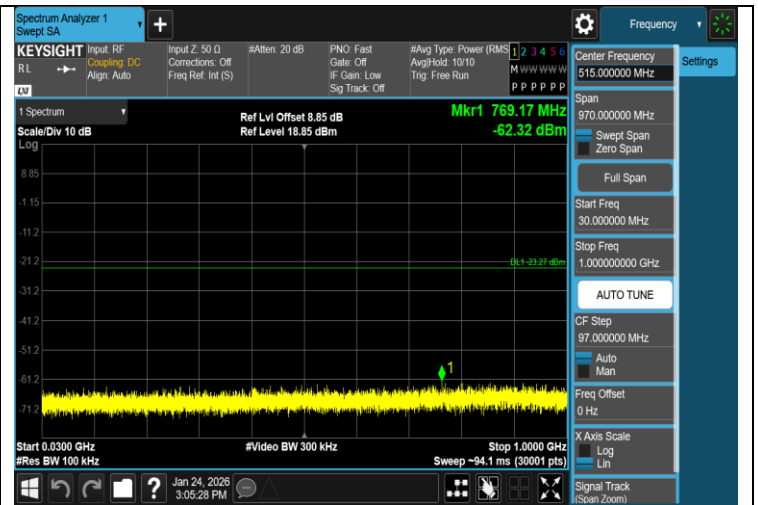

Test Report No.: EFGX26010180-IE-03-E04



Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

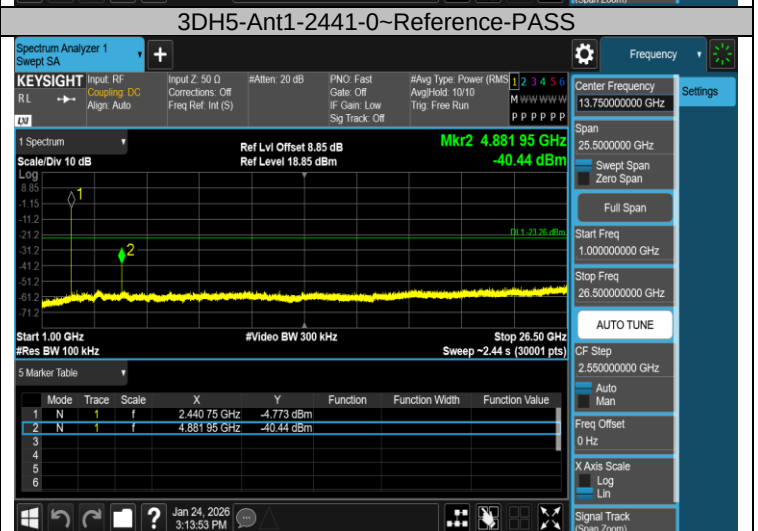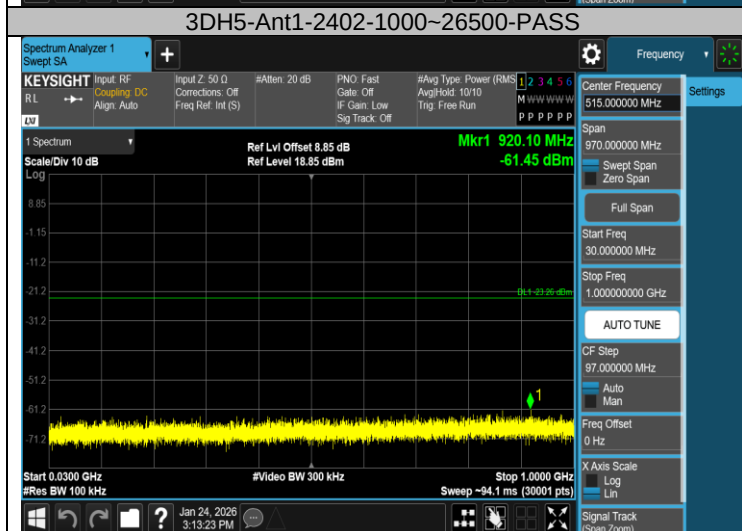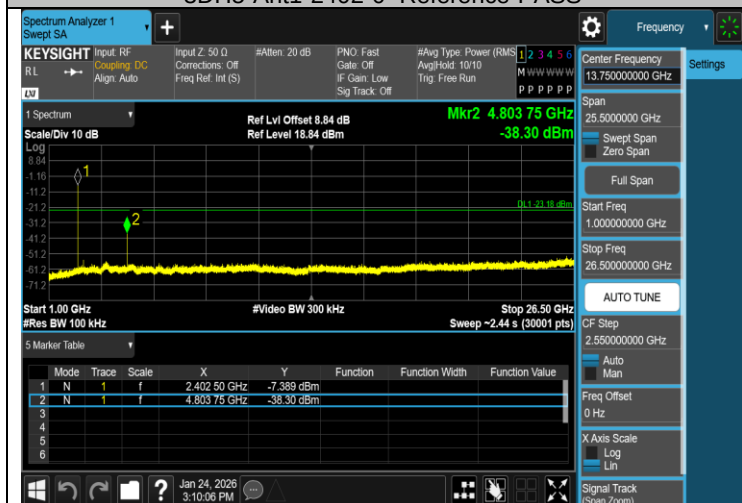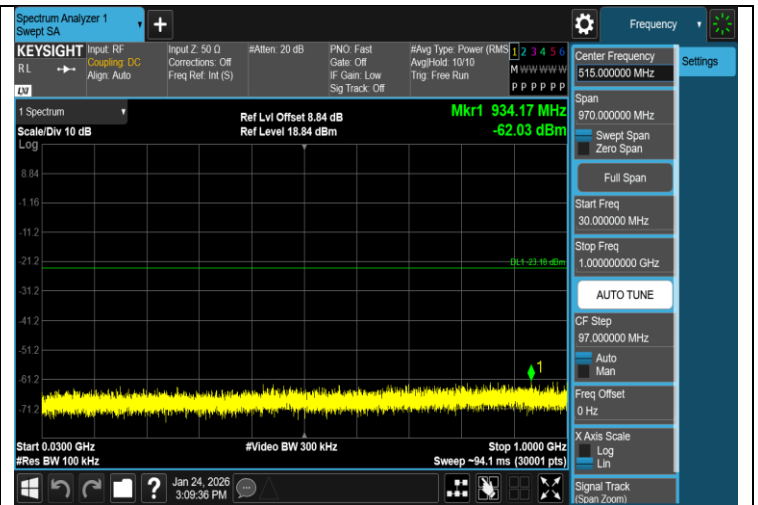

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

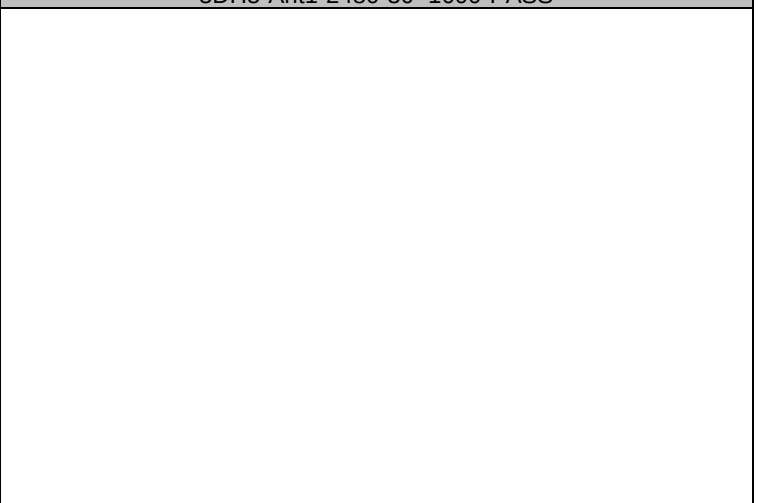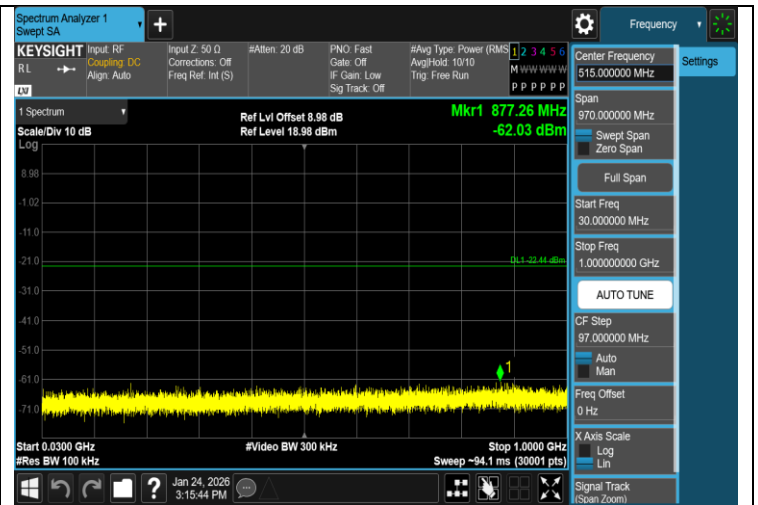

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Appendix I: Duty Cycle






Test Result

TestMode	Antenna	Channel [MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.90	3.75	77.33	1.12
DH5	Ant1	2441	2.90	3.75	77.33	1.12
DH5	Ant1	2480	2.90	3.75	77.33	1.12
2DH5	Ant1	2402	2.91	3.75	77.60	1.10
2DH5	Ant1	2441	2.91	3.75	77.60	1.10
2DH5	Ant1	2480	2.90	3.75	77.33	1.12
3DH5	Ant1	2402	2.91	3.75	77.60	1.10
3DH5	Ant1	2441	2.91	3.75	77.60	1.10
3DH5	Ant1	2480	2.91	3.75	77.60	1.10

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China





Test Graphs

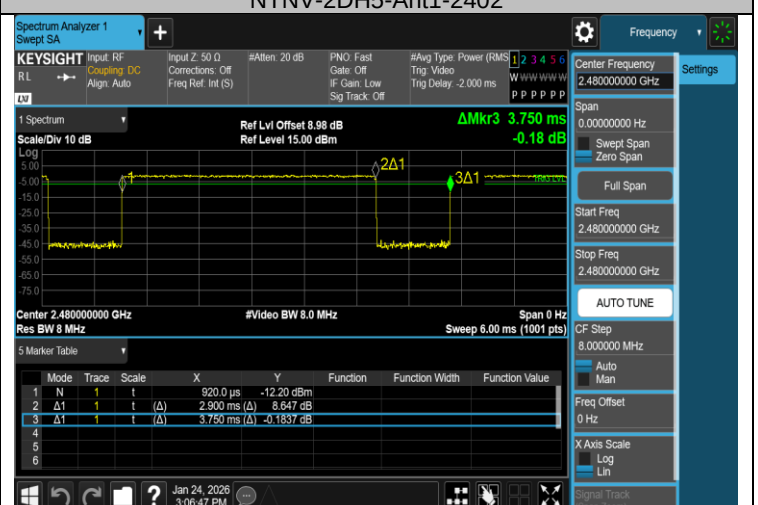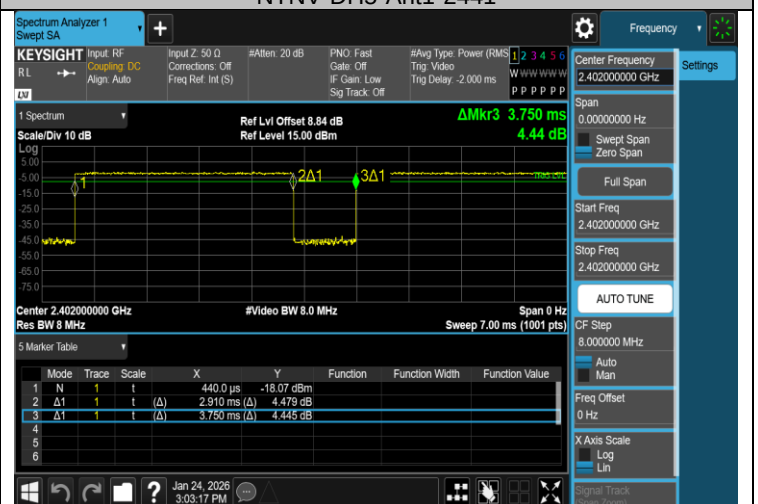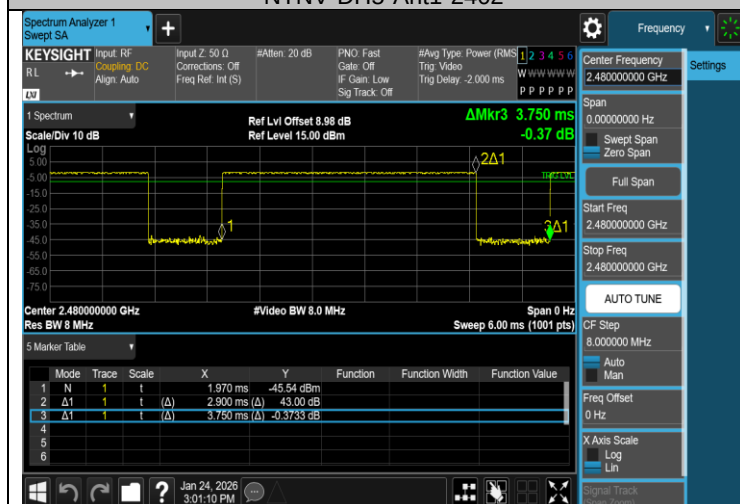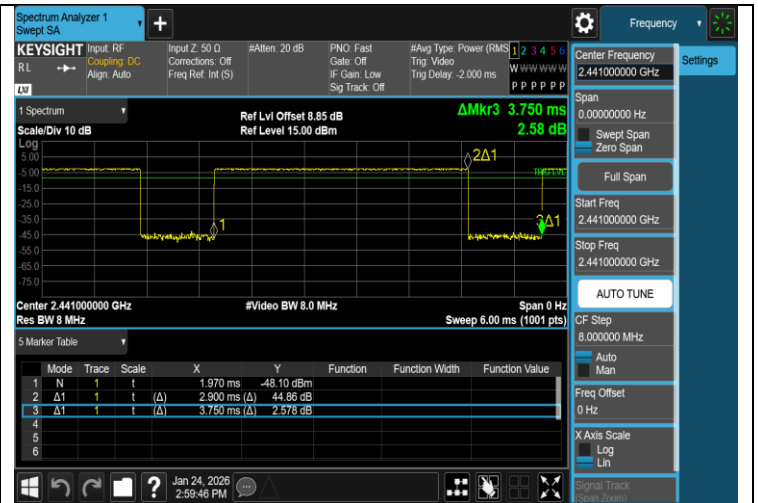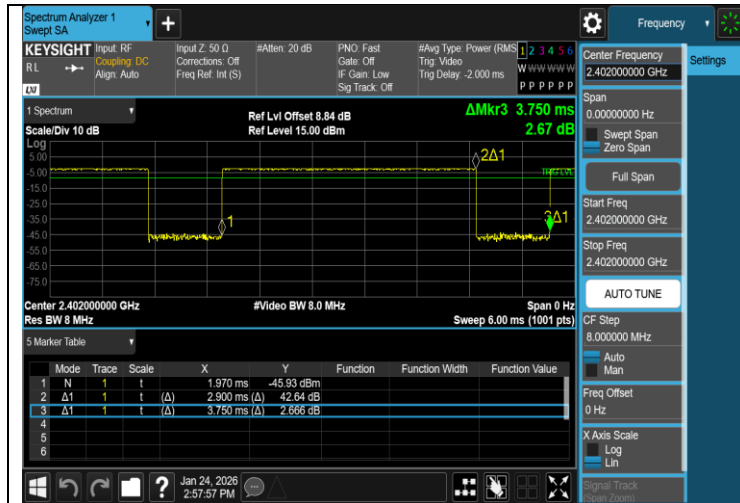

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

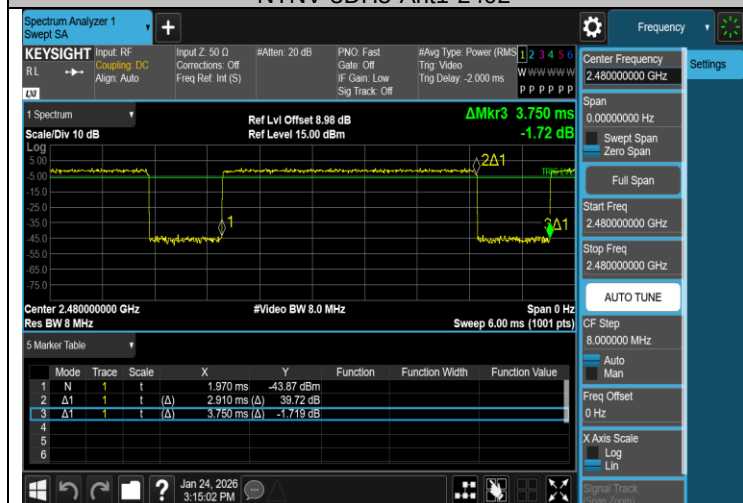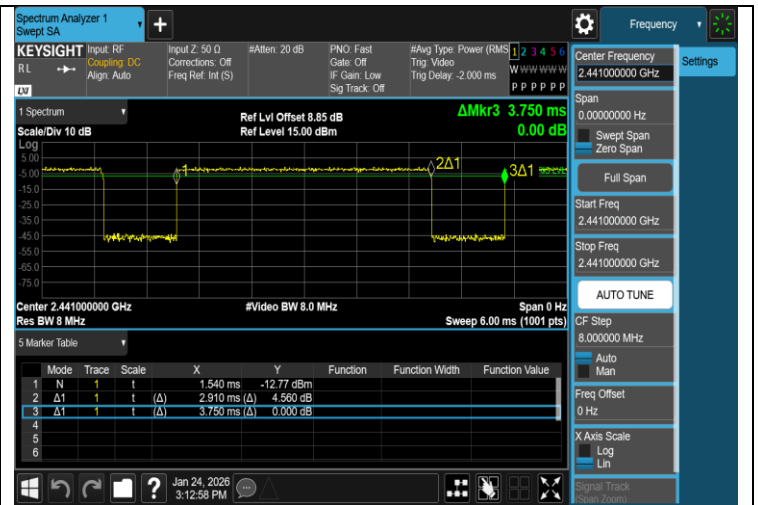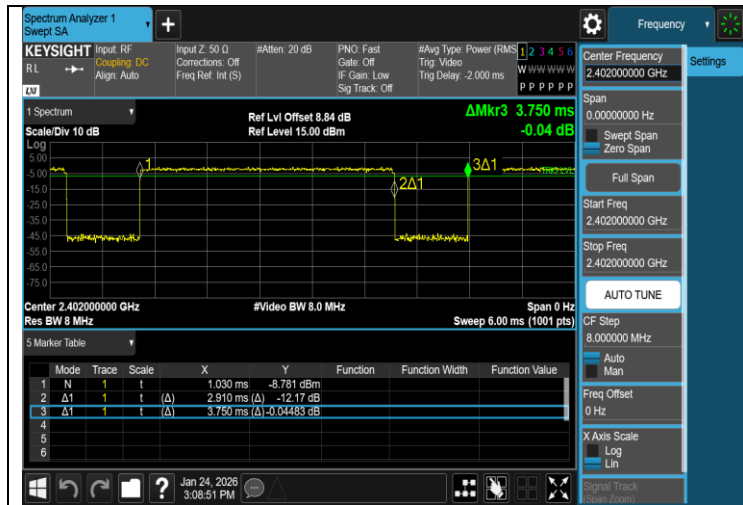

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Appendix J: Emissions in Restricted Bands

The report only records the worst-case emission levels.

For radiated emissions in the frequency range of 9 kHz to 30 MHz, a preliminary scan was performed. Per FCC §15.31(o), emissions that were more than 20 dB below the applicable limit are not reported. For radiated emissions at frequencies above 1 GHz, per ANSI C63.10-2020, Section 6.6.4.3, Note 1, if the peak measured value complies with the average limit, an average measurement is not required. Therefore, for frequencies where the peak result complies with the average limit, average (AV) emission values may be omitted from the table below.


Y13 measurement

Below 1GHz

Mode:	Normal operation	Channel:	/
Antenna:	/	State:	/

Start of Test: 2026-02-06 10:27:07

Test Graph

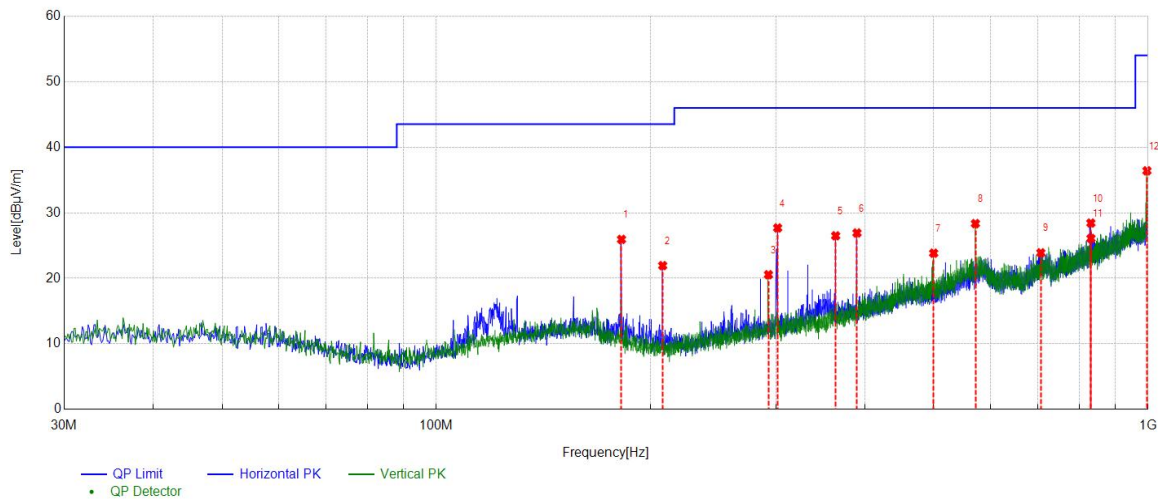


PK Suspected Data List										
NO.	Freq. [MHz]	Reading [dBµV/m]	Factor [dB/m]	Level [dBµV/m]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	182.0475	43.62	-17.68	25.94	43.50	17.56	100	232	Horizontal	PASS
2	207.9950	41.07	-19.13	21.94	43.50	21.56	100	40	Horizontal	PASS
3	292.8700	36.81	-16.25	20.56	46.00	25.44	100	191	Vertical	PASS
4	301.7212	43.31	-15.62	27.69	46.00	18.31	100	185	Horizontal	PASS
5	364.0438	41.02	-14.53	26.49	46.00	19.51	100	37	Horizontal	PASS
6	389.9912	40.67	-13.75	26.92	46.00	19.08	100	360	Horizontal	PASS
7	499.8438	35.45	-11.61	23.84	46.00	22.16	100	320	Vertical	PASS
8	572.1088	37.74	-9.39	28.35	46.00	17.65	100	66	Vertical	PASS
9	706.9388	30.56	-6.66	23.90	46.00	22.10	100	4	Vertical	PASS
10	831.0988	32.84	-4.41	28.43	46.00	17.57	100	291	Horizontal	PASS
11	831.3412	30.50	-4.41	26.09	46.00	19.91	100	330	Vertical	PASS
12	996.4838	37.65	-1.25	36.40	54.00	17.60	100	216	Vertical	PASS

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.


Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Above 1GHz

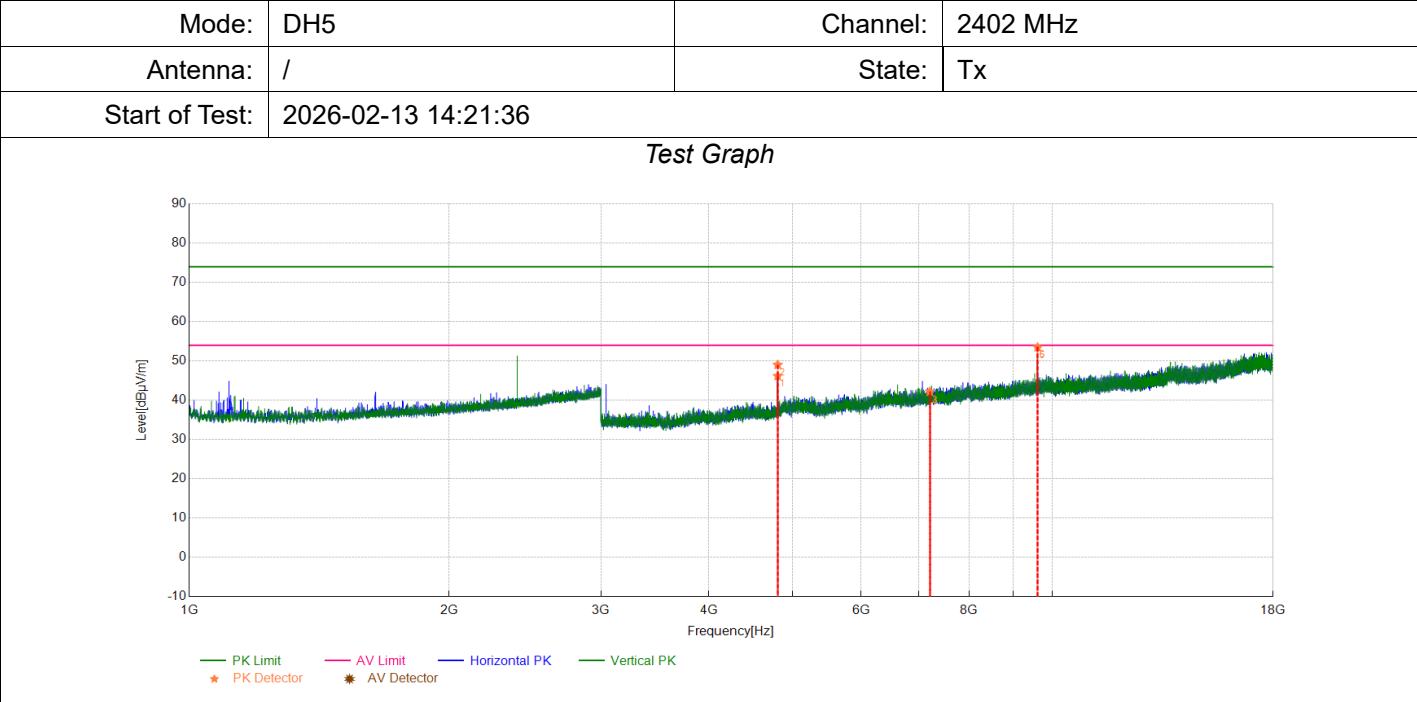

Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Limit [dBμV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	60.72	46.19	74.00	27.81	54.00	150	268	Horizontal	PASS
2	4804.0000	-14.53	63.579	49.05	74.00	24.95	54.00	153.1	228	Vertical	PASS
3	7206.0000	-9.40	51.58	42.18	74.00	31.82	54.00	150	341	Vertical	PASS
4	7206.0000	-9.40	51.01	41.61	74.00	32.39	54.00	150	195	Horizontal	PASS
5	9608.0000	-5.07	58.556	53.49	74.00	20.51	54.00	110.8	90	Vertical	PASS
6	9608.0000	-5.07	58.742	53.67	74.00	20.33	54.00	111.7	344.3	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

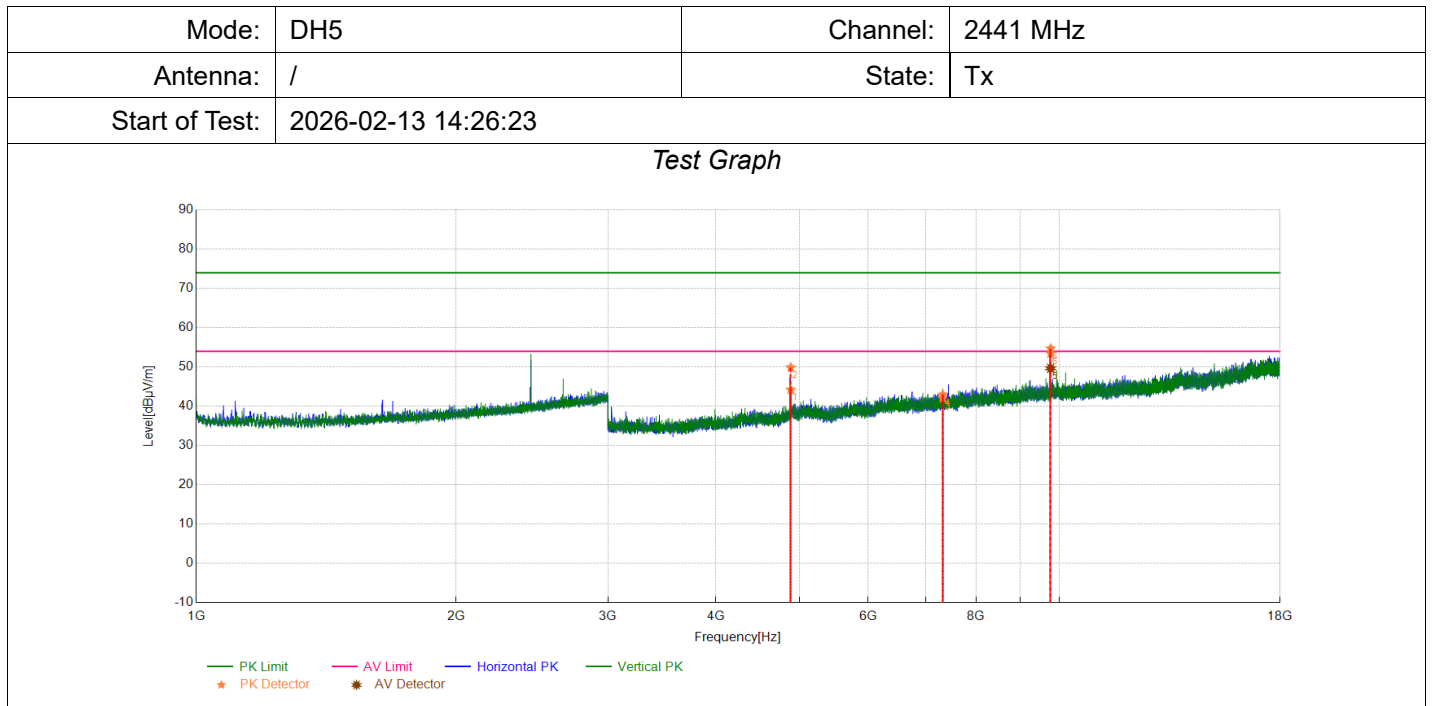

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4882.0000	-14.00	58.24	44.24	74.00	29.76			54.00		150	260	Horizontal	PASS
2	4882.0000	-14.00	63.904	49.90	74.00	24.10			54.00		153.1	228	Vertical	PASS
3	7323.0000	-9.17	51.24	42.07	74.00	31.93			54.00		150	102	Horizontal	PASS
4	7323.0000	-9.17	52.15	42.98	74.00	31.02			54.00		150	337	Vertical	PASS
5	9764.0000	-4.62	59.353	54.73	74.00	19.27	54.302	49.68	54.00	4.32	110.8	90	Vertical	PASS
6	9764.0000	-4.62	58.085	53.47	74.00	20.53			54.00		111.7	344.3	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

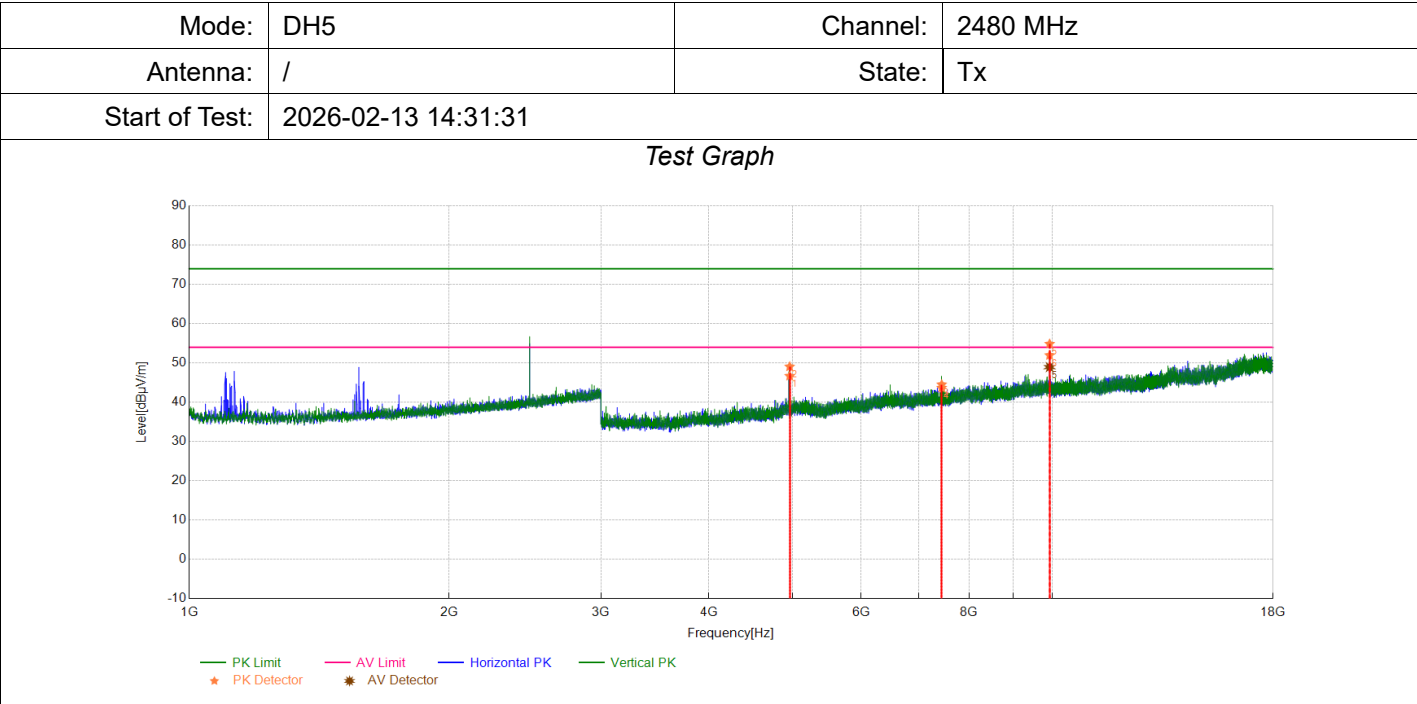

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Reading [dBµV/m]	AV Value [dBµV/m]	AV Limit [dBµV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	61.55	46.71	74.00	27.29			54.00		150	311	Horizontal	PASS
2	4960.0000	-14.84	63.927	49.09	74.00	24.91			54.00		153.1	228	Vertical	PASS
3	7440.0000	-8.89	53.42	44.53	74.00	29.47			54.00		150	332	Vertical	PASS
4	7440.0000	-8.89	52.58	43.69	74.00	30.31			54.00		150	198	Horizontal	PASS
5	9920.0000	-4.28	59.145	54.87	74.00	19.13	53.239	48.96	54.00	5.04	110.8	90	Vertical	PASS
6	9920.0000	-4.28	56.248	51.97	74.00	22.03			54.00		111.7	344.3	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

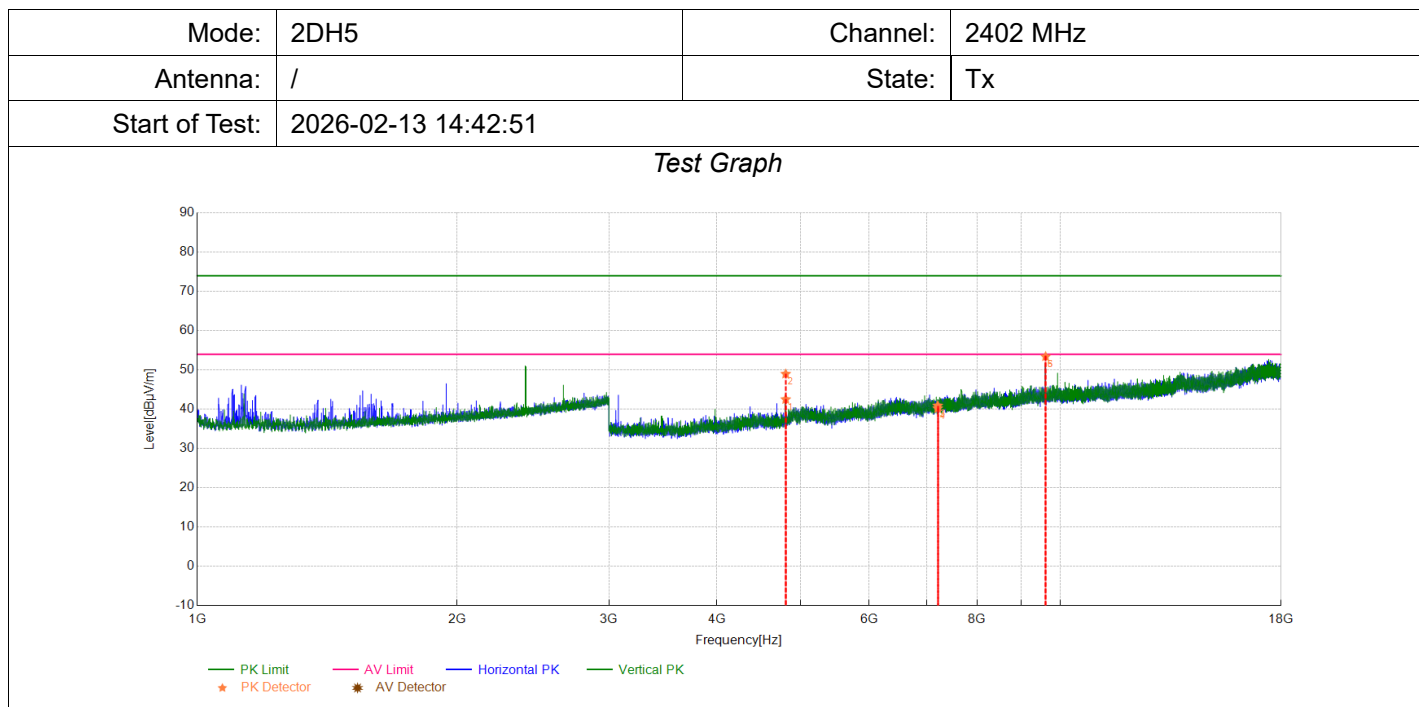

Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Limit [dBμV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	57.06	42.53	74.00	31.47	54.00	150	261	Horizontal	PASS
2	4804.0000	-14.53	63.542	49.01	74.00	24.99	54.00	153.1	228	Vertical	PASS
3	7206.0000	-9.40	50.32	40.92	74.00	33.08	54.00	150	286	Vertical	PASS
4	7206.0000	-9.40	49.63	40.23	74.00	33.77	54.00	150	119	Horizontal	PASS
5	9608.0000	-5.07	58.495	53.43	74.00	20.57	54.00	110.8	90	Vertical	PASS
6	9608.0000	-5.07	58.649	53.58	74.00	20.42	54.00	111.7	344.3	Horizontal	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China