


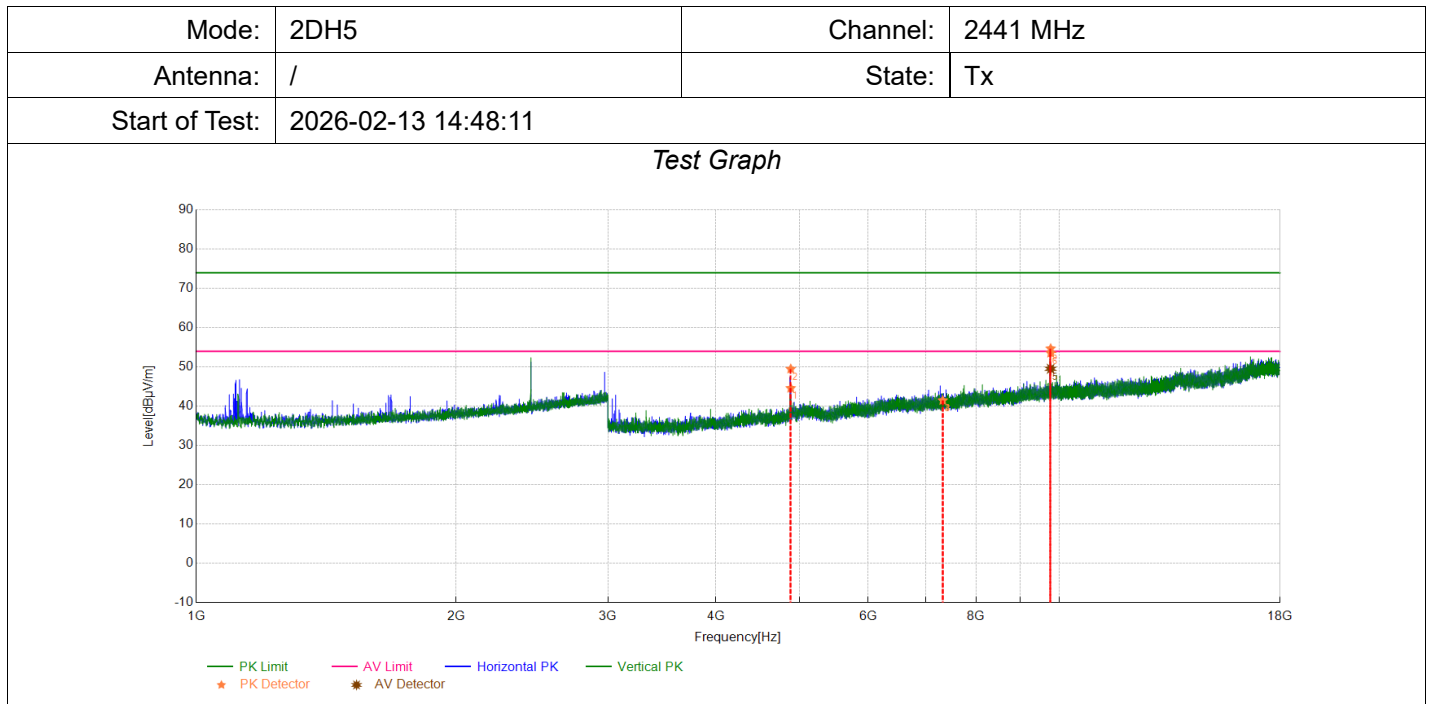

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4882.0000	-14.00	58.62	44.62	74.00	29.38			54.00		150	262	Horizontal	PASS
2	4882.0000	-14.00	63.508	49.51	74.00	24.49			54.00		153.1	228	Vertical	PASS
3	7323.0000	-9.17	50.68	41.51	74.00	32.49			54.00		150	53	Horizontal	PASS
4	7323.0000	-9.17	50.7	41.53	74.00	32.47			54.00		150	326	Vertical	PASS
5	9764.0000	-4.62	59.338	54.72	74.00	19.28	54.173	49.55	54.00	4.45	110.8	90	Vertical	PASS
6	9764.0000	-4.62	58.193	53.57	74.00	20.43			54.00		111.7	344.3	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

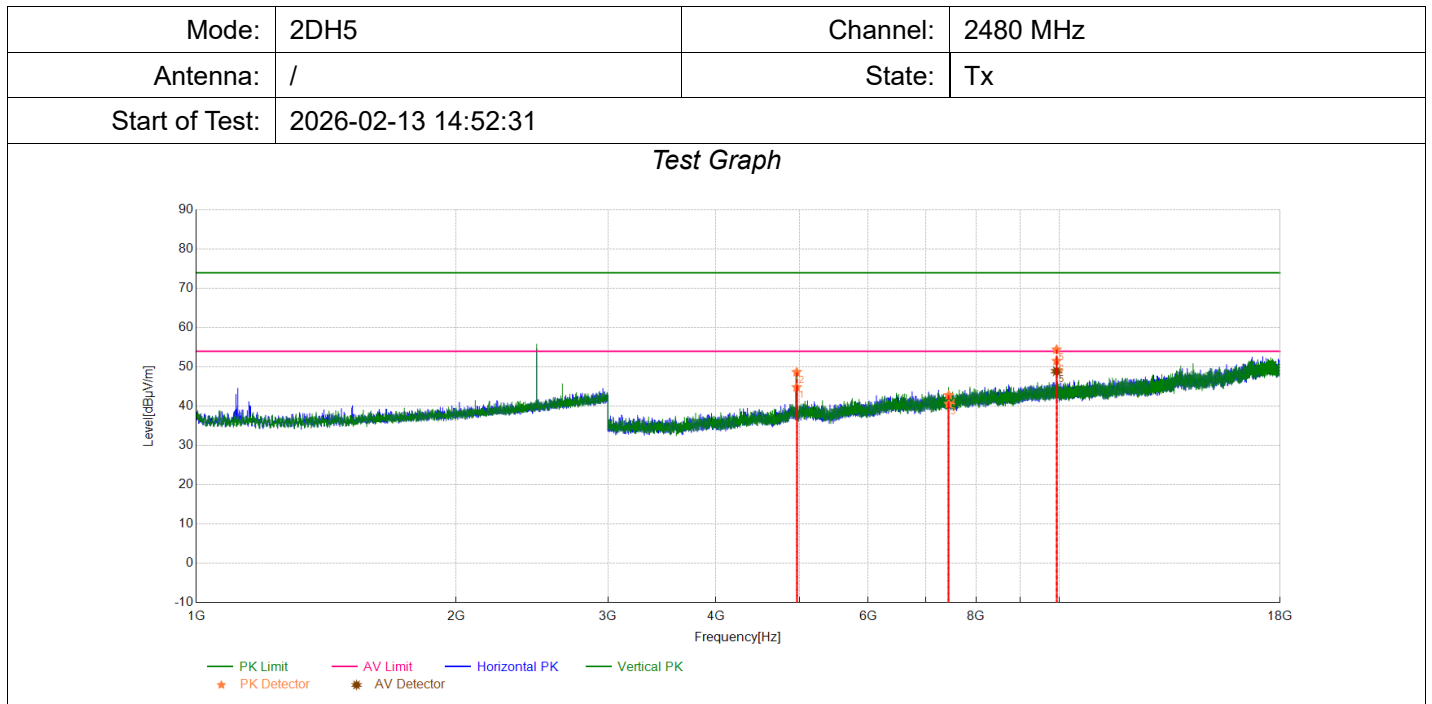

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	59.69	44.85	74.00	29.15			54.00		150	256	Horizontal	PASS
2	4960.0000	-14.84	63.557	48.72	74.00	25.28			54.00		153.1	228	Vertical	PASS
3	7440.0000	-8.89	49.52	40.63	74.00	33.37			54.00		150	337	Horizontal	PASS
4	7440.0000	-8.89	51.72	42.83	74.00	31.17			54.00		150	211	Vertical	PASS
5	9920.0000	-4.28	58.731	54.45	74.00	19.55	53.217	48.94	54.00	5.06	110.8	90	Vertical	PASS
6	9920.0000	-4.28	55.815	51.54	74.00	22.46			54.00		111.7	344.3	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

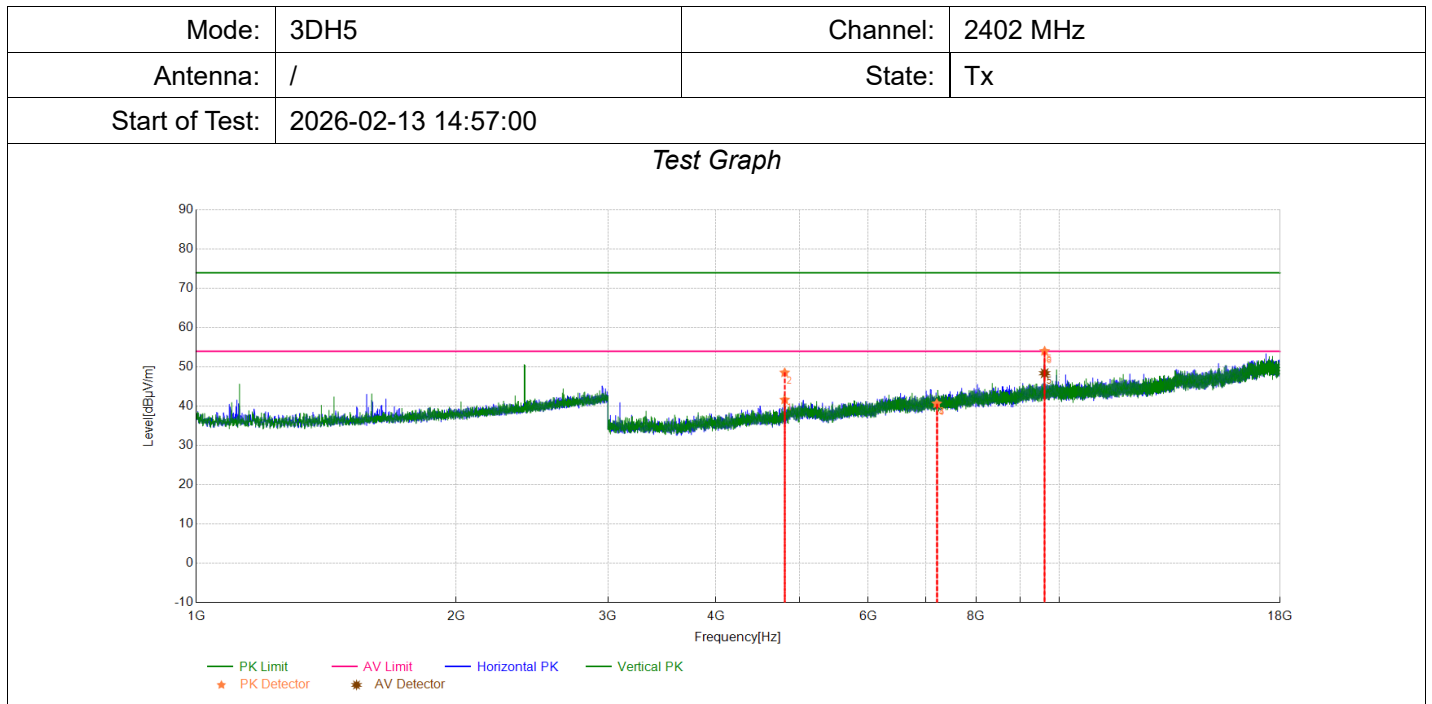

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	56.19	41.66	74.00	32.34			54.00		150	263	Horizontal	PASS
2	4804.0000	-14.53	63.101	48.57	74.00	25.43			54.00		153.1	228	Vertical	PASS
3	7206.0000	-9.40	50.1	40.70	74.00	33.30			54.00		150	336	Vertical	PASS
4	7206.0000	-9.40	49.89	40.49	74.00	33.51			54.00		150	124	Horizontal	PASS
5	9608.0000	-5.07	59.104	54.03	74.00	19.97	53.492	48.42	54.00	5.58	110.8	90	Vertical	PASS
6	9608.0000	-5.07	58.667	53.60	74.00	20.40			54.00		111.7	344.3	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

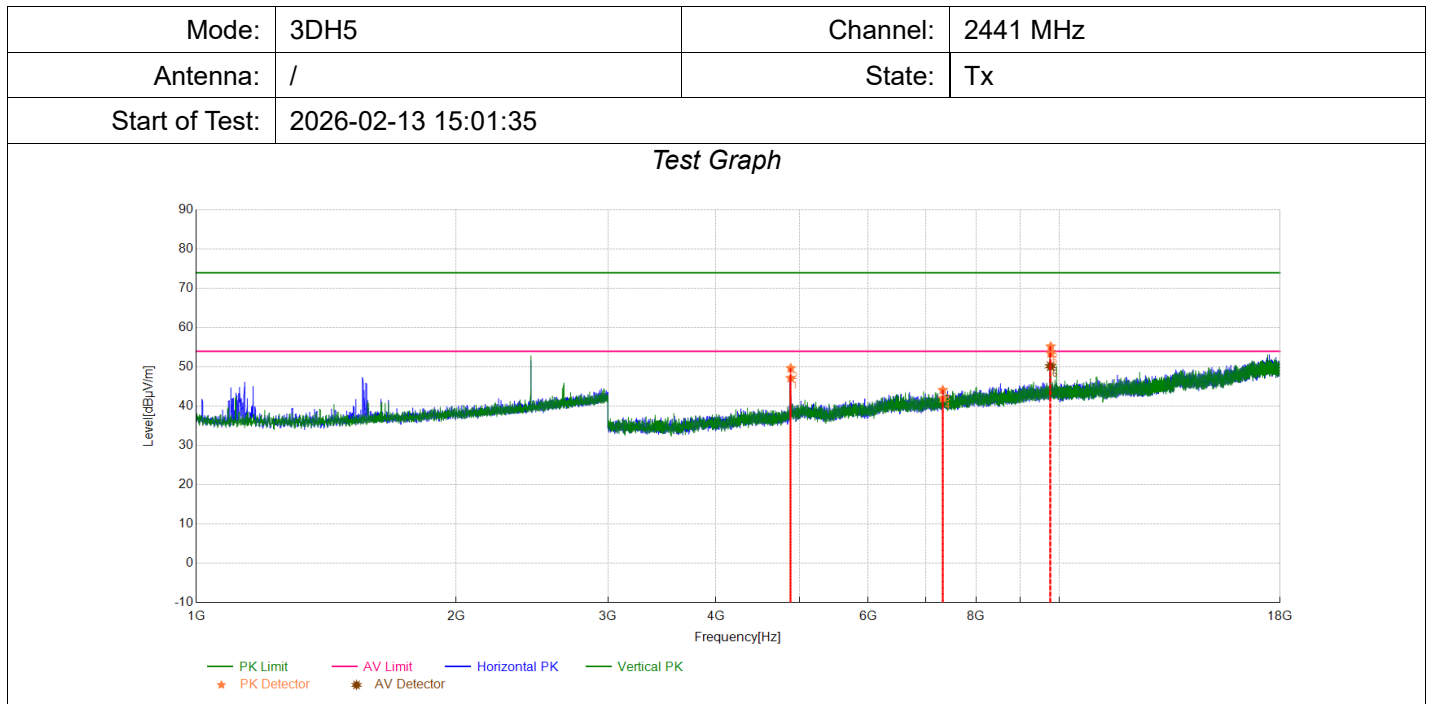

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4882.0000	-14.00	61.2	47.20	74.00	26.80			54.00		150	262	Horizontal	PASS
2	4882.0000	-14.00	63.701	49.70	74.00	24.30			54.00		153.1	228	Vertical	PASS
3	7323.0000	-9.17	53.32	44.15	74.00	29.85			54.00		150	345	Vertical	PASS
4	7323.0000	-9.17	51.2	42.03	74.00	31.97			54.00		150	134	Horizontal	PASS
5	9764.0000	-4.62	58.104	53.48	74.00	20.52			54.00		111.7	344.3	Horizontal	PASS
6	9764.0000	-4.62	59.864	55.24	74.00	18.76	54.834	50.21	54.00	3.79	110.8	90	Vertical	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

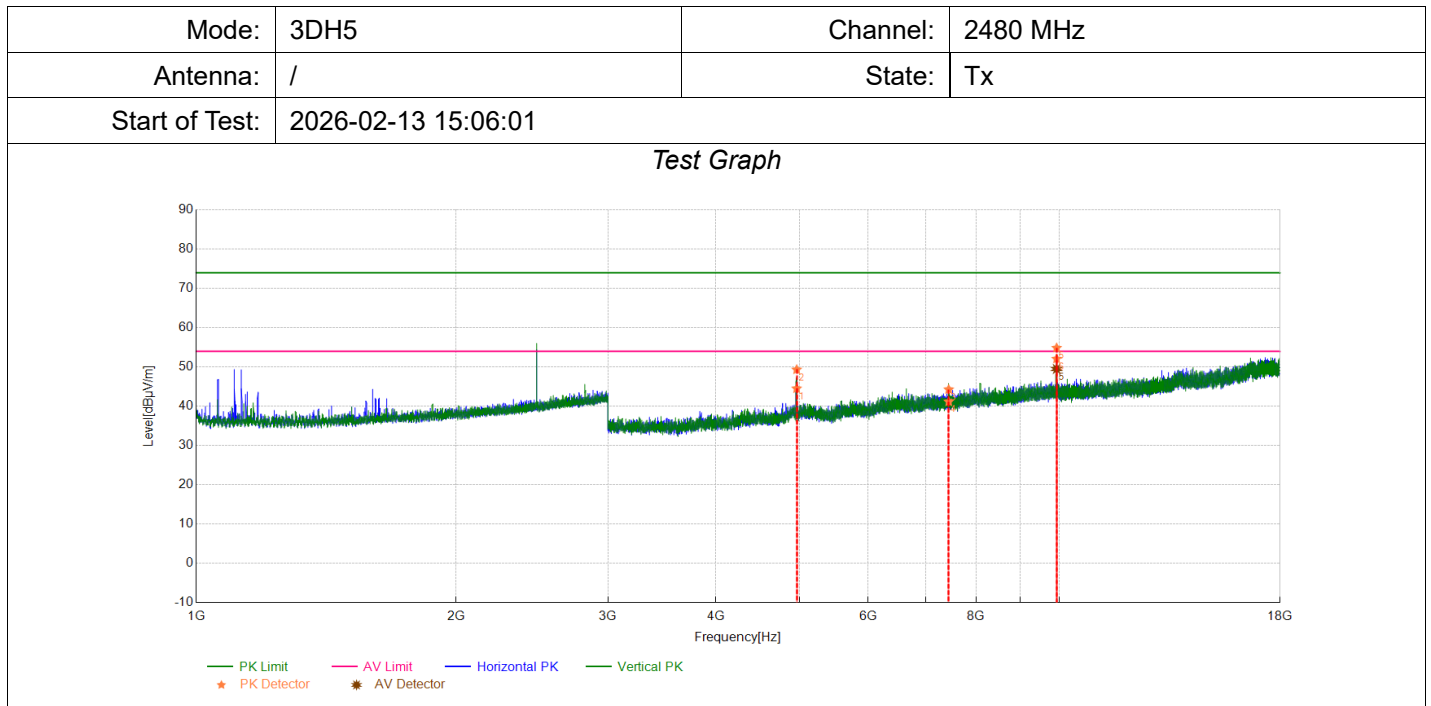


Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	59.37	44.53	74.00	29.47			54.00		150	57	Horizontal	PASS
2	4960.0000	-14.84	64.190	49.35	74.00	24.65			54.00		153.1	228	Vertical	PASS
3	7440.0000	-8.89	53.19	44.30	74.00	29.70			54.00		150	356	Vertical	PASS
4	7440.0000	-8.89	50.08	41.19	74.00	32.81			54.00		150	17	Horizontal	PASS
5	9920.0000	-4.28	59.145	54.87	74.00	19.13	53.779	49.50	54.00	4.50	110.8	90	Vertical	PASS
6	9920.0000	-4.28	56.373	52.09	74.00	21.91			54.00		111.7	344.3	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

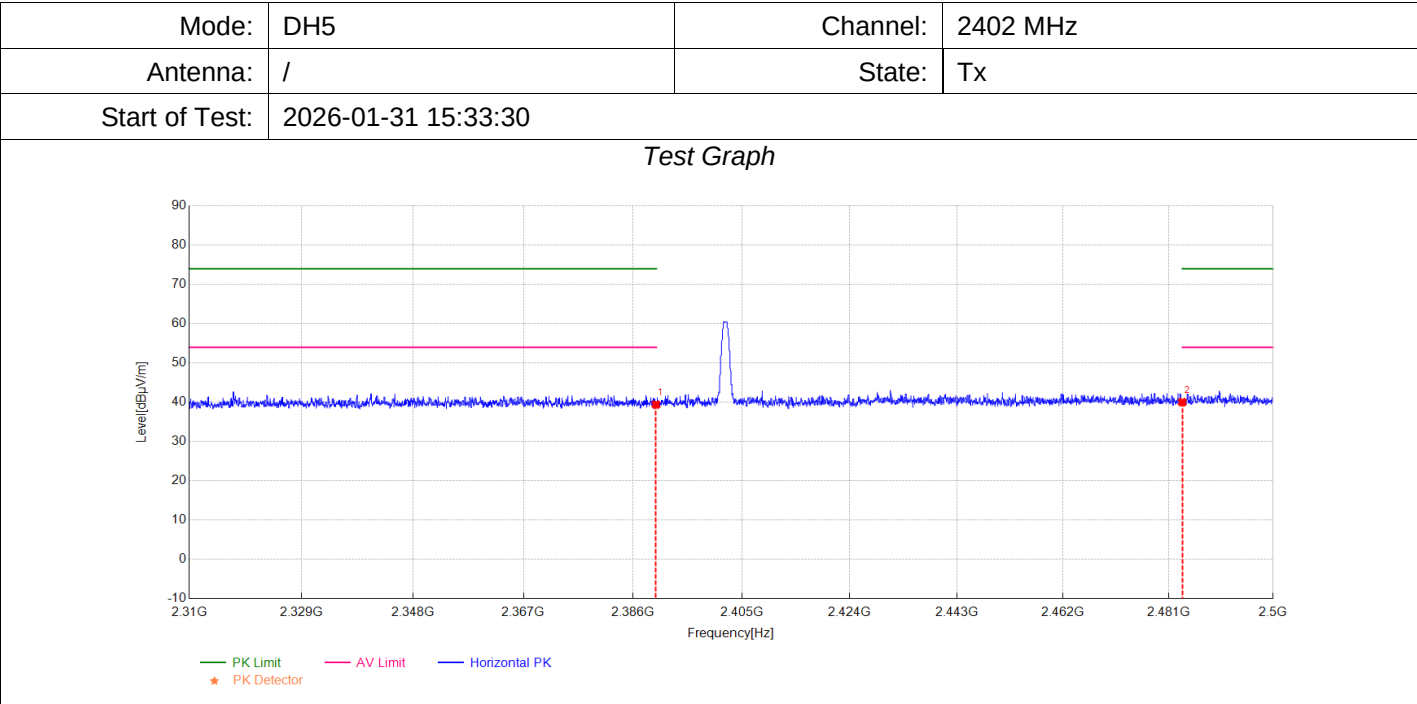


Suspected Data List											
NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.46	39.41	2.95	74.00	34.59	150	100	PK	Horizontal	PASS
2	2483.5000	36.59	40.05	3.46	74.00	33.95	150	130	PK	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Mode:	DH5	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-01-31 15:57:40		

Test Graph

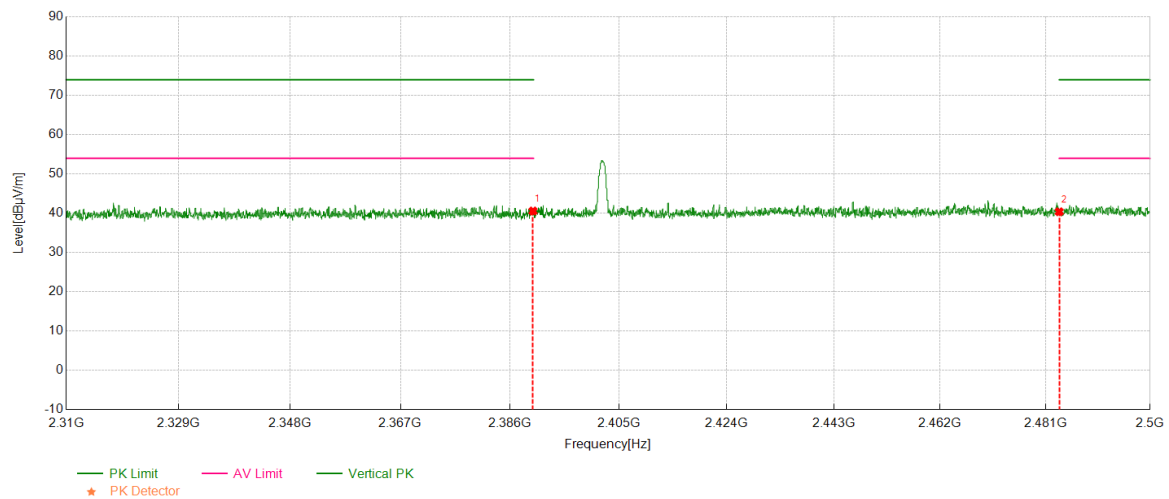


Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.64	40.59	2.95	74.00	33.41	137.8	350	PK	Vertical	PASS
2	2483.5000	36.94	40.40	3.46	74.00	33.60	137.8	260	PK	Vertical	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

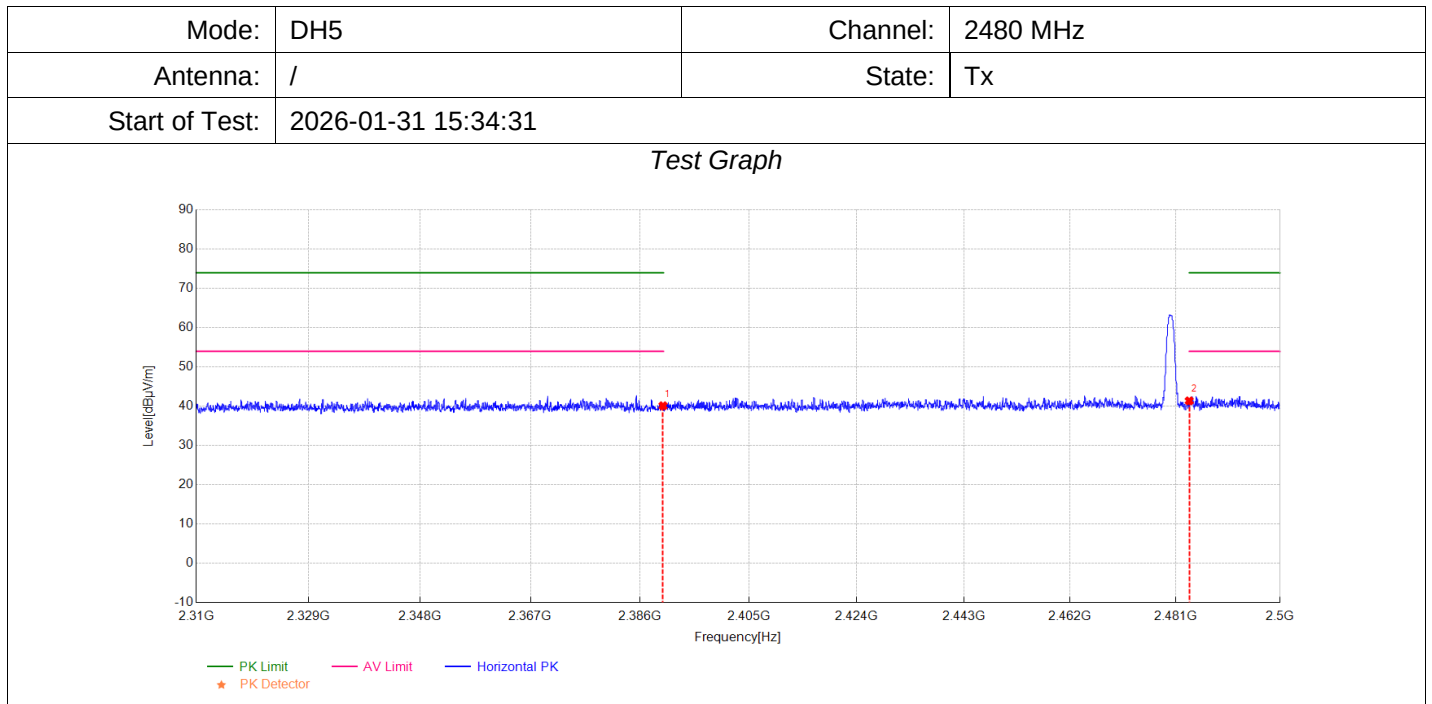

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.19	40.14	2.95	74.00	33.86	150	190	PK	Horizontal	PASS
2	2483.5000	37.94	41.40	3.46	74.00	32.60	150	30	PK	Horizontal	PASS

Note: (1) Level = Reading + Factor
(2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

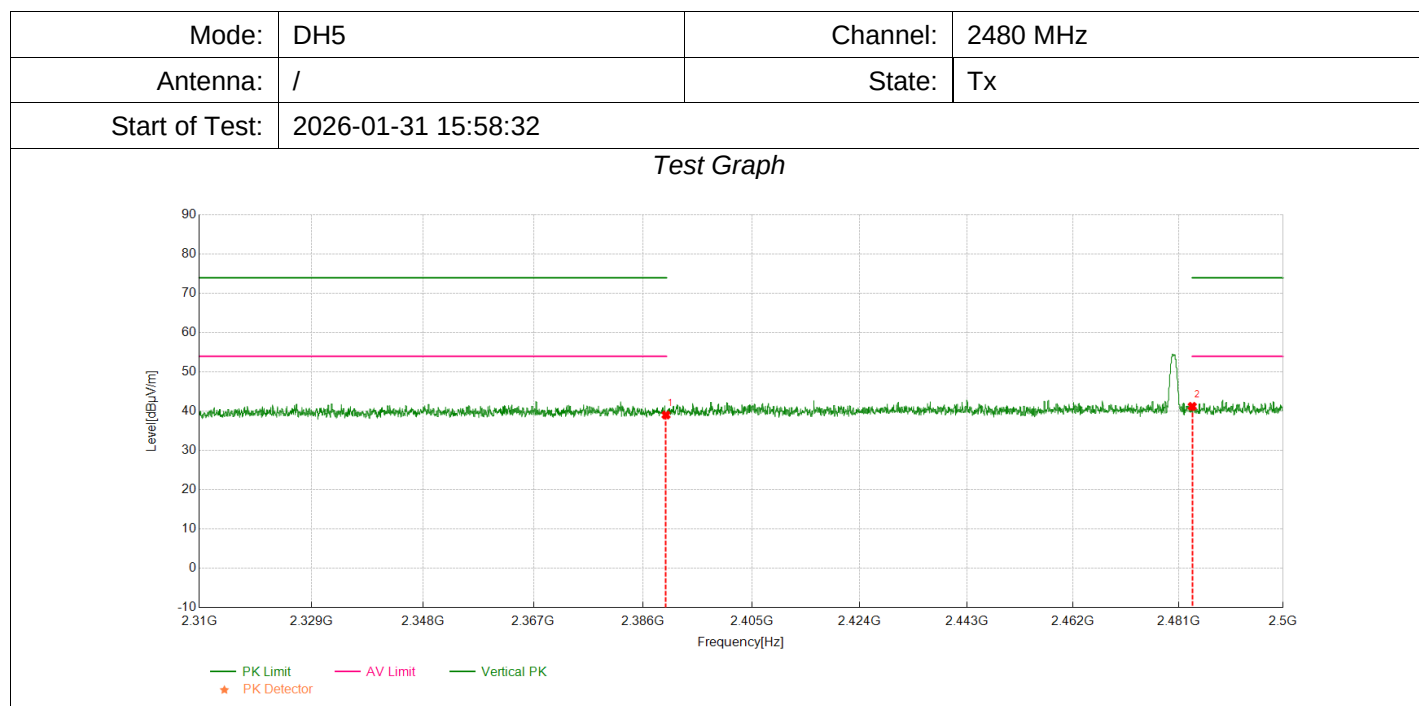
Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.11	39.06	2.95	74.00	34.94	137.8	80	PK	Vertical	PASS
2	2483.5000	37.80	41.26	3.46	74.00	32.74	137.8	70	PK	Vertical	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

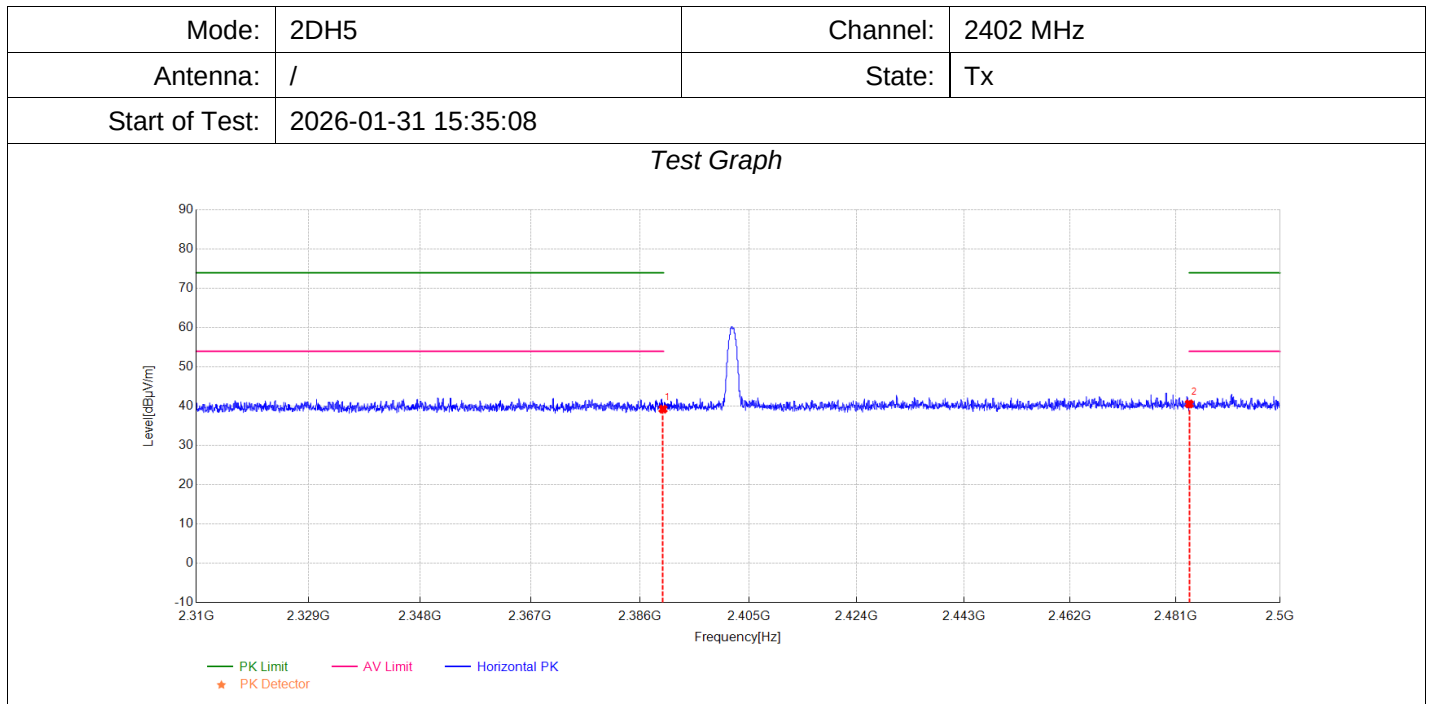
Suspected Data List

NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.34	39.29	2.95	74.00	34.71	150	130	PK	Horizontal	PASS
2	2483.5000	37.16	40.62	3.46	74.00	33.38	150	250	PK	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

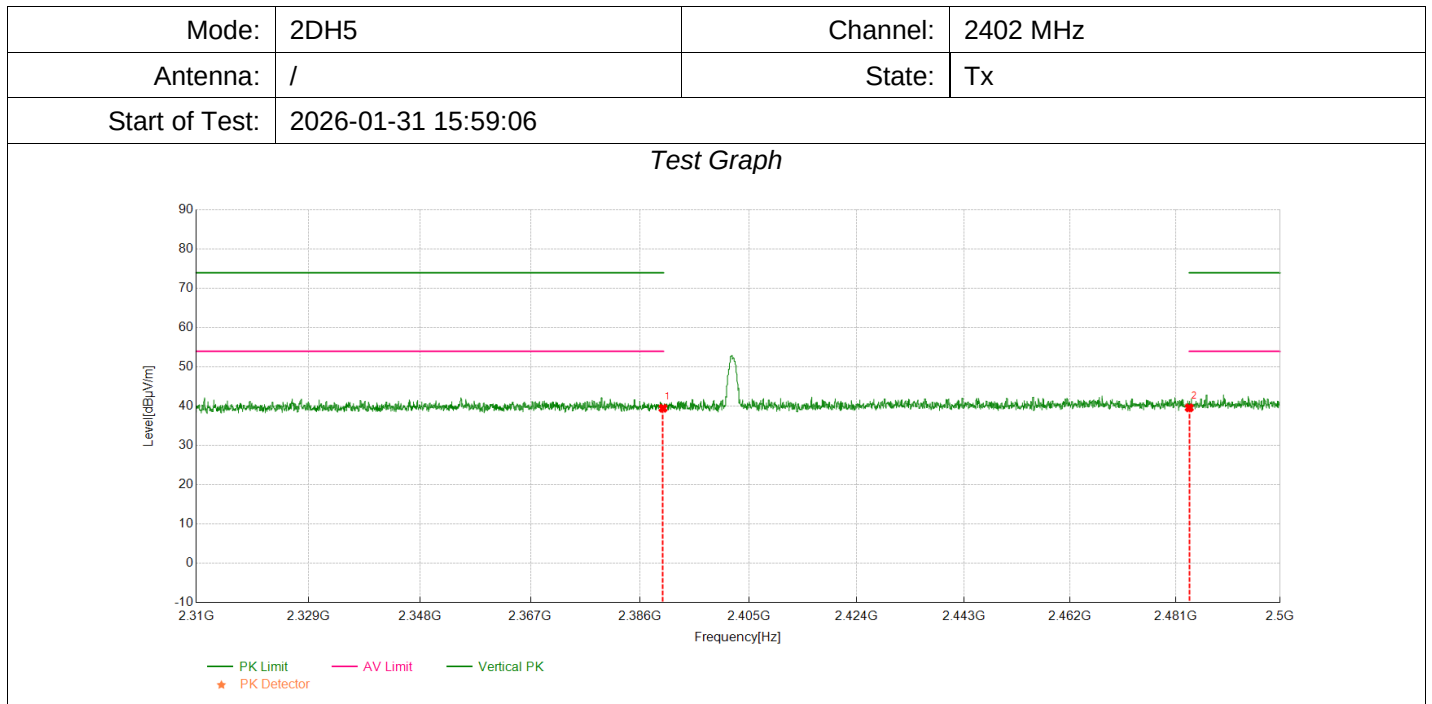

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.56	39.51	2.95	74.00	34.49	137.8	260	PK	Vertical	PASS
2	2483.5000	36.16	39.62	3.46	74.00	34.38	137.8	70	PK	Vertical	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

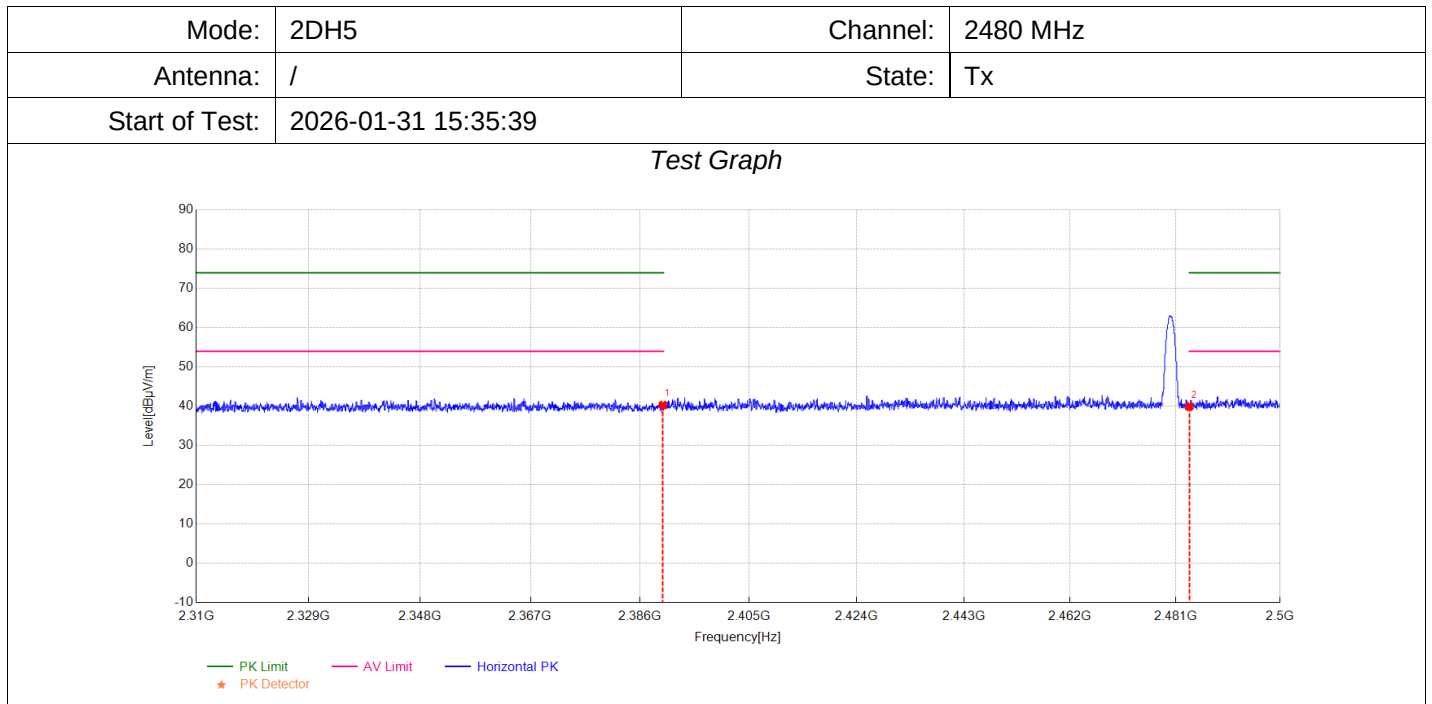

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.36	40.31	2.95	74.00	33.69	150	10	PK	Horizontal	PASS
2	2483.5000	36.47	39.93	3.46	74.00	34.07	150	40	PK	Horizontal	PASS

Note: (1) Level = Reading + Factor
(2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

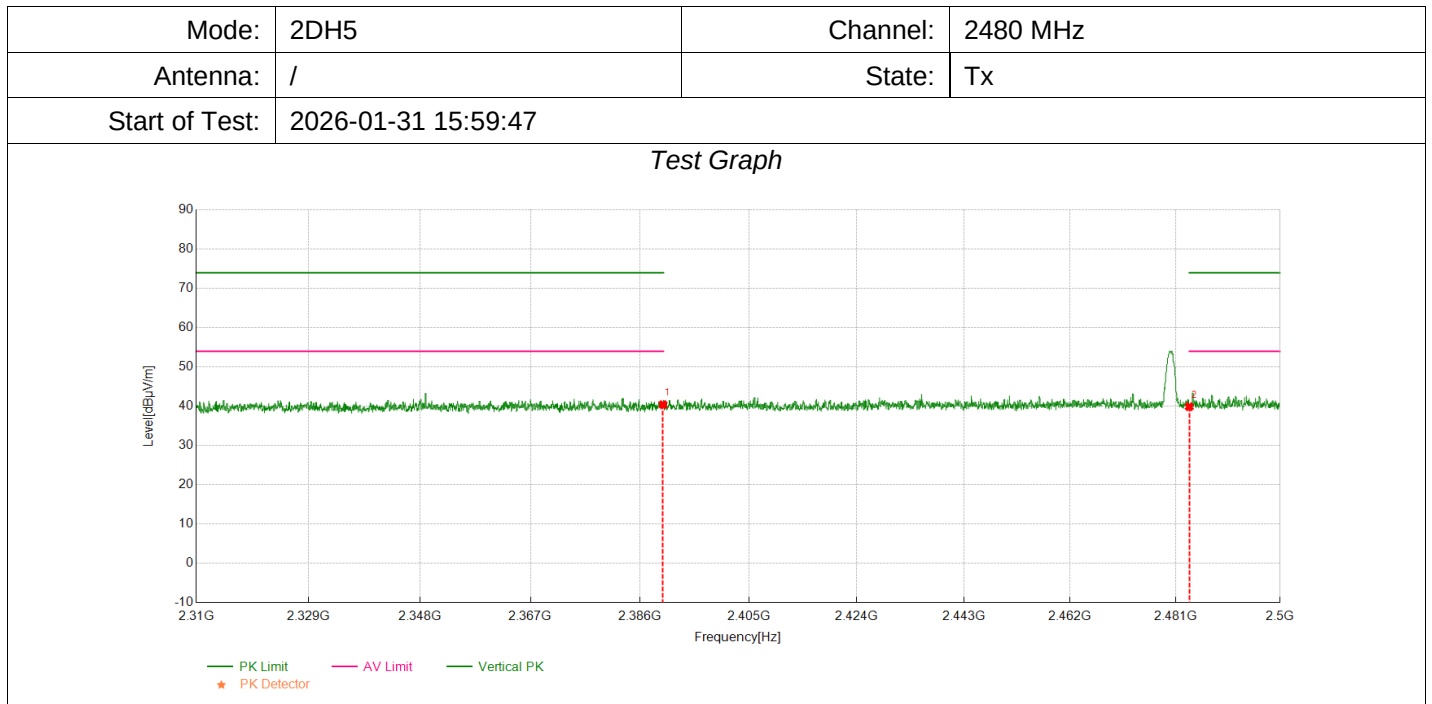

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.48	40.43	2.95	74.00	33.57	137.8	340	PK	Vertical	PASS
2	2483.5000	36.45	39.91	3.46	74.00	34.09	137.8	270	PK	Vertical	PASS

Note: (1) Level = Reading + Factor
 (2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
 Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
 Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

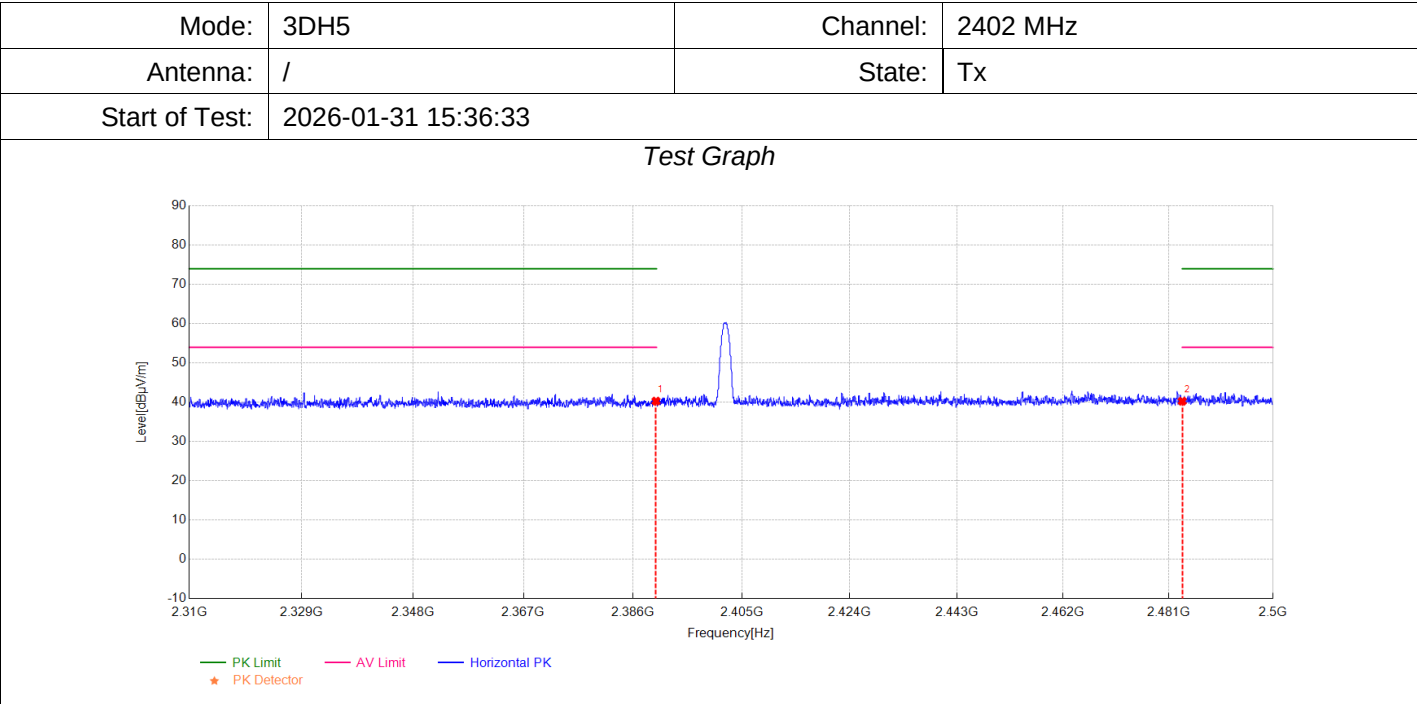


Suspected Data List											
NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.36	40.31	2.95	74.00	33.69	150	180	PK	Horizontal	PASS
2	2483.5000	36.82	40.28	3.46	74.00	33.72	150	260	PK	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Mode:	3DH5	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-01-31 16:00:23		

Test Graph

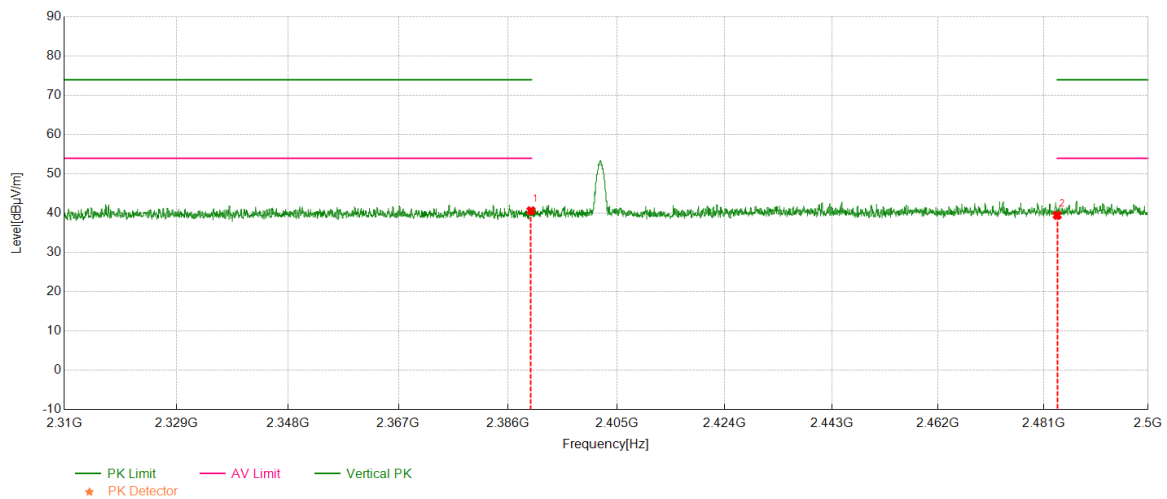

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.73	40.68	2.95	74.00	33.32	137.8	140	PK	Vertical	PASS
2	2483.5000	36.03	39.49	3.46	74.00	34.51	137.8	310	PK	Vertical	PASS


Note: (1) Level = Reading + Factor
(2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	3DH5	Channel:	2480 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-01-31 15:37:18		

Test Graph

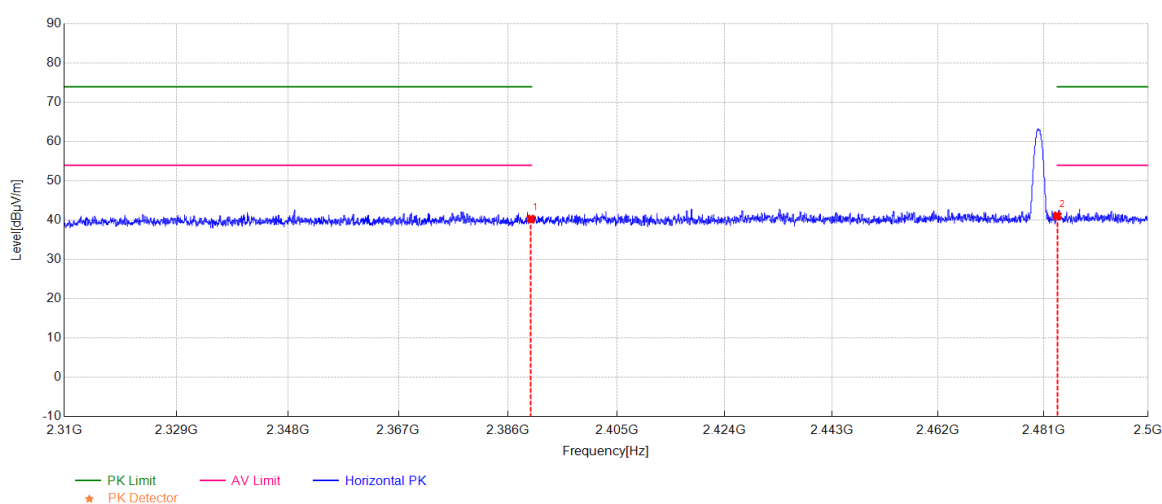

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.40	40.35	2.95	74.00	33.65	150	290	PK	Horizontal	PASS
2	2483.5000	37.68	41.14	3.46	74.00	32.86	150	130	PK	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

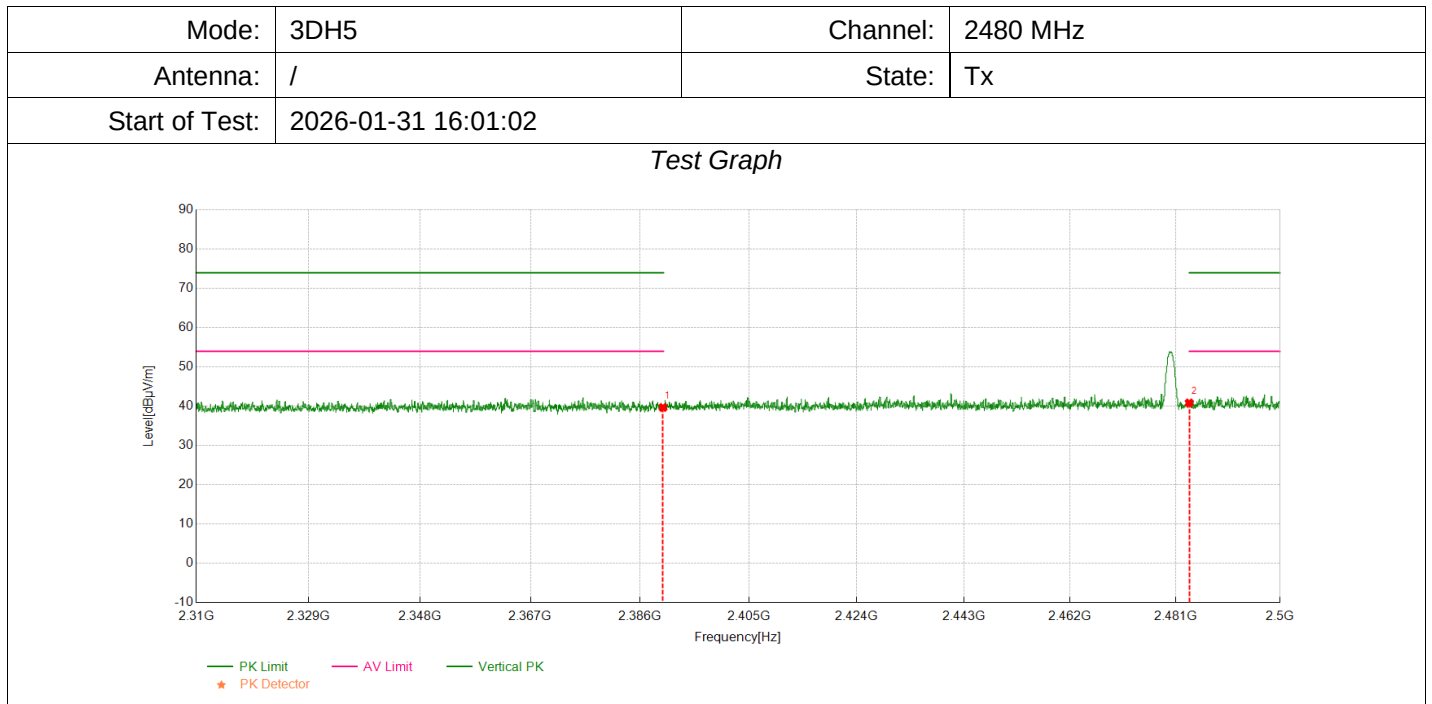
Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.76	39.71	2.95	74.00	34.29	137.8	90	PK	Vertical	PASS
2	2483.5000	37.41	40.87	3.46	74.00	33.13	137.8	280	PK	Vertical	PASS

Note: (1) Level = Reading + Factor
 (2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
 Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
 Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China


P15 measurement

Below 1GHz

Mode:	Normal operation	Channel:	/
Antenna:	/	State:	/

Start of Test: 2026-02-06 10:29:57

Test Graph

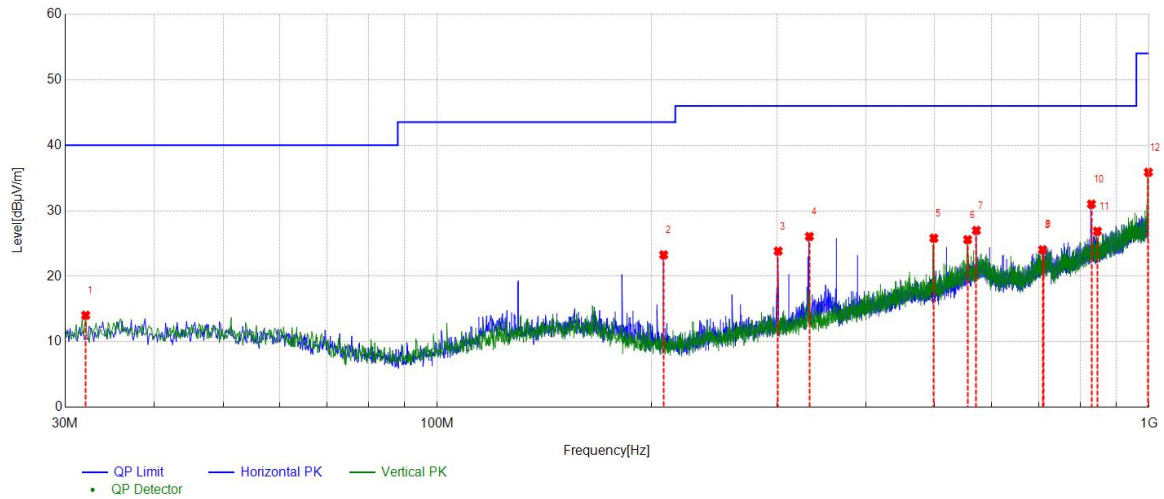

PK Suspected Data List


NO.	Freq. [MHz]	Reading [dBμV/m]	Factor [dB/m]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	32.0612	30.31	-16.25	14.06	40.00	25.94	100	192	Vertical	PASS
2	207.9950	42.40	-19.13	23.27	43.50	20.23	100	228	Horizontal	PASS
3	301.2362	39.48	-15.63	23.85	46.00	22.15	100	57	Horizontal	PASS
4	333.2462	41.18	-15.10	26.08	46.00	19.92	100	13	Horizontal	PASS
5	498.5100	37.44	-11.62	25.82	46.00	20.18	100	170	Vertical	PASS
6	556.1038	35.50	-9.90	25.60	46.00	20.40	100	180	Vertical	PASS
7	571.9875	36.40	-9.40	27.00	46.00	19.00	100	271	Horizontal	PASS
8	708.5150	30.67	-6.62	24.05	46.00	21.95	100	0	Vertical	PASS
9	710.6975	30.77	-6.59	24.18	46.00	21.82	100	291	Horizontal	PASS
10	829.8862	35.40	-4.39	31.01	46.00	14.99	100	311	Horizontal	PASS
11	846.1338	31.22	-4.34	26.88	46.00	19.12	100	30	Vertical	PASS
12	997.8175	37.10	-1.23	35.87	54.00	18.13	100	208	Vertical	PASS

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Above 1GHz

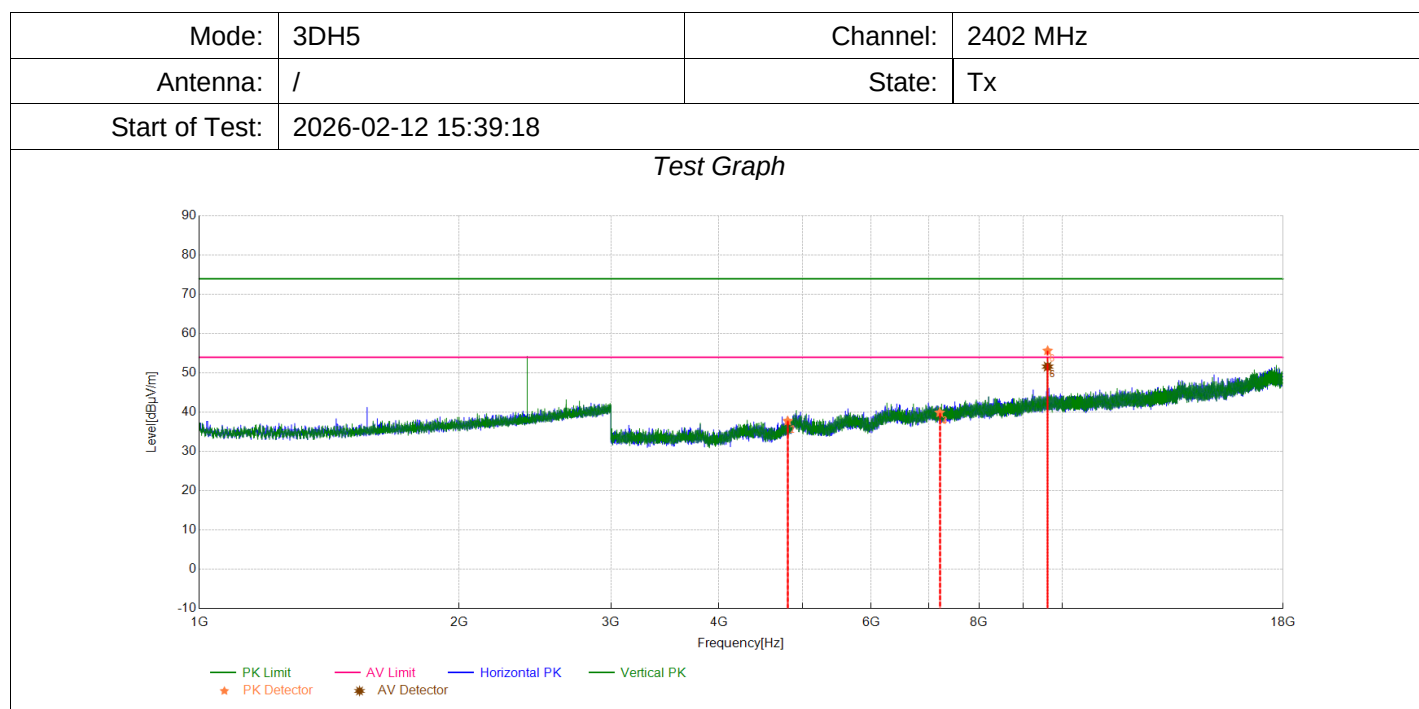


Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	52.32	37.79	74.00	36.21			54.00		150	316	Vertical	PASS
2	4804.0000	-14.53	52.03	37.50	74.00	36.50			54.00		150	124	Horizontal	PASS
3	7206.0000	-9.40	49.31	39.91	74.00	34.09			54.00		150	334	Horizontal	PASS
4	7206.0000	-9.40	49.02	39.62	74.00	34.38			54.00		150	339	Vertical	PASS
5	9608.0000	-5.07	56.718	51.65	74.00	22.35			54.00		110.9	43.3	Horizontal	PASS
6	9608.0000	-5.07	60.755	55.69	74.00	18.31	56.705	51.64	54.00	2.36	120	0	Vertical	PASS

Note: (1) Level = Reading + Factor
(2) Margin = Limit - Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

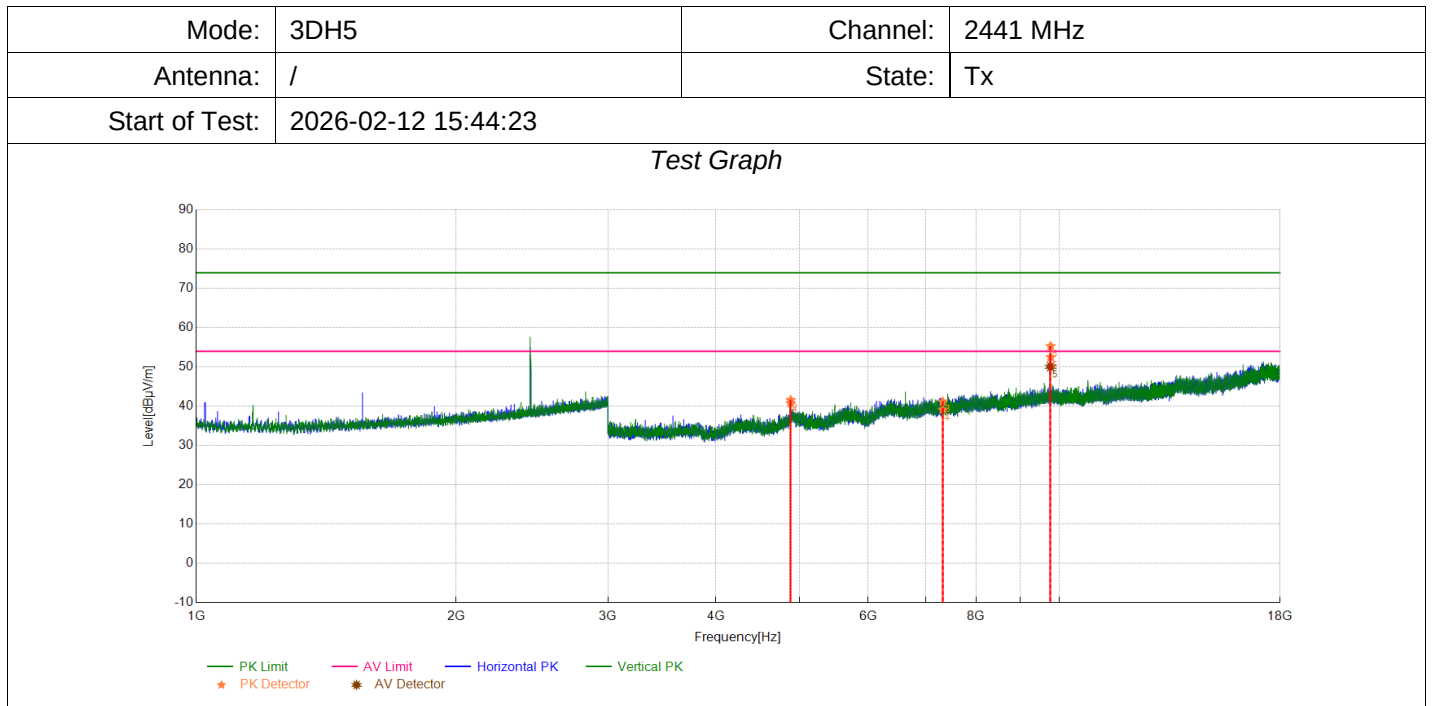

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Reading [dBµV/m]	AV Value [dBµV/m]	AV Limit [dBµV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4882.0000	-14.00	54.83	40.83	74.00	33.17			54.00		150	311	Horizontal	PASS
2	4882.0000	-14.00	55.62	41.62	74.00	32.38			54.00		150	160	Vertical	PASS
3	7323.0000	-9.17	50.36	41.19	74.00	32.81			54.00		150	228	Vertical	PASS
4	7323.0000	-9.17	48.33	39.16	74.00	34.84			54.00		150	338	Horizontal	PASS
5	9764.0000	-4.62	59.936	55.32	74.00	18.68	54.721	50.10	54.00	3.90	120	0	Vertical	PASS
6	9764.0000	-4.62	57.136	52.52	74.00	21.48			54.00		110.9	43.3	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

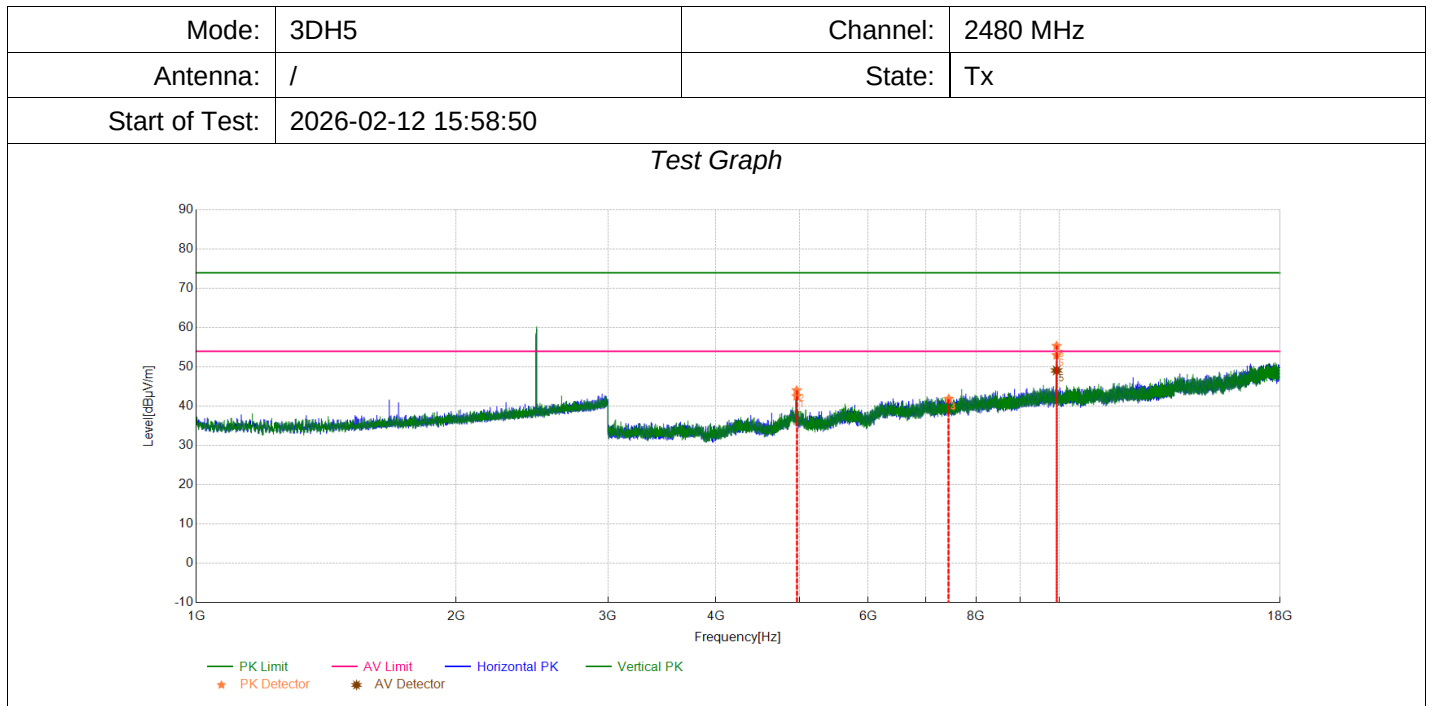

Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	57.41	42.57	74.00	31.43			54.00		150	320	Horizontal	PASS
2	4960.0000	-14.84	58.91	44.07	74.00	29.93			54.00		150	210	Vertical	PASS
3	7440.0000	-8.89	50.79	41.90	74.00	32.10			54.00		150	248	Vertical	PASS
4	7440.0000	-8.89	50.62	41.73	74.00	32.27			54.00		150	354	Horizontal	PASS
5	9920.0000	-4.28	59.650	55.37	74.00	18.63	53.423	49.14	54.00	4.86	120	0	Vertical	PASS
6	9920.0000	-4.28	57.286	53.01	74.00	20.99			54.00		110.9	43.3	Horizontal	PASS


Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	3DH5	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-02-12 17:18:59		

Test Graph

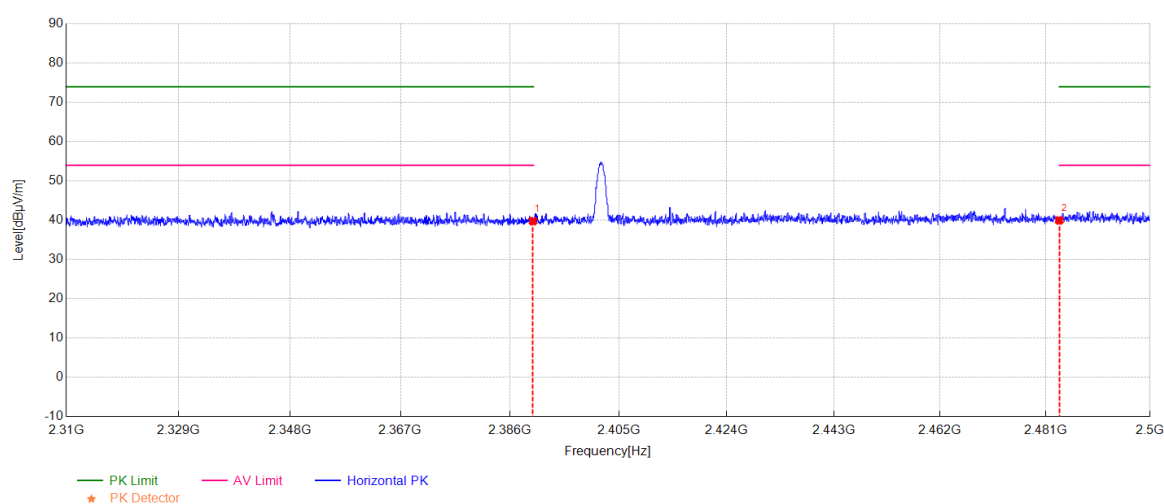

Suspected Data List

NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.86	39.81	2.95	74.00	34.19	101.8	10	PK	Horizontal	PASS
2	2483.5000	36.54	40.00	3.46	74.00	34.00	101.8	240	PK	Horizontal	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level


Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	3DH5	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-02-12 17:33:22		

Test Graph

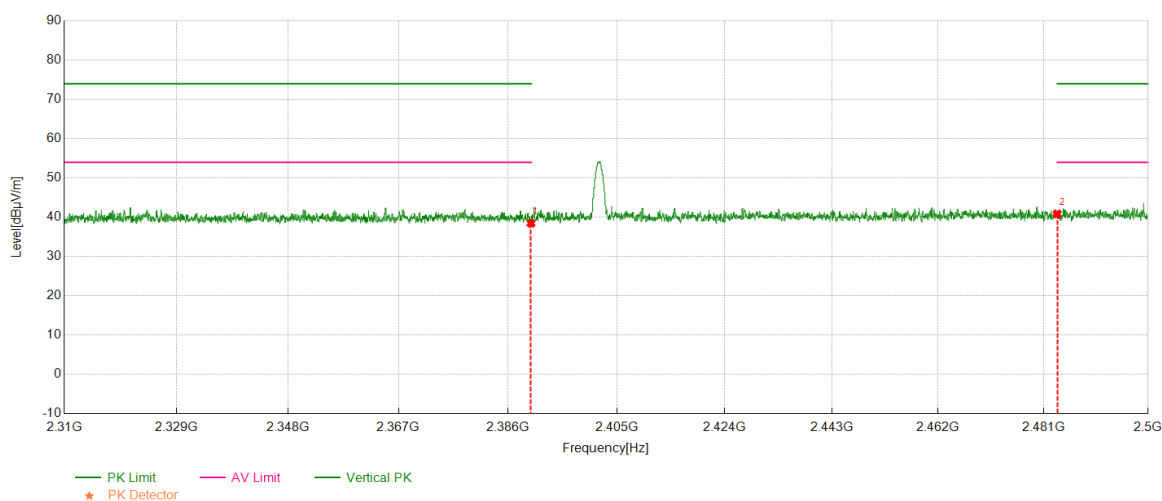

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	35.54	38.49	2.95	74.00	35.51	140.3	310	PK	Vertical	PASS
2	2483.5000	37.42	40.88	3.46	74.00	33.12	140.3	220	PK	Vertical	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

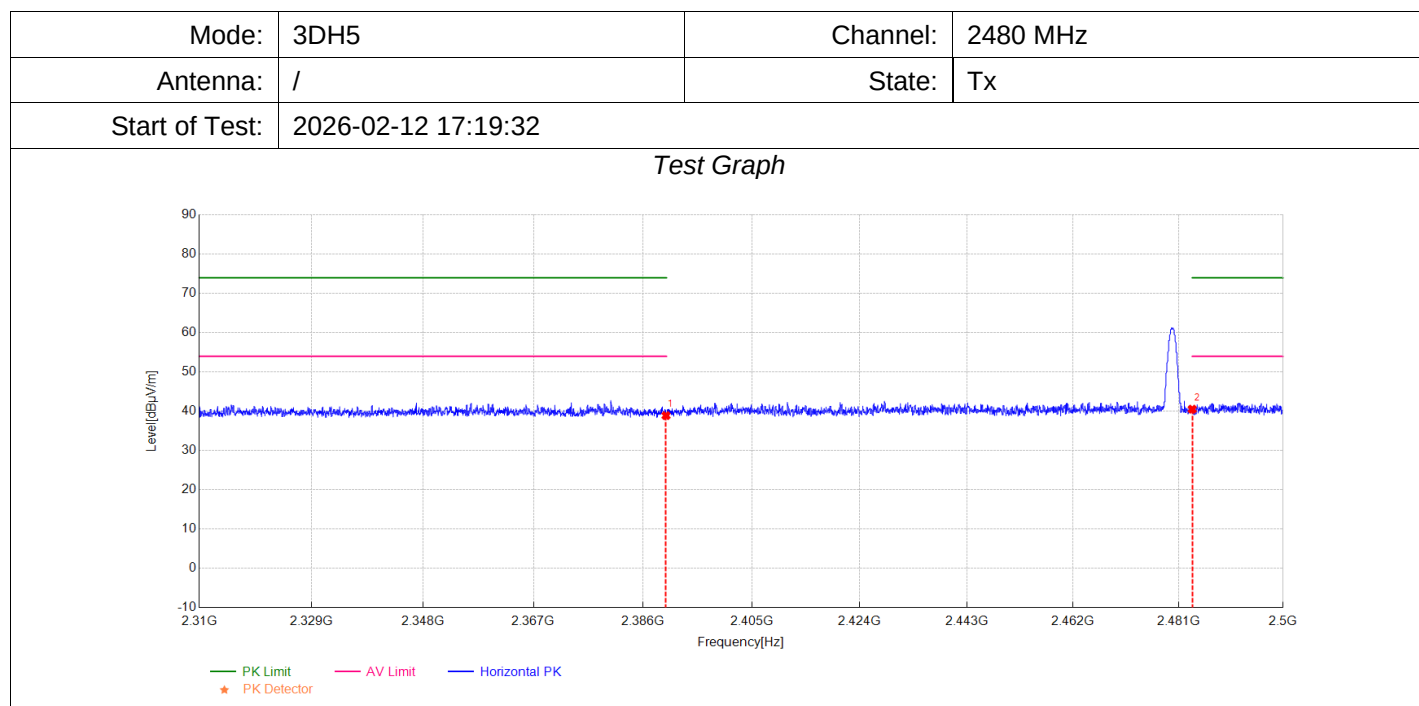
Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	35.96	38.91	2.95	74.00	35.09	101.8	270	PK	Horizontal	PASS
2	2483.5000	37.08	40.54	3.46	74.00	33.46	101.8	150	PK	Horizontal	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level


Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	3DH5	Channel:	2480 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-02-12 17:33:56		

Test Graph

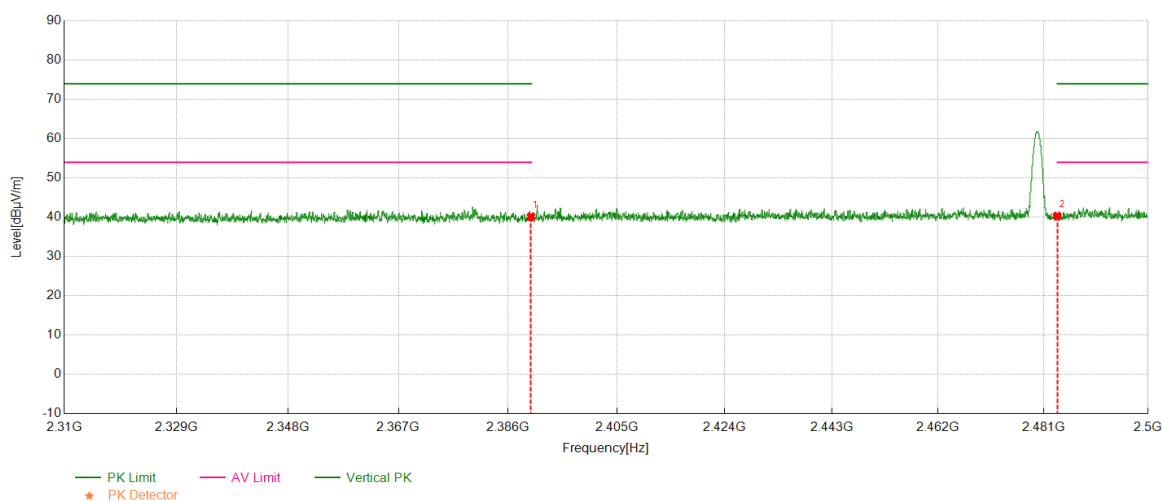

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.19	40.14	2.95	74.00	33.86	140.3	40	PK	Vertical	PASS
2	2483.5000	36.83	40.29	3.46	74.00	33.71	140.3	240	PK	Vertical	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

--End of report--

Test Report No.: EFGX26010180-IE-03-E04

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China