





BLE_2M-Ant1-2440-0~Reference-PASS

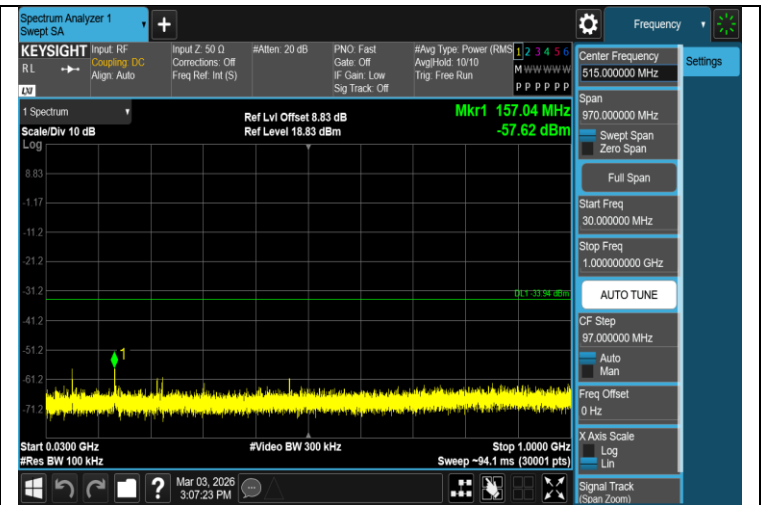


BLE_2M-Ant1-2440-30~1000-PASS

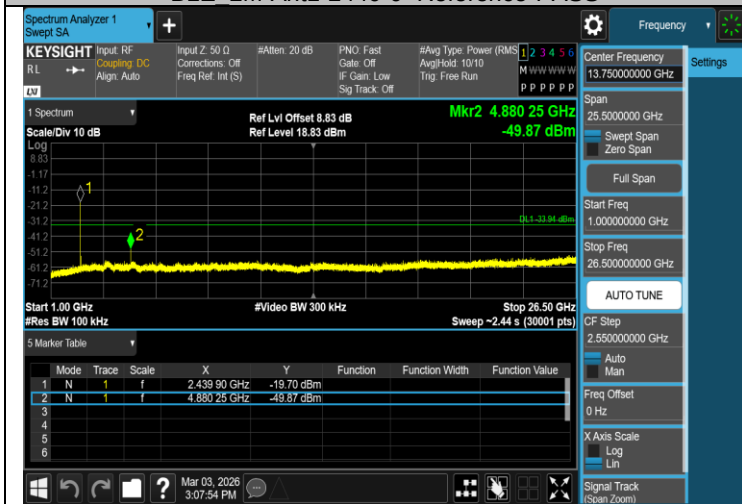

BLE_2M-Ant1-2440-1000~26500-PASS



BLE_2M-Ant1-2480-0~Reference-PASS

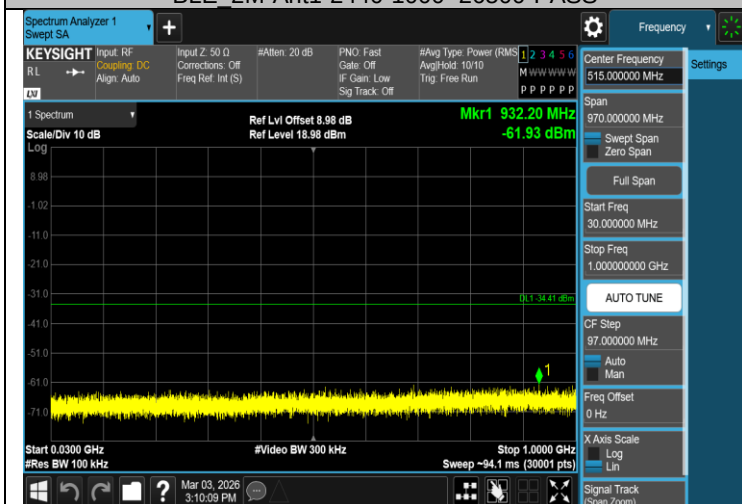

BLE_2M-Ant1-2480-30~1000-PASS



BLE_2M-Ant1-2480-1000~26500-PASS

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Appendix G: Duty Cycle


Test Result

TestMode	Antenna	Channel[MHz]	ON Time[ms]	Period[ms]	Duty Cycle[%]	Duty Cycle Factor[dB]
BLE_1M	Ant1	2402	2.14	5.83	36.71	4.35
BLE_1M	Ant1	2440	2.13	5.83	36.54	4.37
BLE_1M	Ant1	2480	2.14	5.84	36.64	4.36
BLE_2M	Ant1	2402	1.09	4.78	22.80	6.42
BLE_2M	Ant1	2440	1.09	4.78	22.80	6.42
BLE_2M	Ant1	2480	1.08	4.78	22.59	6.46

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China






Test Graphs

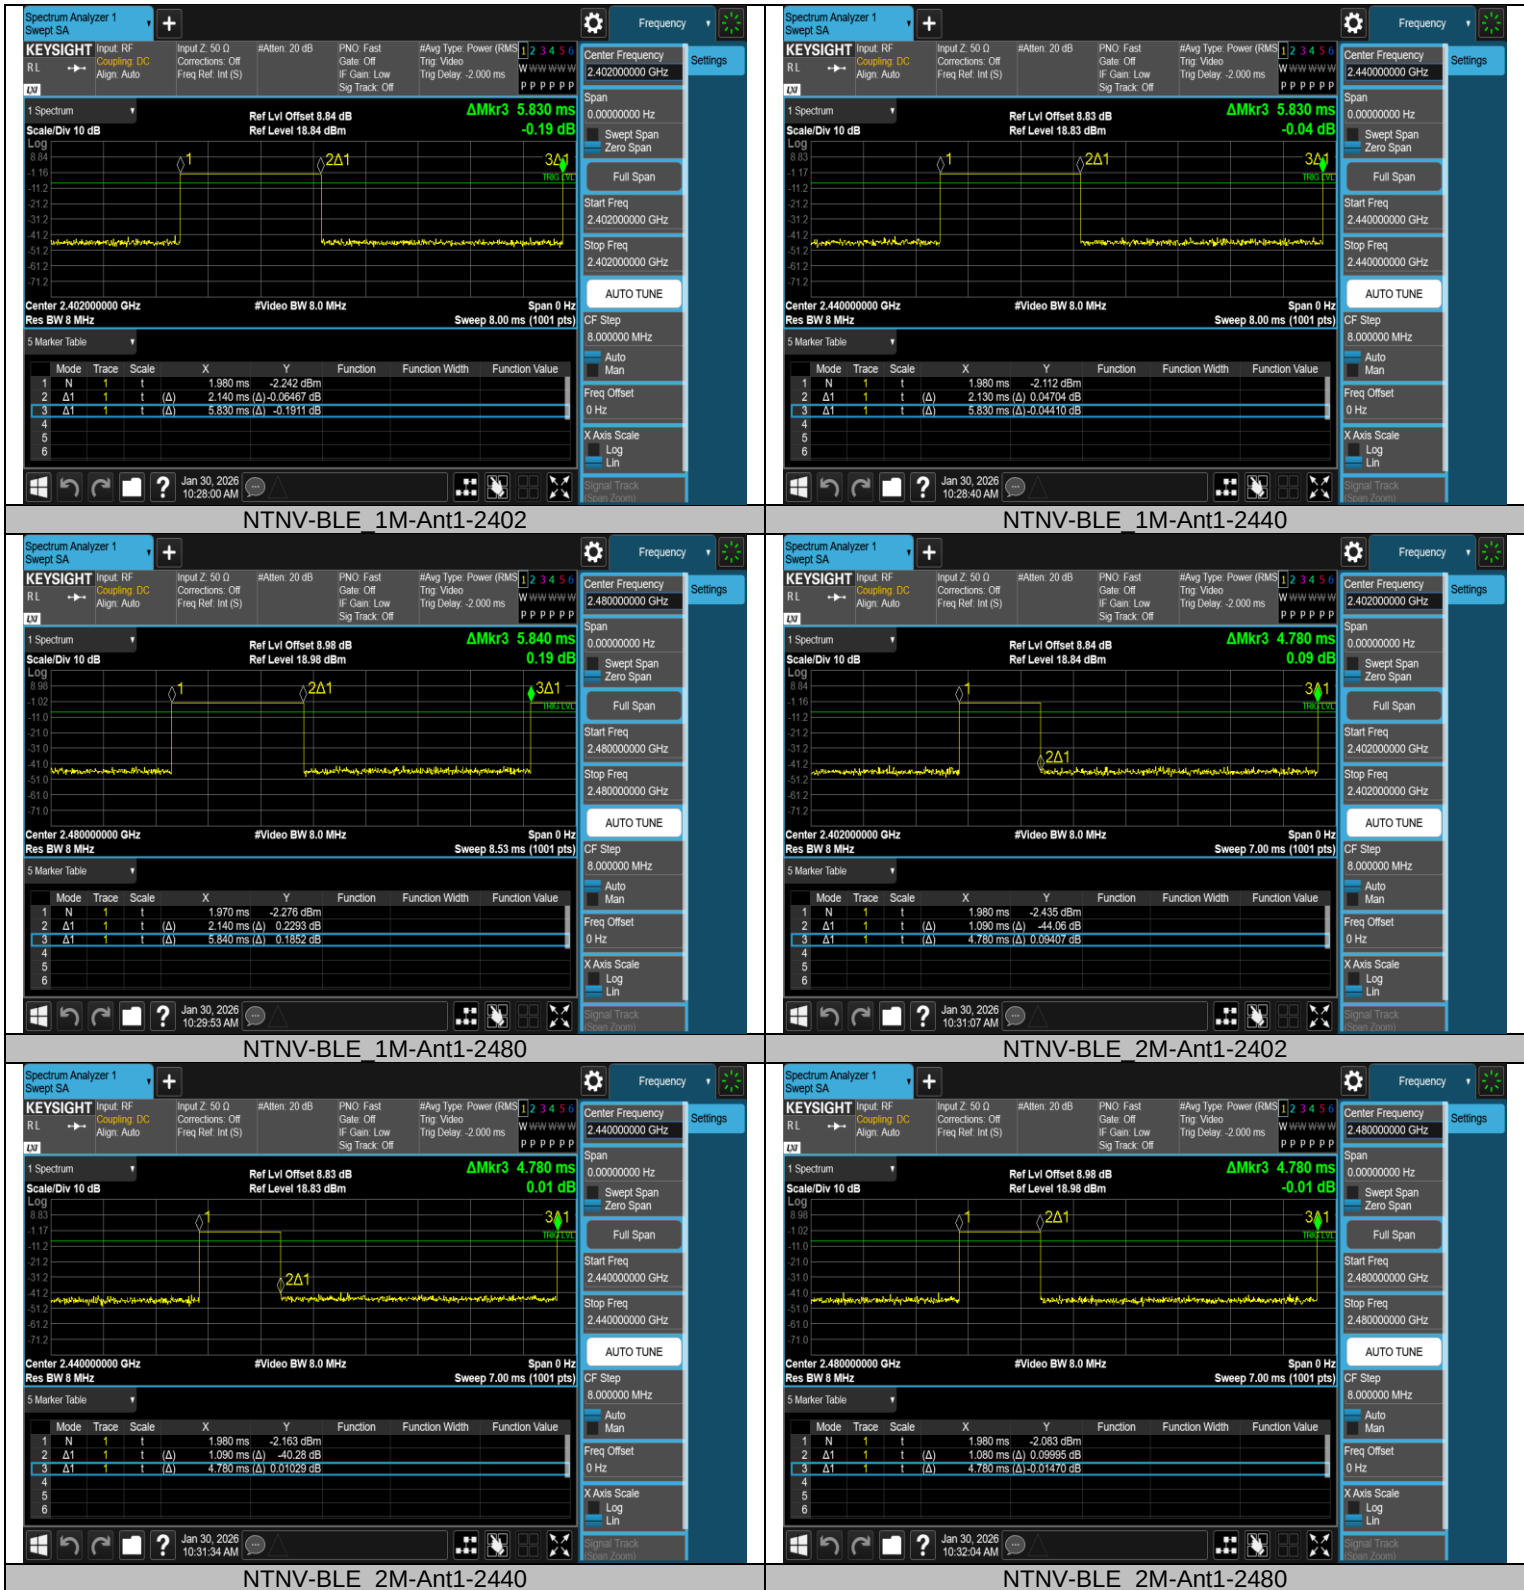

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

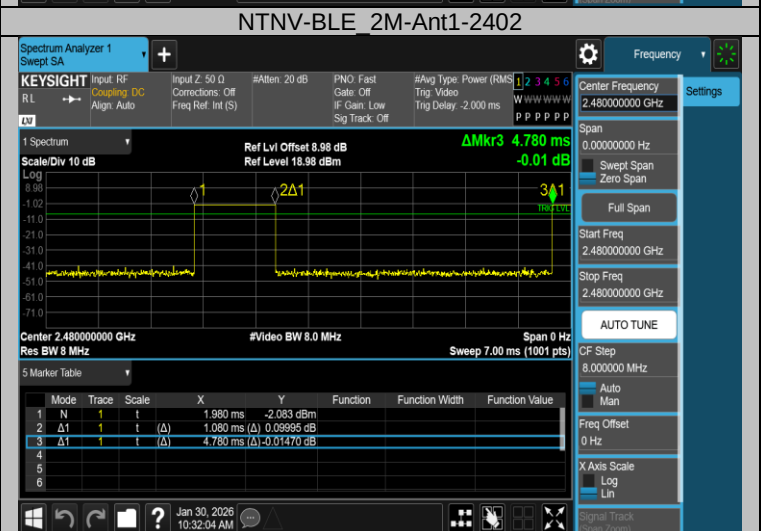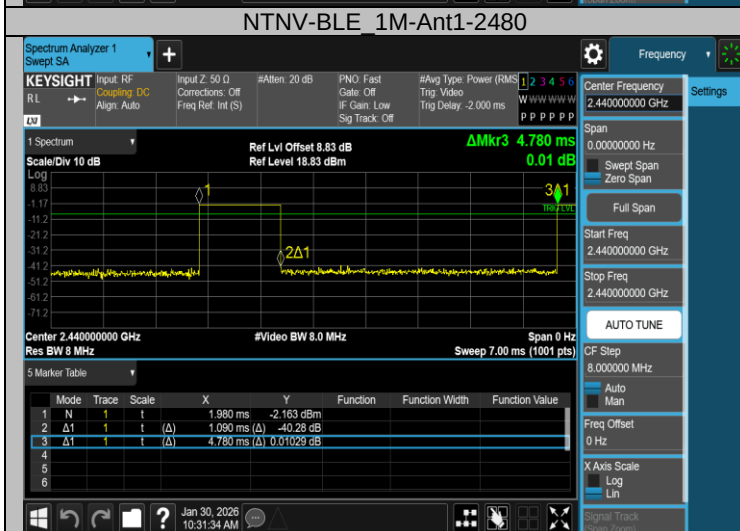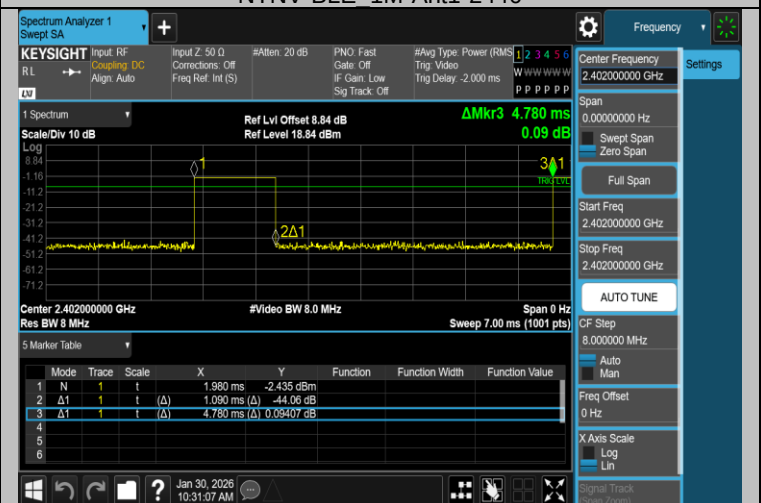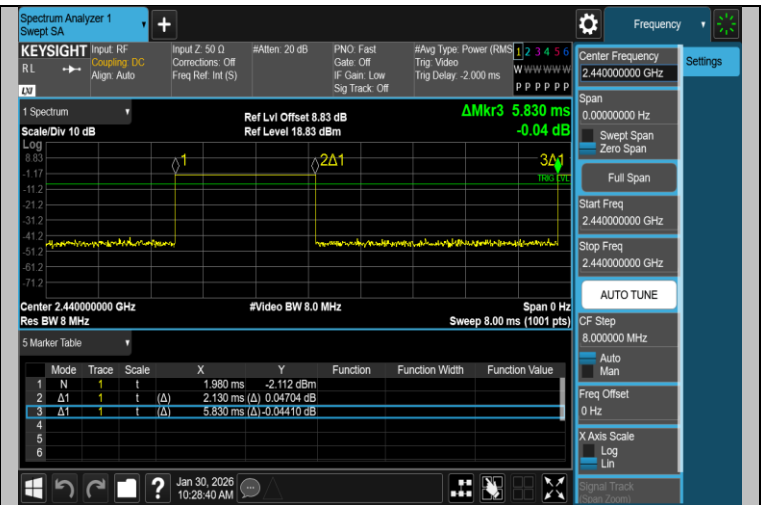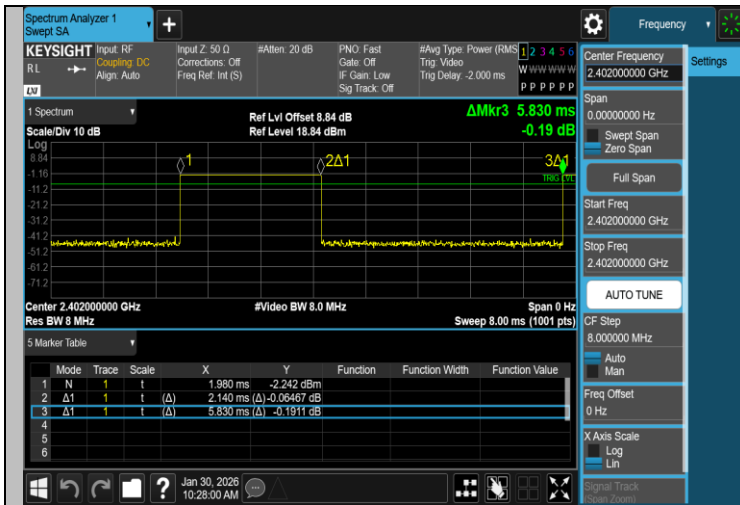

NTNV-BLE_2M-Ant1-2440

NTNV-BLE_2M-Ant1-2480

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Appendix H: Emissions in Restricted Bands

The report only records the worst-case emission levels.


For radiated emissions in the frequency range of 9 kHz to 30 MHz, a preliminary scan was performed. Per FCC §15.31(o), emissions that were more than 20 dB below the applicable limit are not reported. For radiated emissions at frequencies above 1 GHz, per ANSI C63.10-2020, Section 6.6.4.3, Note 1, if the peak measured value complies with the average limit, an average measurement is not required. Therefore, for frequencies where the peak result complies with the average limit, average (AV) emission values may be omitted from the table below.

Below 1GHz

Mode:	Normal operation	Channel:	/
Antenna:	/	State:	/

Start of Test: 2026-03-03 17:25:00

Test Graph

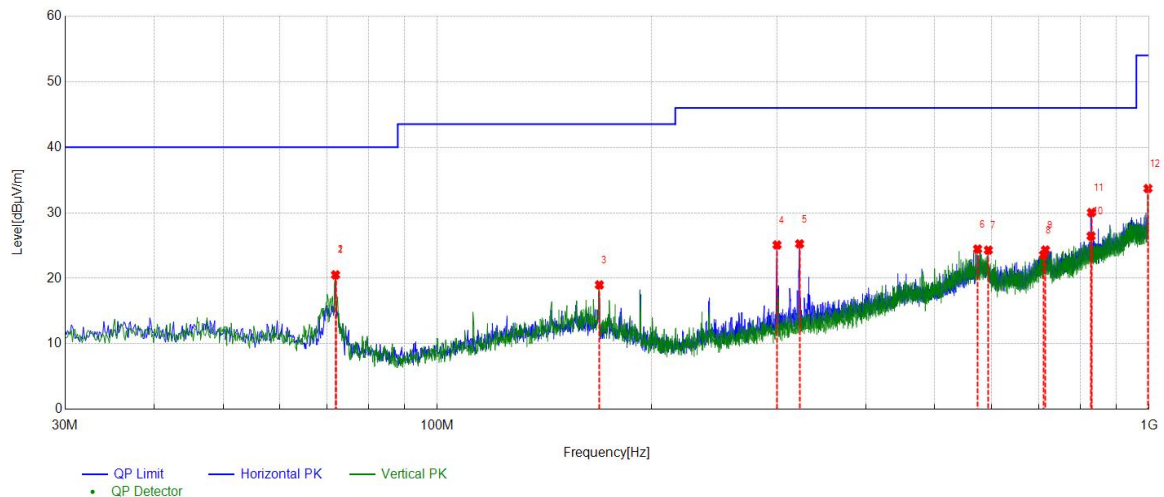

PK Suspected Data List


NO.	Freq. [MHz]	Reading [dBμV/m]	Factor [dB/m]	Level [dBμV/m]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	71.9525	39.46	-18.93	20.53	40.00	19.47	200	314	Horizontal	PASS
2	71.9525	39.65	-18.93	20.72	40.00	19.28	100	268	Vertical	PASS
3	168.9525	35.46	-16.46	19.00	43.50	24.50	100	166	Vertical	PASS
4	300.1450	40.75	-15.66	25.09	46.00	20.91	100	96	Horizontal	PASS
5	322.9400	40.35	-15.09	25.26	46.00	20.74	100	93	Horizontal	PASS
6	574.2912	33.82	-9.35	24.47	46.00	21.53	100	273	Vertical	PASS
7	594.6612	33.22	-8.92	24.30	46.00	21.70	200	108	Horizontal	PASS
8	710.8188	30.17	-6.58	23.59	46.00	22.41	100	34	Vertical	PASS
9	715.3050	30.88	-6.56	24.32	46.00	21.68	100	193	Horizontal	PASS
10	829.0375	30.83	-4.38	26.45	46.00	19.55	100	219	Vertical	PASS
11	830.1288	34.42	-4.39	30.03	46.00	15.97	100	350	Horizontal	PASS
12	996.6050	34.95	-1.25	33.70	54.00	20.30	100	100	Vertical	PASS

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.


Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Above 1GHz

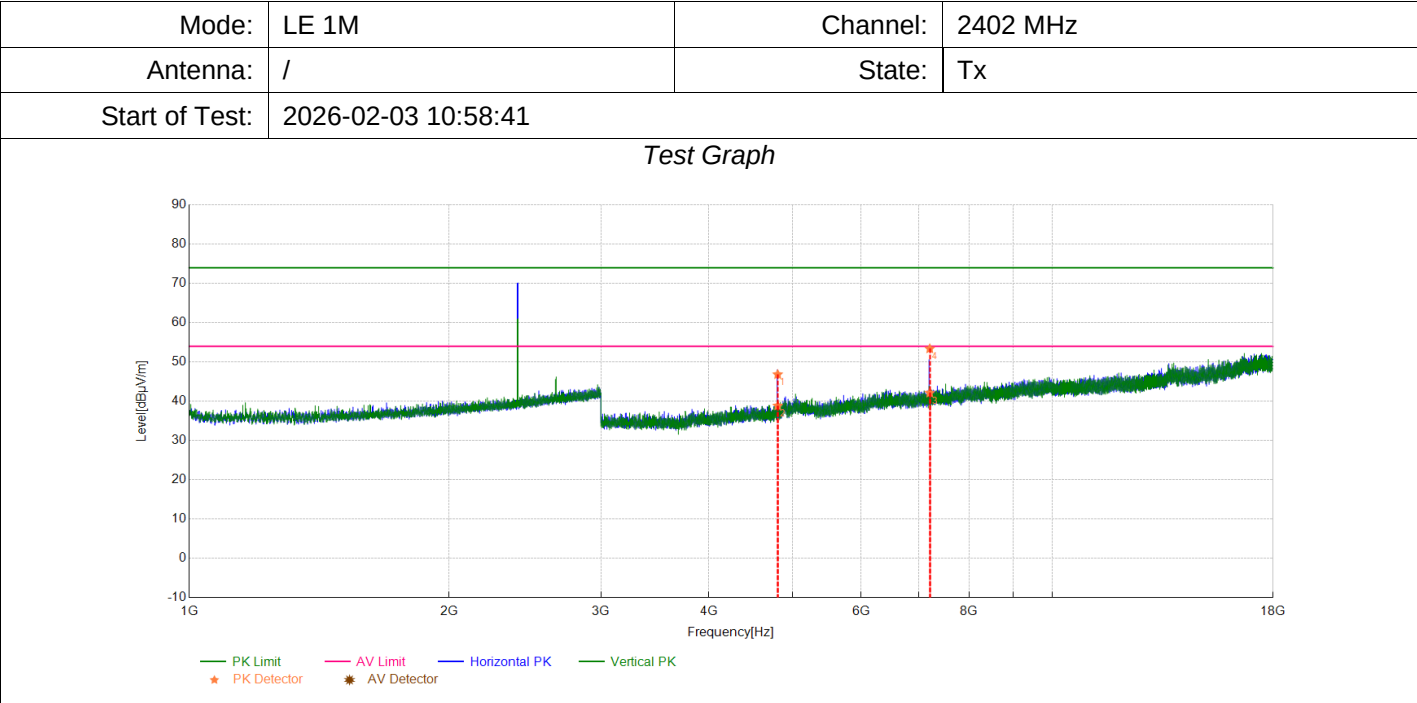

Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Mar- gin [dB]	AV Limit [dBμV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	61.38	46.85	74.00	27.15	54.00	150	273	Horizontal	PASS
2	4804.0000	-14.53	53.39	38.86	74.00	35.14	54.00	150	292	Vertical	PASS
3	7206.0000	-9.40	51.53	42.13	74.00	31.87	54.00	150	273	Vertical	PASS
4	7206.0000	-9.40	62.796	53.40	74.00	20.60	54.00	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

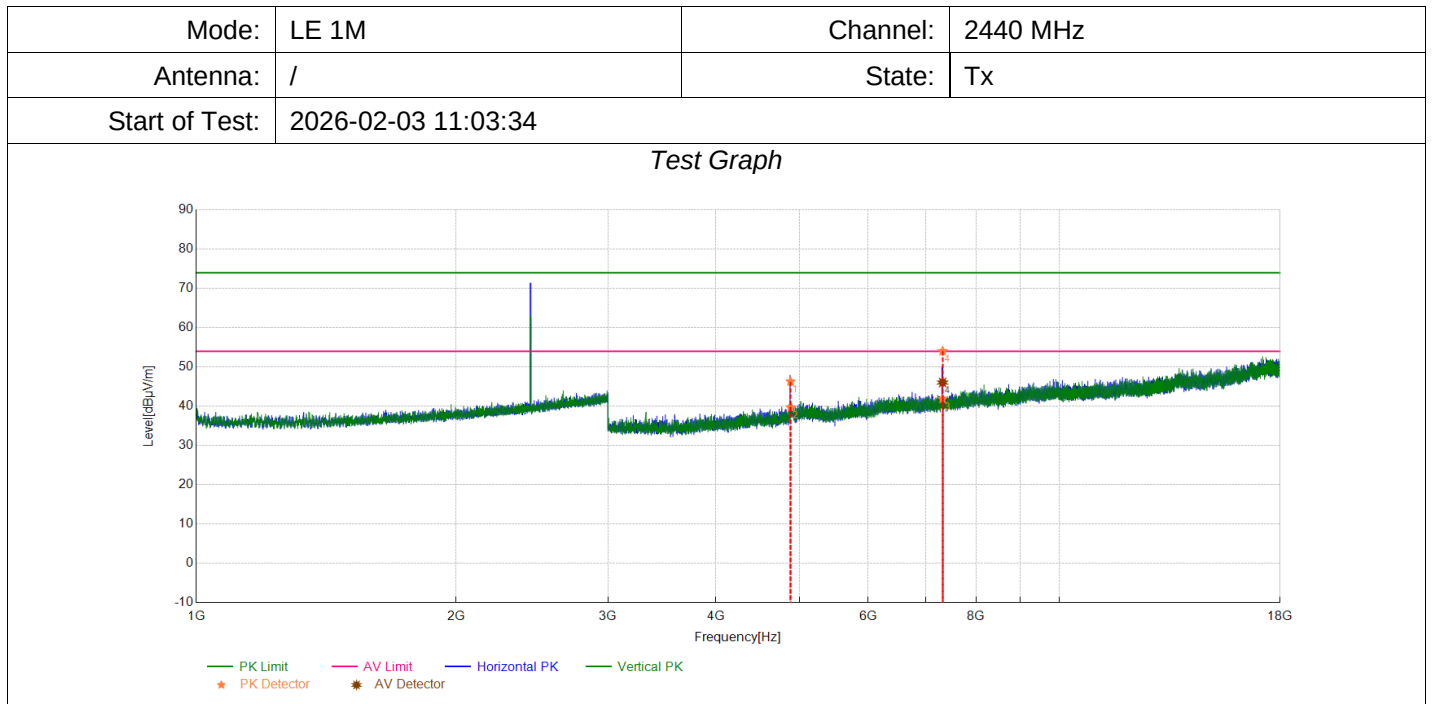


Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBμV/m]	PK Value [dBμV/m]	PK Limit [dBμV/m]	PK Margin [dB]	AV Reading [dBμV/m]	AV Value [dBμV/m]	AV Limit [dBμV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4880.0000	-14.07	60.39	46.32	74.00	27.68			54.00		150	268	Horizontal	PASS
2	4880.0000	-14.07	53.82	39.75	74.00	34.25			54.00		150	292	Vertical	PASS
3	7320.0000	-9.14	51.04	41.90	74.00	32.10			54.00		150	171	Vertical	PASS
4	7320.0000	-9.14	63.189	54.05	74.00	19.95	55.199	46.06	54.00	7.94	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level


Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

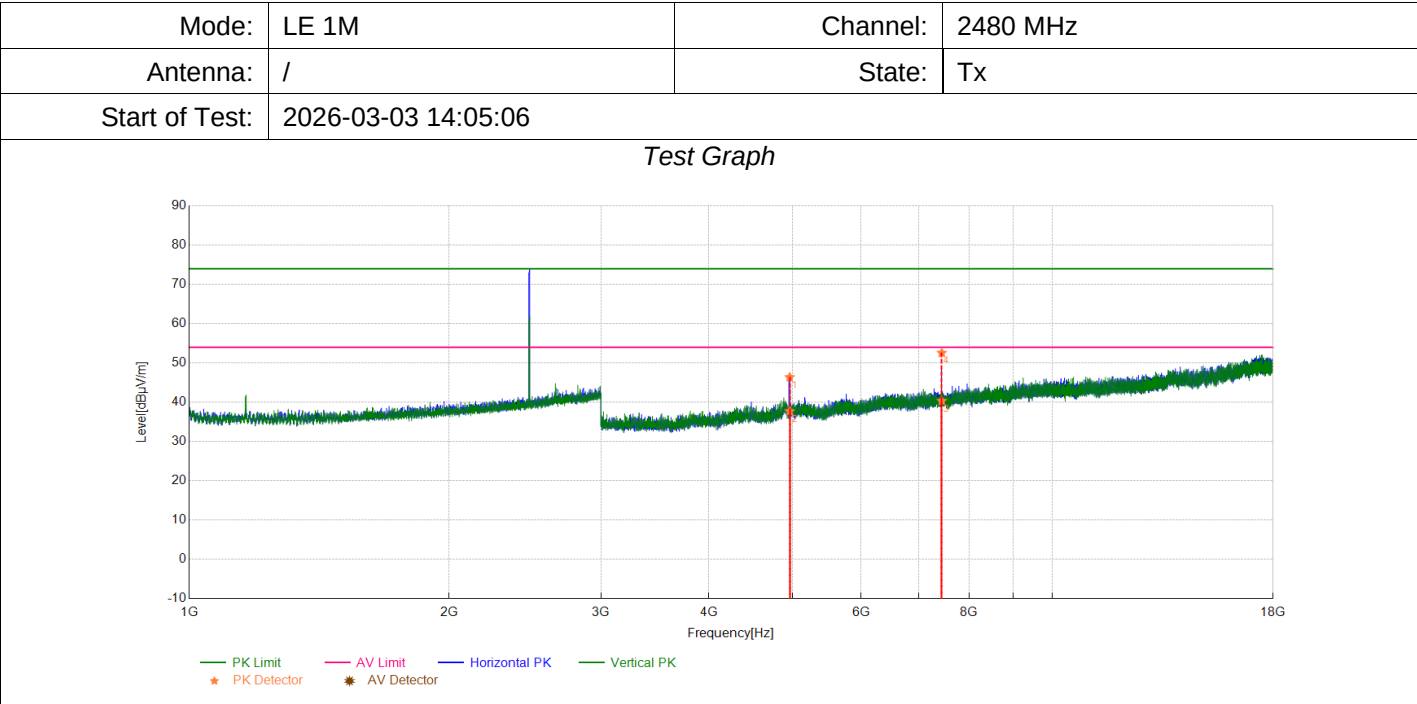


Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Limit [dBµV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	61.22	46.38	74.00	27.62	54.00	150	175	Horizontal	PASS
2	4960.0000	-14.84	52.59	37.75	74.00	36.25	54.00	150	233	Vertical	PASS
3	7440.0000	-8.89	49.24	40.35	74.00	33.65	54.00	150	116	Vertical	PASS
4	7440.0000	-8.89	61.477	52.59	74.00	21.41	54.00	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

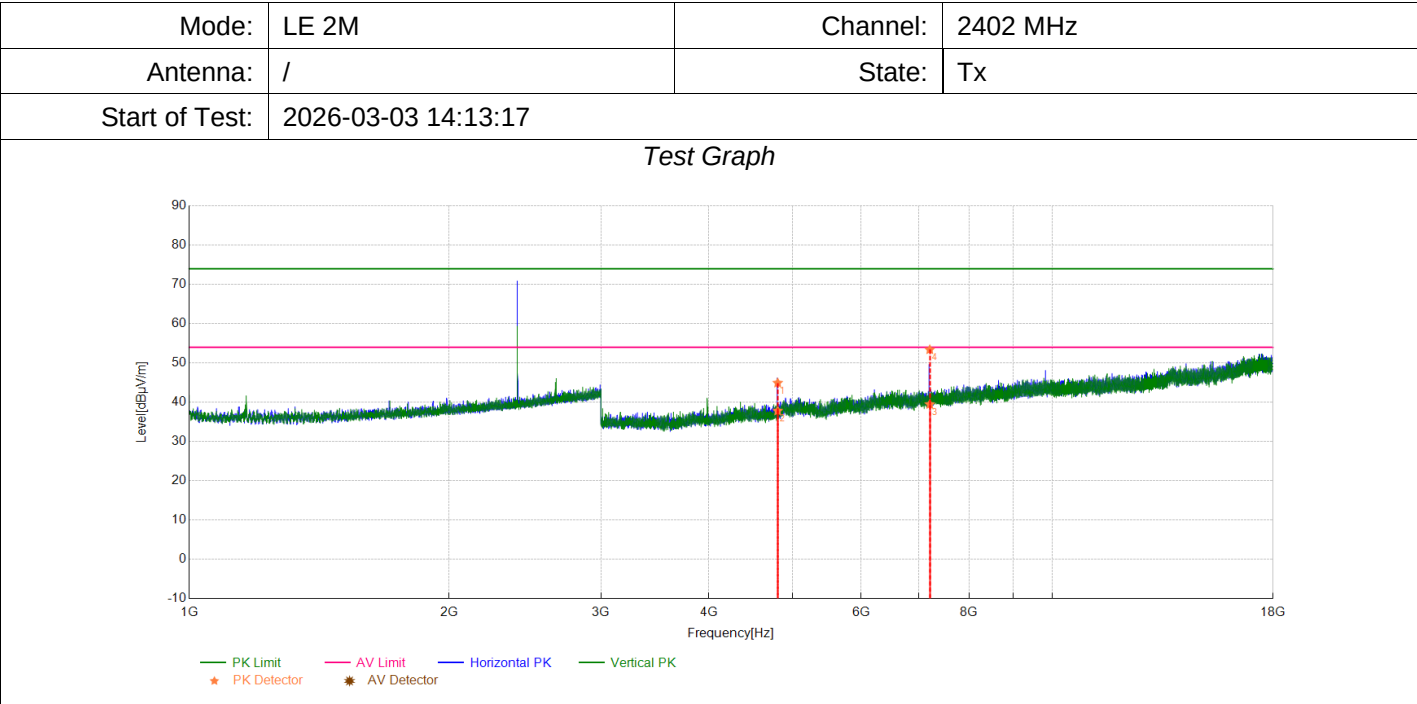


Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Limit [dBµV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4804.0000	-14.53	59.46	44.93	74.00	29.07	54.00	150	166	Horizontal	PASS
2	4804.0000	-14.53	52.35	37.82	74.00	36.18	54.00	150	208	Vertical	PASS
3	7206.0000	-9.40	48.89	39.49	74.00	34.51	54.00	150	12	Vertical	PASS
4	7206.0000	-9.40	62.816	53.42	74.00	20.58	54.00	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

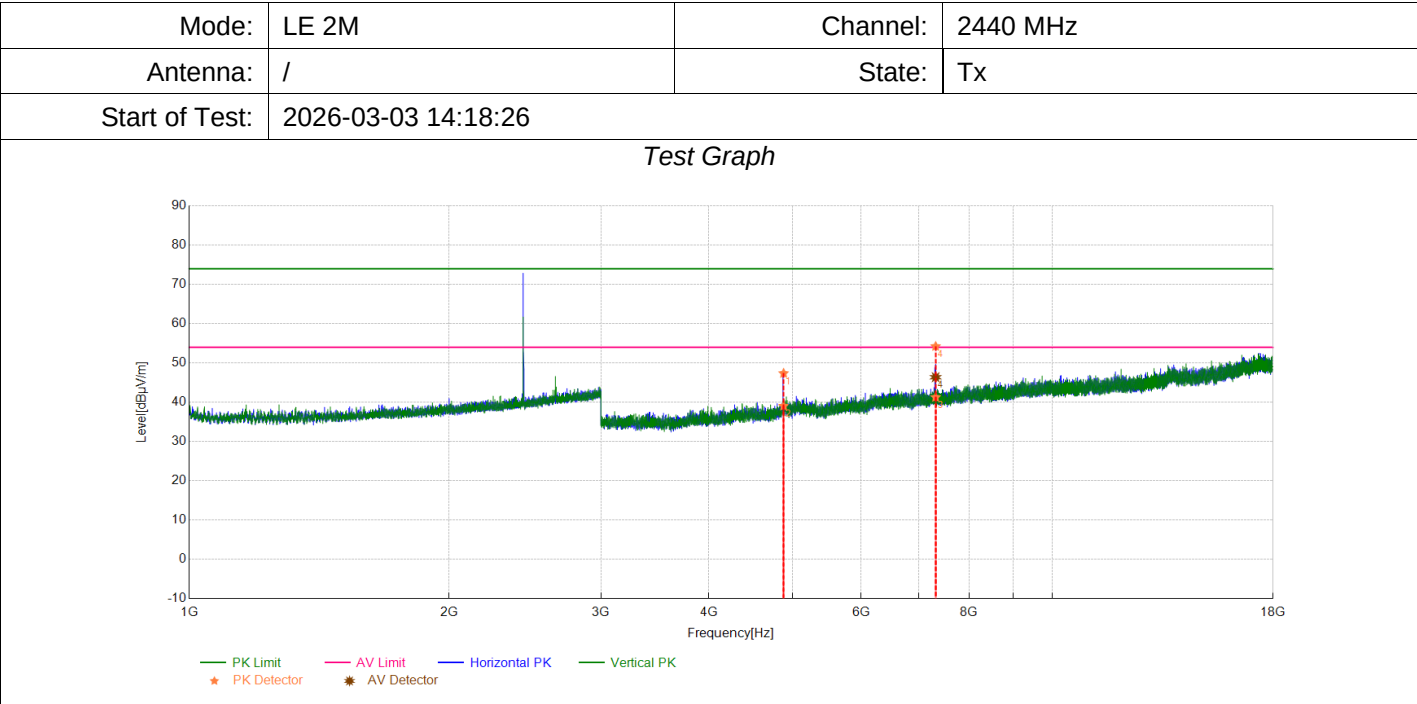


Final Data List														
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Reading [dBµV/m]	AV Value [dBµV/m]	AV Limit [dBµV/m]	AV Margin [dB]	Height [cm]	Angle [°]	Polarity	Verdict
1	4880.0000	-14.07	61.45	47.38	74.00	26.62			54.00		150	185	Horizontal	PASS
2	4880.0000	-14.07	53.13	39.06	74.00	34.94			54.00		150	202	Vertical	PASS
3	7320.0000	-9.14	50.43	41.29	74.00	32.71			54.00		150	332	Vertical	PASS
4	7320.0000	-9.14	63.398	54.26	74.00	19.74	55.527	46.39	54.00	7.61	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

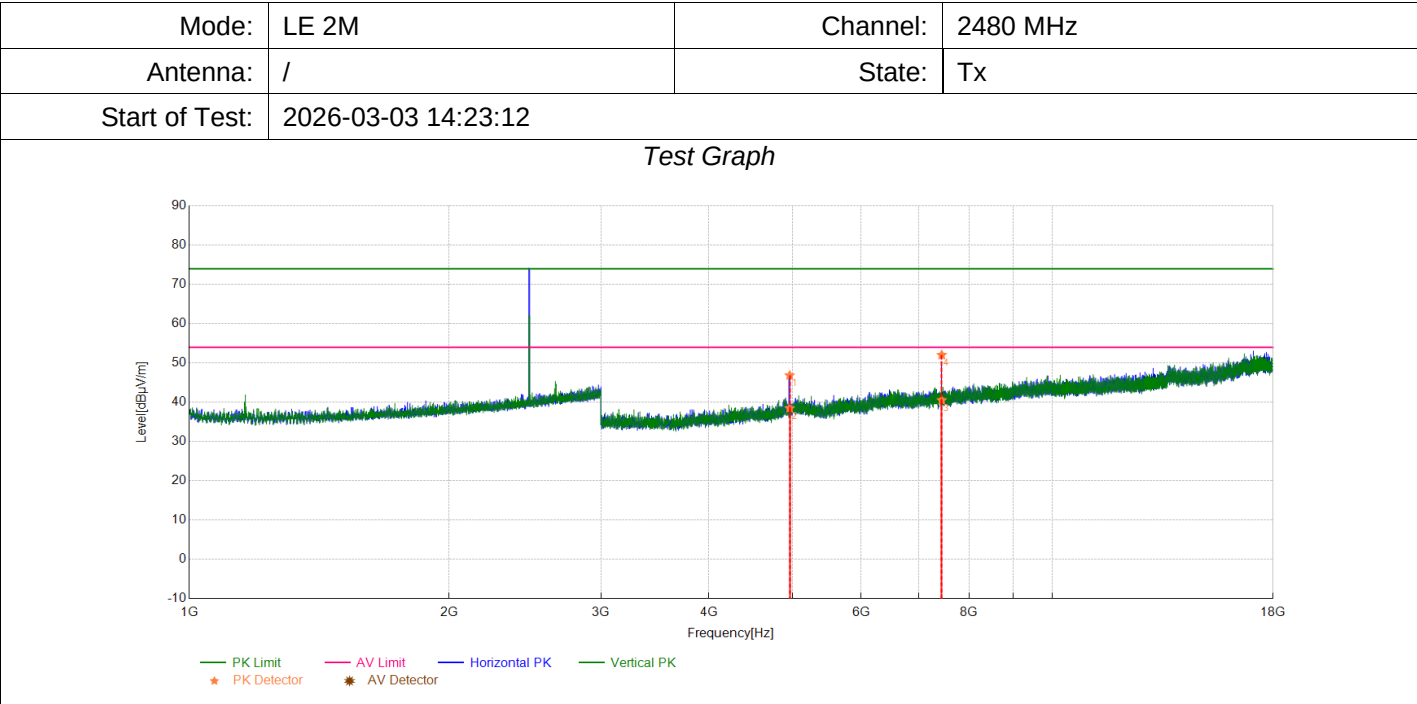

Final Data List											
NO.	Frequency [MHz]	Factor [dB]	PK Reading [dBµV/m]	PK Value [dBµV/m]	PK Limit [dBµV/m]	PK Margin [dB]	AV Limit [dBµV/m]	Height [cm]	Angle [°]	Polarity	Verdict
1	4960.0000	-14.84	61.7	46.86	74.00	27.14	54.00	150	184	Horizontal	PASS
2	4960.0000	-14.84	53.32	38.48	74.00	35.52	54.00	150	210	Vertical	PASS
3	7440.0000	-8.89	49.43	40.54	74.00	33.46	54.00	150	170	Vertical	PASS
4	7440.0000	-8.89	60.942	52.05	74.00	21.95	54.00	130.6	360	Horizontal	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

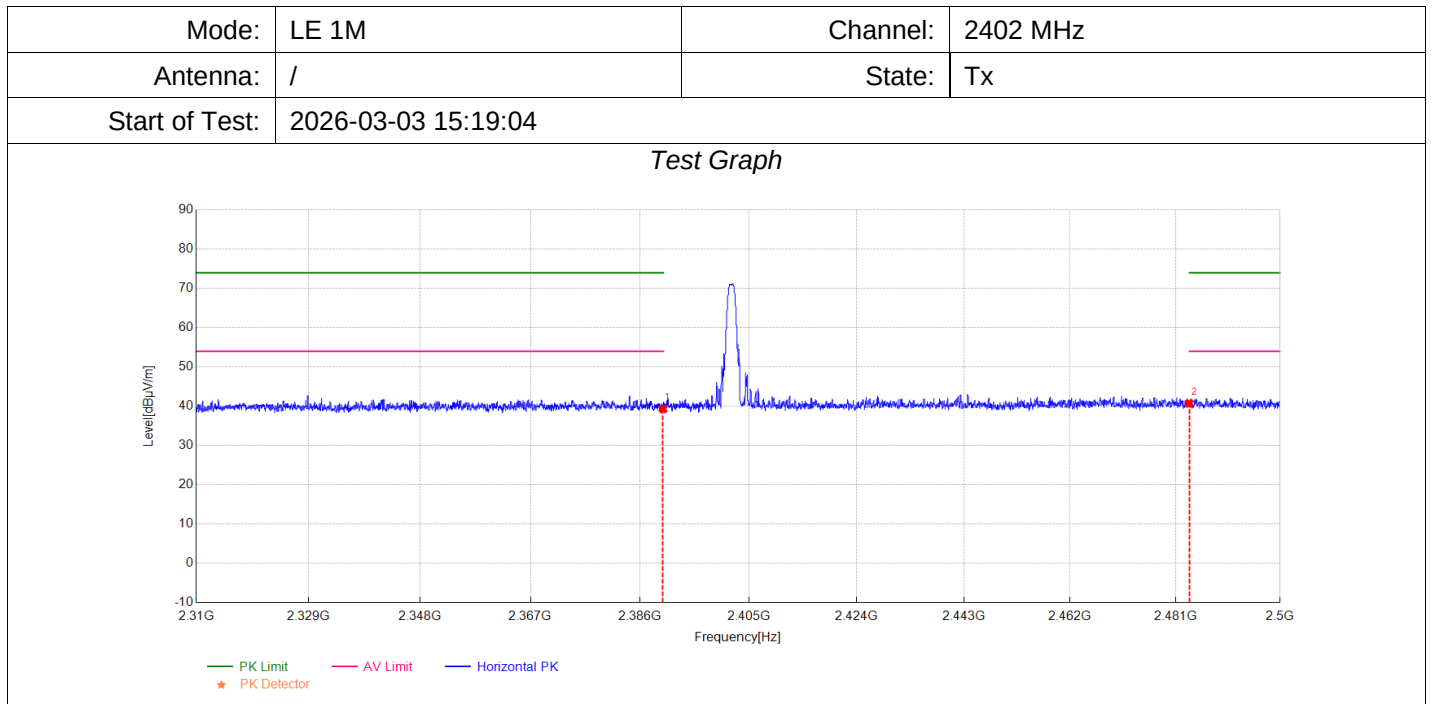
Suspected Data List

NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.37	39.32	2.95	74.00	34.68	150	50	PK	Horizontal	PASS
2	2483.5000	37.32	40.78	3.46	74.00	33.22	150	90	PK	Horizontal	PASS


Note: (1) Level = Reading + Factor
 (2) Margin = Limit - Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
 Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
 Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	LE 1M	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-03-03 15:40:09		

Test Graph

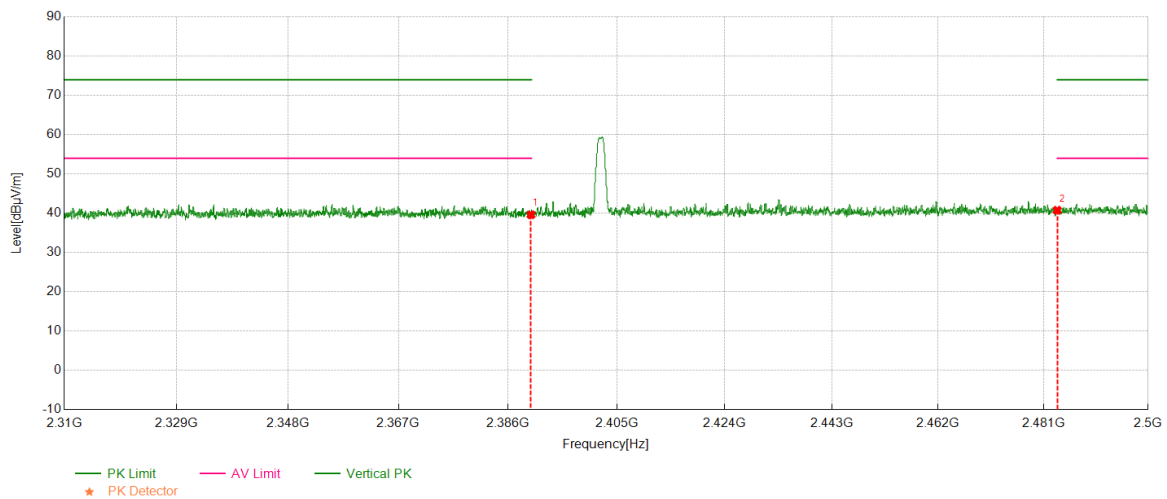


Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	36.68	39.63	2.95	74.00	34.37	249	360	PK	Vertical	PASS
2	2483.5000	37.32	40.78	3.46	74.00	33.22	249	300	PK	Vertical	PASS

Note:(1)Level=Reading+Factor
(2)Margin=Limit-Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

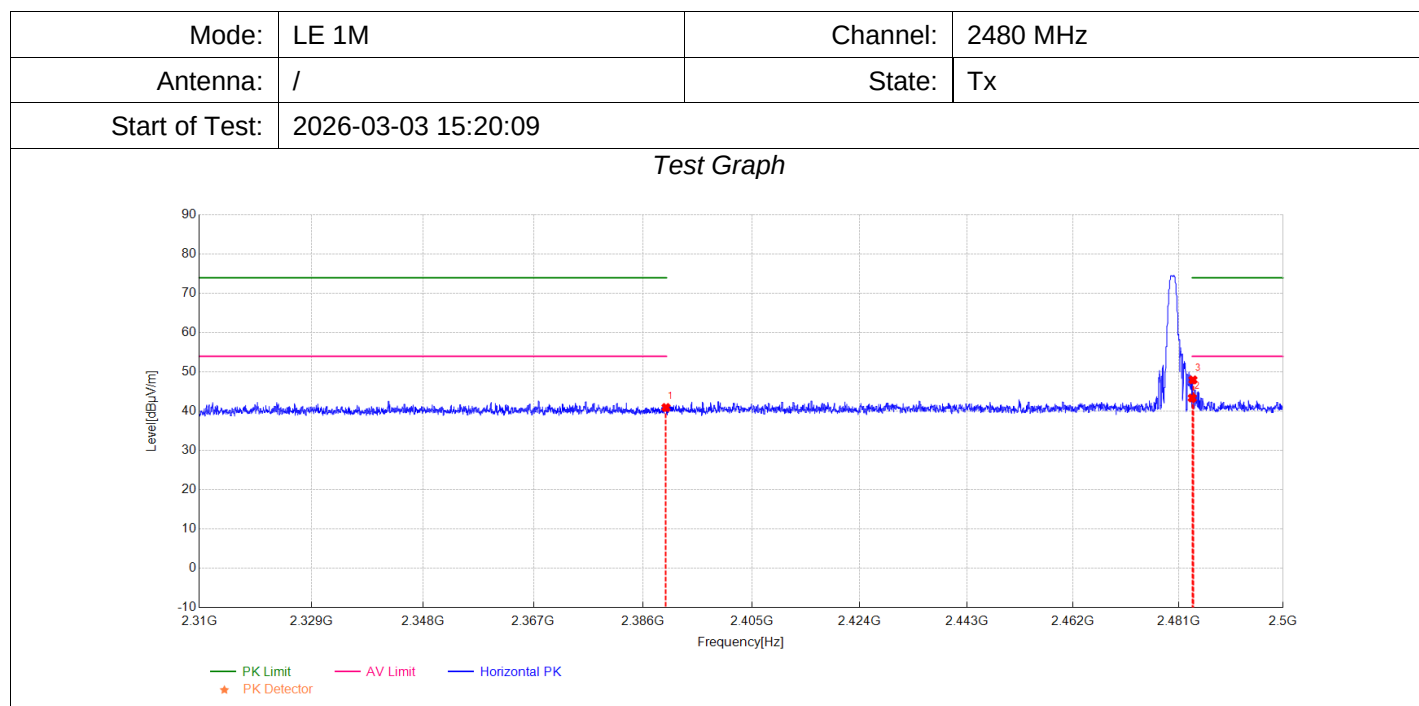
Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	38.02	40.97	2.95	74.00	33.03	150	80	PK	Horizontal	PASS
2	2483.5000	39.93	43.39	3.46	74.00	30.61	150	320	PK	Horizontal	PASS
3	2483.6363	44.55	48.01	3.46	74.00	25.99	150	110	PK	Horizontal	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

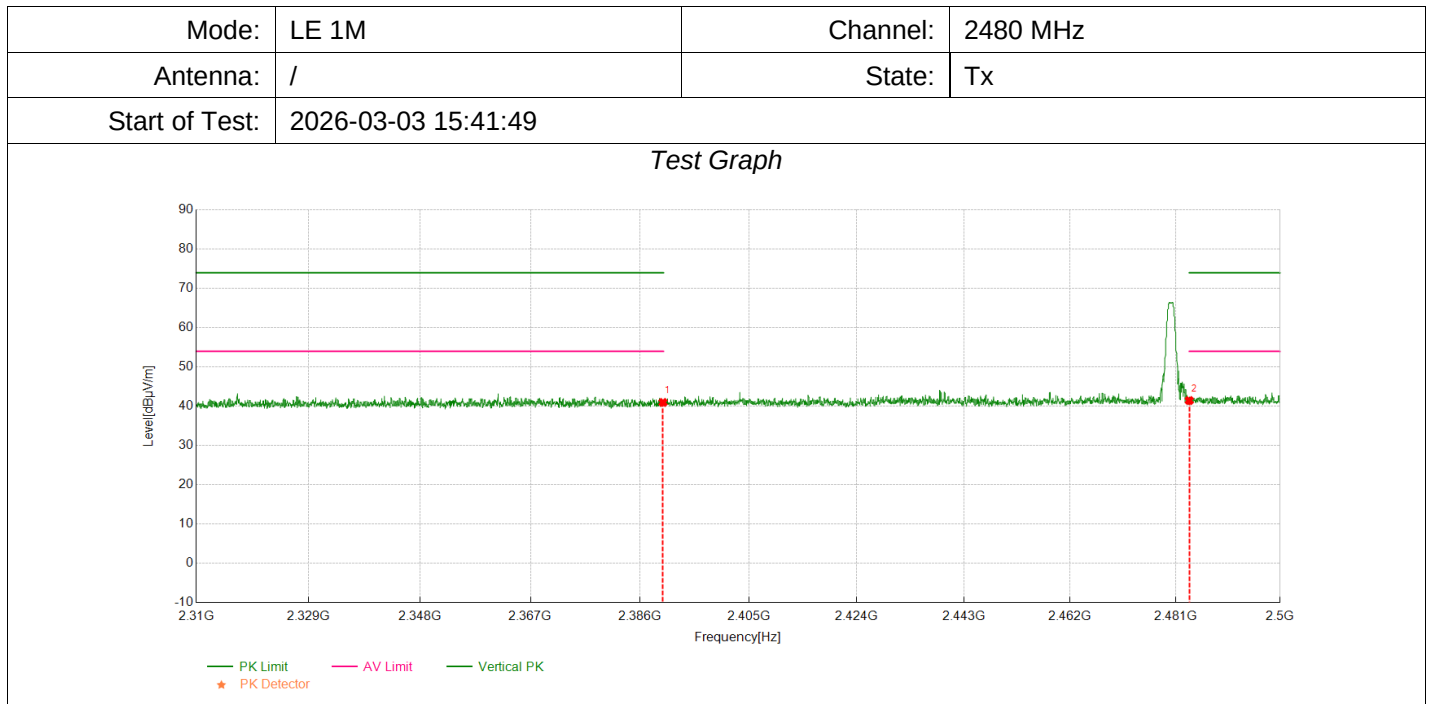
Suspected Data List

NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	38.05	41.00	2.95	74.00	33.00	249	60	PK	Vertical	PASS
2	2483.5000	38.02	41.48	3.46	74.00	32.52	249	60	PK	Vertical	PASS


Note: (1) Level = Reading + Factor
 (2) Margin = Limit - Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
 Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
 Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	LE 2M	Channel:	2402 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-03-03 15:20:58		

Test Graph

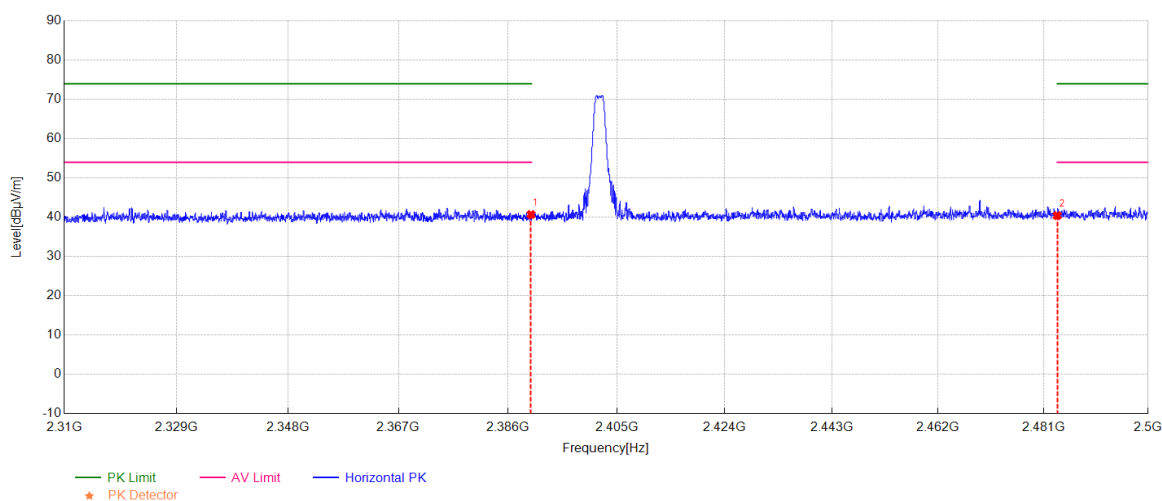

Suspected Data List


NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.77	40.72	2.95	74.00	33.28	150	110	PK	Horizontal	PASS
2	2483.5000	36.97	40.43	3.46	74.00	33.57	150	80	PK	Horizontal	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

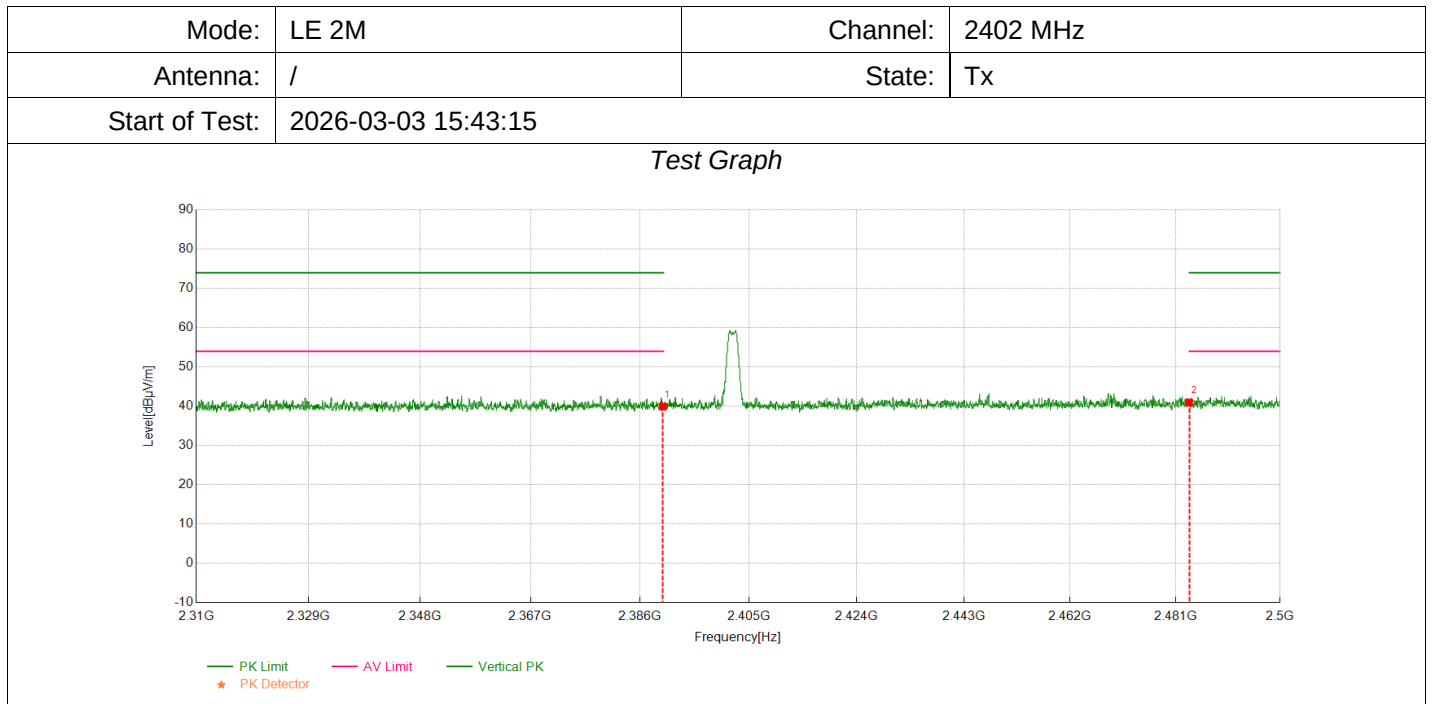
Suspected Data List

NO.	Frequency [MHz]	Reading [dBµV/m]	Level [dBµV/m]	Factor [dB]	Limit [dBµV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.03	39.98	2.95	74.00	34.02	249	330	PK	Vertical	PASS
2	2483.5000	37.53	40.99	3.46	74.00	33.01	249	270	PK	Vertical	PASS


Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.

Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83, Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

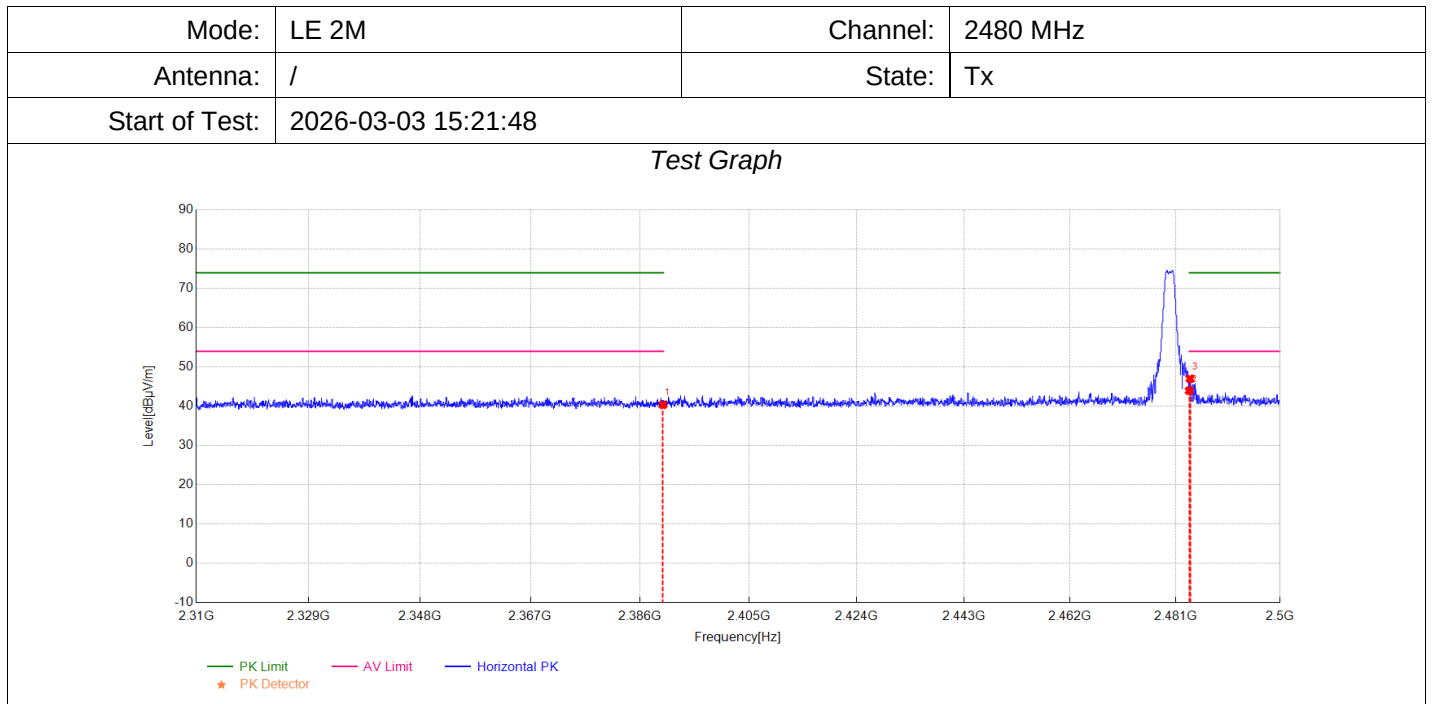
Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.45	40.40	2.95	74.00	33.60	150	120	PK	Horizontal	PASS
2	2483.5000	40.52	43.98	3.46	74.00	30.02	150	180	PK	Horizontal	PASS
3	2483.6363	43.57	47.03	3.46	74.00	26.97	150	260	PK	Horizontal	PASS


Note: (1) Level = Reading + Factor
 (2) Margin = Limit - Level

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
 Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
 Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China

Mode:	LE 2M	Channel:	2480 MHz
Antenna:	/	State:	Tx
Start of Test:	2026-03-03 15:43:57		

Test Graph

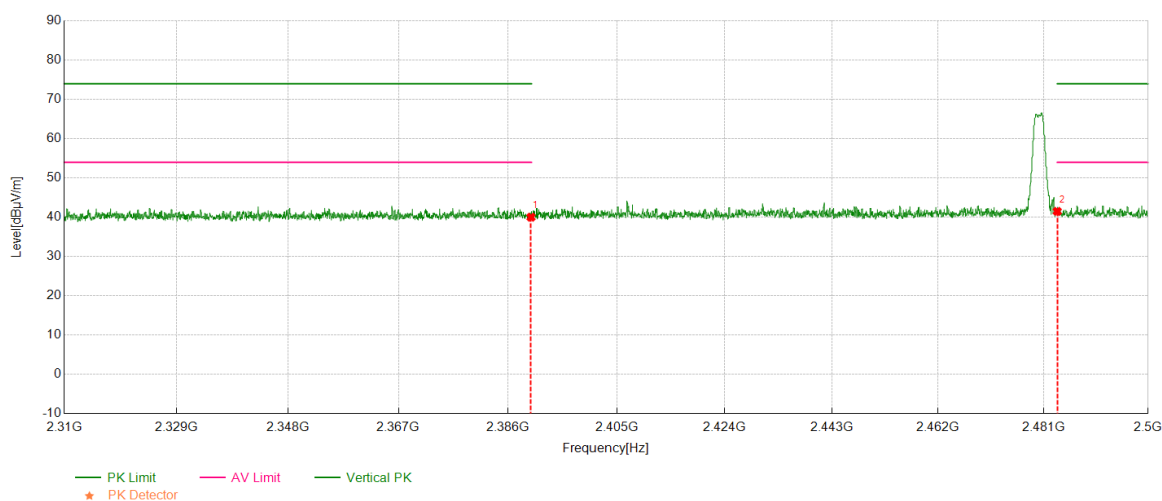

Suspected Data List

NO.	Frequency [MHz]	Reading [dBμV/m]	Level [dBμV/m]	Factor [dB]	Limit [dBμV/m]	Margin [dB]	Height [cm]	Angle [°]	Det	Polarity	Verdict
1	2390.0000	37.08	40.03	2.95	74.00	33.97	249	100	PK	Vertical	PASS
2	2483.5000	38.06	41.52	3.46	74.00	32.48	249	100	PK	Vertical	PASS

Note:(1)Level=Reading+Factor

(2)Margin=Limit-Level

--End of report--

Test Report No.: EFGX25120330-IE-01-E03

EUROFINS ELECTRICAL TESTING SERVICE (SHENZHEN) CO., LTD.
Room 20 of 2/F., 1/F., Building 2, Spring Block & Room 102, Building 8, Autumn Block Meishenghuigu Innovation Park, No.83,
Dabao Road, Bao'an District Shenzhen, Guangdong, People's Republic of China