




28.35 – 40 GHz Result

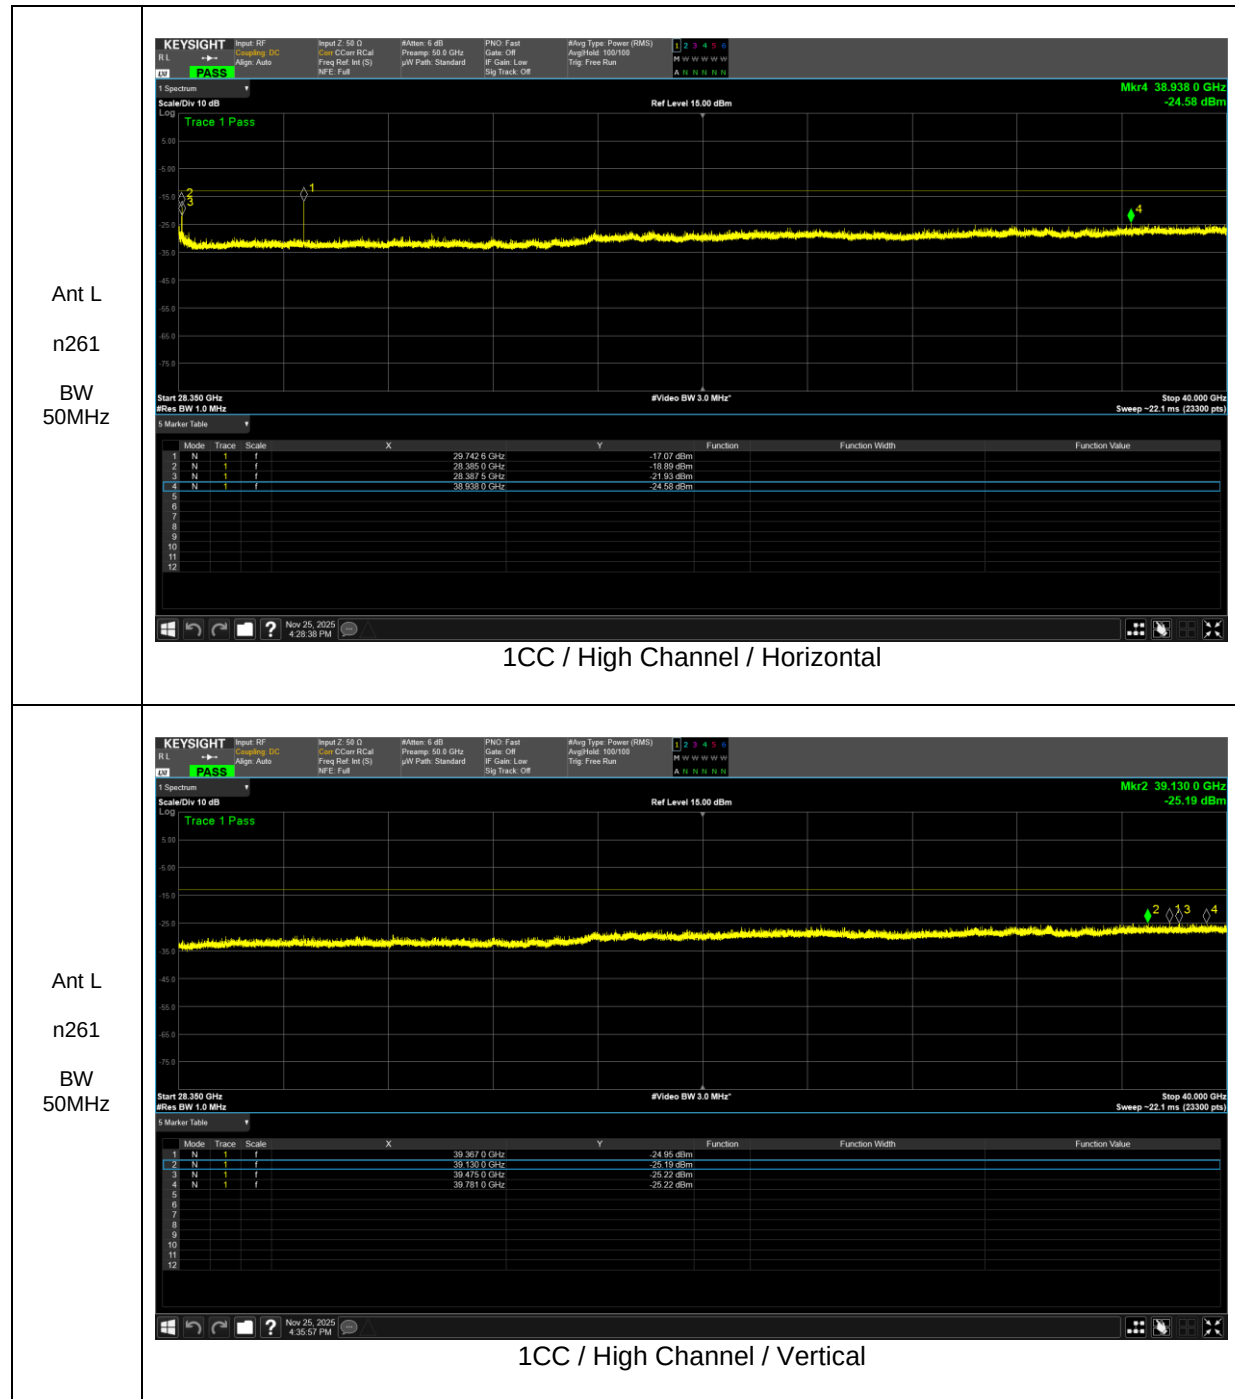


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

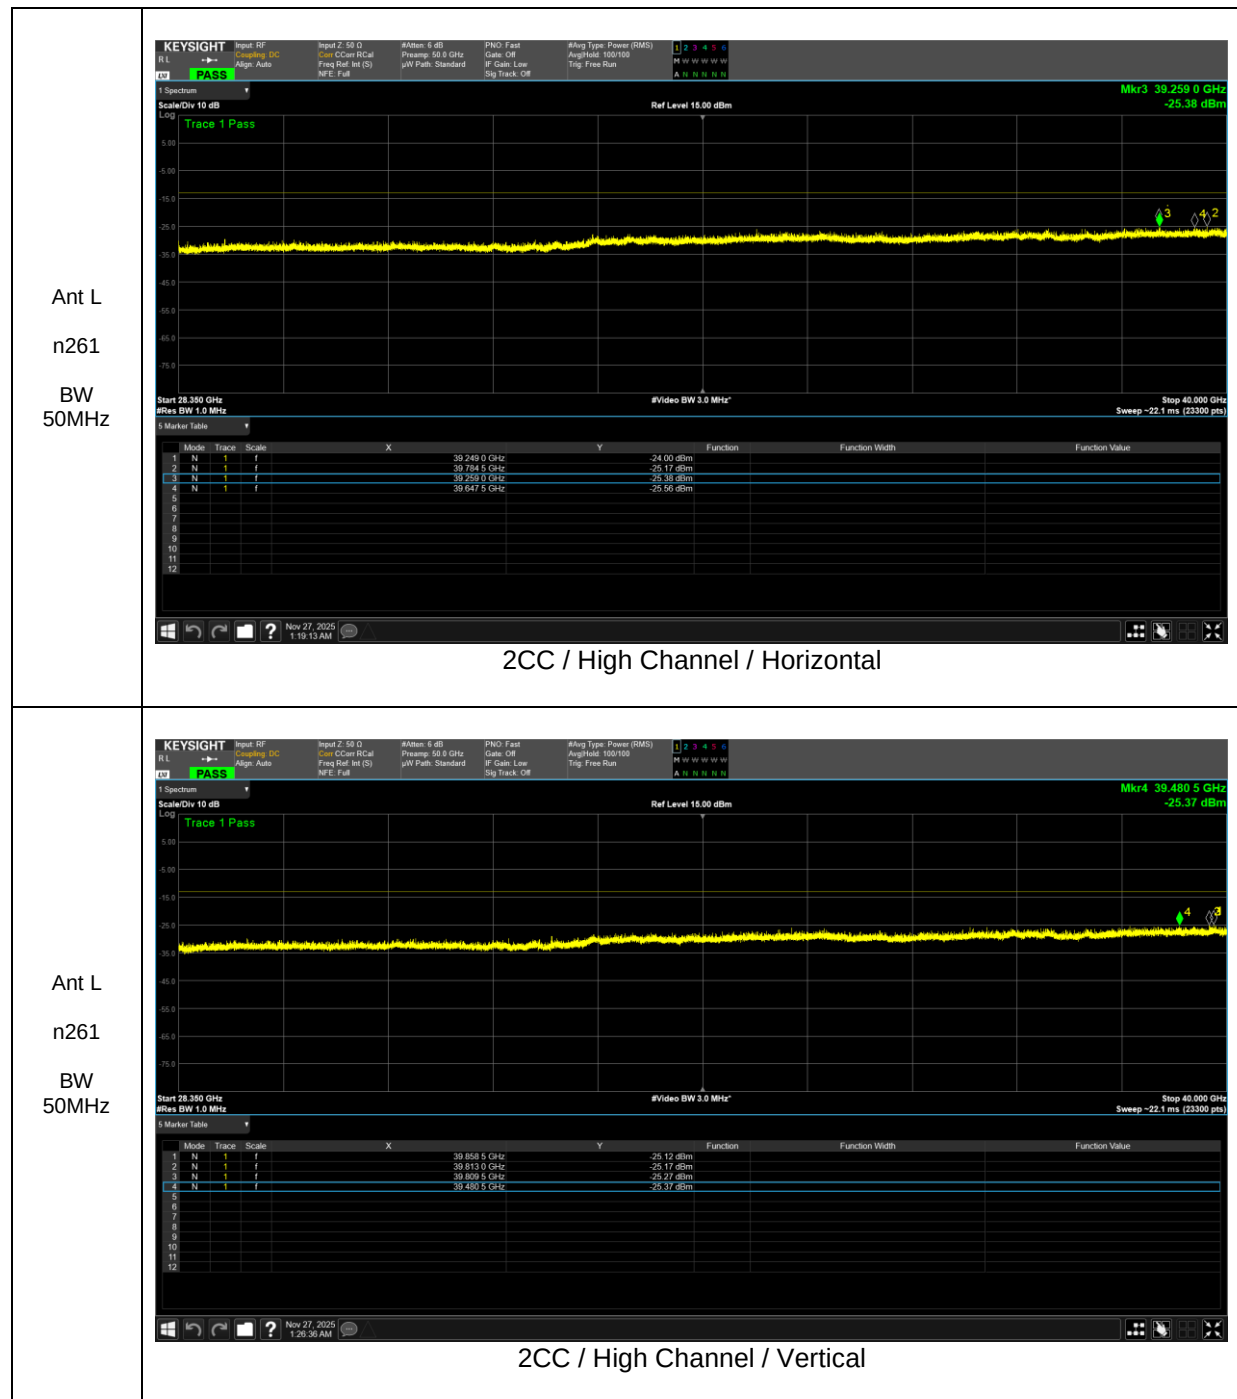


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

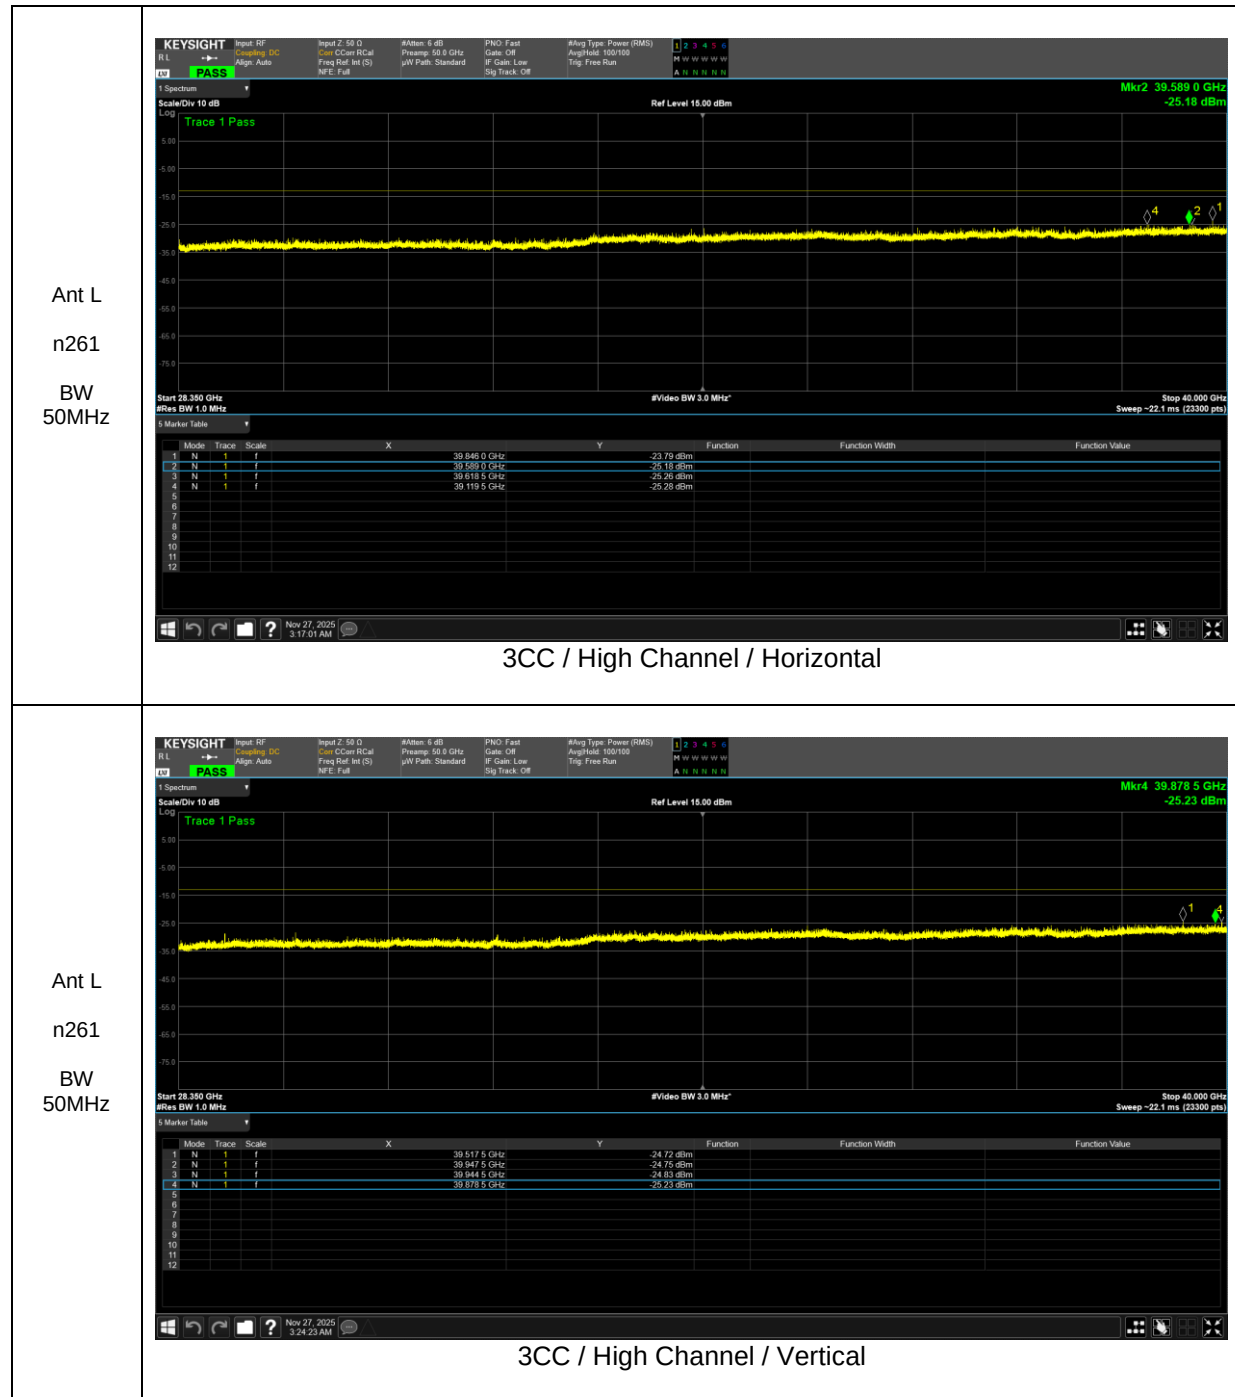

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

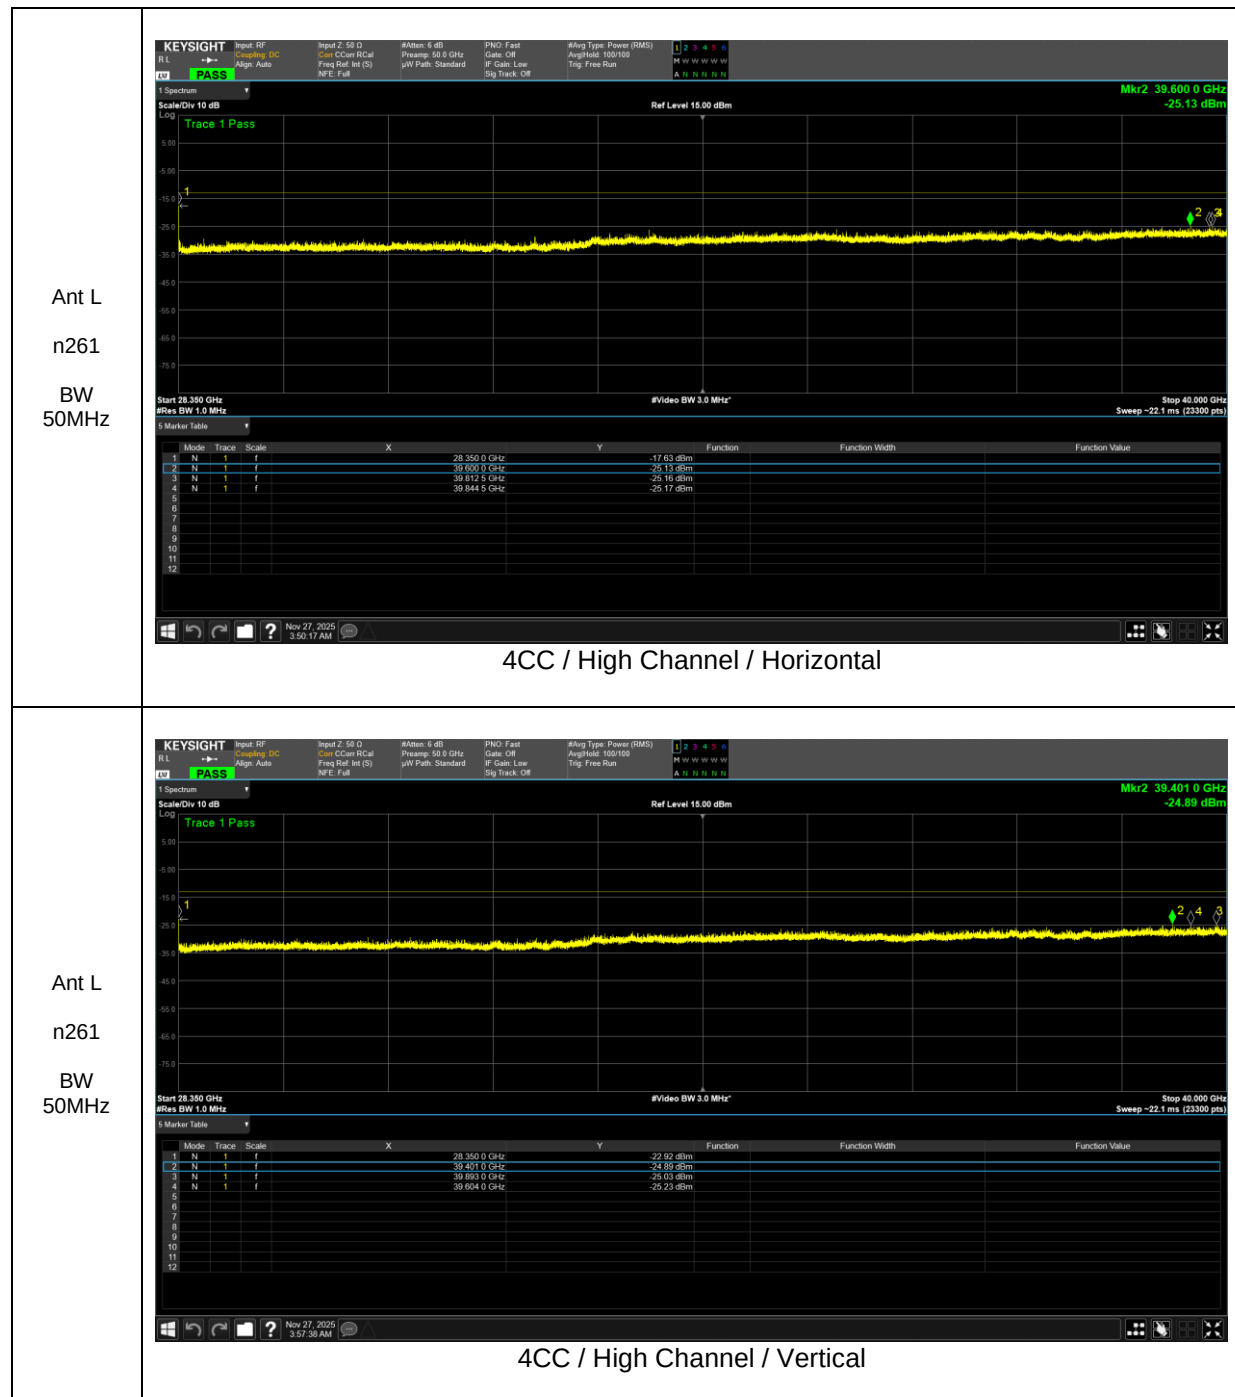


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

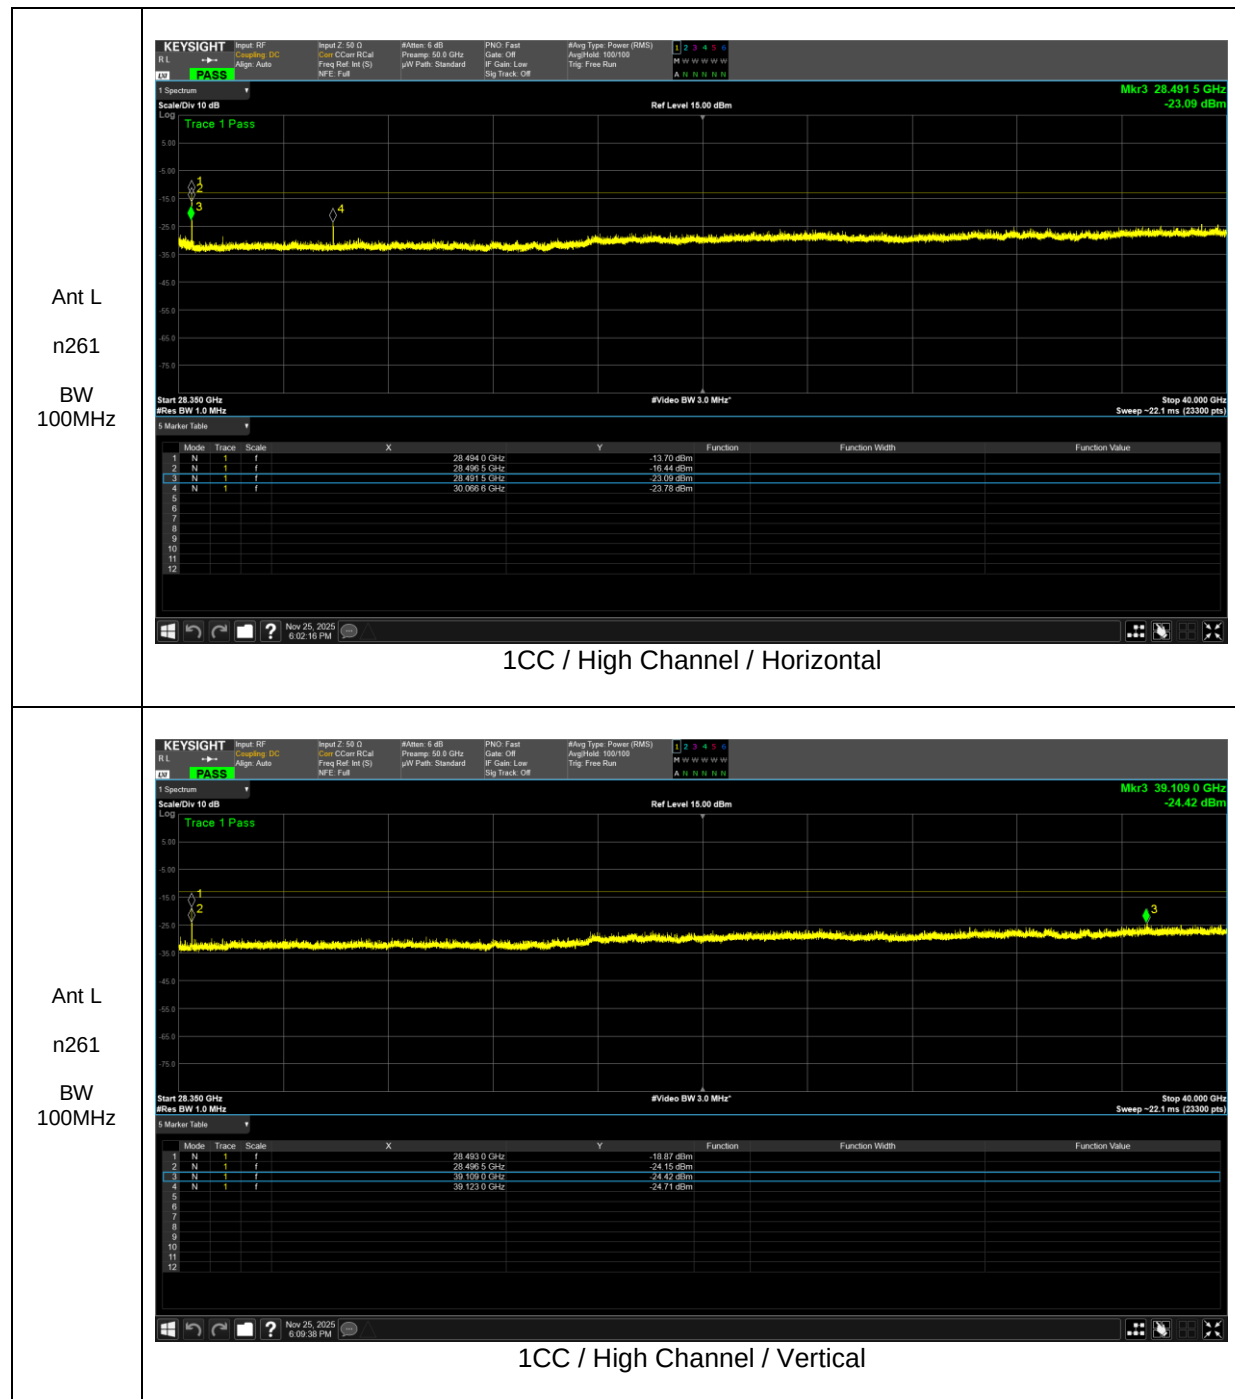


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

Final Measurement Data Table


Frequency [GHz]	Bandwidth [MHz]	EUT Beam	Modulation	Ant pol [H/V]	X-Axis [degree]	Y-Axis [degree]	EIRP [dBm]	Limit [dBm]	Margin [dB]
28.495	100	SISO-Dual	QPSK	H	34.9	84.3	-21.93	-13	8.93

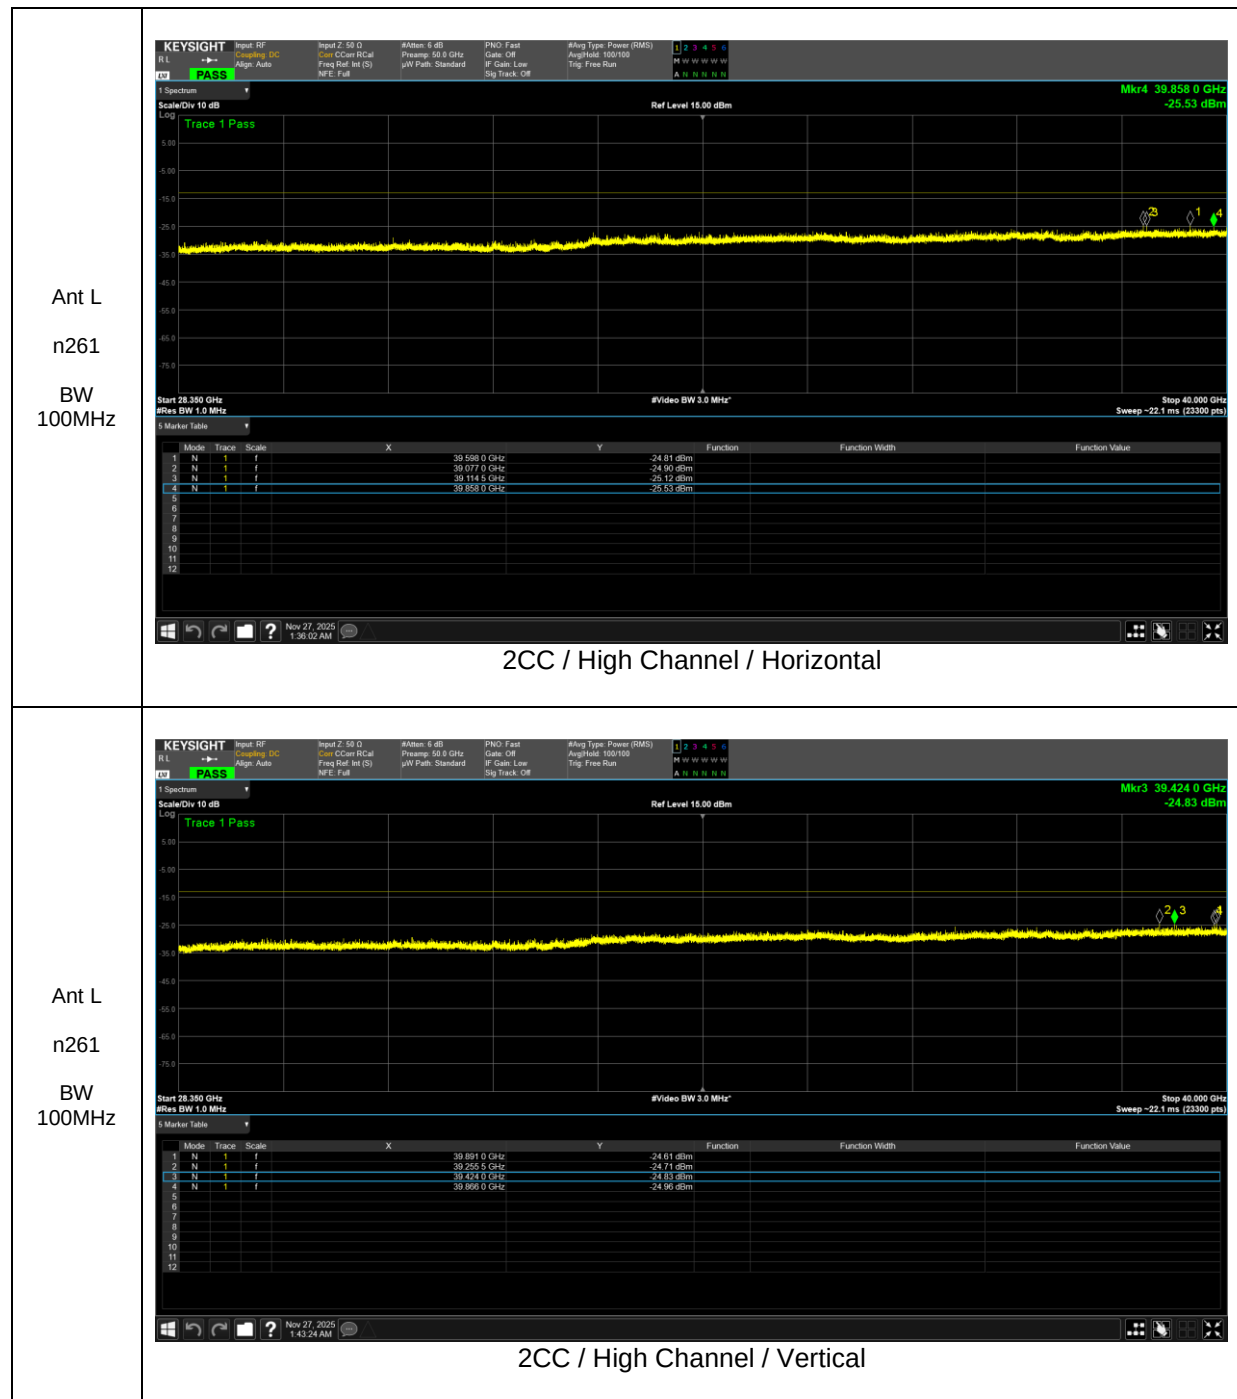

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

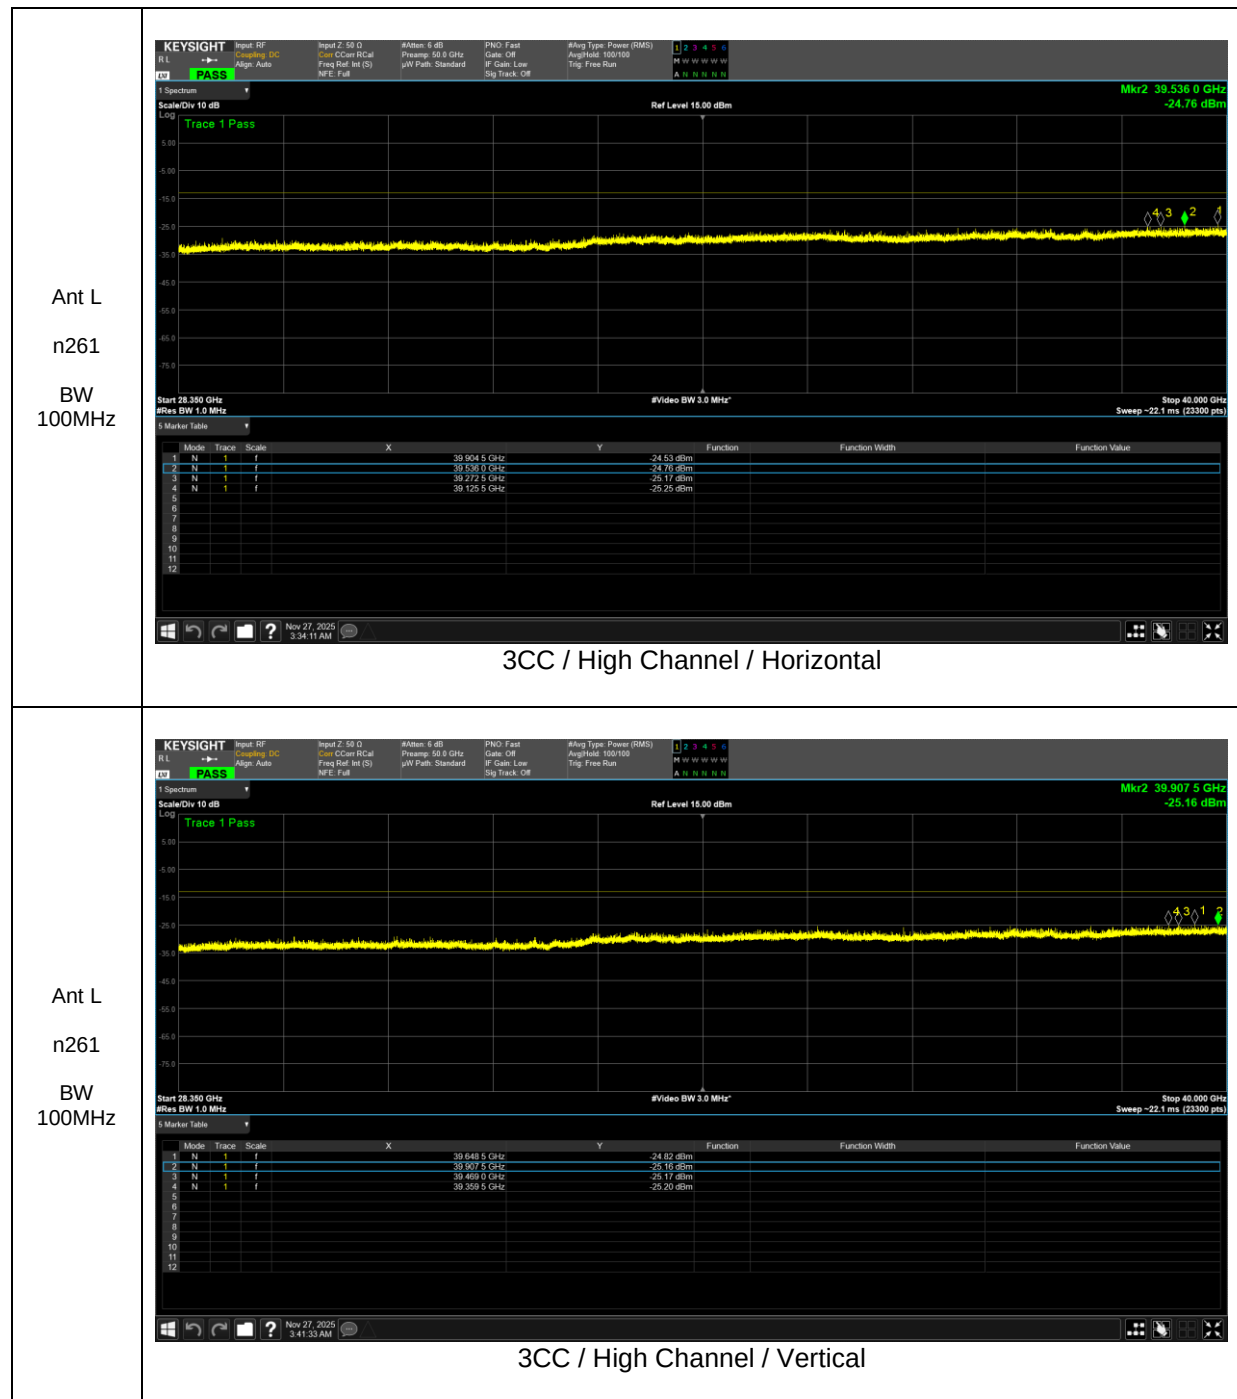


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

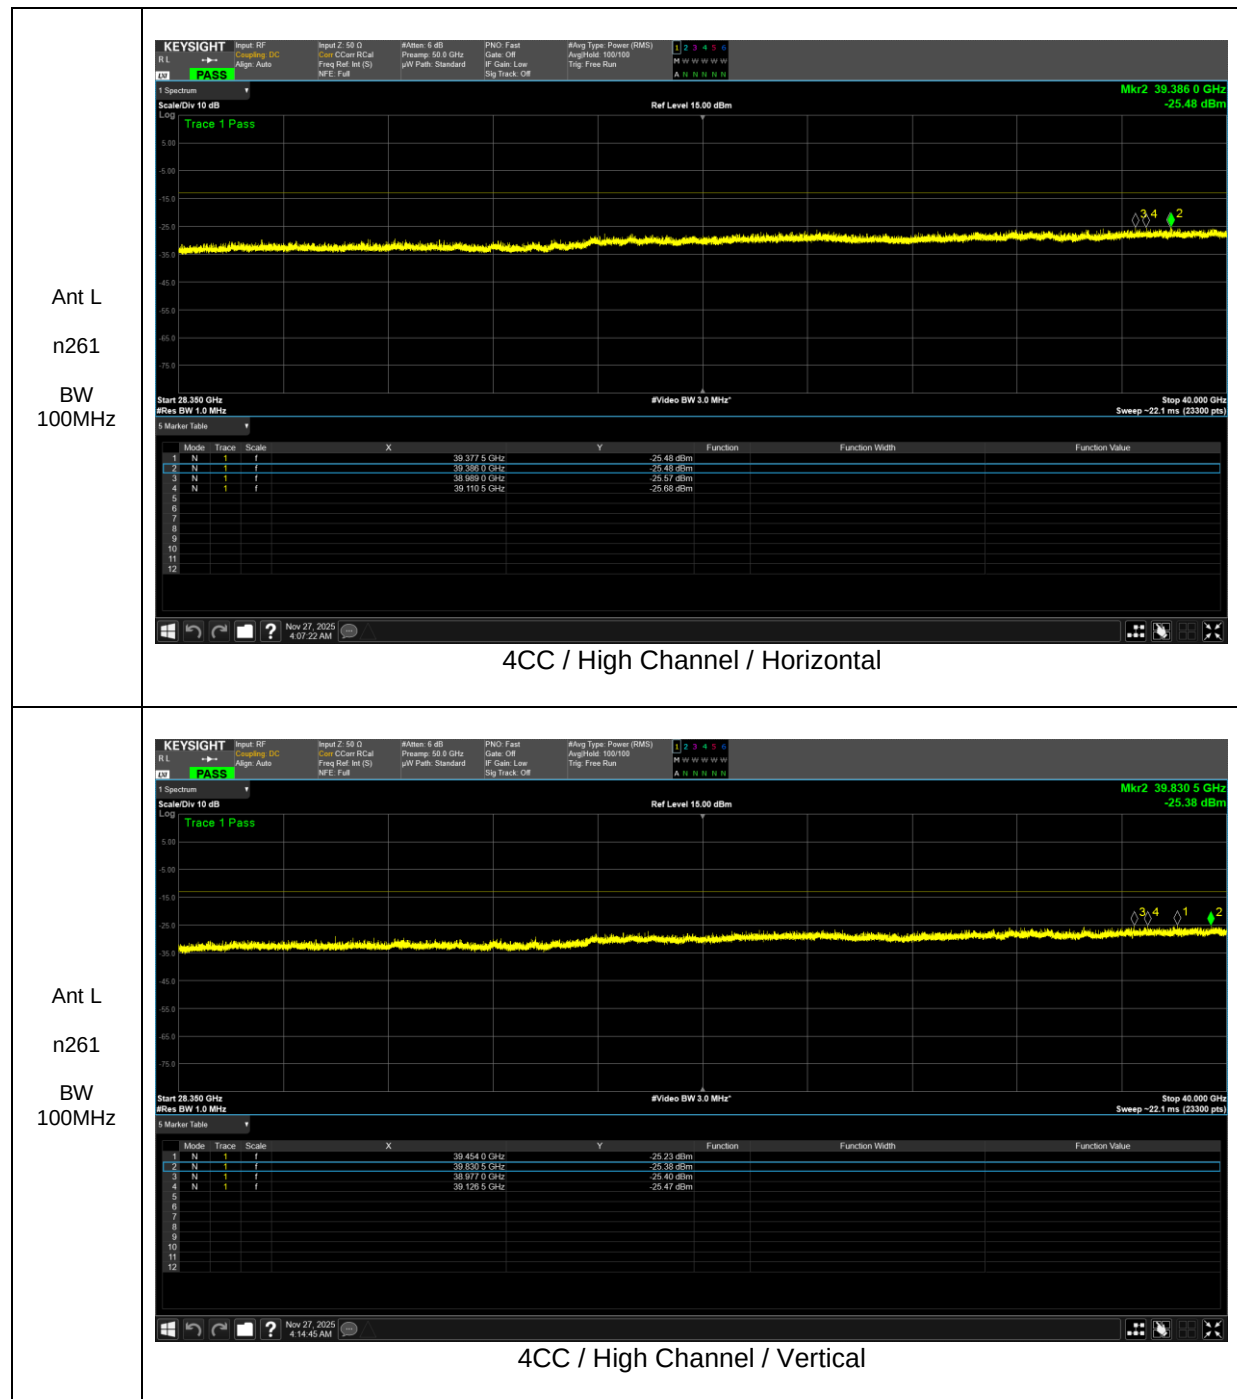


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

40 – 50 GHz Result

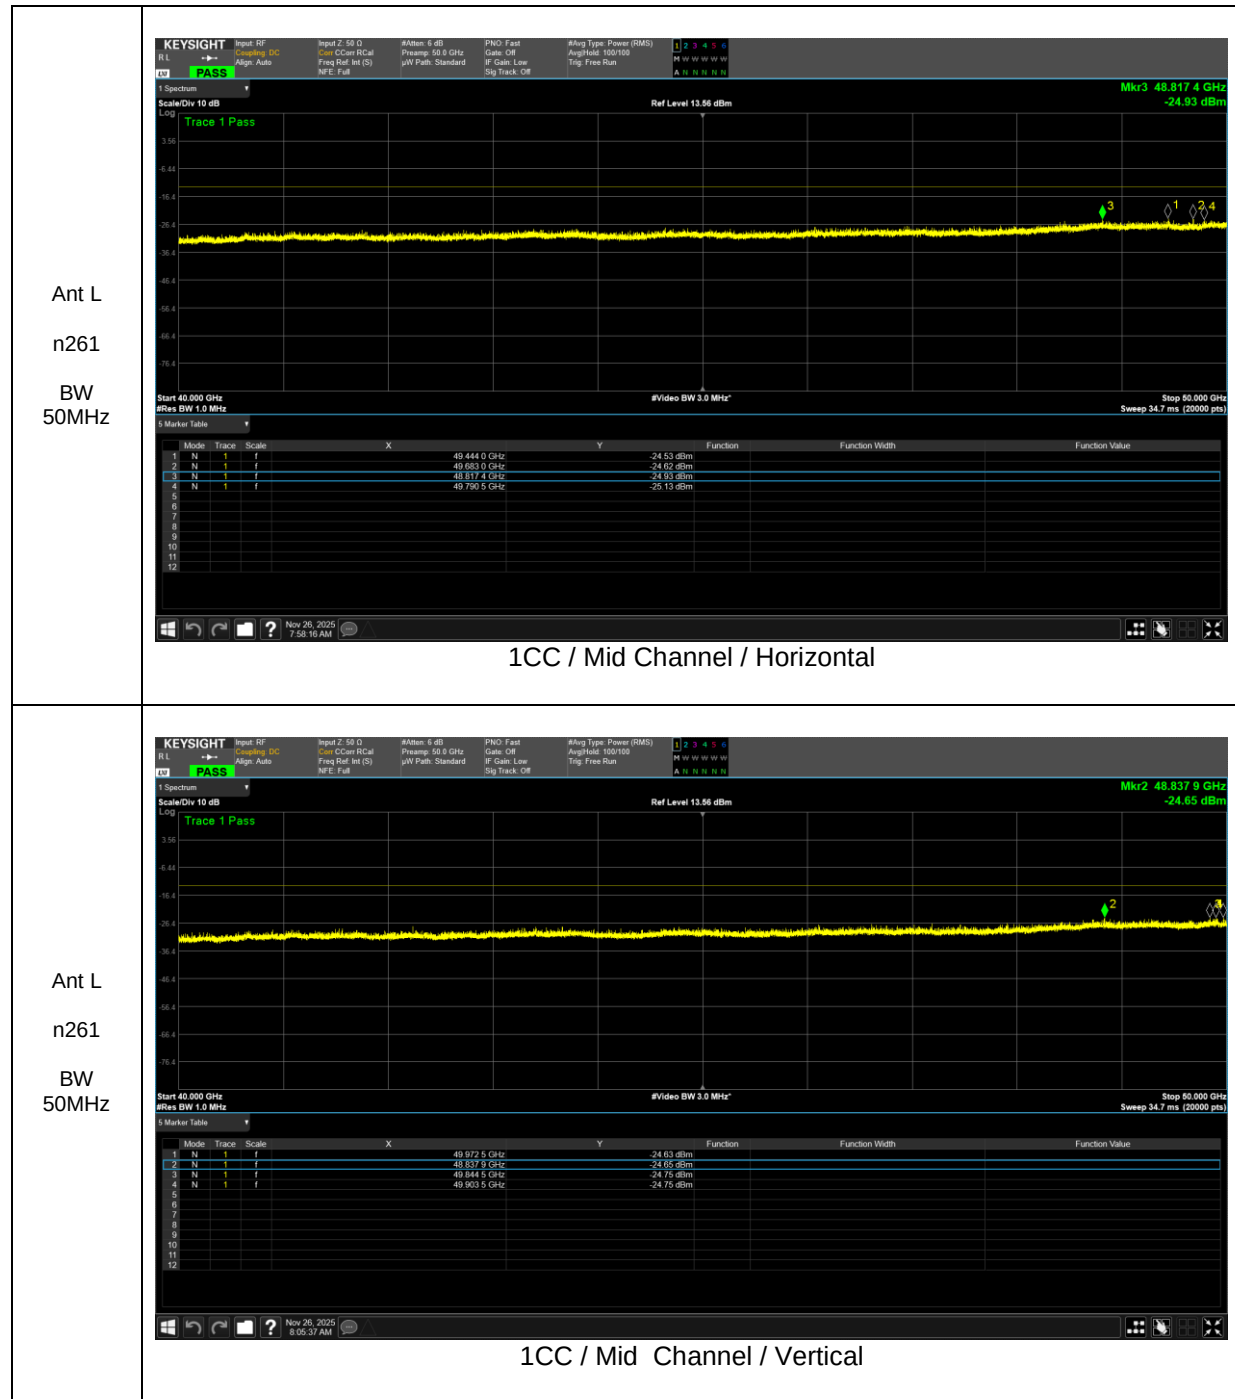


All channels were investigated, but no emission above the noise floor was detected.

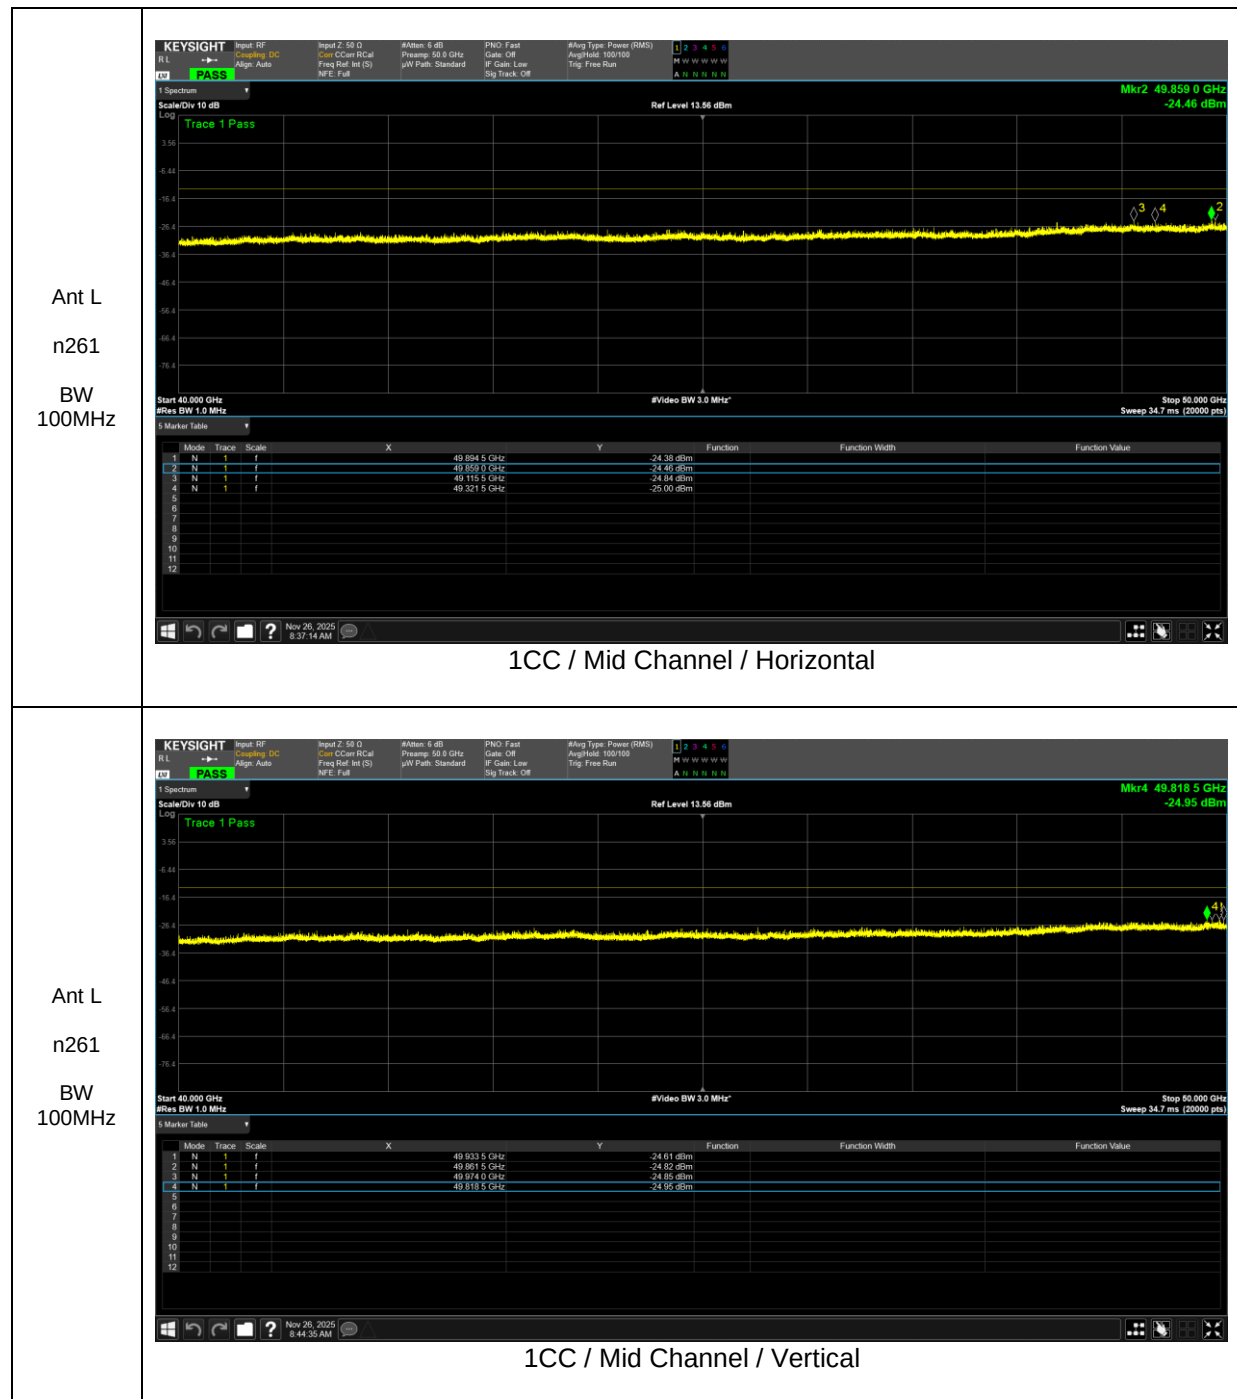


All channels were investigated, but no emission above the noise floor was detected.

50 – 75 GHz Result

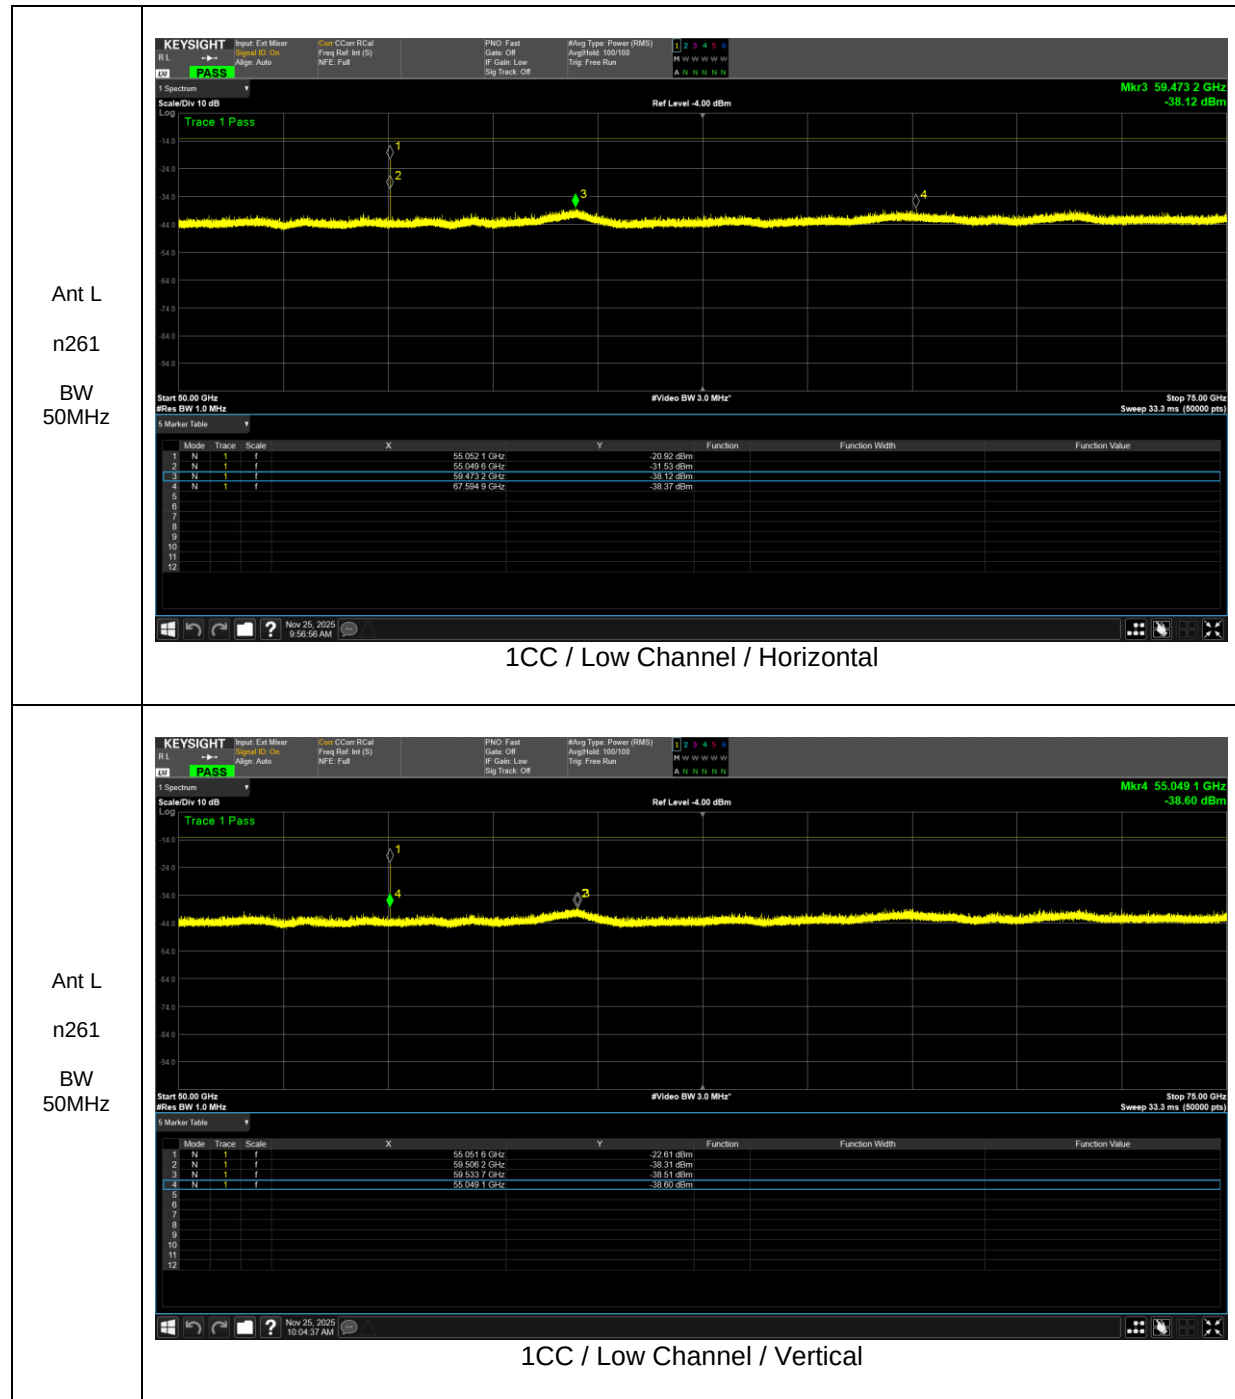


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

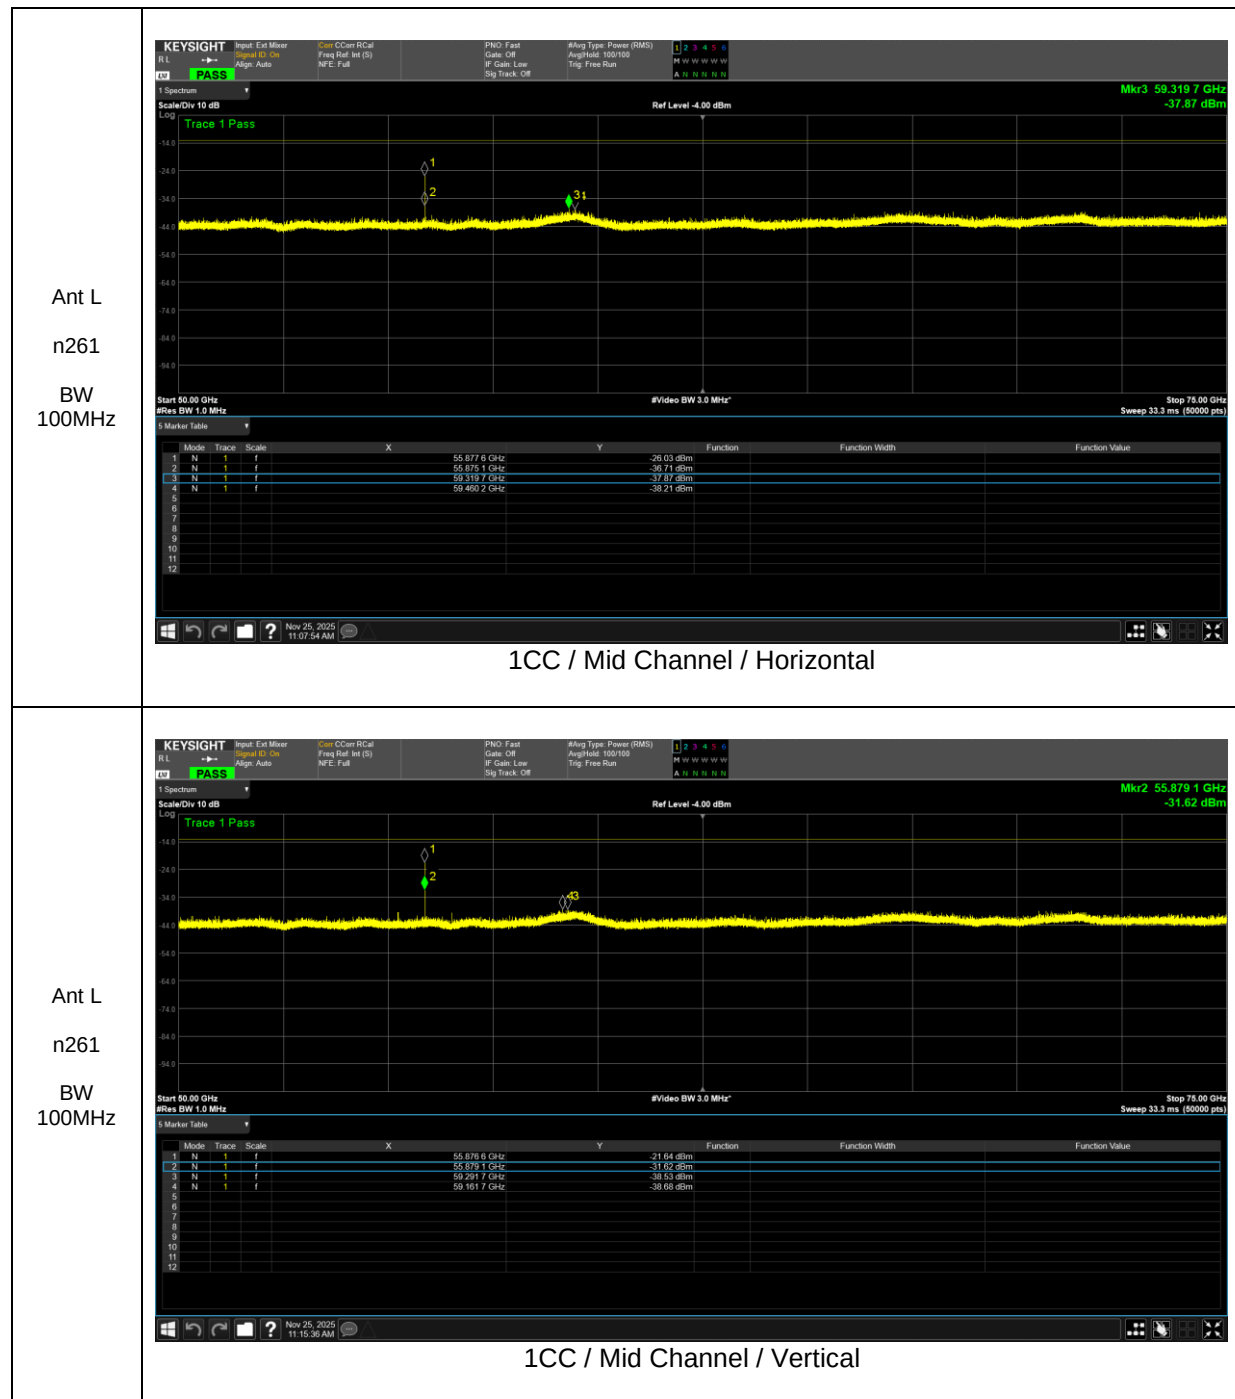


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

75 – 100 GHz Result

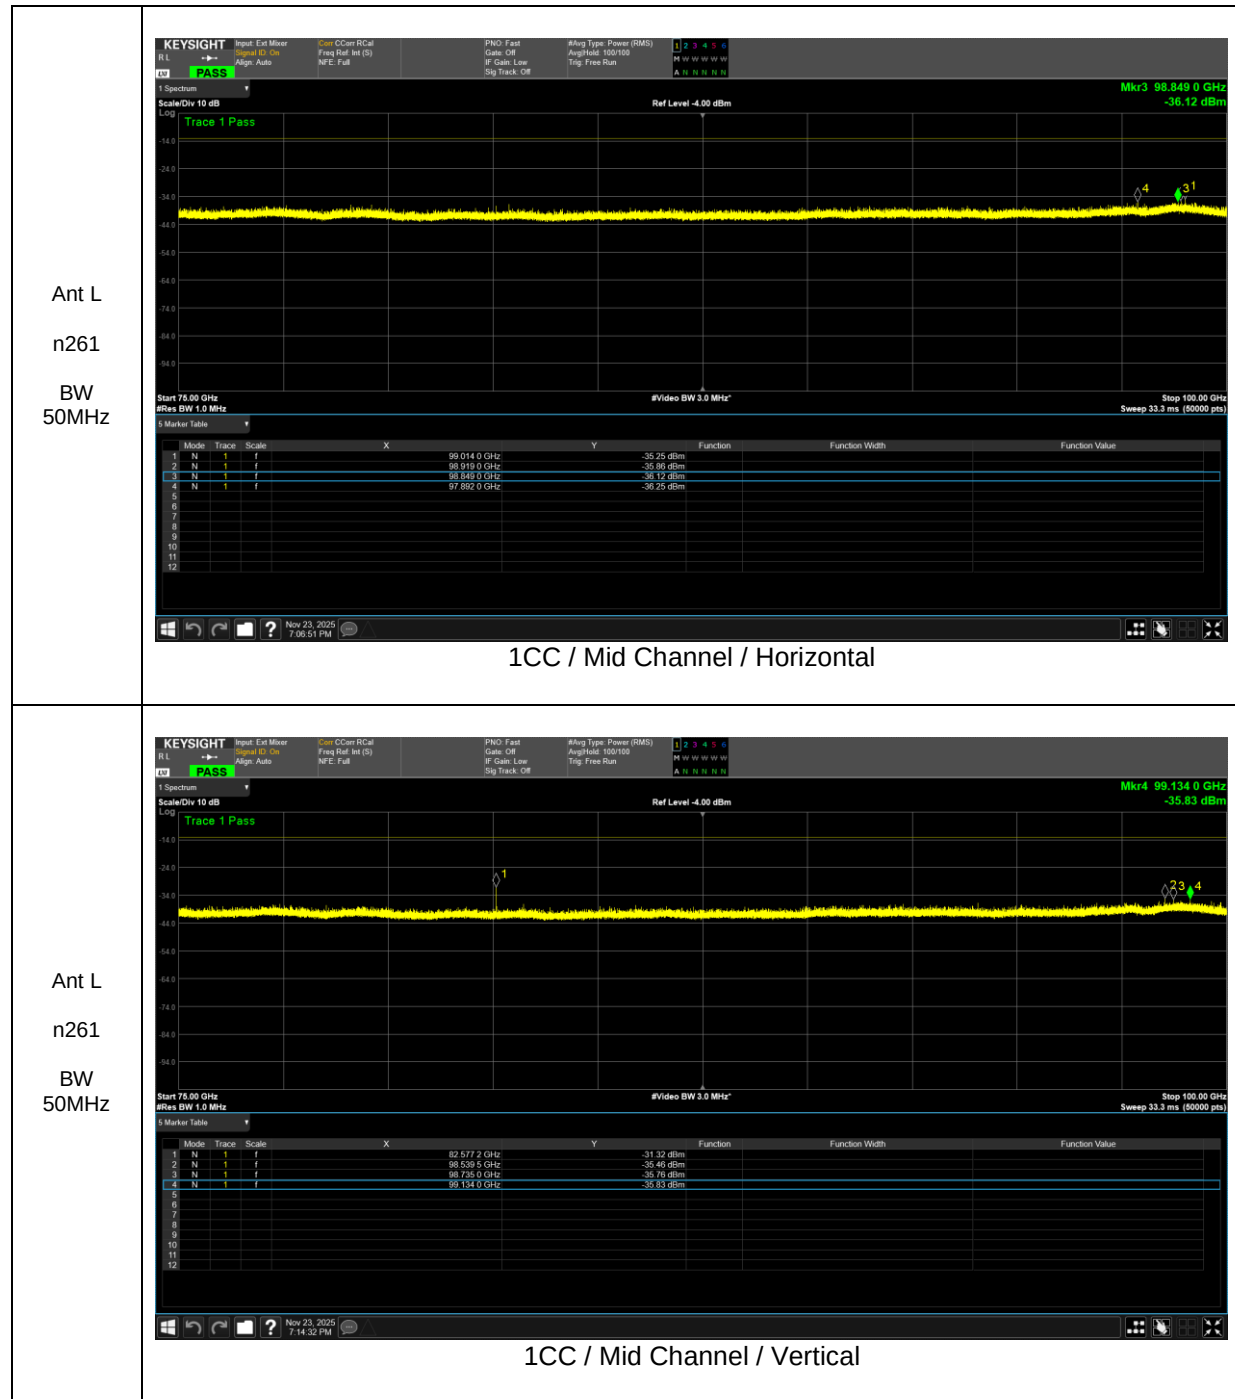


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

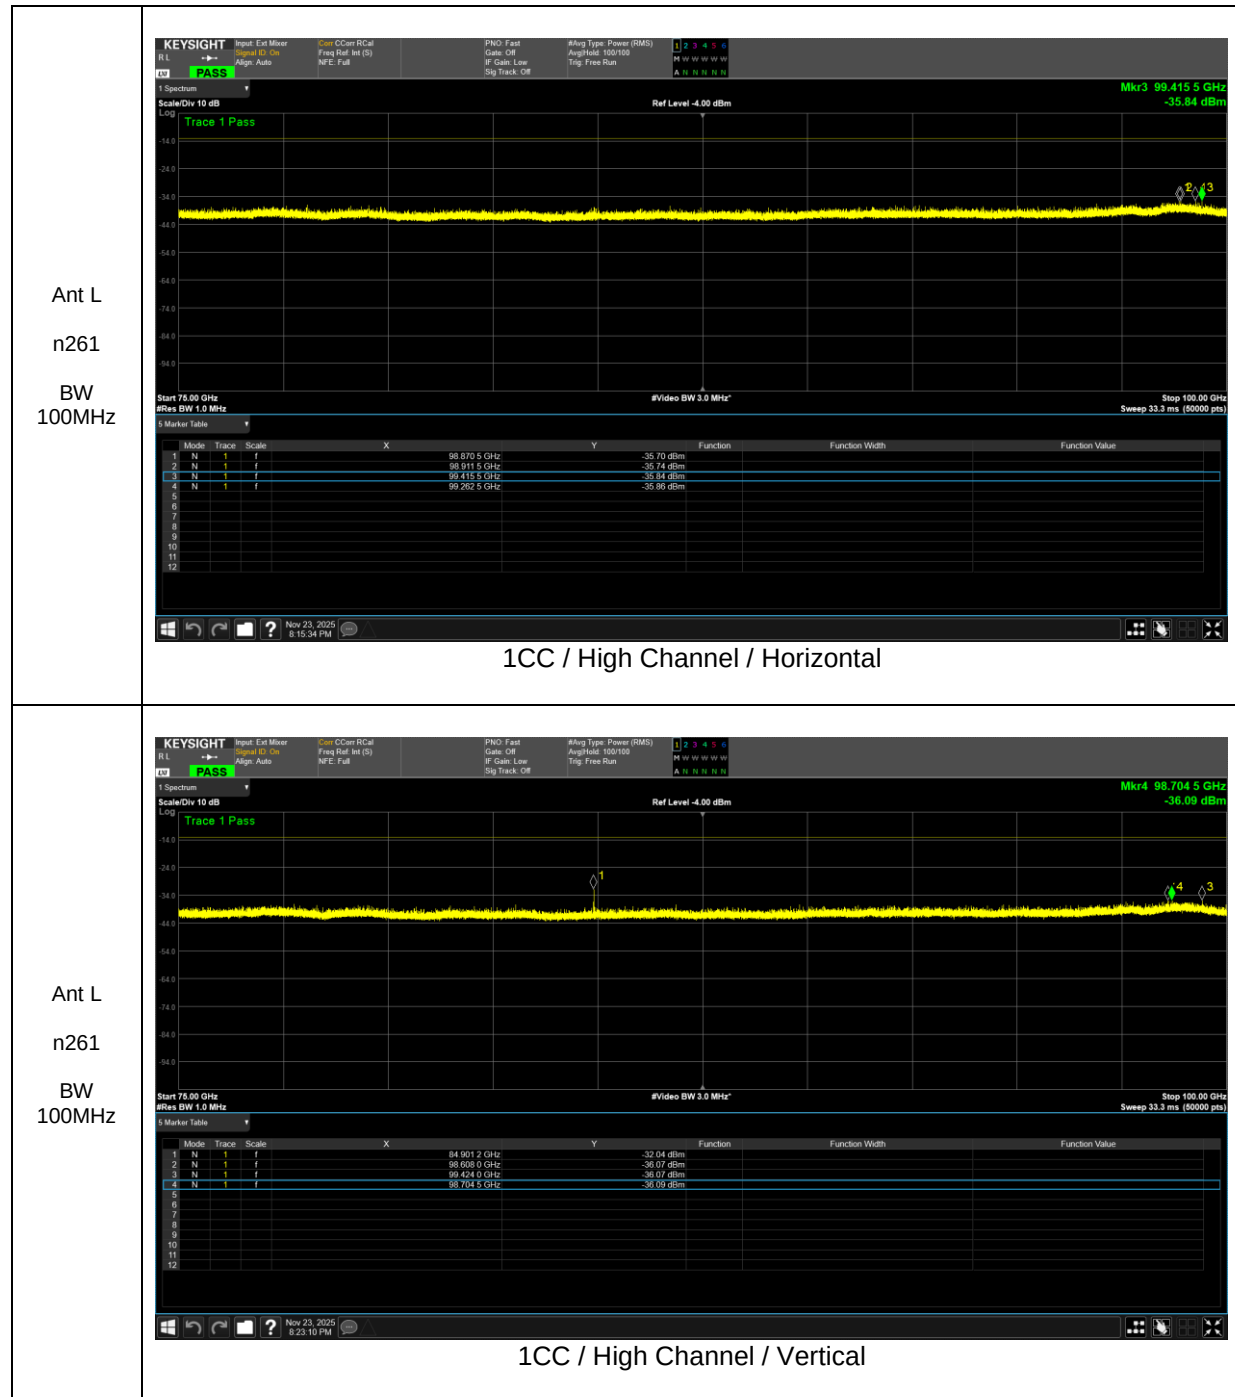

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

Antenna 1 / Ant L / n260

30 – 1000 MHz Result

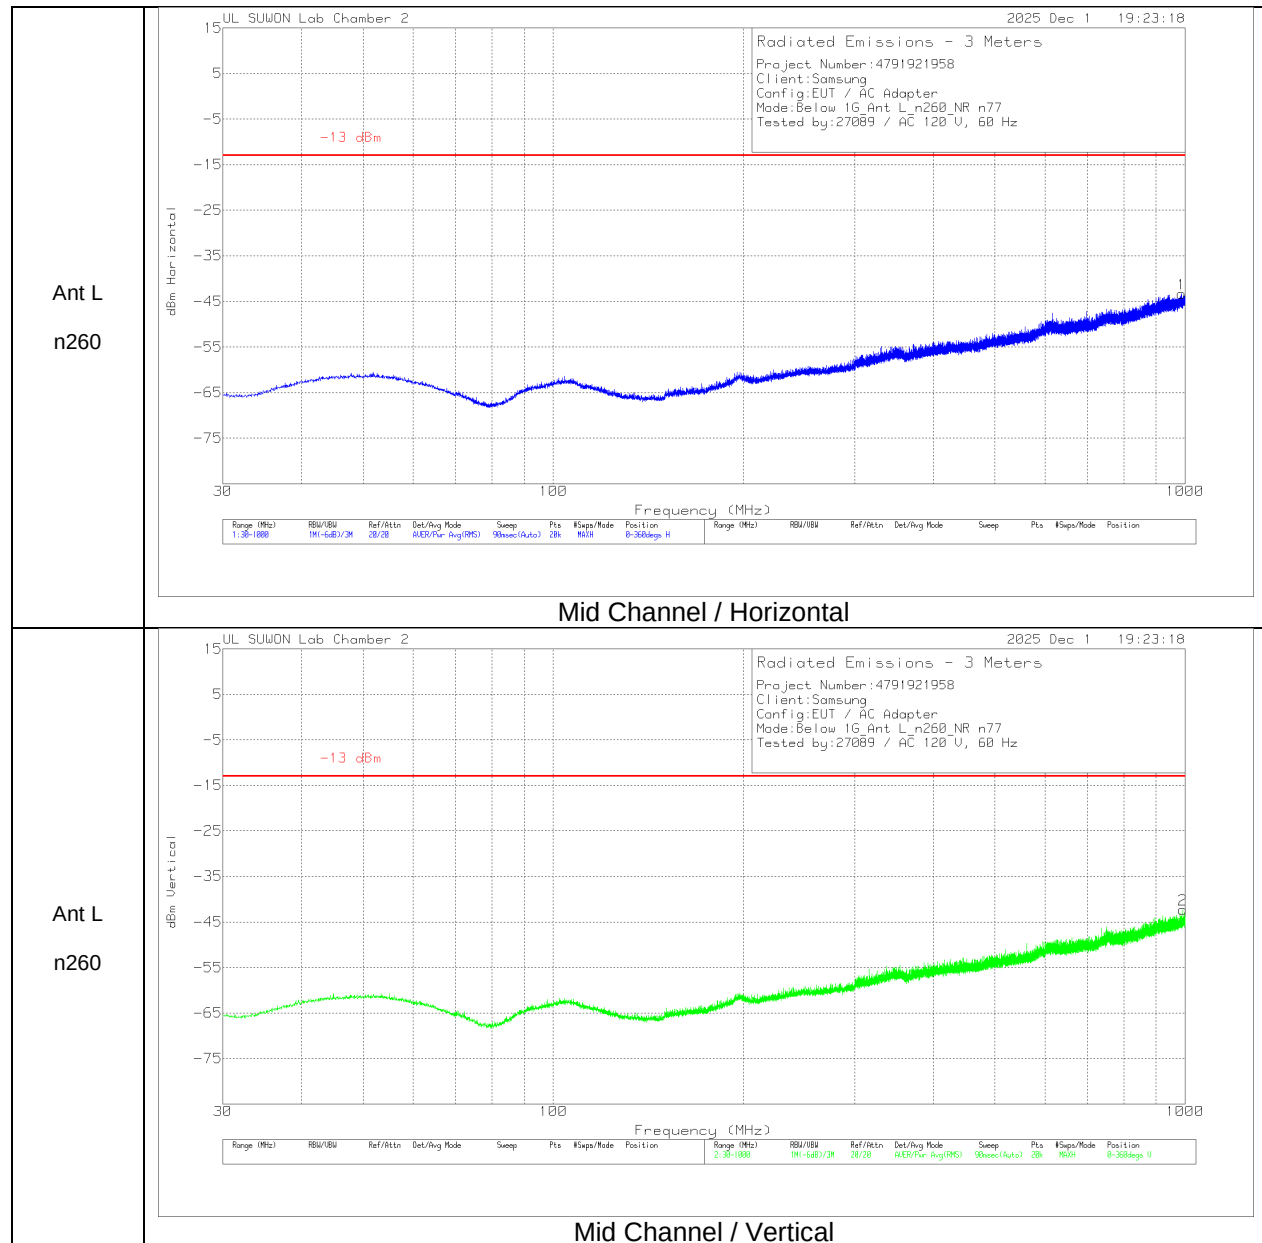


Trace Markers

Marker	Frequency (MHz)	Meter Reading (dBm)	Det	Antenna Factor (dB/m)	Below 1G_Path Loss(dB)	Conversion Factor(dB)	Corrected Reading dBm	Limit(dBm/MHz)	Margin (dB)	Azimuth (Degs)	Height (cm)	Polarity
1	987.787	-56.15	RMS	28.1	-27.1	11.8	-43.35	-13	-30.35	0-360	100	H
2	991.6183	-55.28	RMS	28.2	-27	11.8	-42.28	-13	-29.28	0-360	100	V

RMS - RMS detection

No emissions were detected above noise floor this antenna and band.

1 – 18 GHz Result

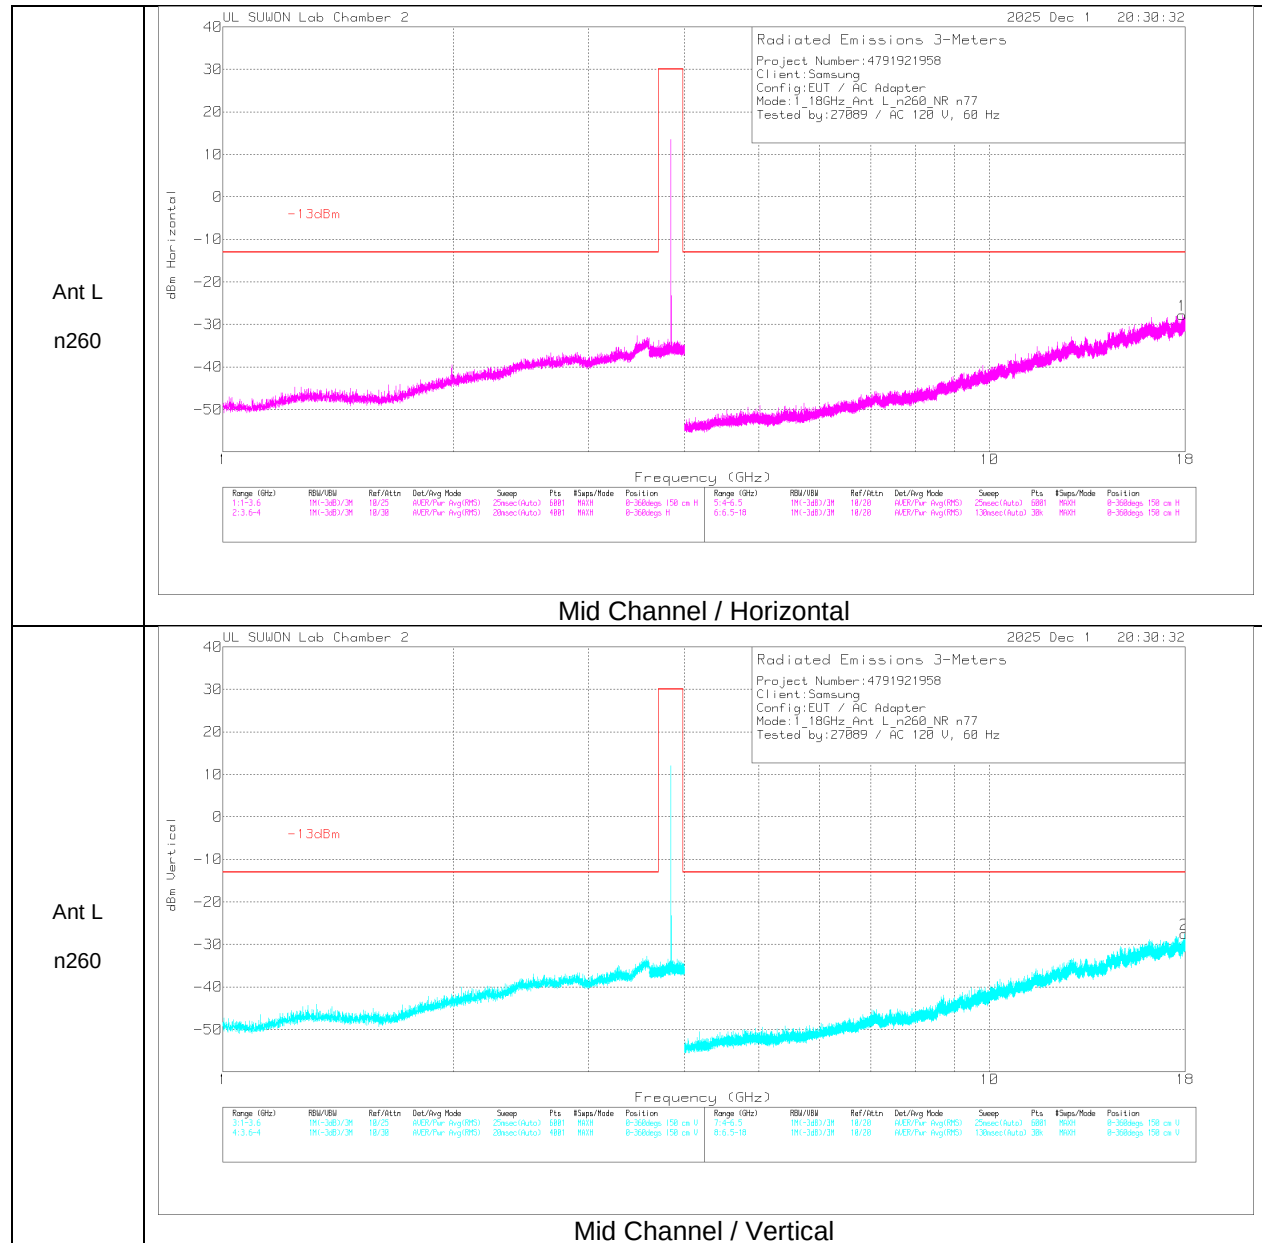


Trace Markers

Marker	Frequency (GHz)	Meter Reading (dBm)	Det	Antenna_Factor (dB/m)	6GHz_HP_Path Loss(dB)	Conversion Factor[dB]	Corrected Reading dBm	-13dBm	Margin (dB)	Azimuth (Degs)	Height (cm)	Polarity
1	17.82982	-61.7	RMS	41.6	-19.5	11.8	-27.8	-13	-14.8	0-360	150	H
2	17.95248	-61.82	RMS	41.6	-19.1	11.8	-27.52	-13	-14.52	0-360	150	V


RMS - RMS detection

No emissions were detected above the noise floor which was at least 20dB below the specification limit.


18 – 37 GHz Result

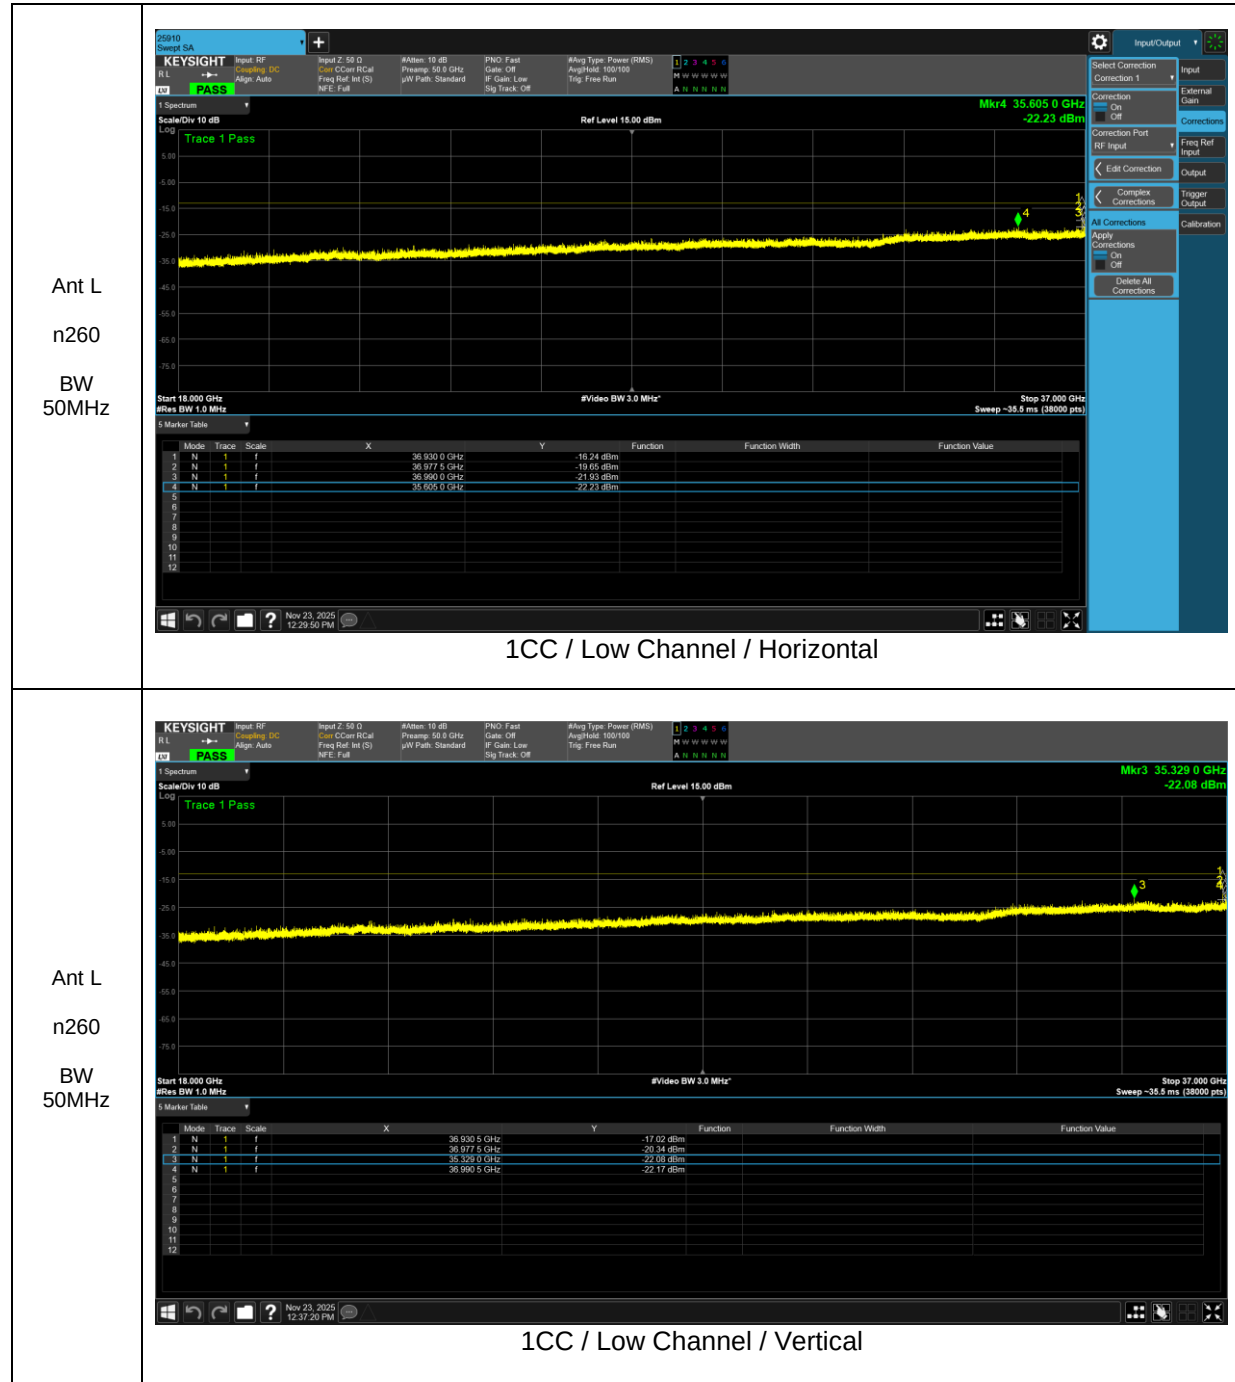


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

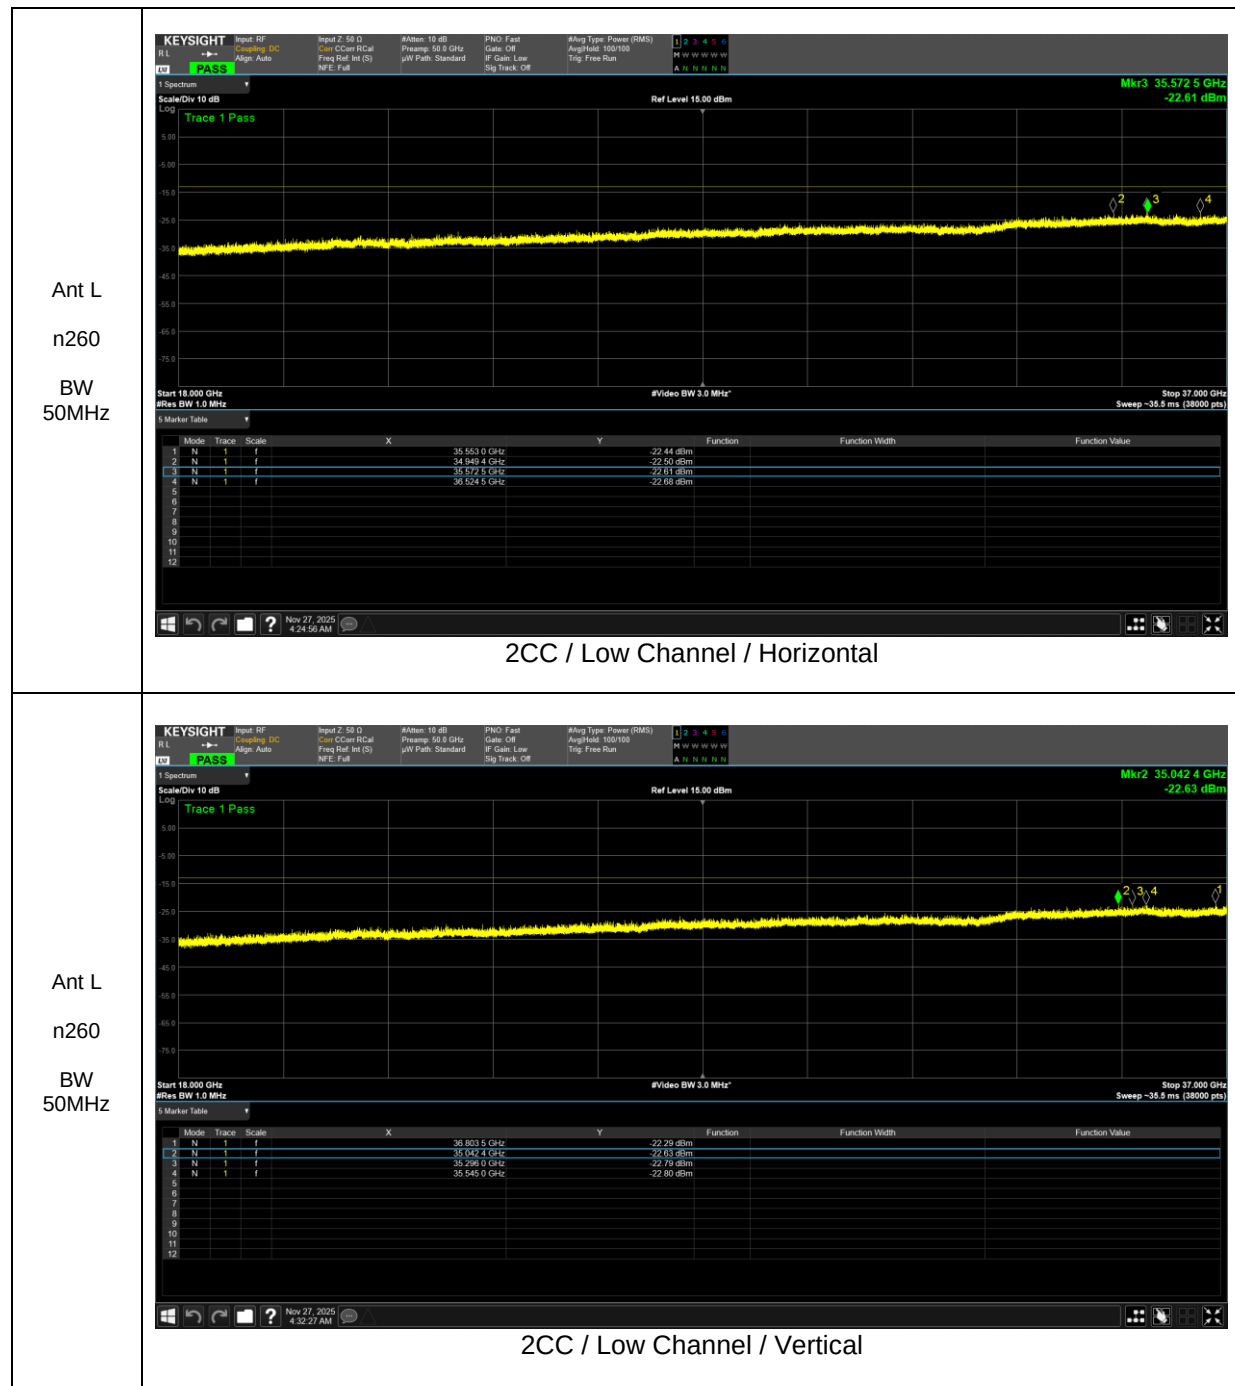


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

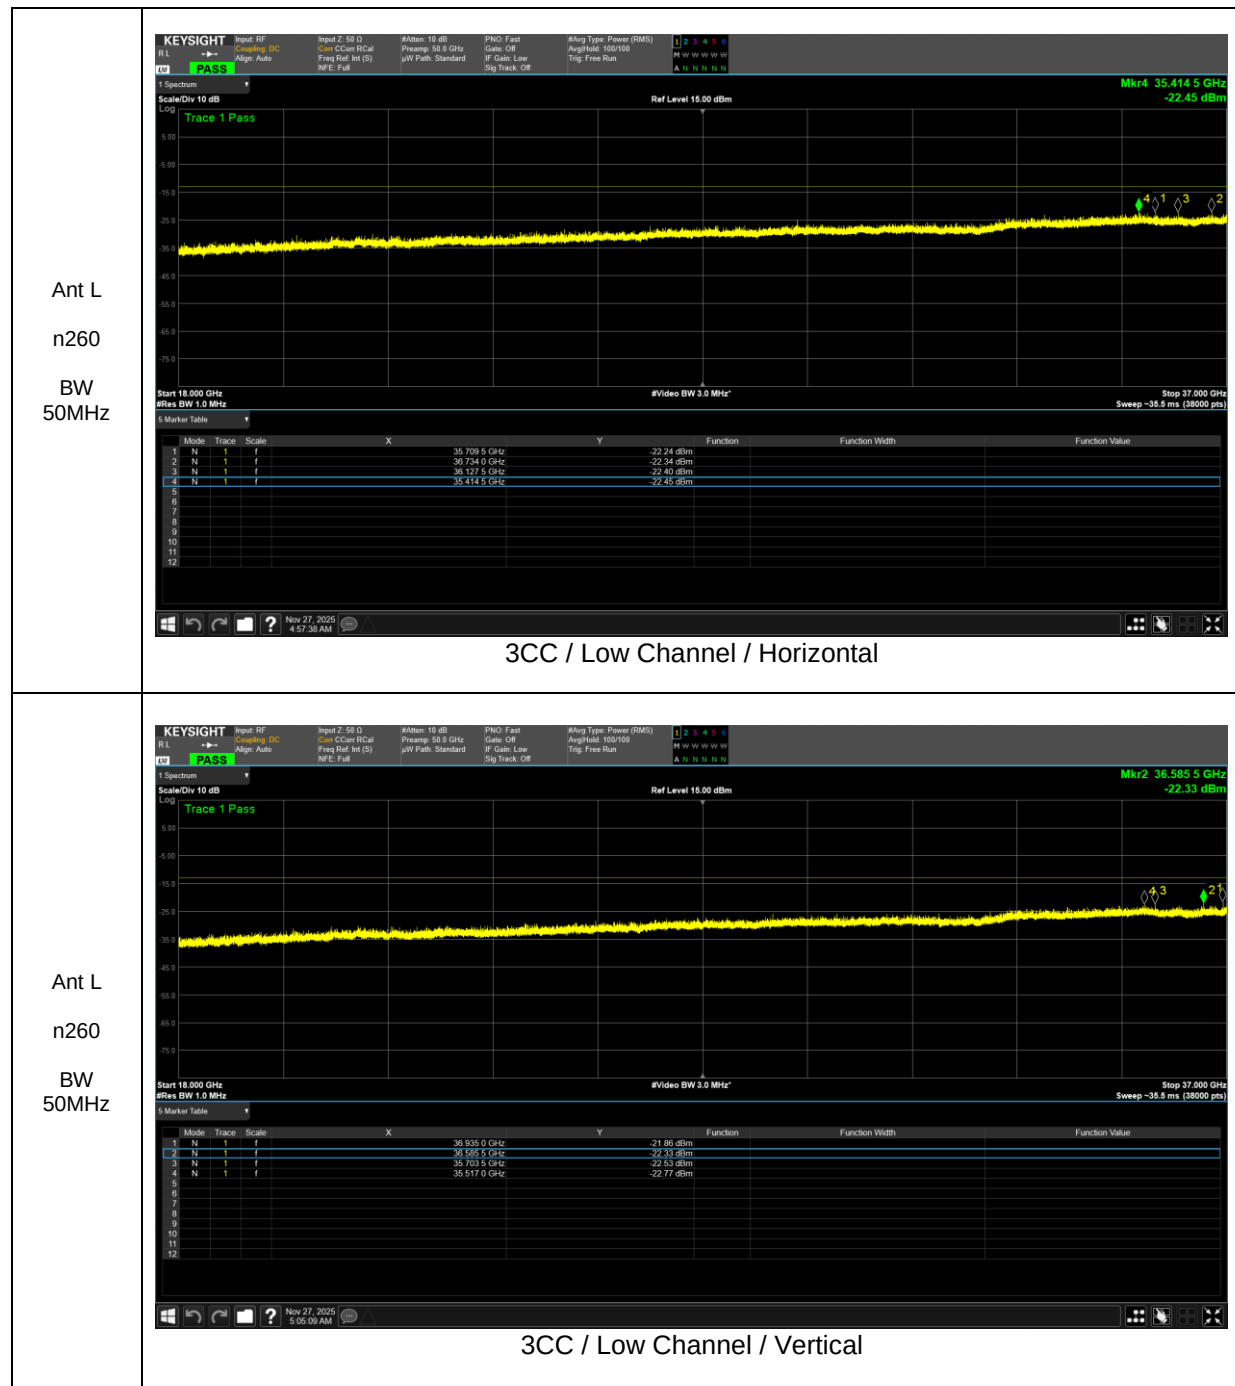

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

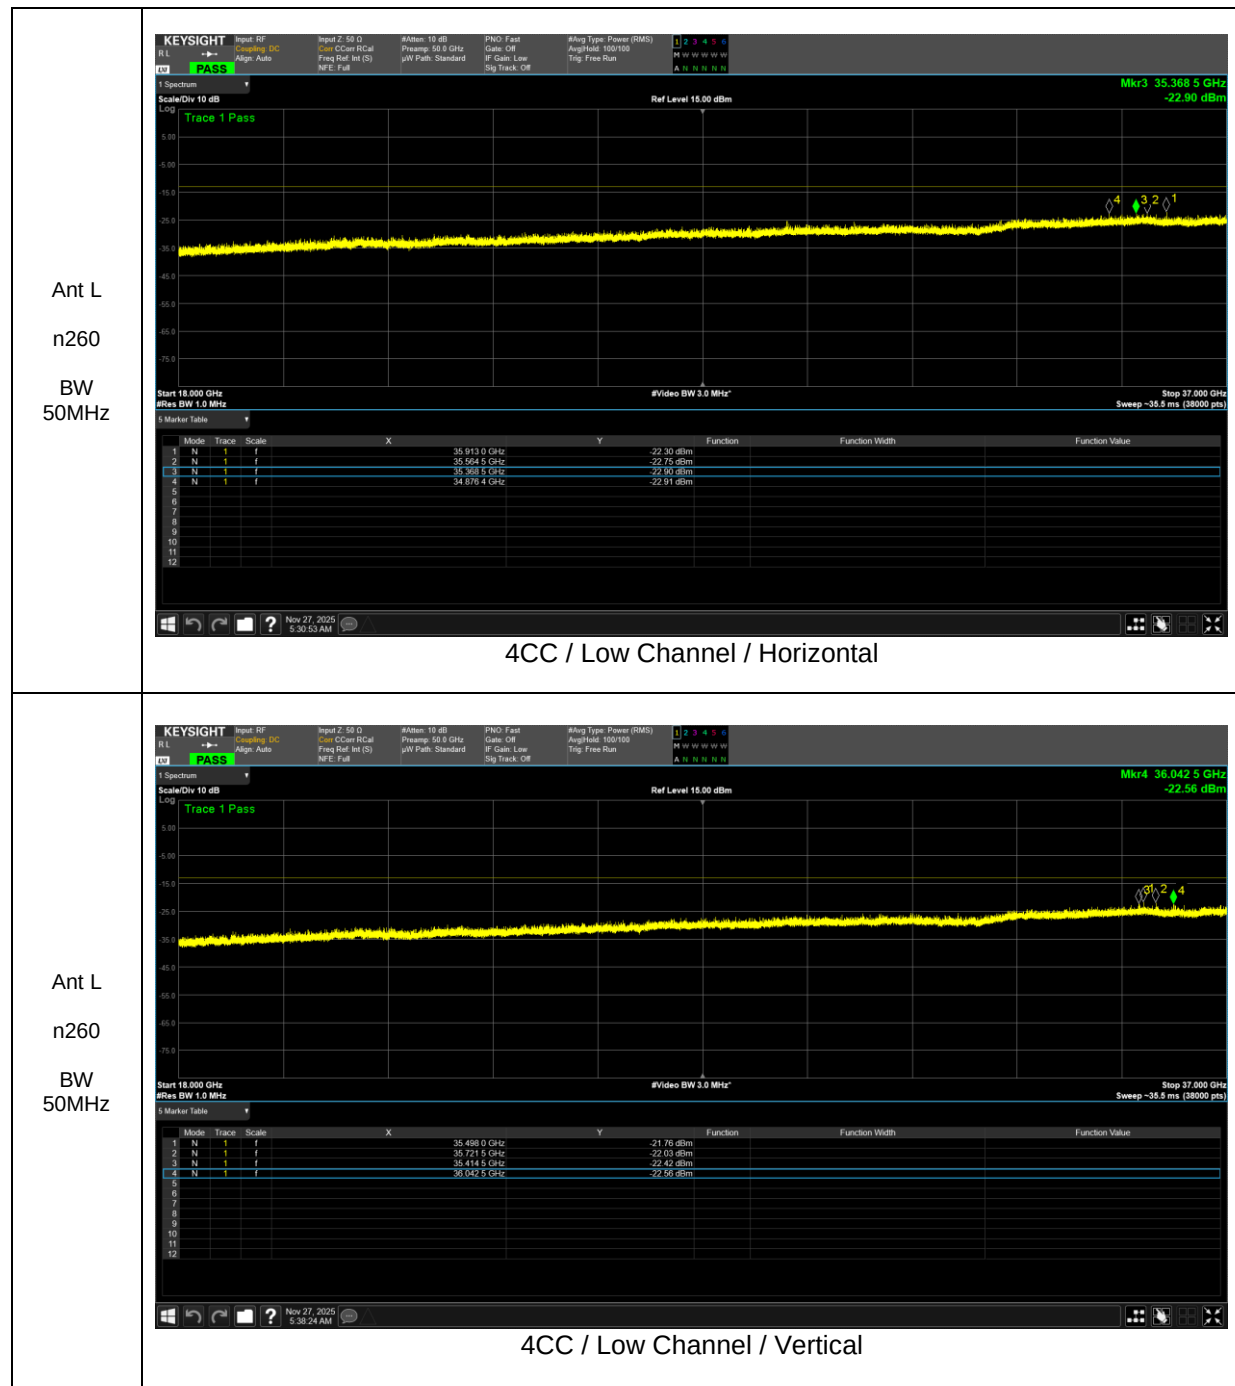


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

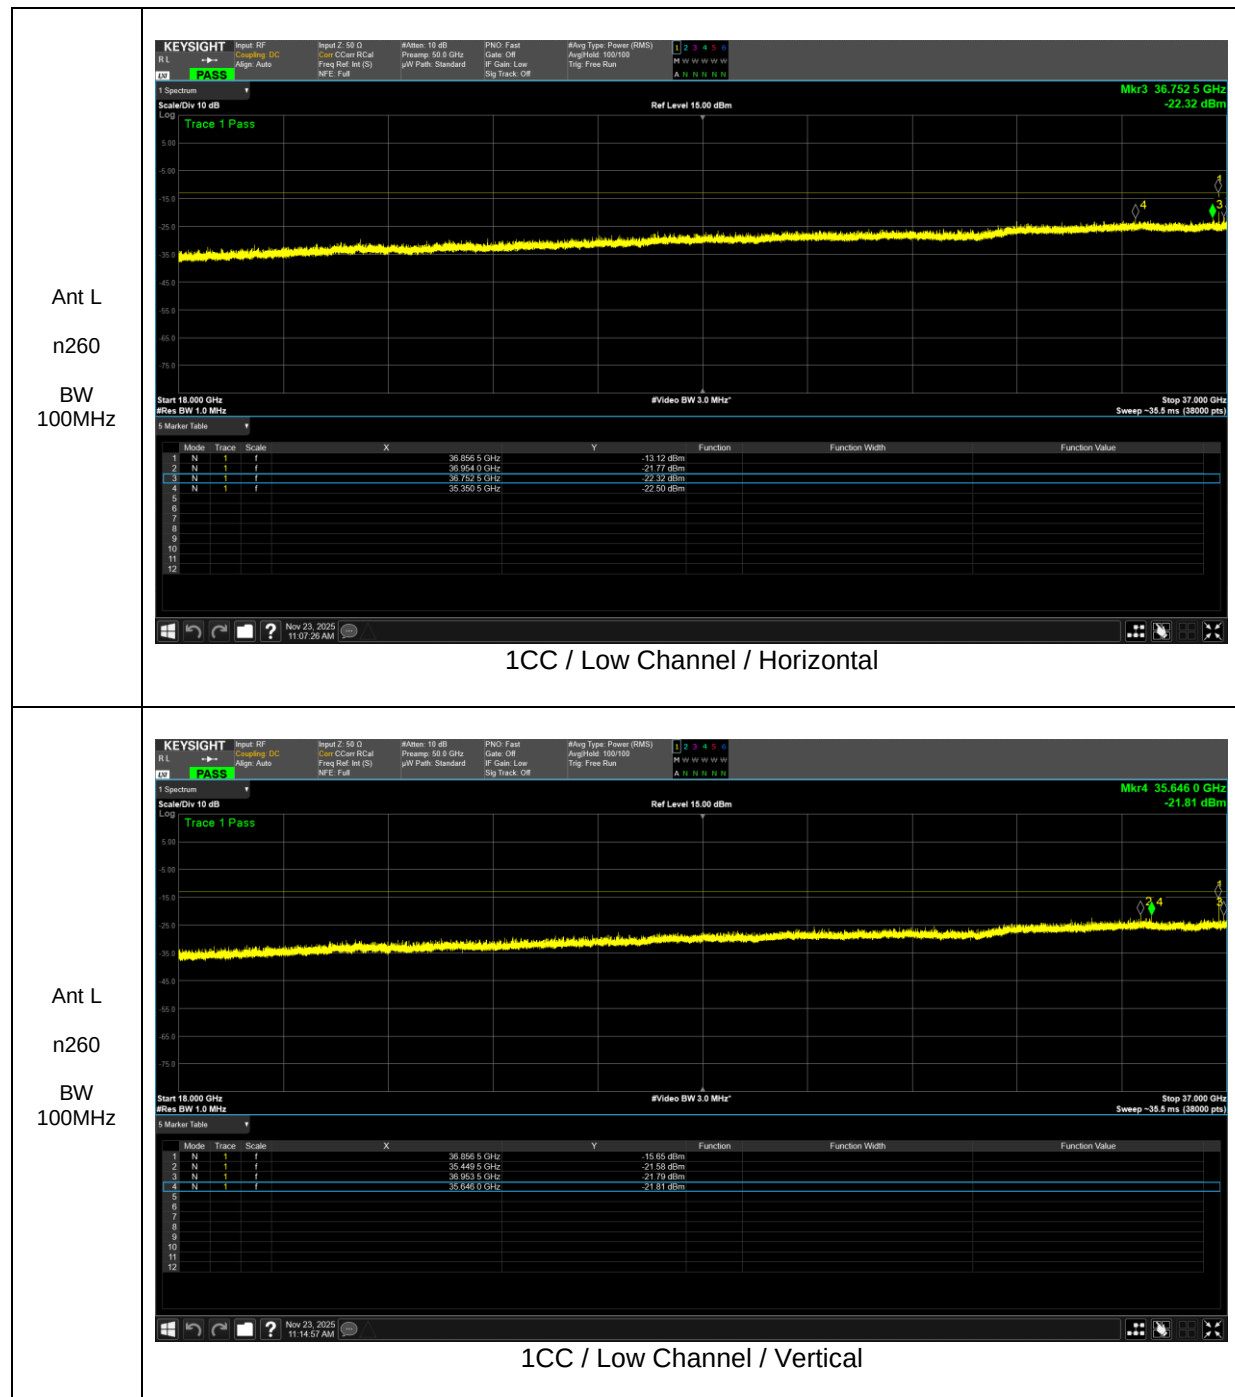


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

Final Measurement Data Table


Frequency [GHz]	Bandwidth [MHz]	EUT Beam	Modulation	Ant pol [H/V]	X-Axis [degree]	Y-Axis [degree]	EIRP [dBm]	Limit [dBm]	Margin [dB]
36.856	50	SISO-Dual	QPSK	H	34.7	51.6	-25.03	-13	12.03
36.857	50	SISO-Dual	QPSK	V	22.5	94.7	-23.69	-13	10.69

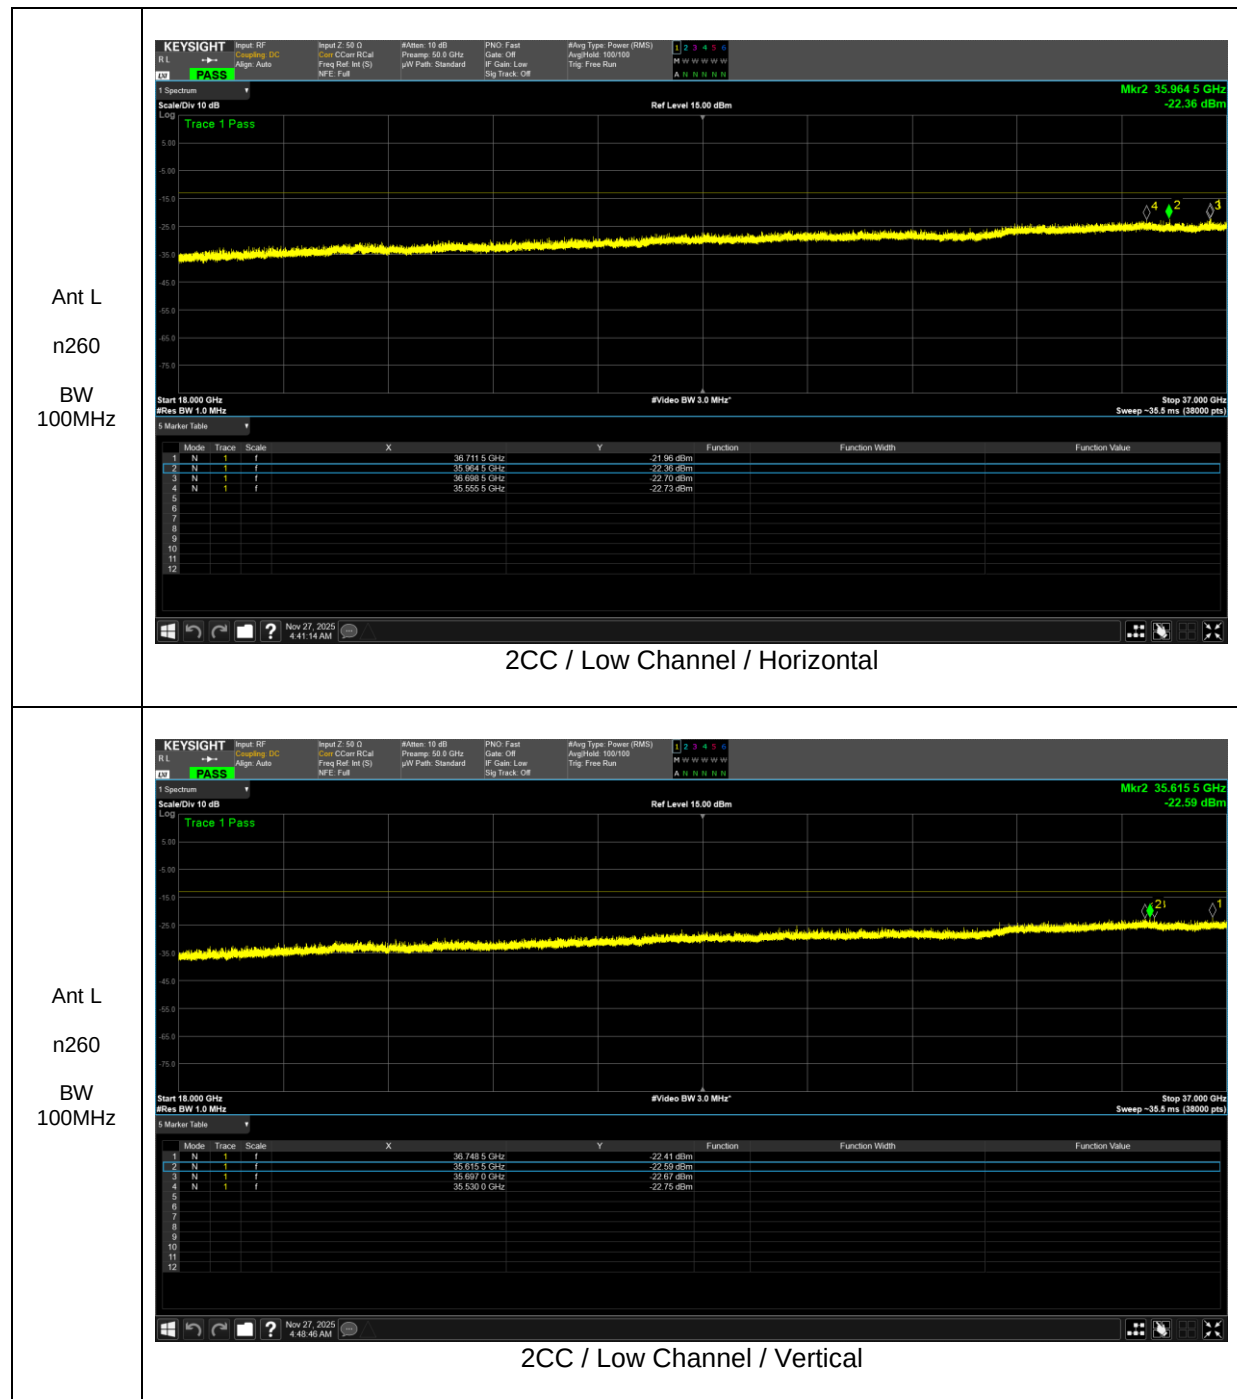

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

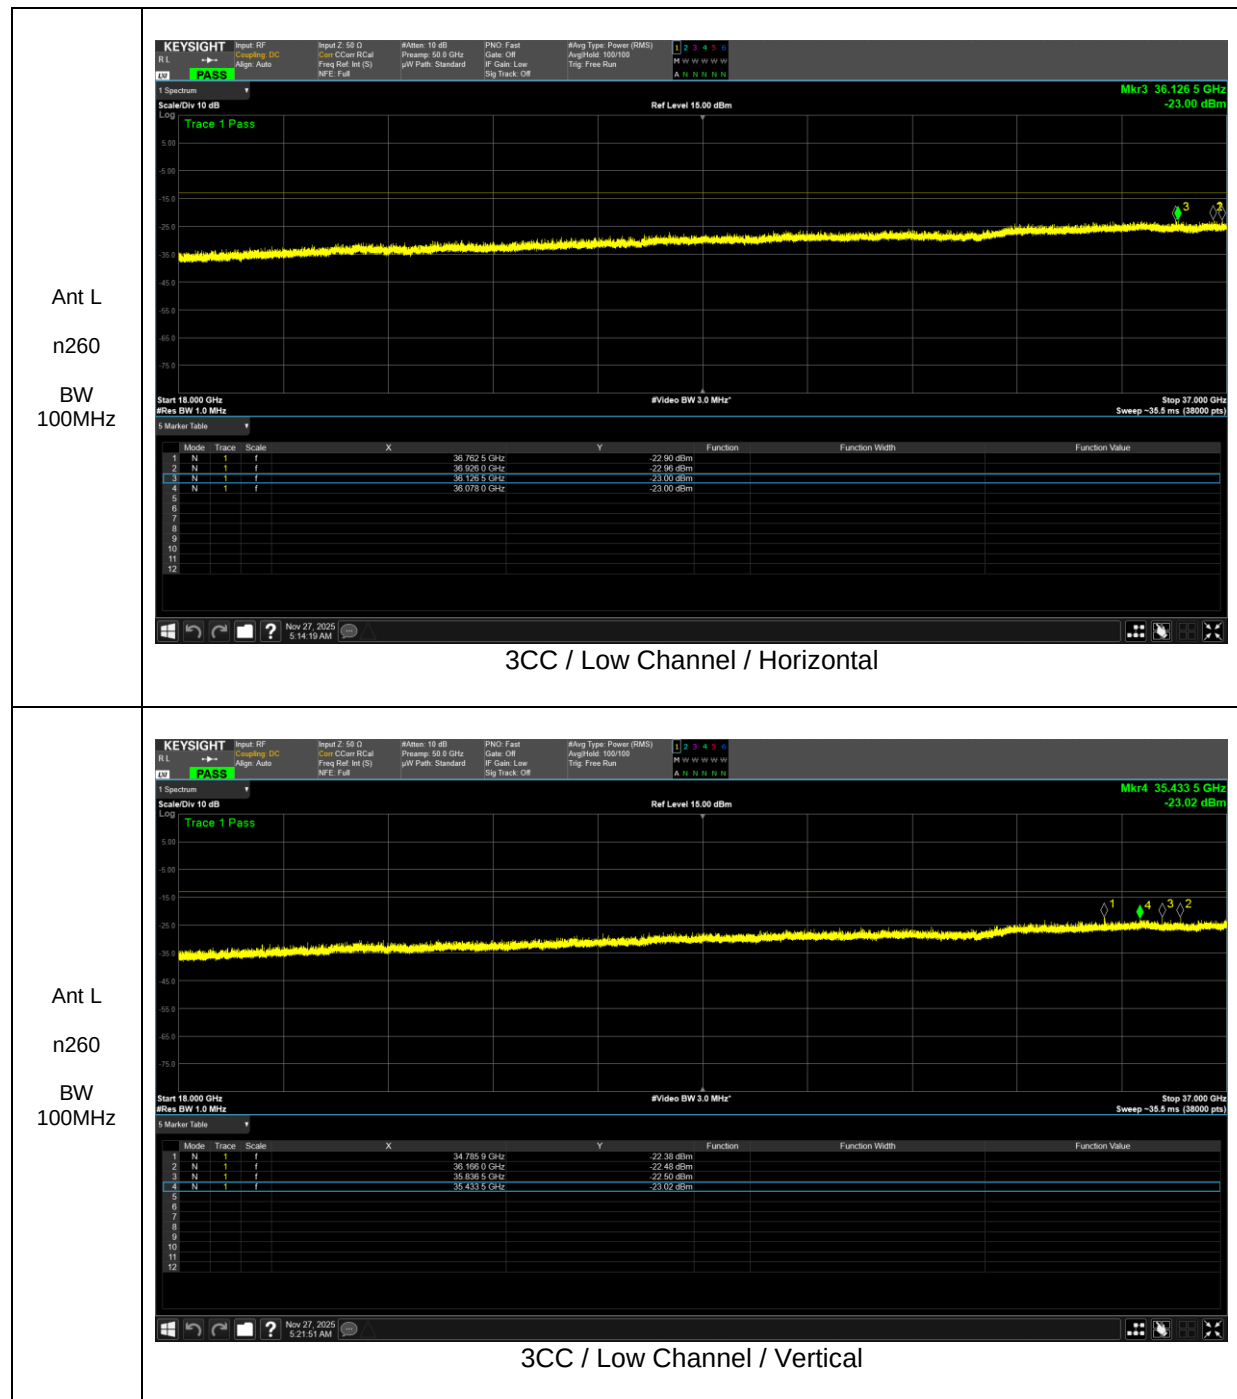


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

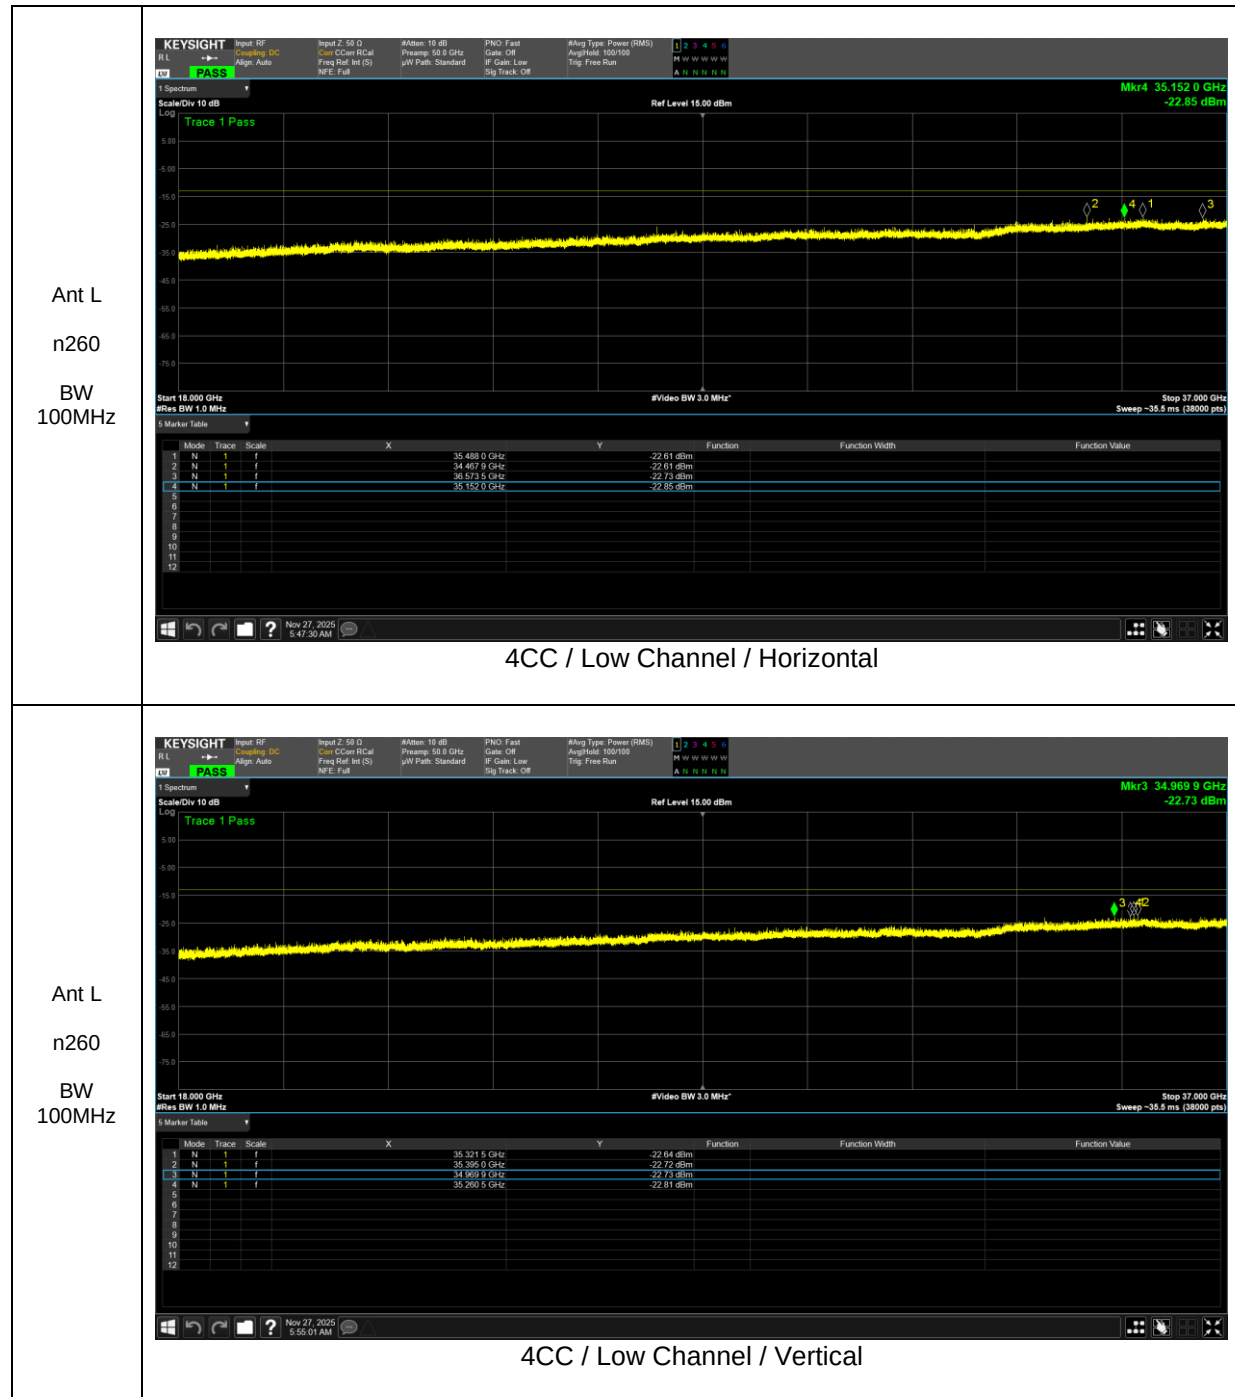


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.


40.1 – 50 GHz Result

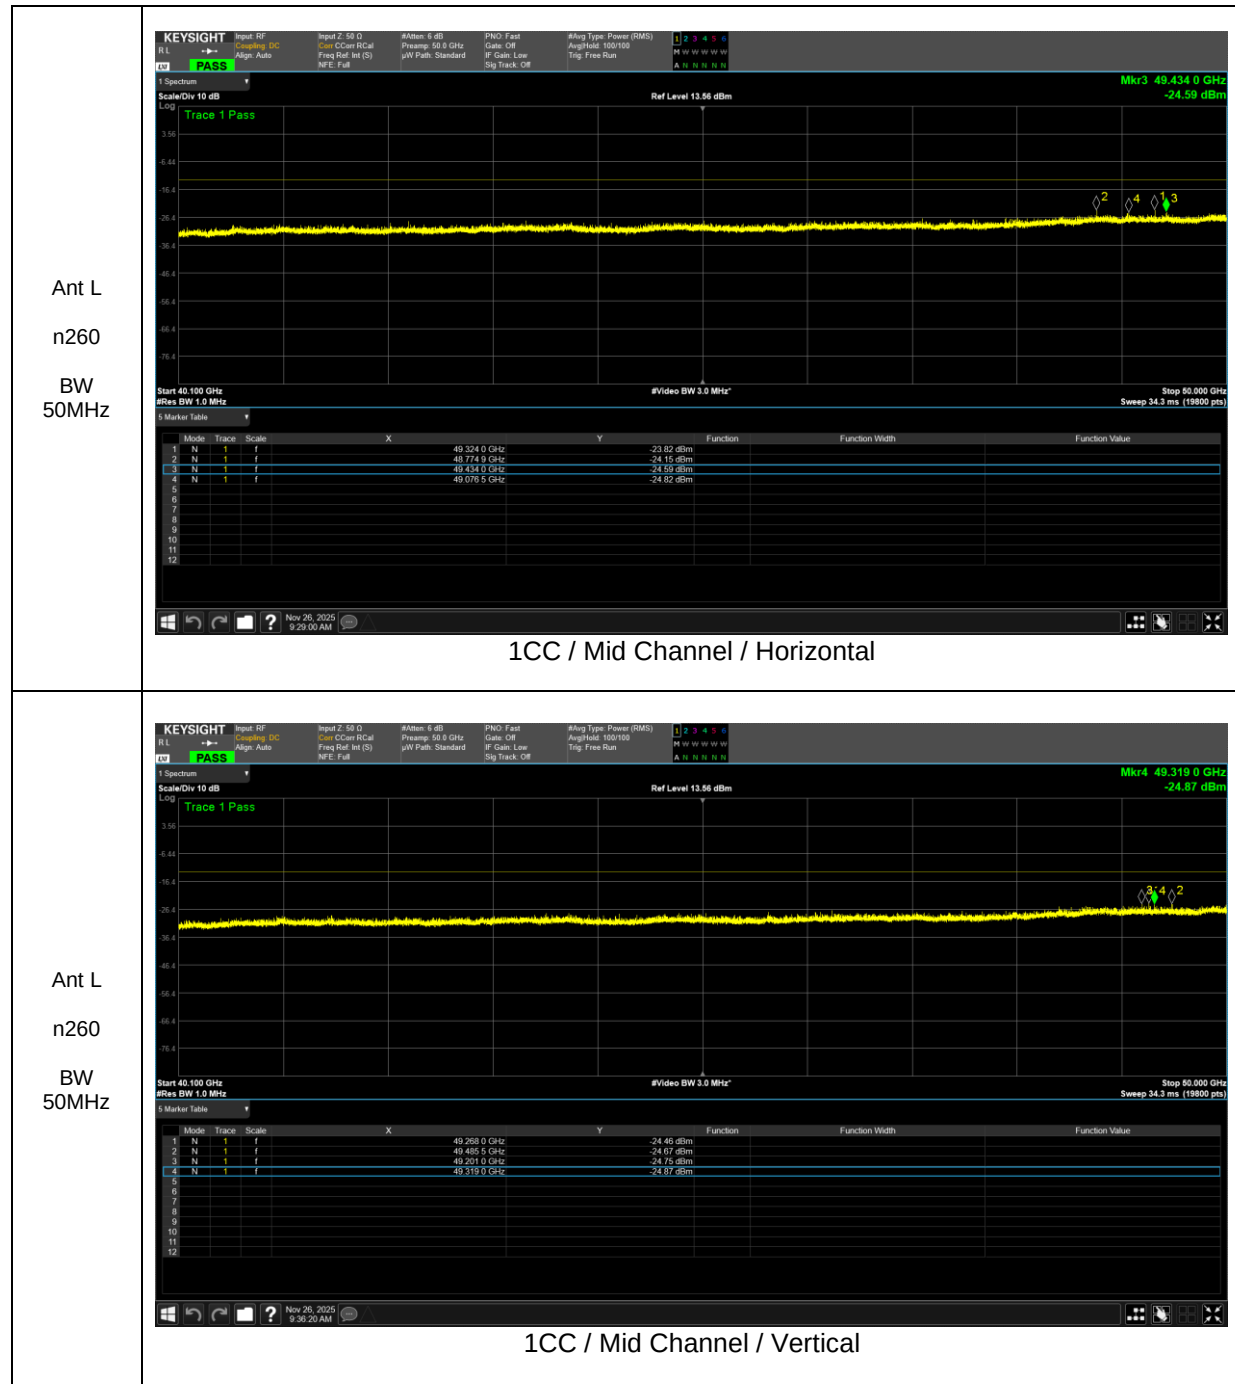


All channels were investigated, but no emission above the noise floor was detected.

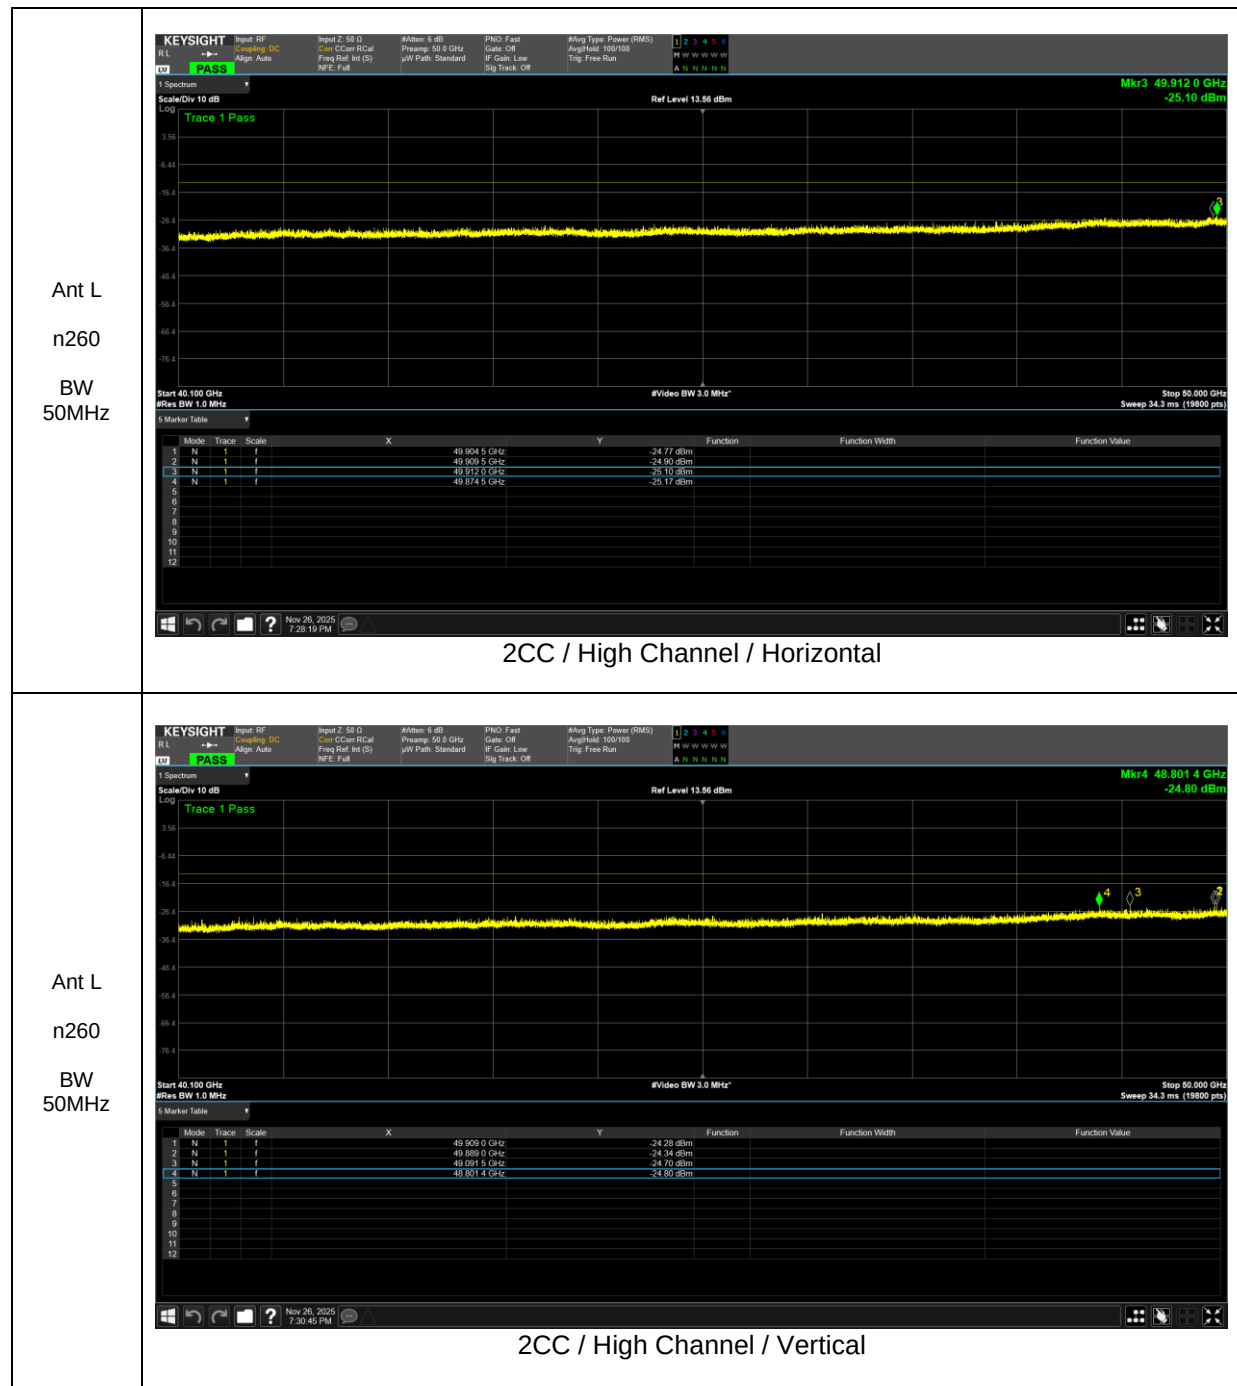


All channels were investigated, but no emission above the noise floor was detected.

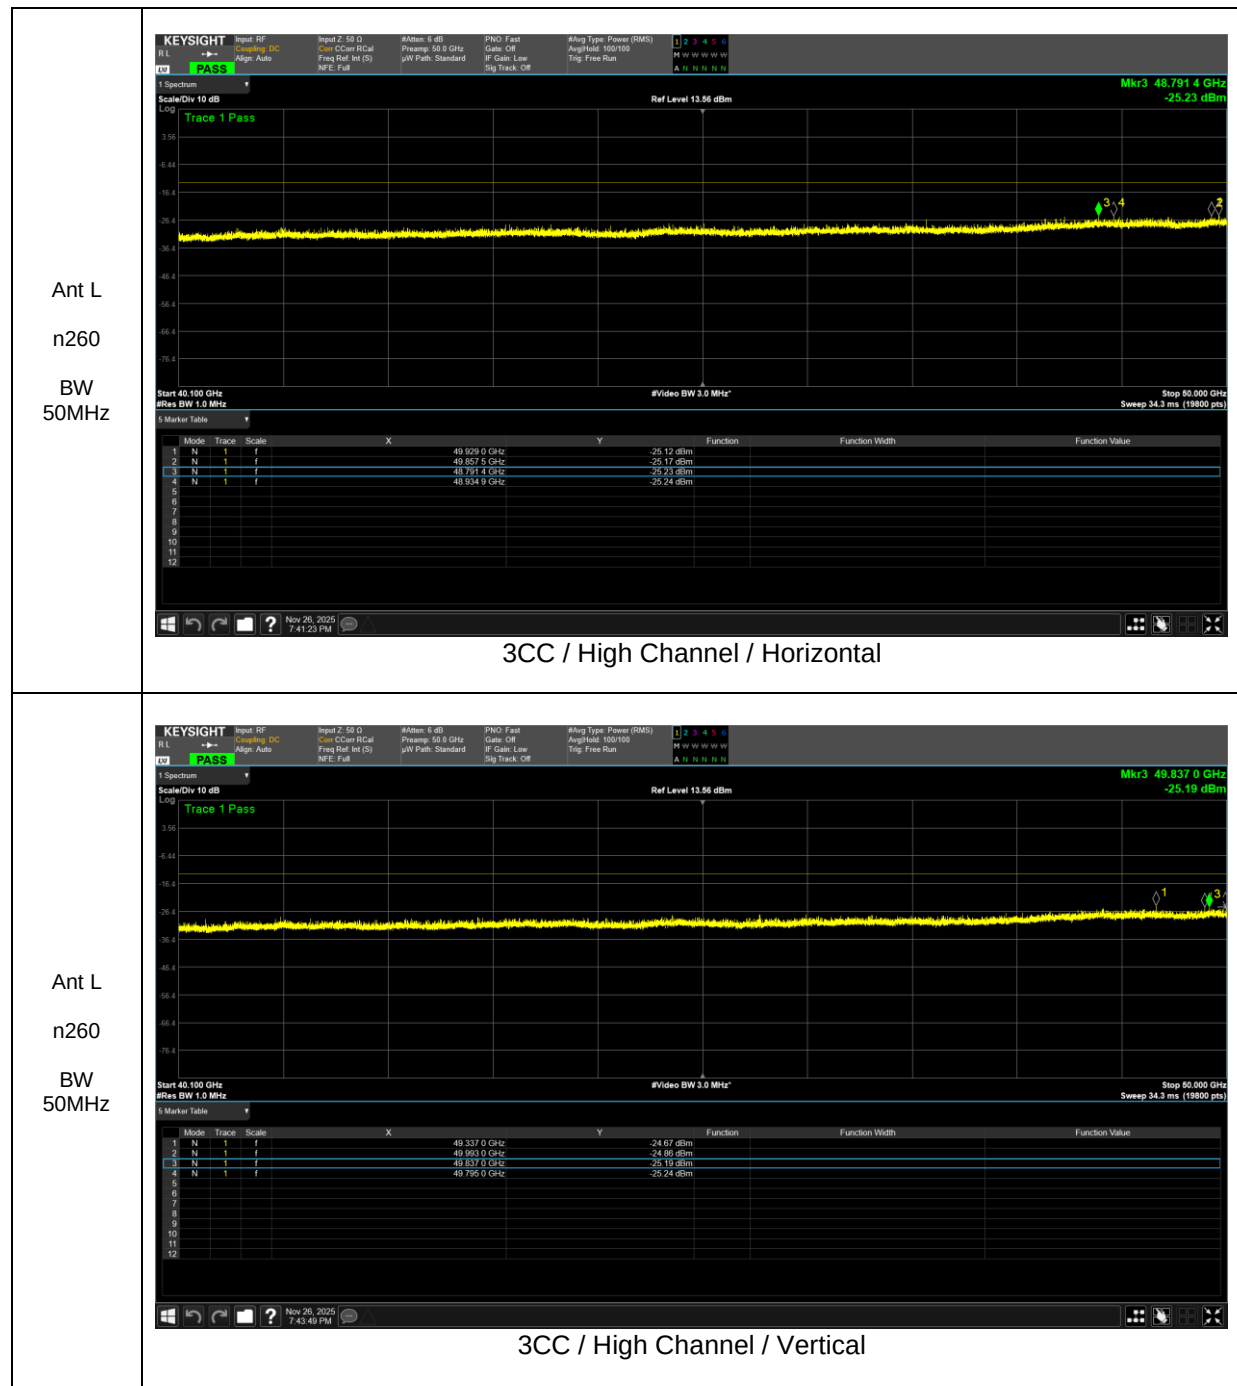


All channels were investigated, but no emission above the noise floor was detected.

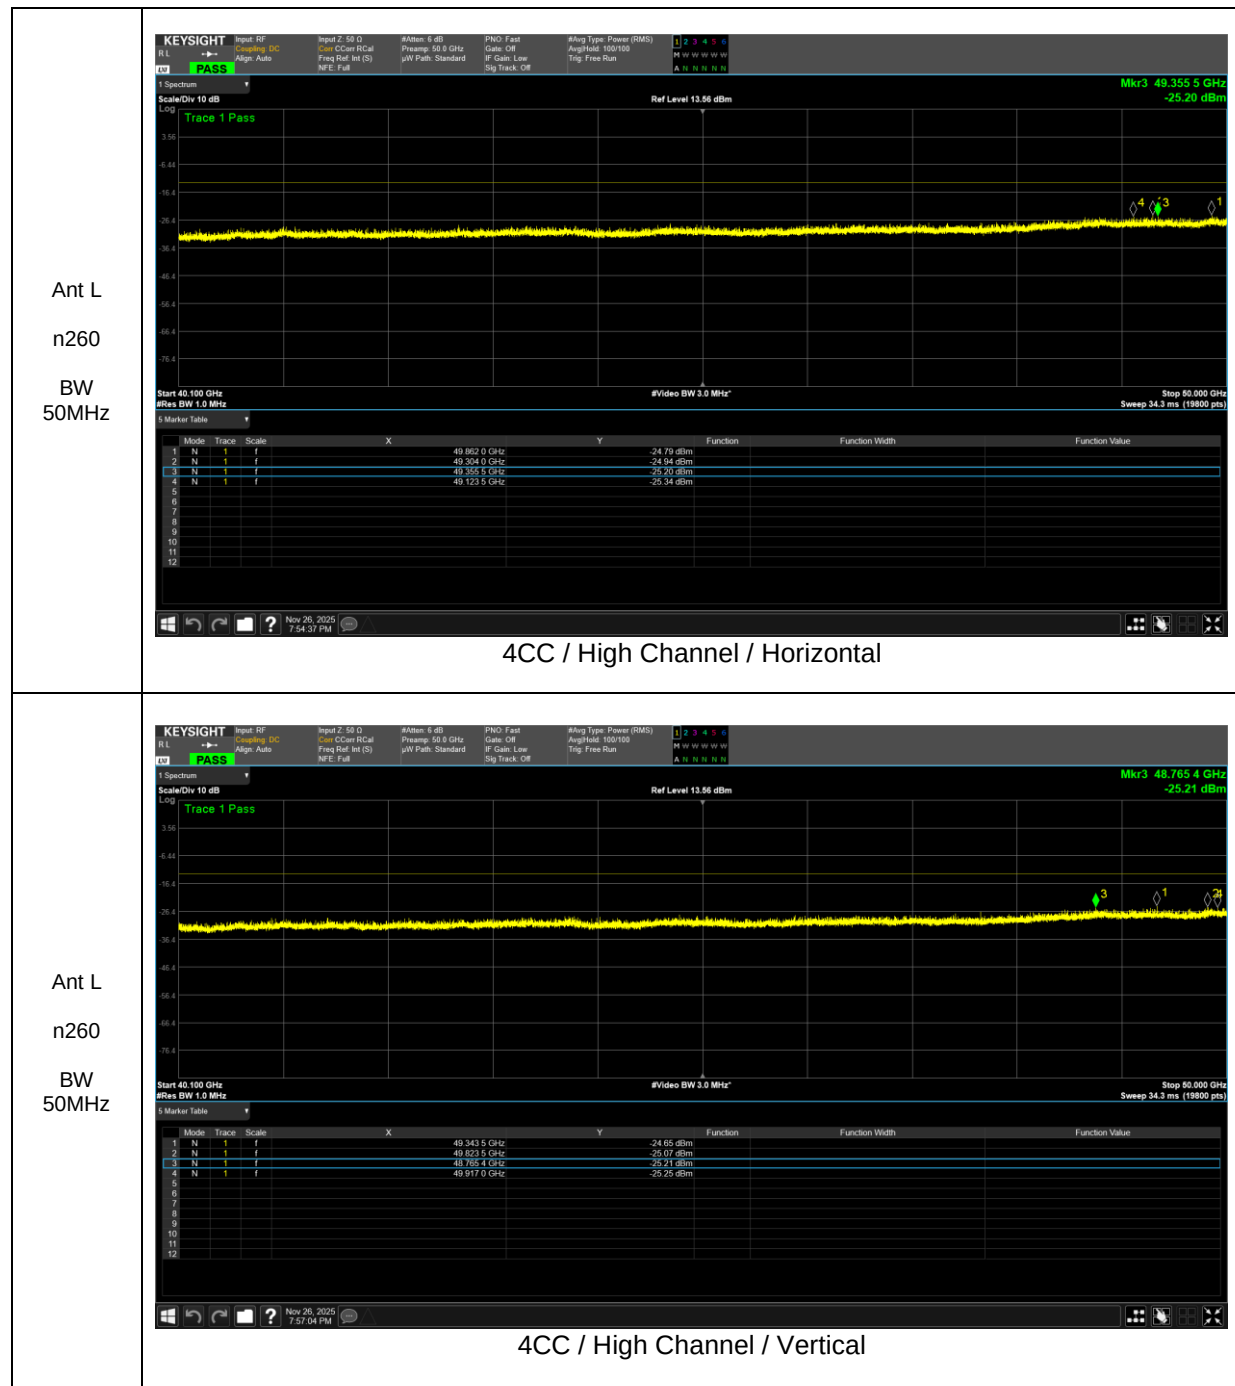


All channels were investigated, but no emission above the noise floor was detected.

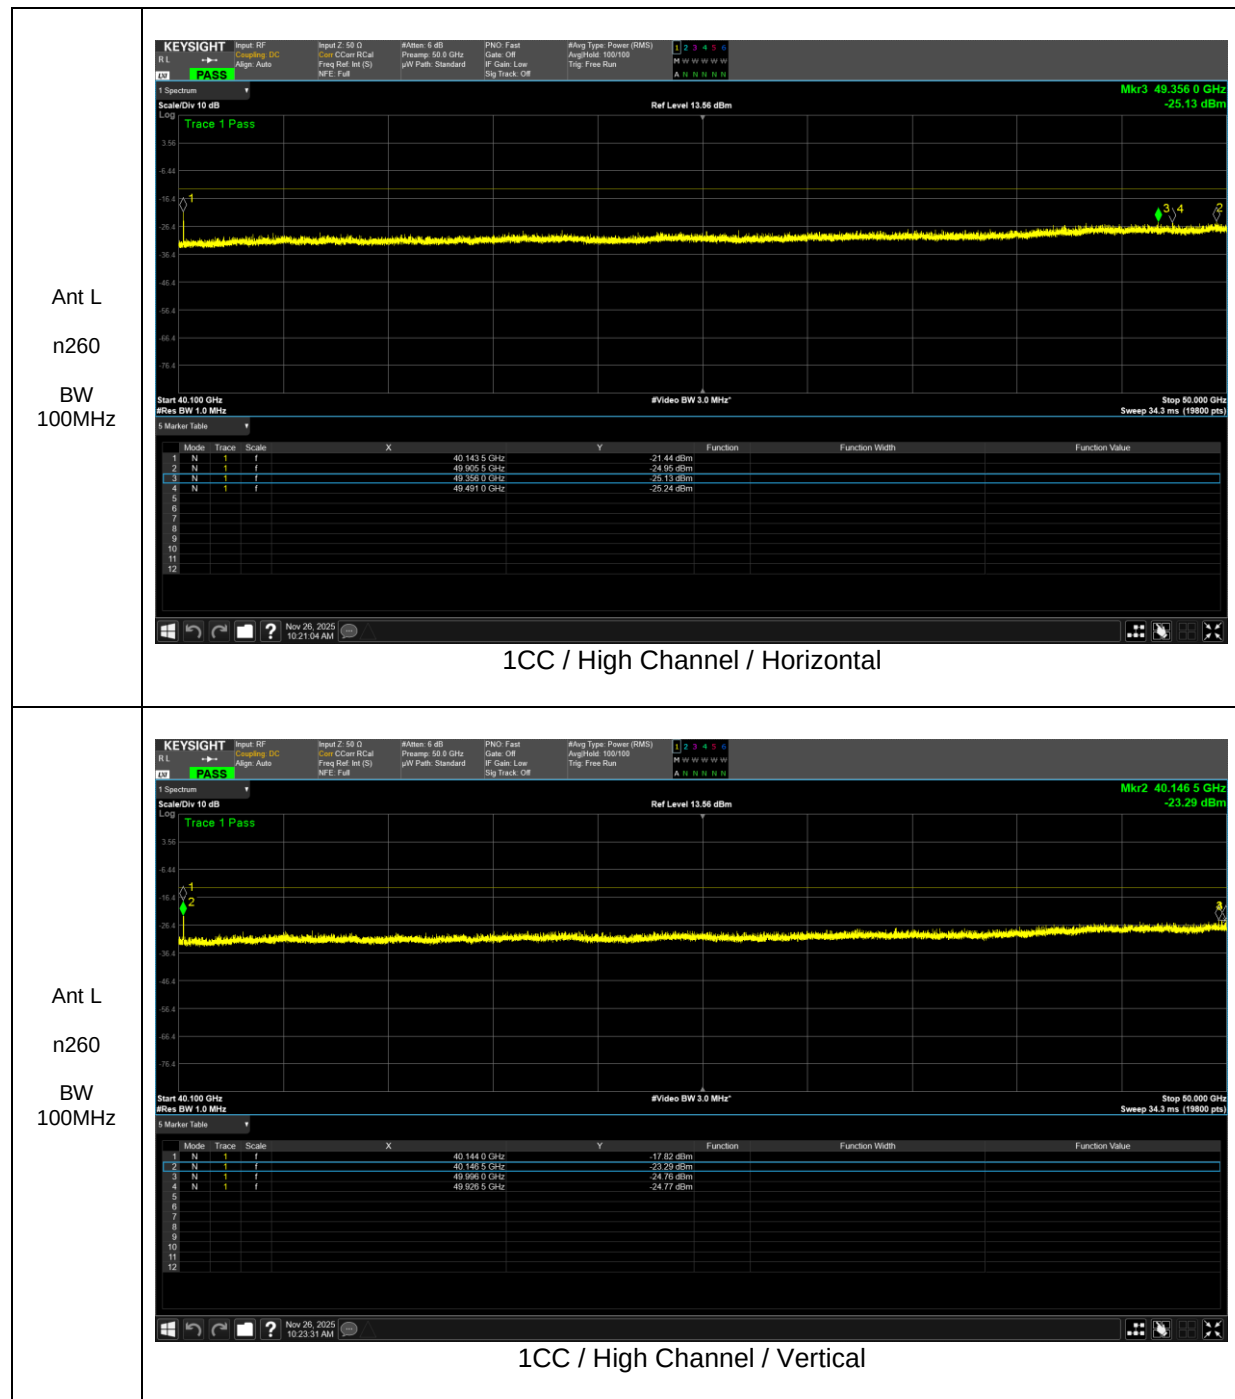


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

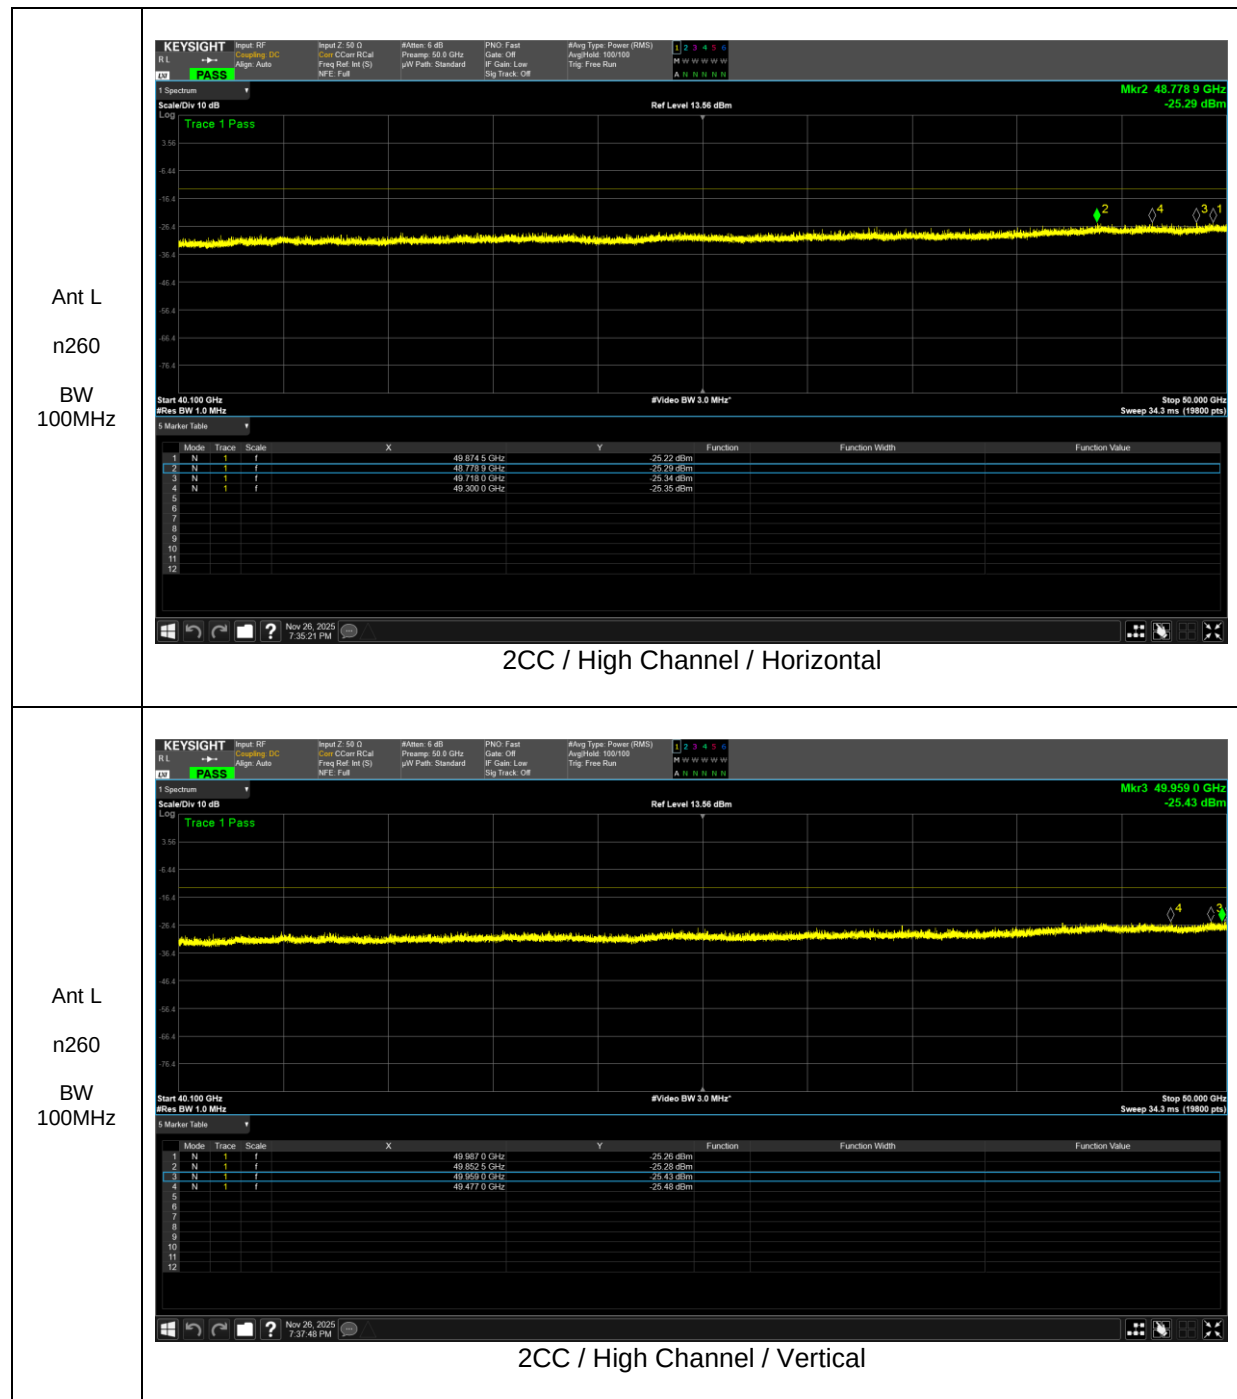

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

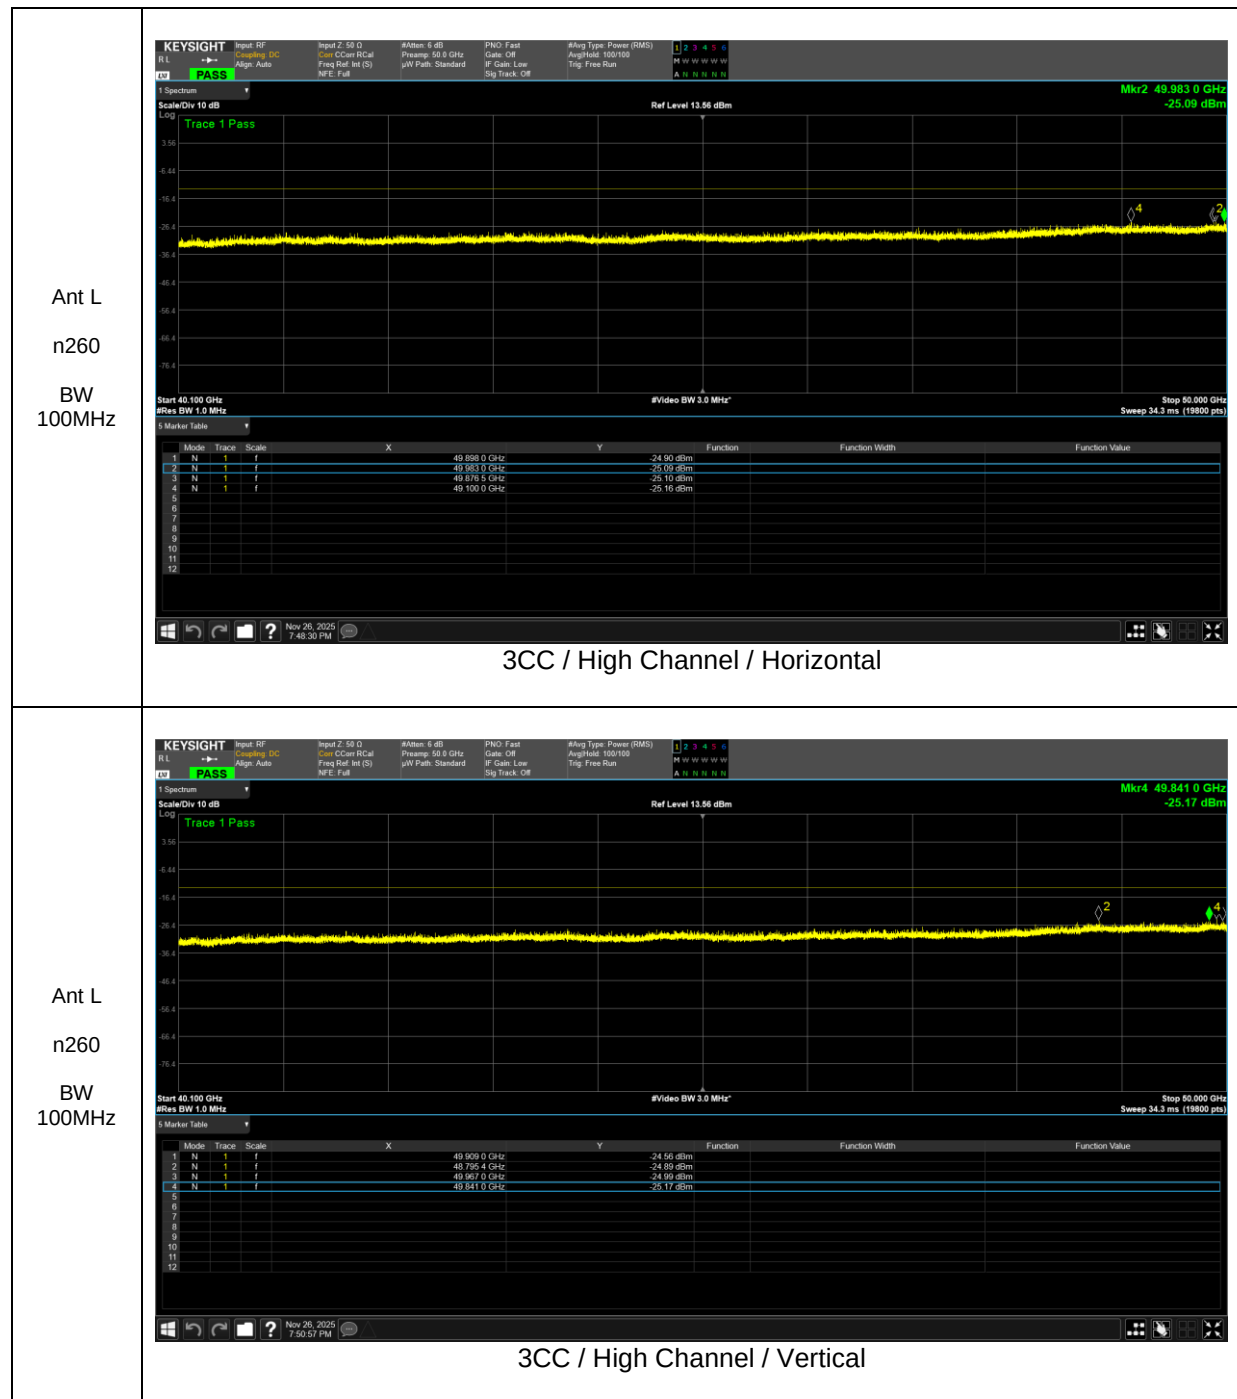


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

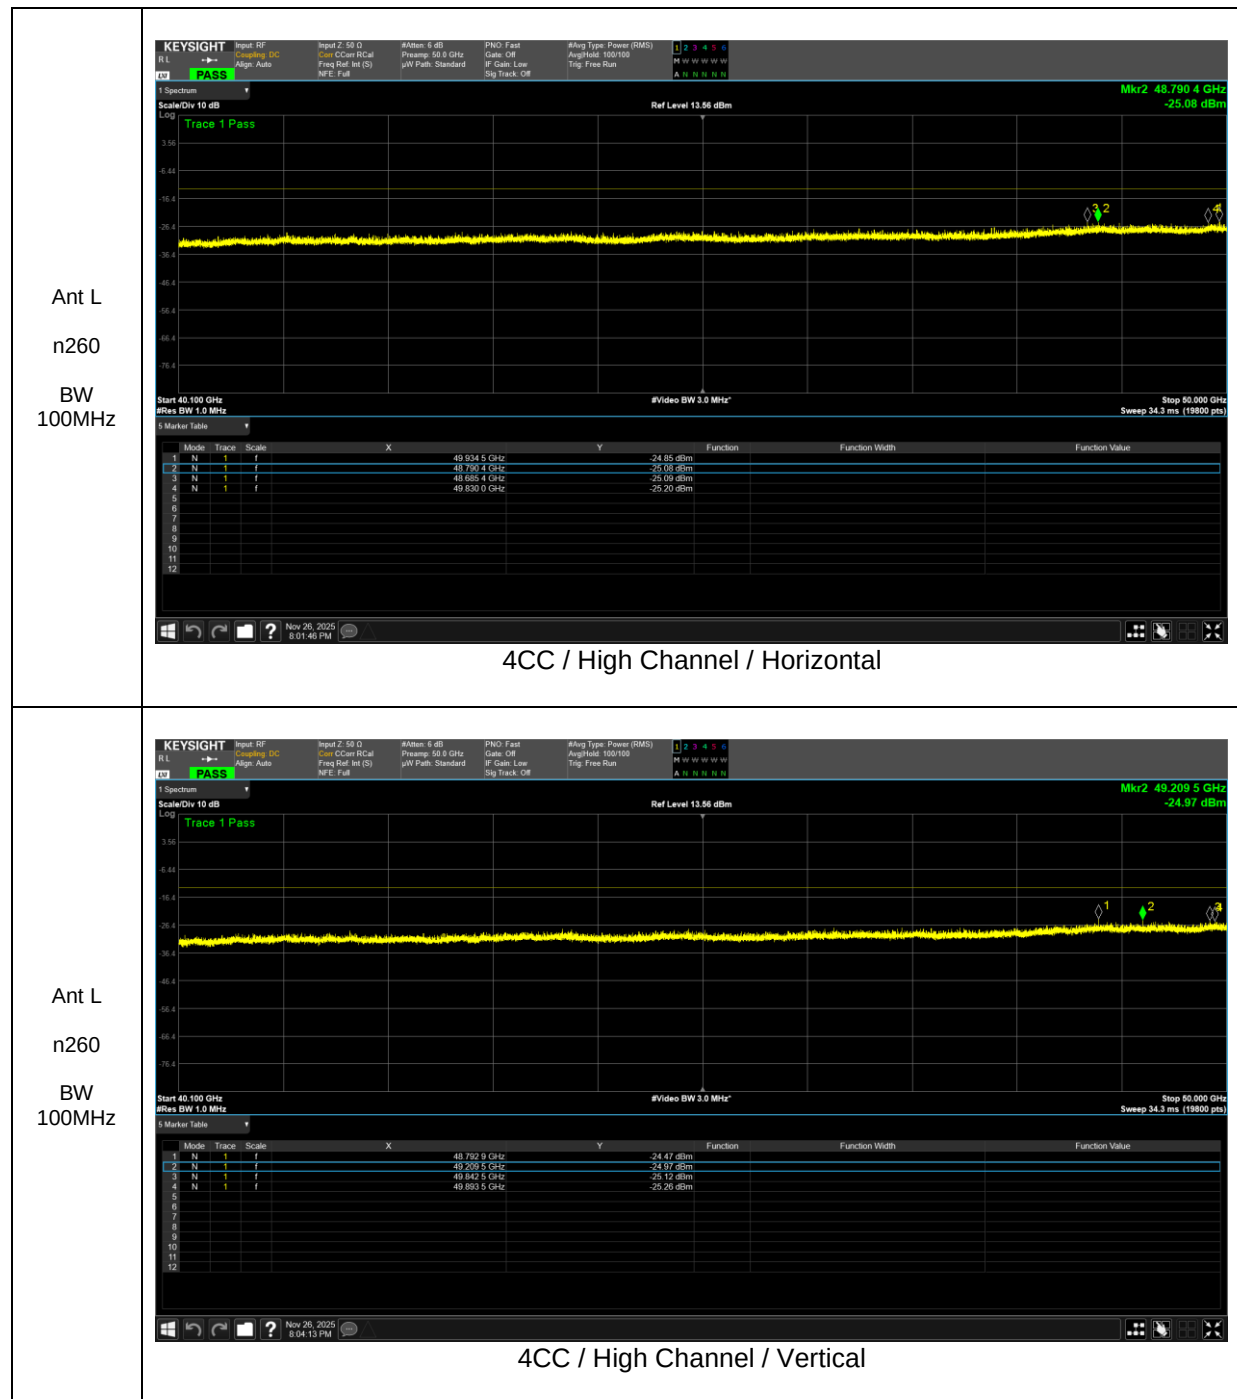


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

50 – 75 GHz Result

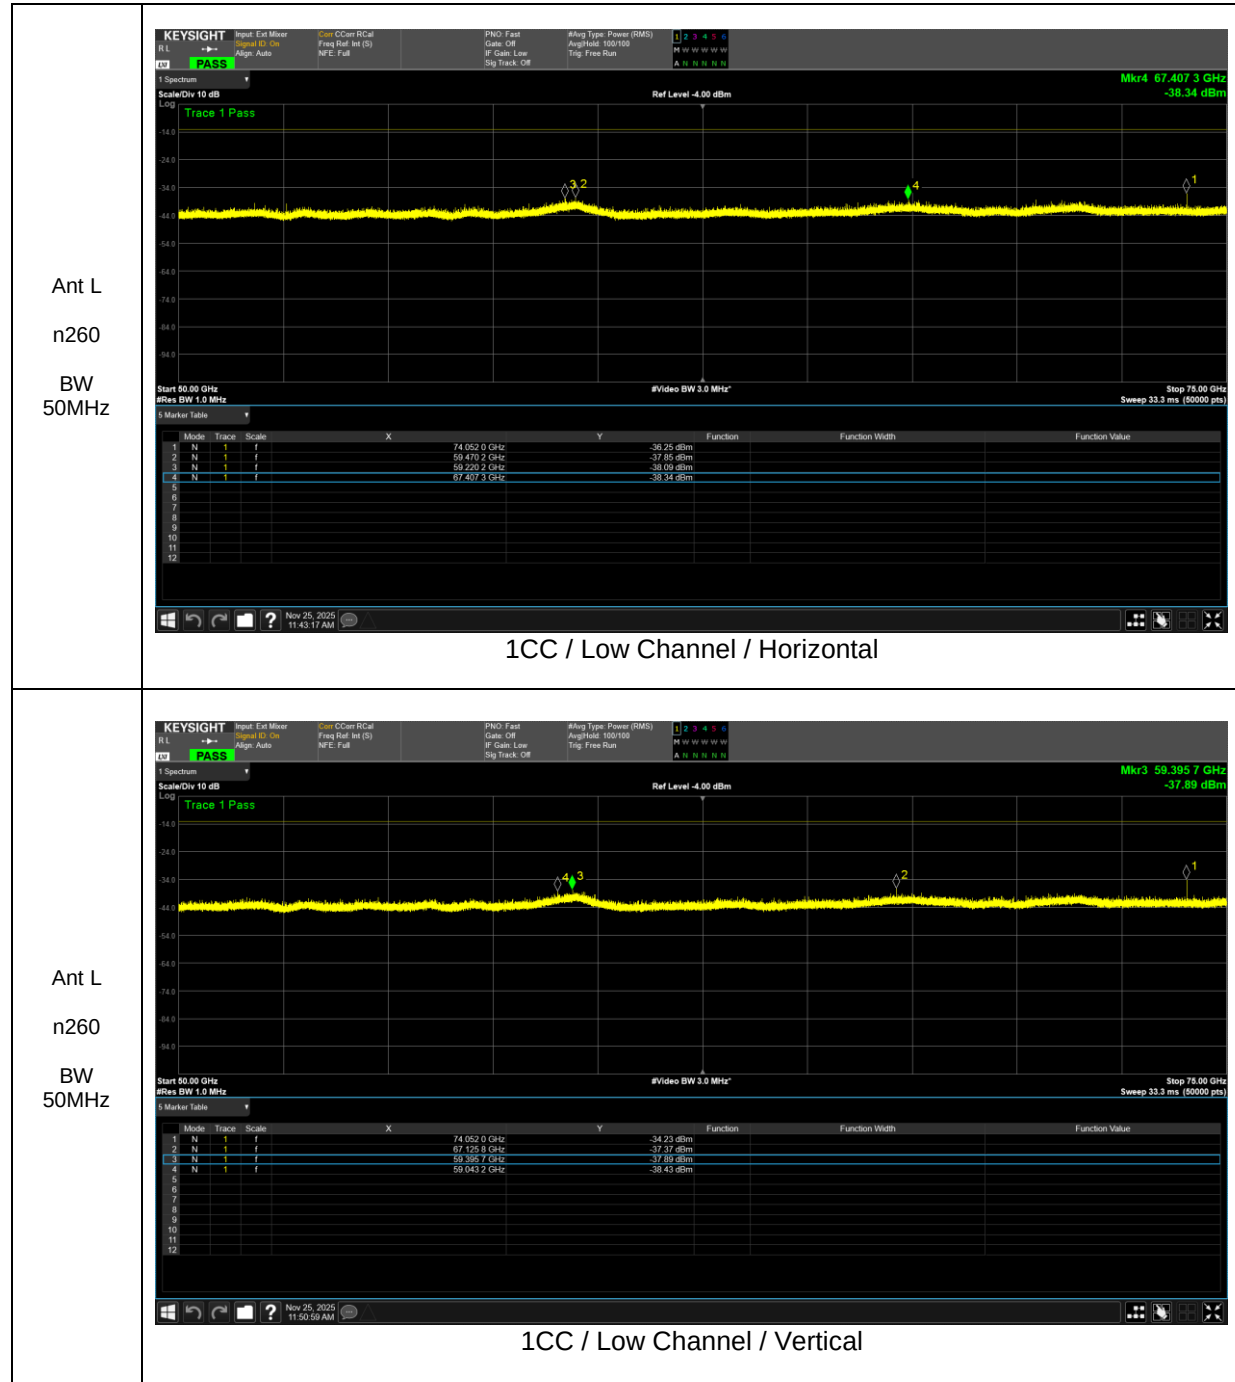


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

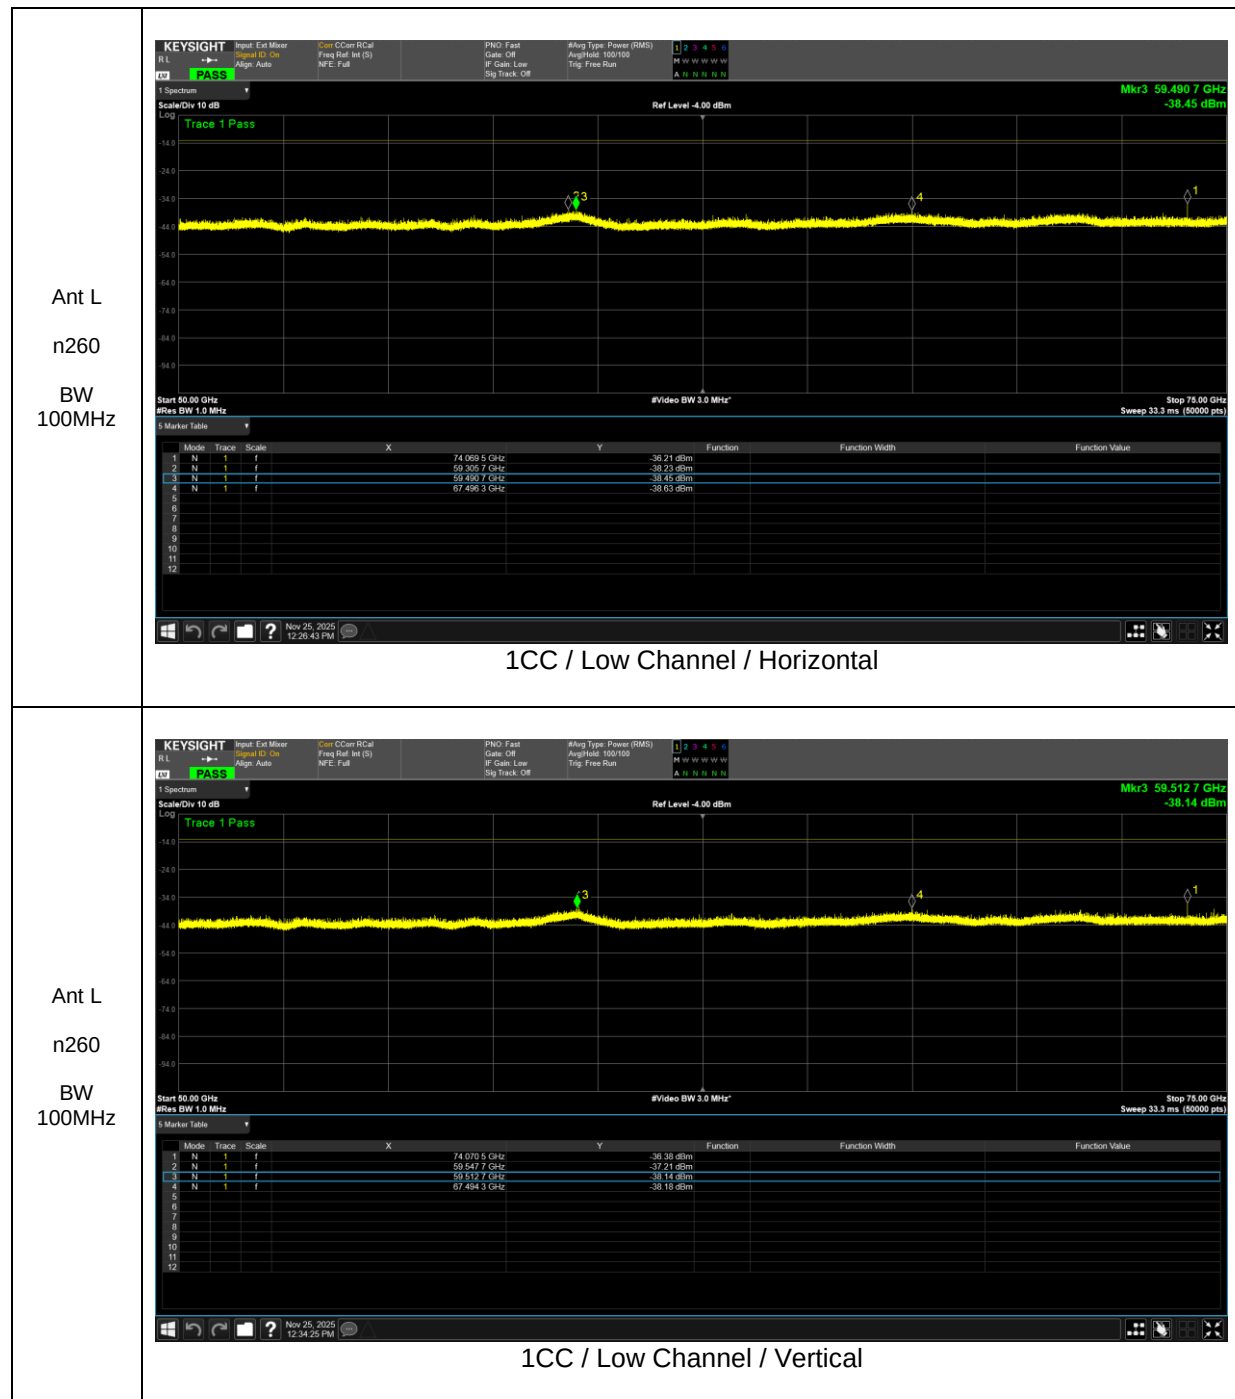


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

75 – 110 GHz Result

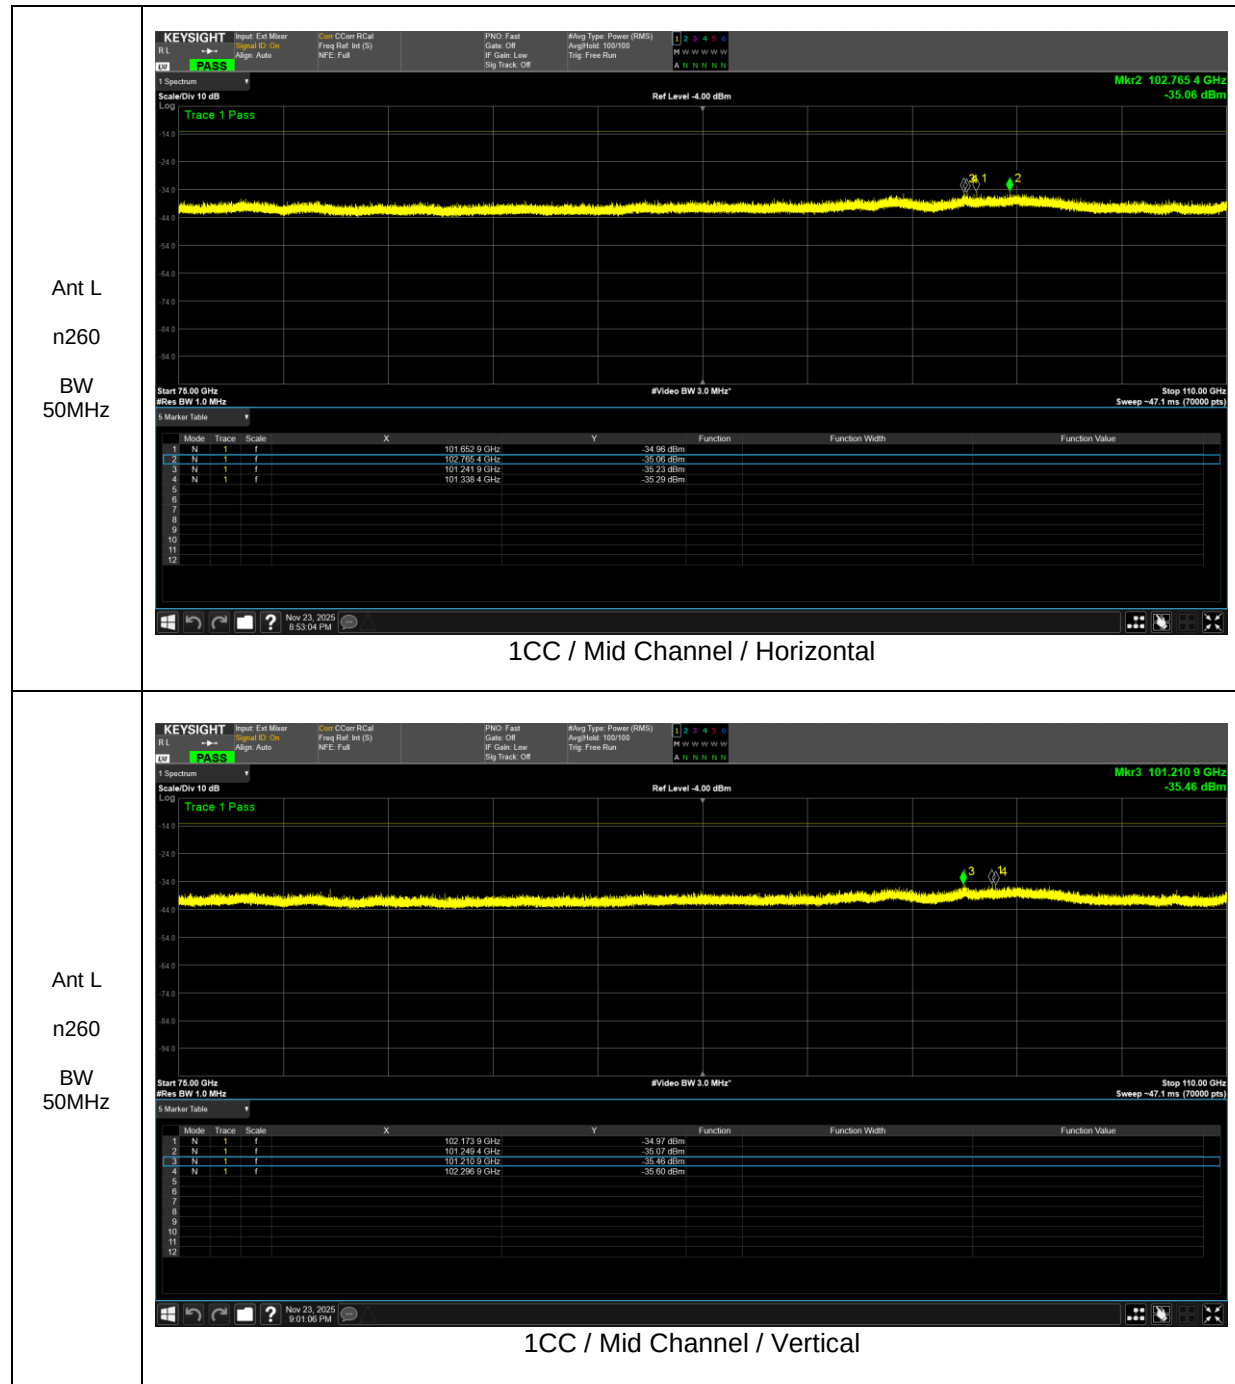


All channels were investigated, but no emission above the noise floor was detected.

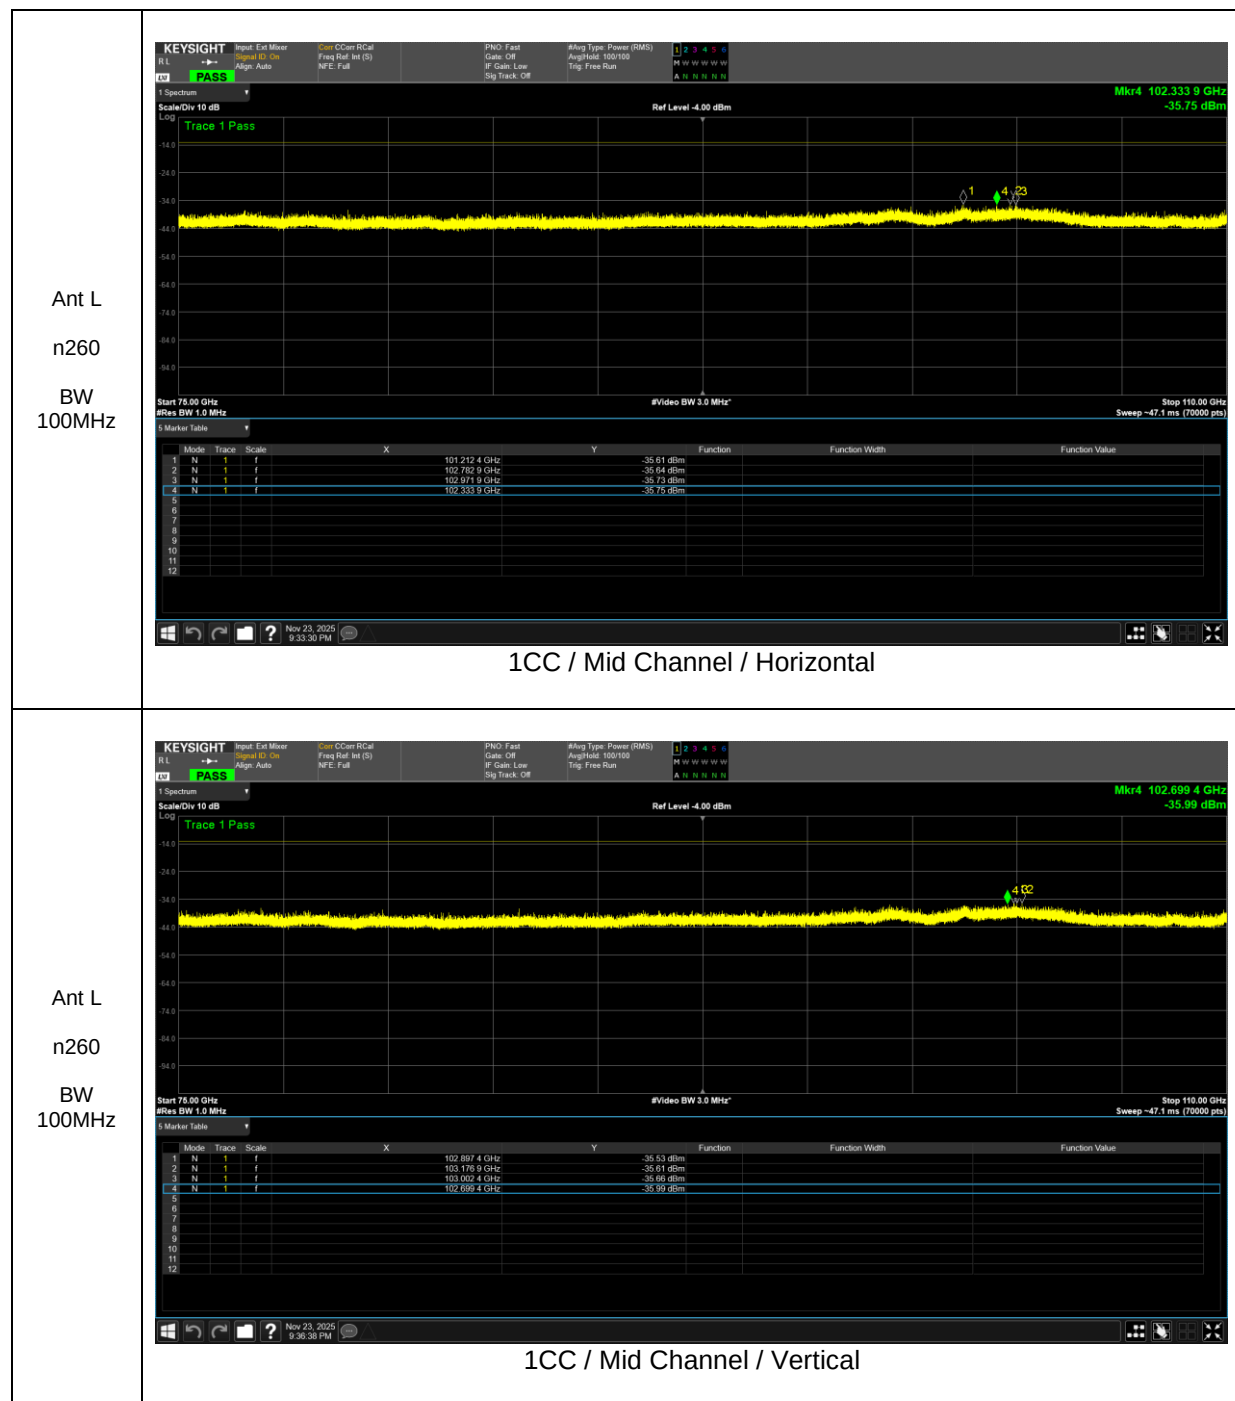


All channels were investigated, but no emission above the noise floor was detected.

110 – 140 GHz Result

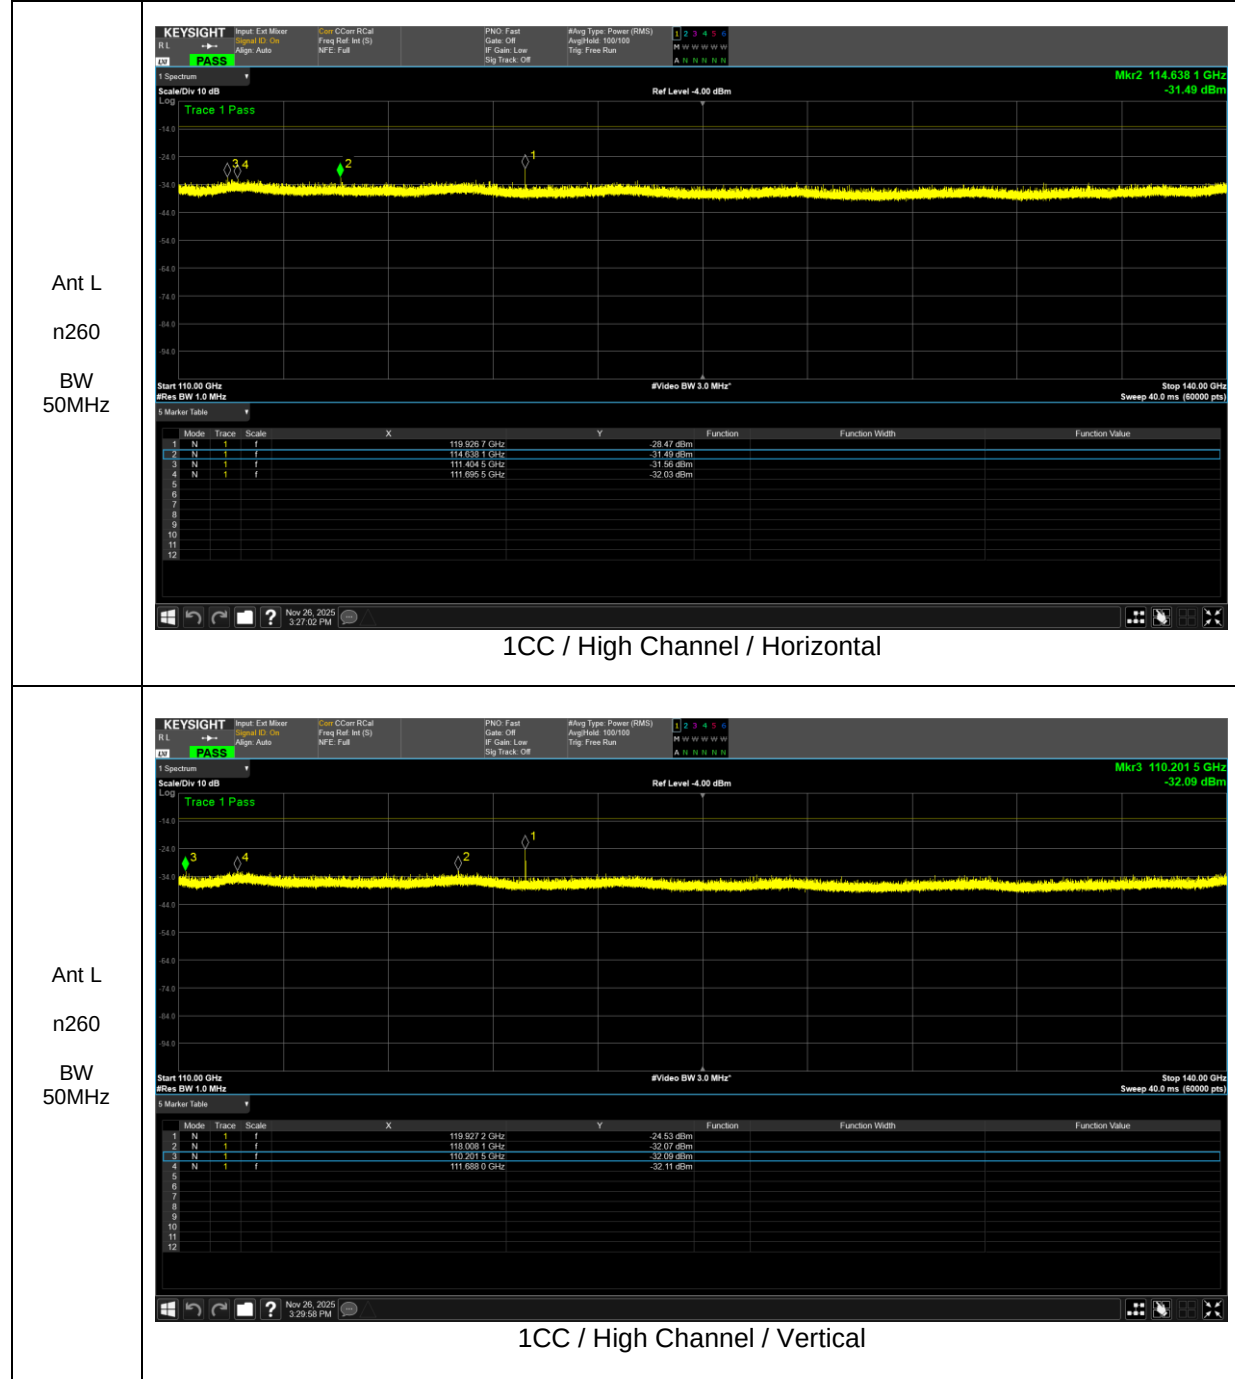


Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

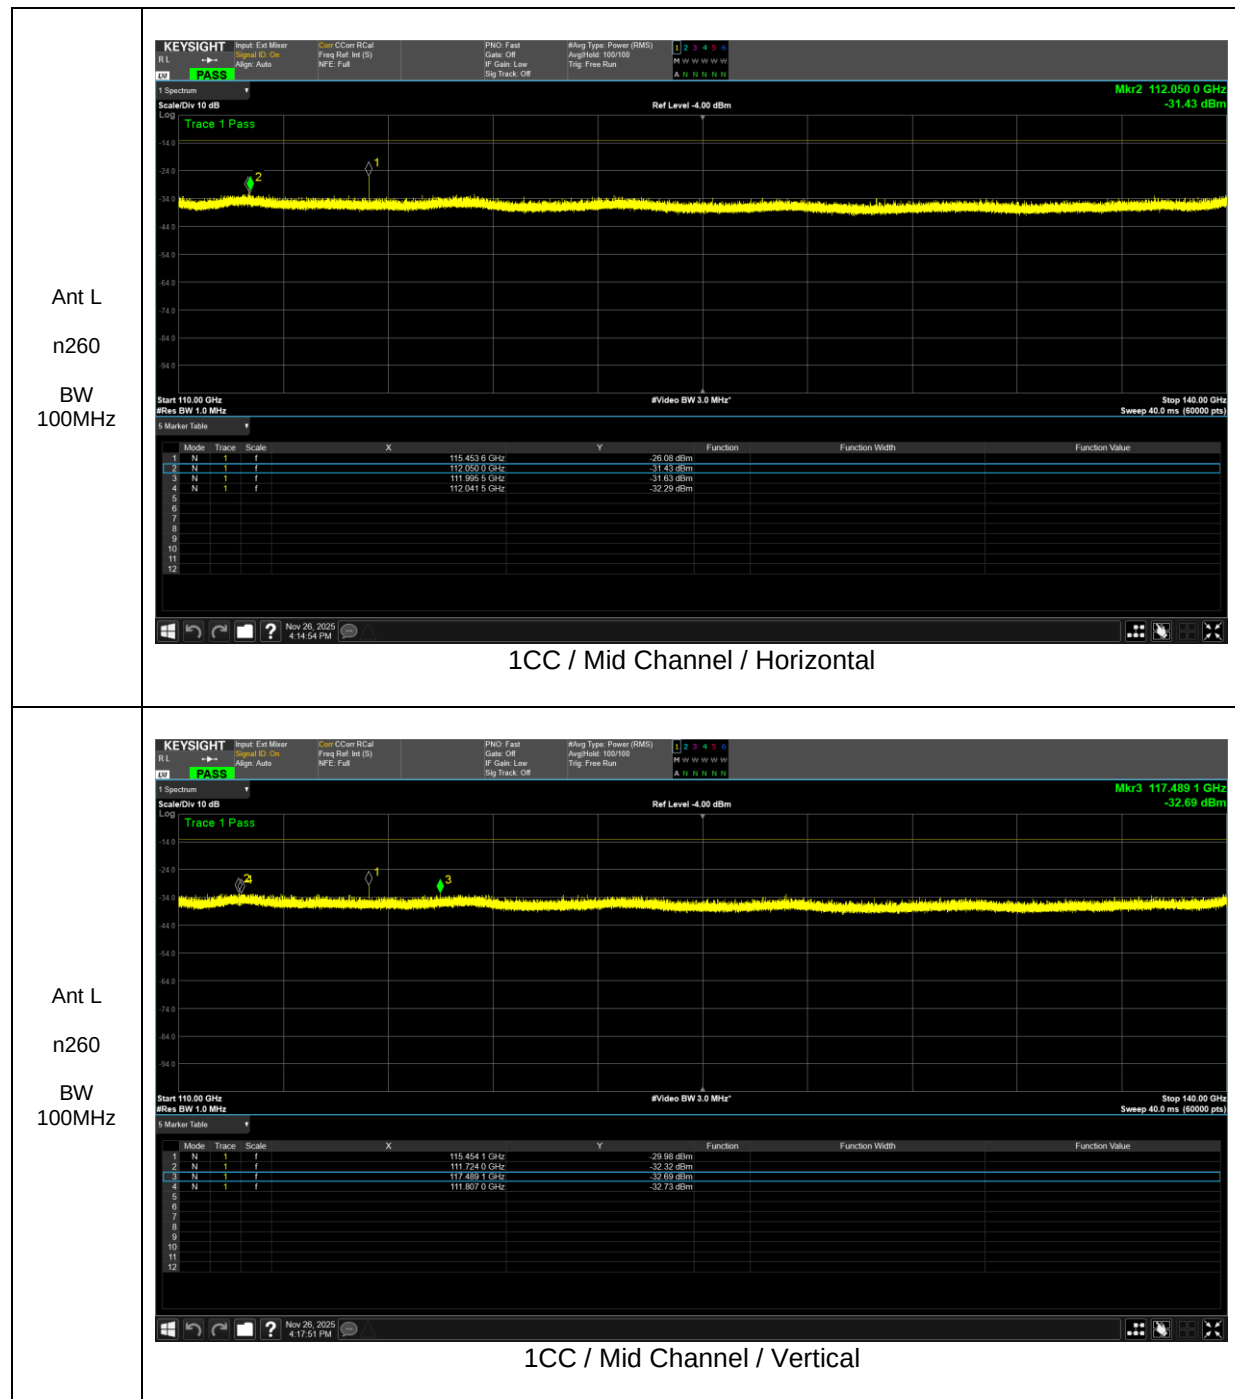

Note. If the margin of the pre-scan result is less than 3dB, the final measurement is performed for the identified spurious emissions.

140 – 170 GHz Result

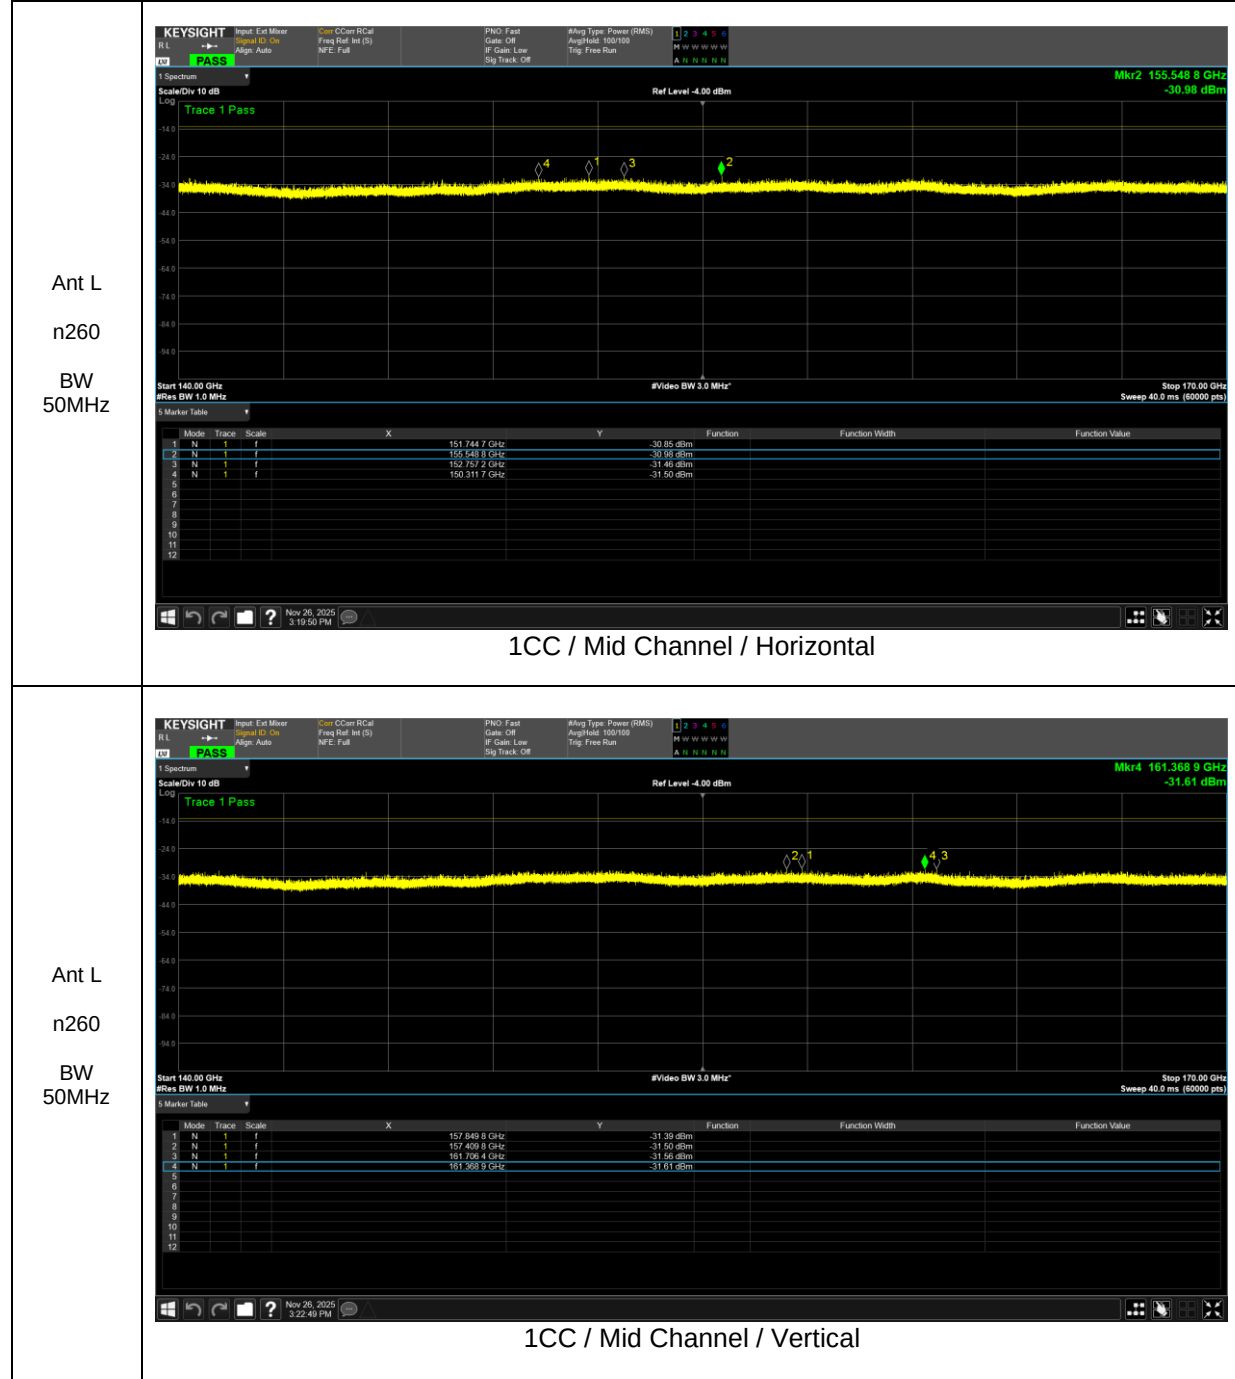

All channels were investigated, but no emission above the noise floor was detected.