#01_HAC_E_GSM850_GSM Voice_Ch128

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 824.2 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 96.28 V/m; Power Drift = -0.02 dB
Applied MIF = 3.63 dB
RF audio interference level = 41.36 dBV/m
Emission category: M3

MIF scaled E-field

Grid 1 **M3** **40.24 dBV/m**	Grid 2 **M3** **41.19 dBV/m**	Grid 3 **M3** **41.02 dBV/m**
Grid 4 **M3** **40.41 dBV/m**	Grid 5 **M3** **41.36 dBV/m**	Grid 6 **M3** **41.21 dBV/m**
Grid 7 **M3** **40.37 dBV/m**	Grid 8 **M3** **41.25 dBV/m**	Grid 9 **M3** **41.11 dBV/m**

Cursor:
Total = 41.36 dBV/m
E Category: M3
Location: -4, 0, 8.7 mm

0 dB = 117.0 V/m = 41.36 dBV/m

#02_HAC_E_GSM850_GSM Voice_Ch189

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 836.4 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 90.24 V/m; Power Drift = -0.05 dB
Applied MIF = 3.63 dB
RF audio interference level = 40.80 dBV/m
Emission category: M3

MIF scaled E-field

Grid 1 **M4** **39.69 dBV/m**	Grid 2 **M3** **40.66 dBV/m**	Grid 3 **M3** **40.5 dBV/m**
Grid 4 **M4** **39.8 dBV/m**	Grid 5 **M3** **40.8 dBV/m**	Grid 6 **M3** **40.63 dBV/m**
Grid 7 **M4** **39.63 dBV/m**	Grid 8 **M3** **40.61 dBV/m**	Grid 9 **M3** **40.49 dBV/m**

Cursor:
Total = 40.80 dBV/m
E Category: M3
Location: -4, -1, 8.7 mm

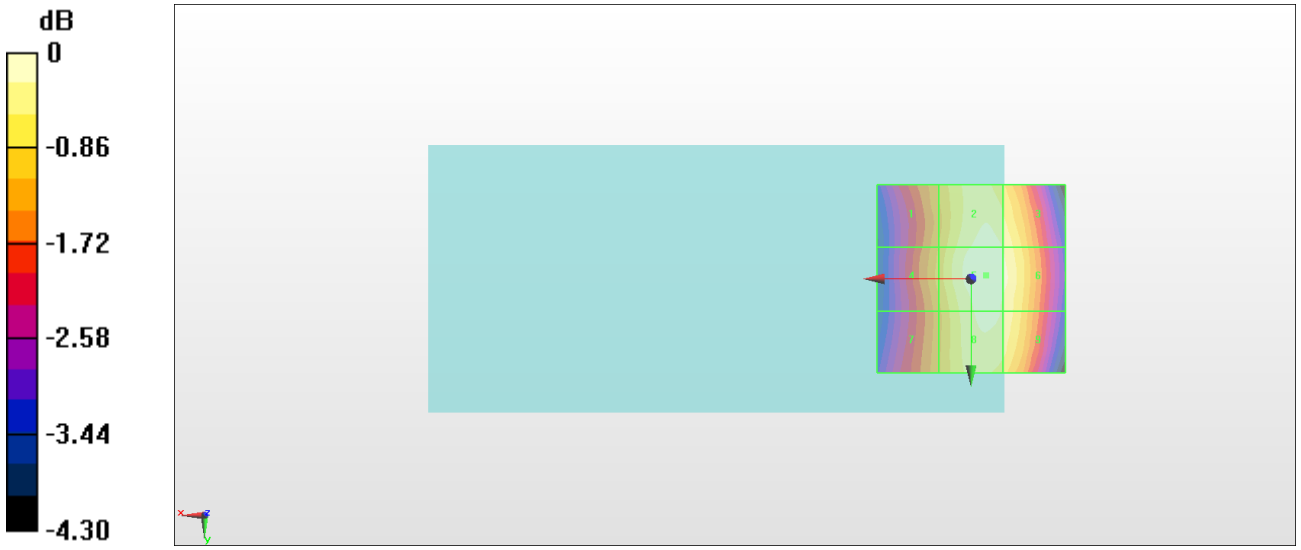

0 dB = 109.7 V/m = 40.80 dBV/m

#03_HAC_E_GSM850_GSM Voice_Ch251

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 848.8 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 79.24 V/m; Power Drift = -0.05 dB
Applied MIF = 3.63 dB
RF audio interference level = 39.76 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **38.41 dBV/m**	Grid 2 **M4** **39.61 dBV/m**	Grid 3 **M4** **39.52 dBV/m**
Grid 4 **M4** **38.53 dBV/m**	Grid 5 **M4** **39.76 dBV/m**	Grid 6 **M4** **39.66 dBV/m**
Grid 7 **M4** **38.36 dBV/m**	Grid 8 **M4** **39.6 dBV/m**	Grid 9 **M4** **39.53 dBV/m**

Cursor:
Total = 39.76 dBV/m
E Category: M4
Location: -5, -1, 8.7 mm

0 dB = 97.23 V/m = 39.76 dBV/m

#16_HAC_E_GSM1900_GSM Voice_Ch512

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 1850.2 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 21.10 V/m; Power Drift = 0.03 dB
Applied MIF = 3.63 dB
RF audio interference level = 30.46 dBV/m
Emission category: M3

MIF scaled E-field

Grid 1 **M4** **28.07 dBV/m**	Grid 2 **M3** **30.46 dBV/m**	Grid 3 **M3** **30.46 dBV/m**
Grid 4 **M4** **26.42 dBV/m**	Grid 5 **M3** **30.09 dBV/m**	Grid 6 **M3** **30.12 dBV/m**
Grid 7 **M4** **25.06 dBV/m**	Grid 8 **M4** **28.14 dBV/m**	Grid 9 **M4** **28.21 dBV/m**

Cursor:
Total = 30.46 dBV/m
E Category: M3
Location: -9, -20.5, 8.7 mm

0 dB = 33.34 V/m = 30.46 dBV/m

#17_HAC_E_GSM1900_GSM Voice_Ch661

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 1880 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 24.98 V/m; Power Drift = -0.05 dB
Applied MIF = 3.63 dB
RF audio interference level = 31.20 dBV/m
Emission category: M3

MIF scaled E-field

Grid 1 **M4** **28.55 dBV/m**	Grid 2 **M3** **31.2 dBV/m**	Grid 3 **M3** **31.2 dBV/m**
Grid 4 **M4** **27.55 dBV/m**	Grid 5 **M3** **31.17 dBV/m**	Grid 6 **M3** **31.19 dBV/m**
Grid 7 **M4** **26.24 dBV/m**	Grid 8 **M4** **29.92 dBV/m**	Grid 9 **M4** **29.99 dBV/m**

Cursor:
Total = 31.20 dBV/m
E Category: M3
Location: -9.5, -13.5, 8.7 mm

0 dB = 36.32 V/m = 31.20 dBV/m

#18_HAC_E_GSM1900_GSM Voice_Ch810

Communication System: GSM-FDD (TDMA, GMSK); Frequency: 1909.8 MHz;Duty Cycle: 1:8.6896
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 26.54 V/m; Power Drift = -0.06 dB
Applied MIF = 3.63 dB
RF audio interference level = 31.60 dBV/m
Emission category: M3

MIF scaled E-field

Grid 1 **M4** **28.95 dBV/m**	Grid 2 **M3** **31.57 dBV/m**	Grid 3 **M3** **31.6 dBV/m**
Grid 4 **M4** **27.89 dBV/m**	Grid 5 **M3** **31.57 dBV/m**	Grid 6 **M3** **31.6 dBV/m**
Grid 7 **M4** **26.12 dBV/m**	Grid 8 **M3** **30.66 dBV/m**	Grid 9 **M3** **30.74 dBV/m**

Cursor:
Total = 31.60 dBV/m
E Category: M3
Location: -10, -7, 8.7 mm

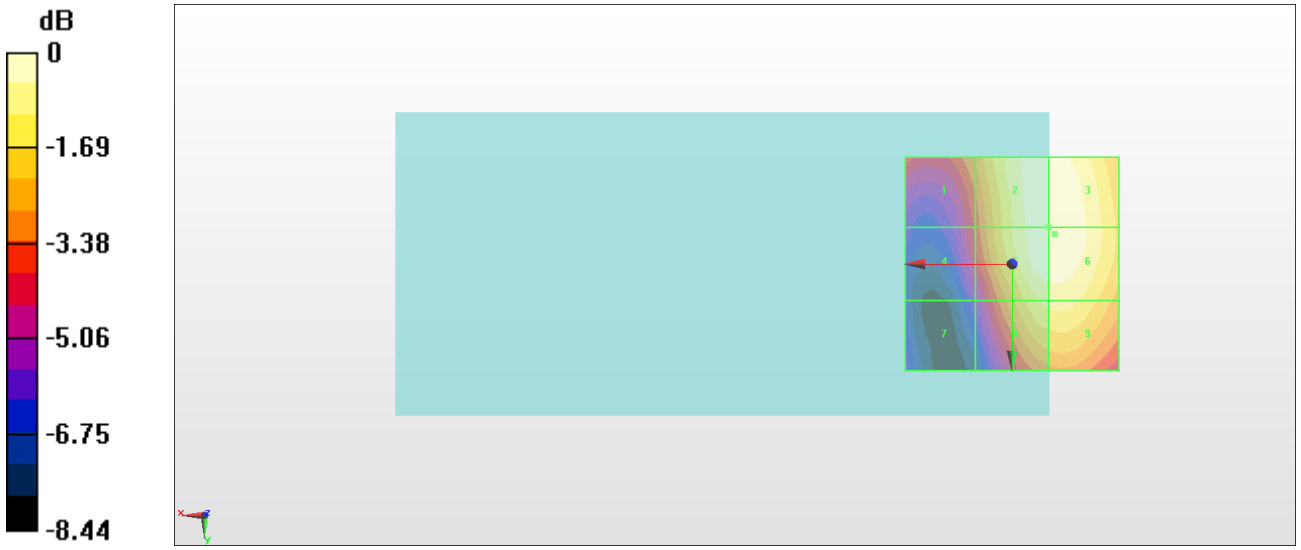

0 dB = 38.04 V/m = 31.60 dBV/m

#07_HAC_E_CDMA BC0_1xRTT, RC1 SO3, 18th Rate_Ch1013

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 824.7 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 27.00 V/m; Power Drift = 0.04 dB
Applied MIF = 3.26 dB
RF audio interference level = 31.19 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **29.26 dBV/m**	Grid 2 **M4** **31.19 dBV/m**	Grid 3 **M4** **31.18 dBV/m**
Grid 4 **M4** **29.07 dBV/m**	Grid 5 **M4** **30.74 dBV/m**	Grid 6 **M4** **30.74 dBV/m**
Grid 7 **M4** **28.95 dBV/m**	Grid 8 **M4** **30.11 dBV/m**	Grid 9 **M4** **30.09 dBV/m**

Cursor:
Total = 31.19 dBV/m
E Category: M4
Location: -7.5, -25, 8.7 mm

0 dB = 36.26 V/m = 31.19 dBV/m

#08_HAC_E_CDMA BC0_1xRTT, RC1 SO3, 18th Rate_Ch384

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 836.52 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 24.97 V/m; Power Drift = -0.01 dB
Applied MIF = 3.26 dB
RF audio interference level = 31.07 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **28.77 dBV/m**	Grid 2 **M4** **31.07 dBV/m**	Grid 3 **M4** **31.07 dBV/m**
Grid 4 **M4** **28.51 dBV/m**	Grid 5 **M4** **30.32 dBV/m**	Grid 6 **M4** **30.34 dBV/m**
Grid 7 **M4** **28.44 dBV/m**	Grid 8 **M4** **29.49 dBV/m**	Grid 9 **M4** **29.49 dBV/m**

Cursor:
Total = 31.07 dBV/m
E Category: M4
Location: -8.5, -25, 8.7 mm

0 dB = 35.77 V/m = 31.07 dBV/m

#09_HAC_E_CDMA BC0_1xRTT, RC1 SO3, 18th Rate_Ch777

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 848.31 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 24.51 V/m; Power Drift = 0.05 dB
Applied MIF = 3.26 dB
RF audio interference level = 30.62 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **27.69 dBV/m**	Grid 2 **M4** **30.58 dBV/m**	Grid 3 **M4** **30.62 dBV/m**
Grid 4 **M4** **27.82 dBV/m**	Grid 5 **M4** **29.95 dBV/m**	Grid 6 **M4** **29.98 dBV/m**
Grid 7 **M4** **27.97 dBV/m**	Grid 8 **M4** **28.93 dBV/m**	Grid 9 **M4** **28.93 dBV/m**

Cursor:
Total = 30.62 dBV/m
E Category: M4
Location: -10, -25, 8.7 mm

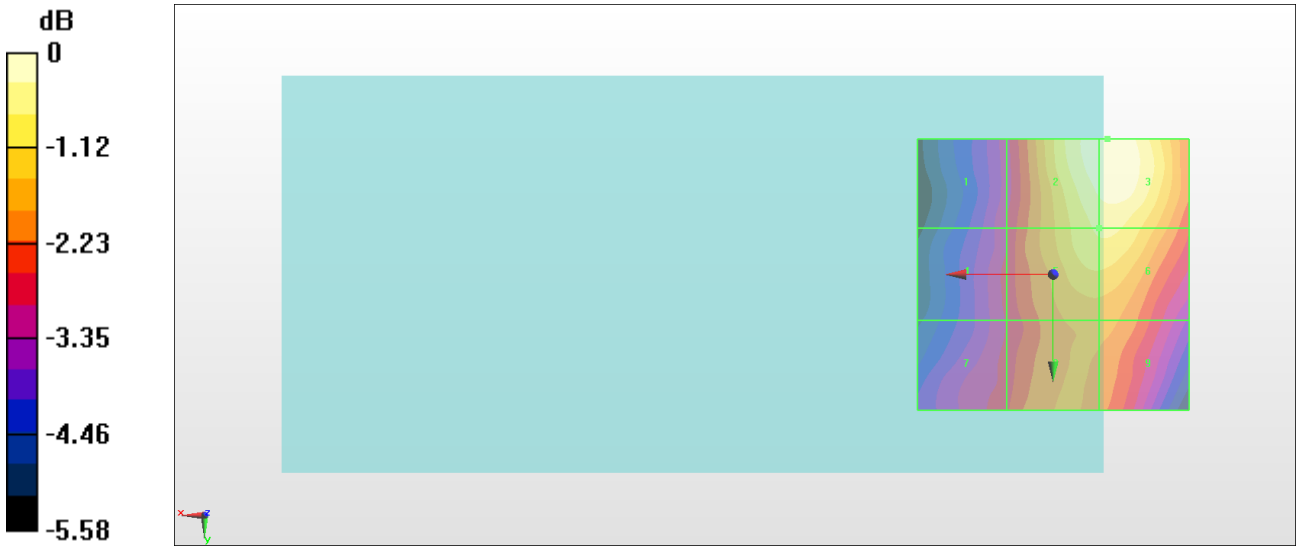

0 dB = 33.96 V/m = 30.62 dBV/m

#10_HAC_E_CDMA BC1_1xRTT, RC1 SO3, 18th Rate_Ch25

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 1851.25 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 17.79 V/m; Power Drift = 0.02 dB
Applied MIF = 3.26 dB
RF audio interference level = 28.86 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **26.47 dBV/m**	Grid 2 **M4** **28.86 dBV/m**	Grid 3 **M4** **28.84 dBV/m**
Grid 4 **M4** **24.96 dBV/m**	Grid 5 **M4** **28.4 dBV/m**	Grid 6 **M4** **28.42 dBV/m**
Grid 7 **M4** **24.04 dBV/m**	Grid 8 **M4** **26.31 dBV/m**	Grid 9 **M4** **26.39 dBV/m**

Cursor:
Total = 28.86 dBV/m
E Category: M4
Location: -6.5, -25, 8.7 mm

0 dB = 27.75 V/m = 28.87 dBV/m

#11_HAC_E_CDMA BC1_1xRTT, RC1 SO3, 18th Rate_Ch600

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 1880 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 19.47 V/m; Power Drift = -0.01 dB
Applied MIF = 3.26 dB
RF audio interference level = 28.83 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **25.92 dBV/m**	Grid 2 **M4** **28.83 dBV/m**	Grid 3 **M4** **28.83 dBV/m**
Grid 4 **M4** **24.99 dBV/m**	Grid 5 **M4** **28.79 dBV/m**	Grid 6 **M4** **28.8 dBV/m**
Grid 7 **M4** **24.08 dBV/m**	Grid 8 **M4** **27.46 dBV/m**	Grid 9 **M4** **27.57 dBV/m**

Cursor:
Total = 28.83 dBV/m
E Category: M4
Location: -9.5, -11.5, 8.7 mm

0 dB = 27.63 V/m = 28.83 dBV/m

#12_HAC_E_CDMA BC1_1xRTT, RC1 SO3, 18th Rate_Ch1175

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 1908.75 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 20.21 V/m; Power Drift = 0.01 dB
Applied MIF = 3.26 dB
RF audio interference level = 28.94 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **26.43 dBV/m**	Grid 2 **M4** **28.92 dBV/m**	Grid 3 **M4** **28.94 dBV/m**
Grid 4 **M4** **25.38 dBV/m**	Grid 5 **M4** **28.91 dBV/m**	Grid 6 **M4** **28.93 dBV/m**
Grid 7 **M4** **23.53 dBV/m**	Grid 8 **M4** **27.92 dBV/m**	Grid 9 **M4** **27.99 dBV/m**

Cursor:
Total = 28.94 dBV/m
E Category: M4
Location: -9.5, -10, 8.7 mm

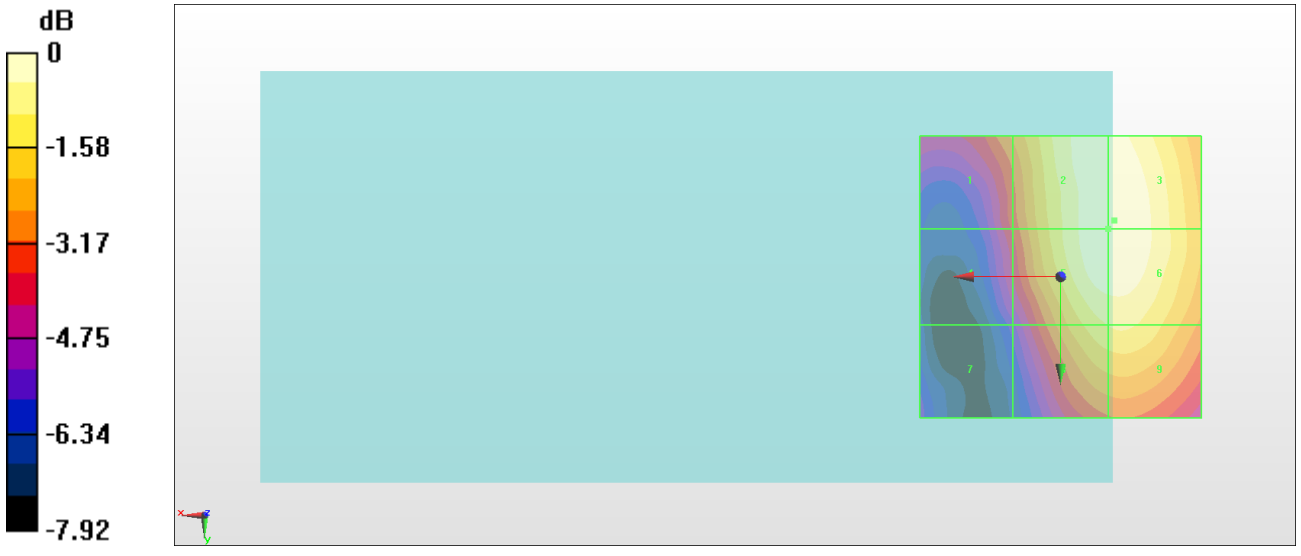

0 dB = 28.00 V/m = 28.94 dBV/m

#13_HAC_E_CDMA BC10_1xRTT, RC1 SO3, 18th Rate_Ch476

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 817.9 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 26.76 V/m; Power Drift = 0.03 dB
Applied MIF = 3.26 dB
RF audio interference level = 30.86 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **29.16 dBV/m**	Grid 2 **M4** **30.86 dBV/m**	Grid 3 **M4** **30.86 dBV/m**
Grid 4 **M4** **29.03 dBV/m**	Grid 5 **M4** **30.55 dBV/m**	Grid 6 **M4** **30.56 dBV/m**
Grid 7 **M4** **28.93 dBV/m**	Grid 8 **M4** **30.14 dBV/m**	Grid 9 **M4** **30.07 dBV/m**

Cursor:
Total = 30.86 dBV/m
E Category: M4
Location: -8, -24.5, 8.7 mm

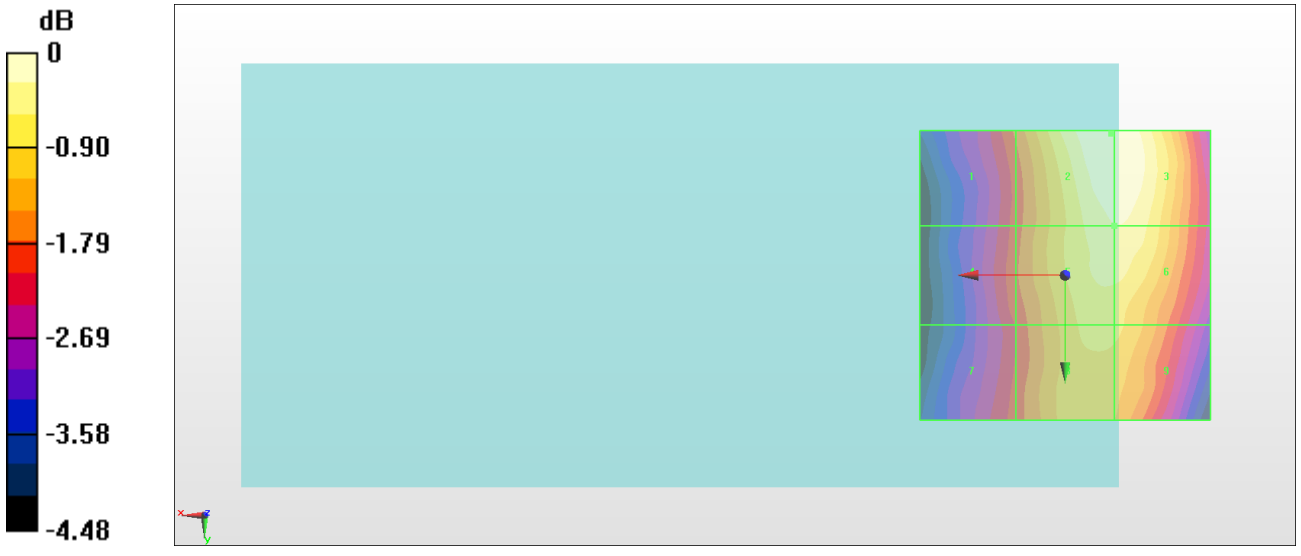

0 dB = 34.93 V/m = 30.86 dBV/m

#14_HAC_E_CDMA BC10_1xRTT, RC1 SO3, 18th Rate_Ch580

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 820.5 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 27.17 V/m; Power Drift = 0.06 dB
Applied MIF = 3.26 dB
RF audio interference level = 31.17 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **29.49 dBV/m**	Grid 2 **M4** **31.17 dBV/m**	Grid 3 **M4** **31.15 dBV/m**
Grid 4 **M4** **29.25 dBV/m**	Grid 5 **M4** **30.77 dBV/m**	Grid 6 **M4** **30.77 dBV/m**
Grid 7 **M4** **29.15 dBV/m**	Grid 8 **M4** **30.24 dBV/m**	Grid 9 **M4** **30.23 dBV/m**

Cursor:
Total = 31.17 dBV/m
E Category: M4
Location: -7, -25, 8.7 mm

0 dB = 36.18 V/m = 31.17 dBV/m

#15_HAC_E_CDMA BC10_1xRTT, RC1 SO3, 18th Rate_Ch684

Communication System: CDMA2000, RC1, SO3, 1/8th Rate 25 fr.; Frequency: 823.1 MHz;Duty Cycle: 1:17.7419
Medium: Air Medium parameters used: $\sigma = 0$ S/m, $\varepsilon_r = 1$; $\rho = 0$ kg/m^3
Ambient Temperature：23.5 ℃

DASY5 Configuration:
- Probe: ER3DV6 - SN2358; ConvF(1, 1, 1); Calibrated: 2018/1/19;
- Sensor-Surface: (Fix Surface)
- Electronics: DAE4 Sn854; Calibrated: 2018/6/14
- Phantom: HAC Test Arch with AMCC; Type: SD HAC P01 BA;
- Measurement SW: DASY52, Version 52.10 (0);SEMCAD X Version 14.6.10 (7417)

E Scan - ER3D: 15 mm from Probe Center to the Device/Hearing Aid Compatibility Test (101x101x1): Interpolated grid: dx=0.5000 mm, dy=0.5000 mm
Device Reference Point: 0, 0, -6.3 mm
Reference Value = 27.82 V/m; Power Drift = -0.06 dB
Applied MIF = 3.26 dB
RF audio interference level = 31.50 dBV/m
Emission category: M4

MIF scaled E-field

Grid 1 **M4** **29.67 dBV/m**	Grid 2 **M4** **31.5 dBV/m**	Grid 3 **M4** **31.5 dBV/m**
Grid 4 **M4** **29.37 dBV/m**	Grid 5 **M4** **31.02 dBV/m**	Grid 6 **M4** **31.03 dBV/m**
Grid 7 **M4** **29.24 dBV/m**	Grid 8 **M4** **30.45 dBV/m**	Grid 9 **M4** **30.41 dBV/m**

Cursor:
Total = 31.50 dBV/m
E Category: M4
Location: -8.5, -25, 8.7 mm

0 dB = 37.60 V/m = 31.50 dBV/m